

MACDAM

Skoda Enyaq '21 BEV

Vehicle information


Make:	Skoda	License:	
Gearbox:	Automatic	Body color:	
Model:	Enyaq '21 BEV	VIN:	TMBJB7NY5NF036325
Fuel type:	Electric	Power:	132 kW
Version:	Enyaq iV60 Sportline	First registration	10/03/2022
Mileage:	200639 km	N° of doors:	

Damage summary

Interior	3
Left	3
Rear	2
Right	2

Commercial pictures



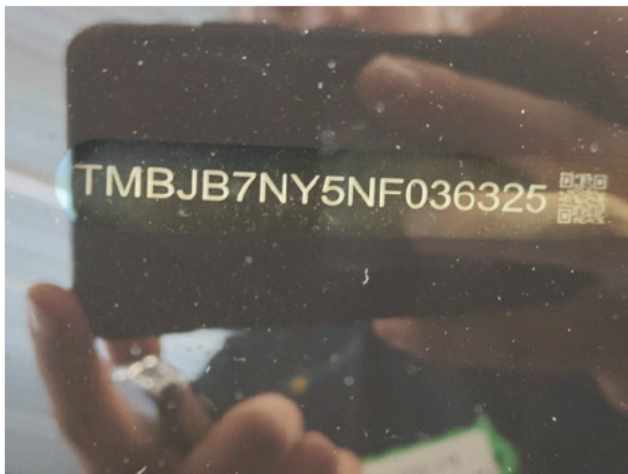

Options according to the inspector

Central consol F	Yes	GPS	Yes	Headlights Xenon/LED/Laser	Yes
Panoramic roof	Yes	Radio multimedia	Yes	Rear view camera	Yes
Sun Roof electric	Yes	Telephone equipment	Yes		

Damages




Alloy rim FL
Scratch(es)
Repair and paint (complete)
Left



Scratch(es)
Repair and paint (complete)
Right



Scratch(es)
Repair and paint (complete)
Rear

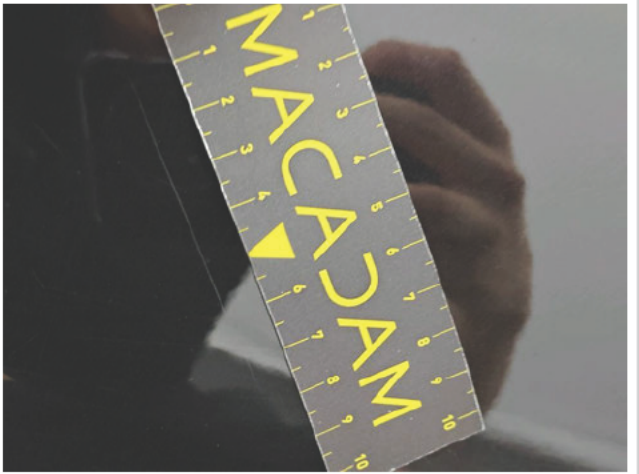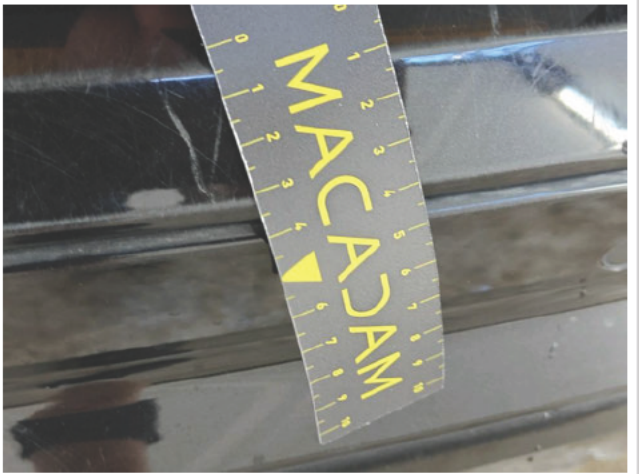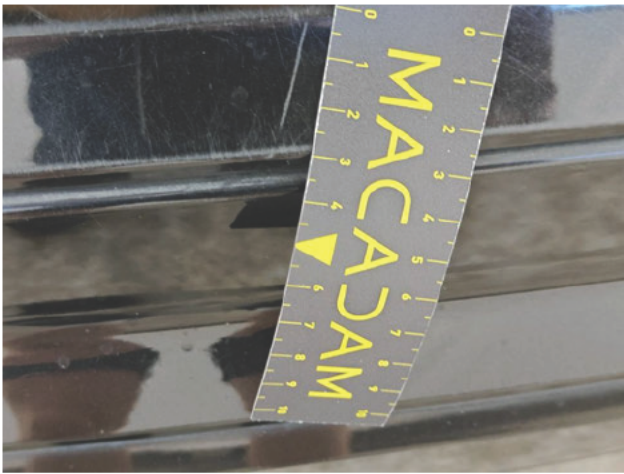

Charging cable (normal)

Missing
Replace
Rear





Ignition key

Broken
Replace
Interior



Interior

Dirty
Chemical cleaning
Interior

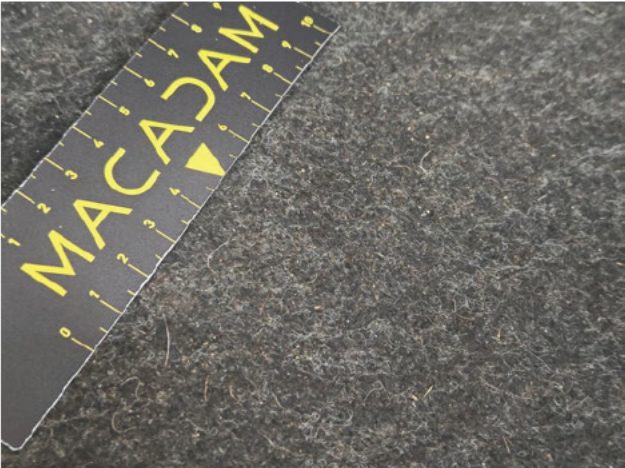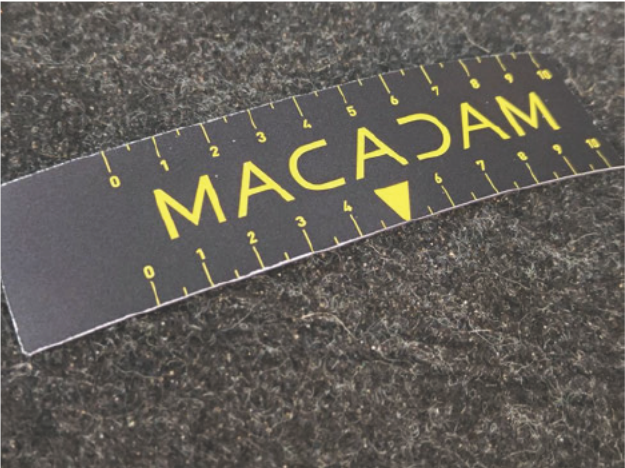


Interior

Smell
Ozone treatment (Animal smell)
Interior




Sill trim L

Scratch(es)
Repair and paint (complete)
Left

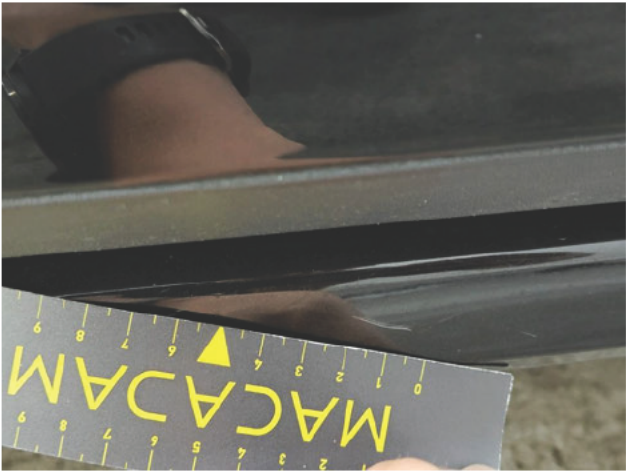

Wing RL

Scratch(es)
Repair and paint (complete)
Left

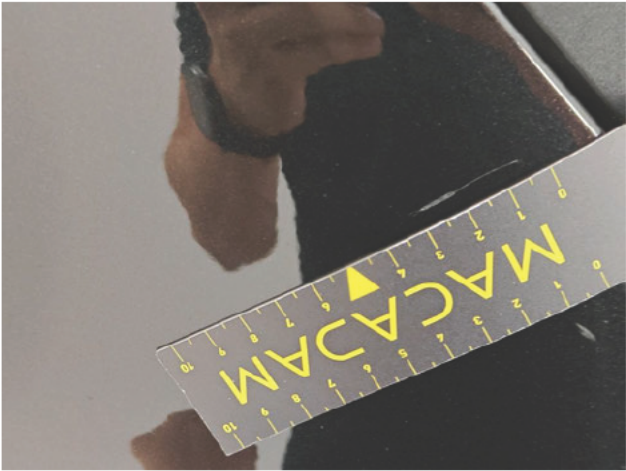

Wing RR

Scratch(es)

Repair and paint (partial)

Right



Tyres			
		Front Left	
		Summer	
		235/50/20/100/T	
		Pirelli	
		4.5 mm	
		Front Right	
		Summer	
		235/50/20/100/T	
		Pirelli	
		4.0 mm	
		Rear Left	
		Summer	
		235/50/20/100/T	
		Pirelli	
		3.8 mm	
		Rear Right	
		Summer	
		235/50/20/100/T	
		Pirelli	
		3.8 mm	

Checks			
CO2 Emission	0	Digital maintenance	Yes
Luggage cover	Yes	Number head rests	3
Number of charging cables (rapid charge)	1	Number of keys total	2
Reset to factory settings	Yes, vehicle is reset to factory settings	Service book	N/A
User's manual	Yes		

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.