


MERCEDES CLA SHOOTING BRAKE:

Vinnumber:	W1K1186101N194948	Versionname:	CLA 180 d DCT Business Solution
First Registrationdate:	7/01/2021	Fiscalpower:	
Expertise Mileage:	152178	Power Kw:	85
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	3506
Fueltype:	Diesel		
Maintenance:	OK		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Seats electric F L:	
Cruise Control:		Seats electric F R:	
Steering wheel multifunctional:		Sun Roof electric:	
Seats F heated:		Luggage cover:	
Radio multimedia:		Front parking sensors:	
Type of headlighting:	Headlighting LED	Rear parking sensors:	
Type of GPS:	GPS base	Type of Tow bar:	No Tow bar
Type of Lining:	Lining leather		
Type of climate control:	Autom climate control		
Type of GPS storage:	HD		

Limited Technical Inspection
Tyres

	205/55/17/91 V			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm
Tyre profile depth FL	5.0			
Tyre profile depth FR	5.0			
Tyre profile depth RL	4.0			
Tyre profile depth RR	4.0			
Tyre size FL	205/55 R 17 91 V			
Tyre size FR	205/55 R 17 91 V			
Tyre size RL	205/55 R 17 91 W			
Tyre size RR	205/55 R 17 91 W			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	261			
Tyre make FR	261			
Tyre make RL	264			
Tyre make RR	264			


Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT:	5388,20
Backrest cover FL, Damaged, Smart repair:	116,69



Floor covering FL, Burned, Replace 229,79

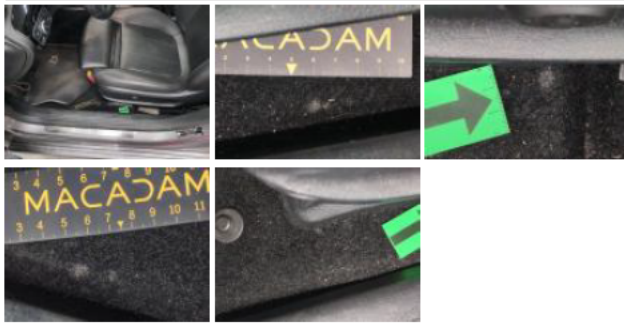

Seat cover FL, Burned, Replace 707,52



Interior covering A pillar L, Burned, Replace 62,72



Steering wheel, Worn, Acceptable 0,00



Bumper F, Crack, Replace and paint 948,96



Headlight R, Scratch(es), Replace 1463,02




Windscreen, Stone chip(s), Windscreen repair 75,44



Door seal FL, Deformed / Strained, Acceptable 0,00



Door FL, Dent(s), Acceptable 0,00

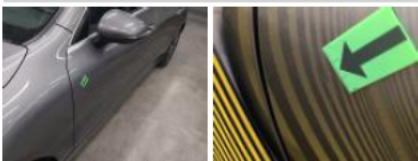

Wing RL, Dent(s) and scratch(es), Repair and paint (complete) 491,09



Door RL, Bad repair, Repair and paint (complete) 445,79



Bumper R, Bad repair, Repair and paint (complete) 356,09



Step R, Scratch(es), Acceptable 0,00



Wing RR, Dent(s), Repair and paint (complete) 491,09



Side window trim RR, Dent(s), Acceptable 0,00



Wing trim RR, Scratch(es), Acceptable 0,00

