

MACDAM

Polestar Polestar 2 '19 BEV

Vehicle information


Make:	Polestar	License:	
Gearbox:	Automatic	Body color:	
Model:	Polestar 2 '19 BEV	VIN:	LPSVSECEKNL046988
Fuel type:	Electric	Power:	165 kW
Version:	Polestar 2 63kWh Sing.M.St.Ra.	First registration	22/10/2021
Mileage:	114390 km	N° of doors:	

Damage summary

Front	1
Interior	2
Left	3
Rear	2
Right	3

Commercial pictures



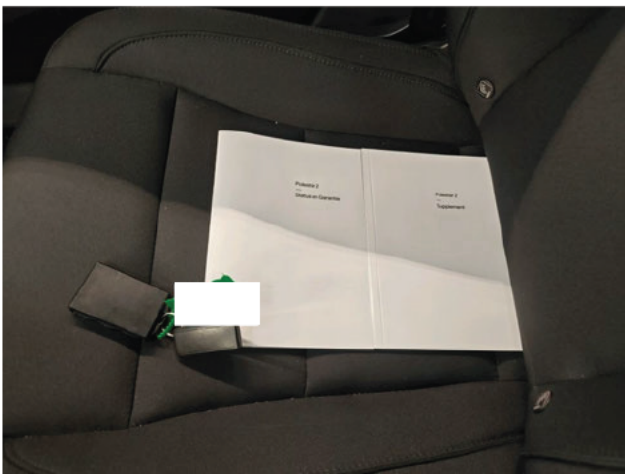

Options according to the inspector				
Central consol F	Yes	GPS	Yes	Headlights Xenon/LED/Laser
Radio multimedia	Yes	Rear view camera	Yes	Telephone equipment

Damages

Alloy rim FL

Scratch(es)

Repair and paint (complete)

Left



Alloy rim FR

Scratch(es)

Repair and paint (complete)

Right



Alloy rim RL

Scratch(es)

Repair and paint (complete)

Left



Alloy rim RR

Scratch(es)

Repair and paint (complete)

Right



Armrest F M

Burned

Replace

Interior



Bumper F
Stone chip(s)
Repair and paint (complete)
Front




Bumper R
Scratch(es)
Repair and paint (complete)
Rear



Charging cable (normal)
Missing
Replace
Rear



Door RL
Scratch(es)
Repair and paint (complete)
Left

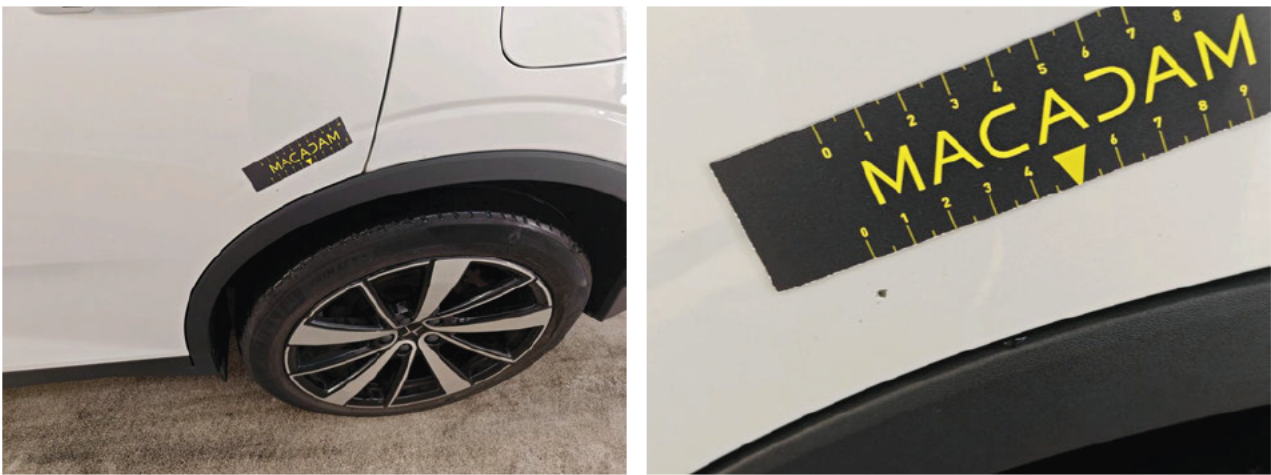

Door RR
Dent(s) and scratch(es)
Repair and paint (complete)
Right




Interior

Smell

Ozone treatment (Smoke)

Interior

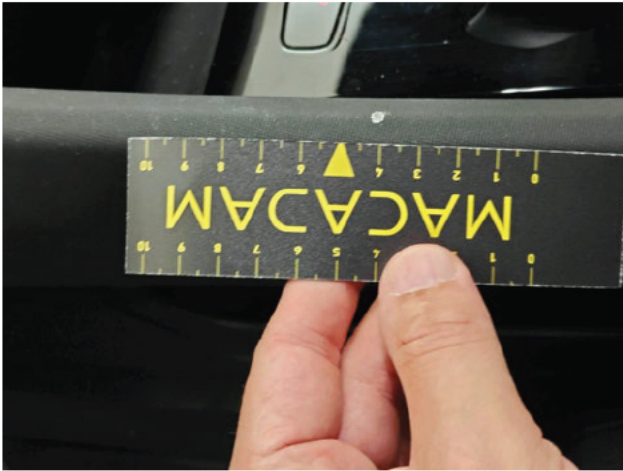

Tyres			
Front Left			
Summer			
245/45/19/102/Y			
Hankook			
4.0 mm			
Front Right			
Summer			
245/45/19/102/Y			
Hankook			
4.2 mm			
Rear Left			
Summer			
245/45/19/102/Y			
Michelin			
4.8 mm			
Rear Right			
Summer			
245/45/19/102/Y			
Michelin			
5.7 mm			

Checks			
CO2 Emission	0	Digital maintenance	N/A
GPS storage	Yes	Luggage cover	Yes
Number head rests	5	Number of charging cables (rapid charge)	1
Number of keys total	1	Reset to factory settings	Yes, vehicle is reset to factory settings
Service book	Yes	User's manual	Yes

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.