

MACDAM

Volkswagen ID.4 '21 BEV



Vehicle information


Make:	Volkswagen	License:	
Gearbox:	Automatic	Body color:	
Model:	ID.4 '21 BEV	VIN:	WVGZZZE2ZMP021532
Fuel type:	Electric	Power:	150 kW
Version:	ID.4 77kWh Life	First registration	02/07/2021
Mileage:	147660 km	N° of doors:	

Damage summary

Front	2
Interior	2
Rear	3
Right	3
Roof & others	1

Commercial pictures

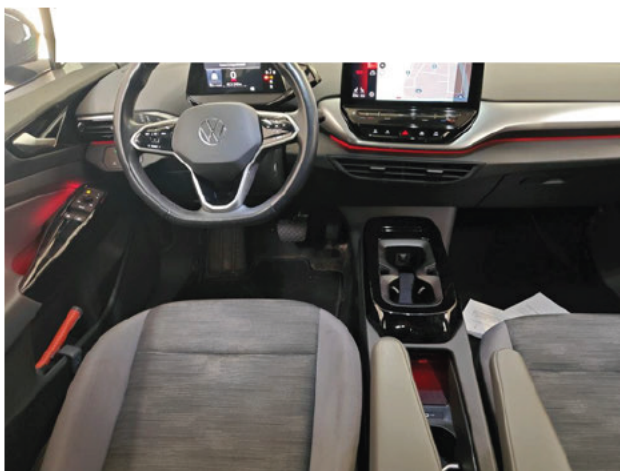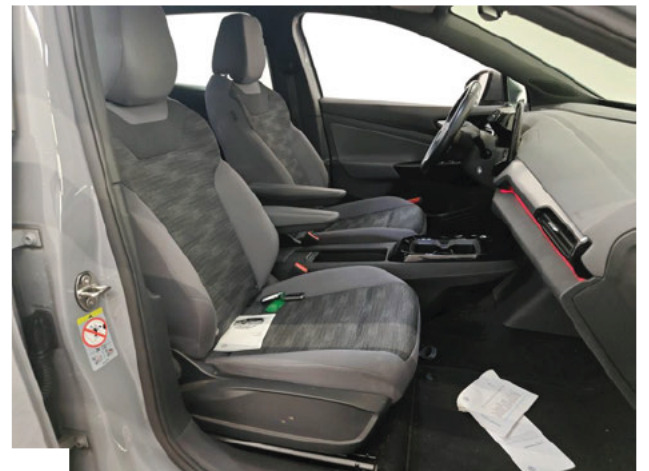

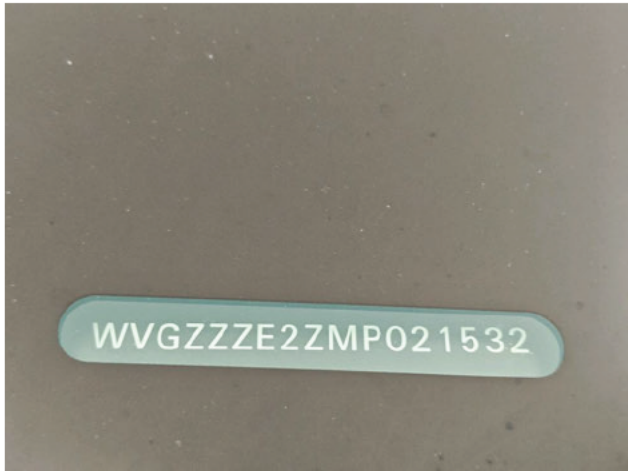


Options according to the inspector				
Central consol F	Yes	GPS	Yes	Headlights Xenon/LED/Laser
Radio multimedia	Yes	Telephone equipment	Yes	

Damages				

Alloy rim FR
Scratch(es)
Repair and paint (complete)
Right



Bonnet
Hail damage
Paintless dent repair (hail)
Front

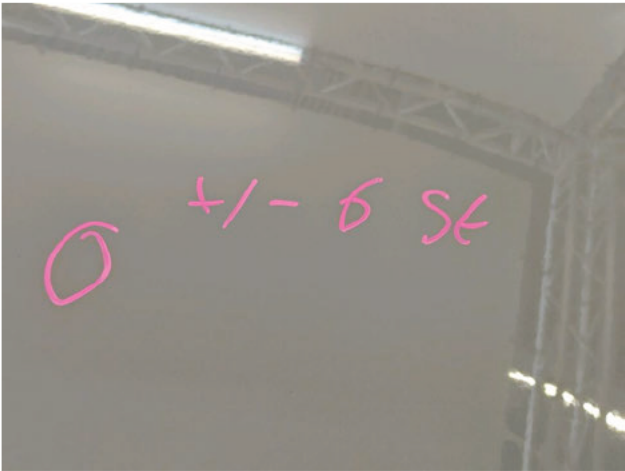

Boot lid covering R
Scratch(es)
Smart repair
Rear



Bumper F
Scratch(es)
Repair and paint (complete)
Front



Bumper R
Scratch(es)
Smart repair
Rear



Charging cable (normal)

Missing
Replace
Rear



Door trim FR

Scratch(es)
Replace
Right




Interior

Smell
Ozone treatment (Animal smell)
Interior



Interior
Dirty
Chemical cleaning
Interior

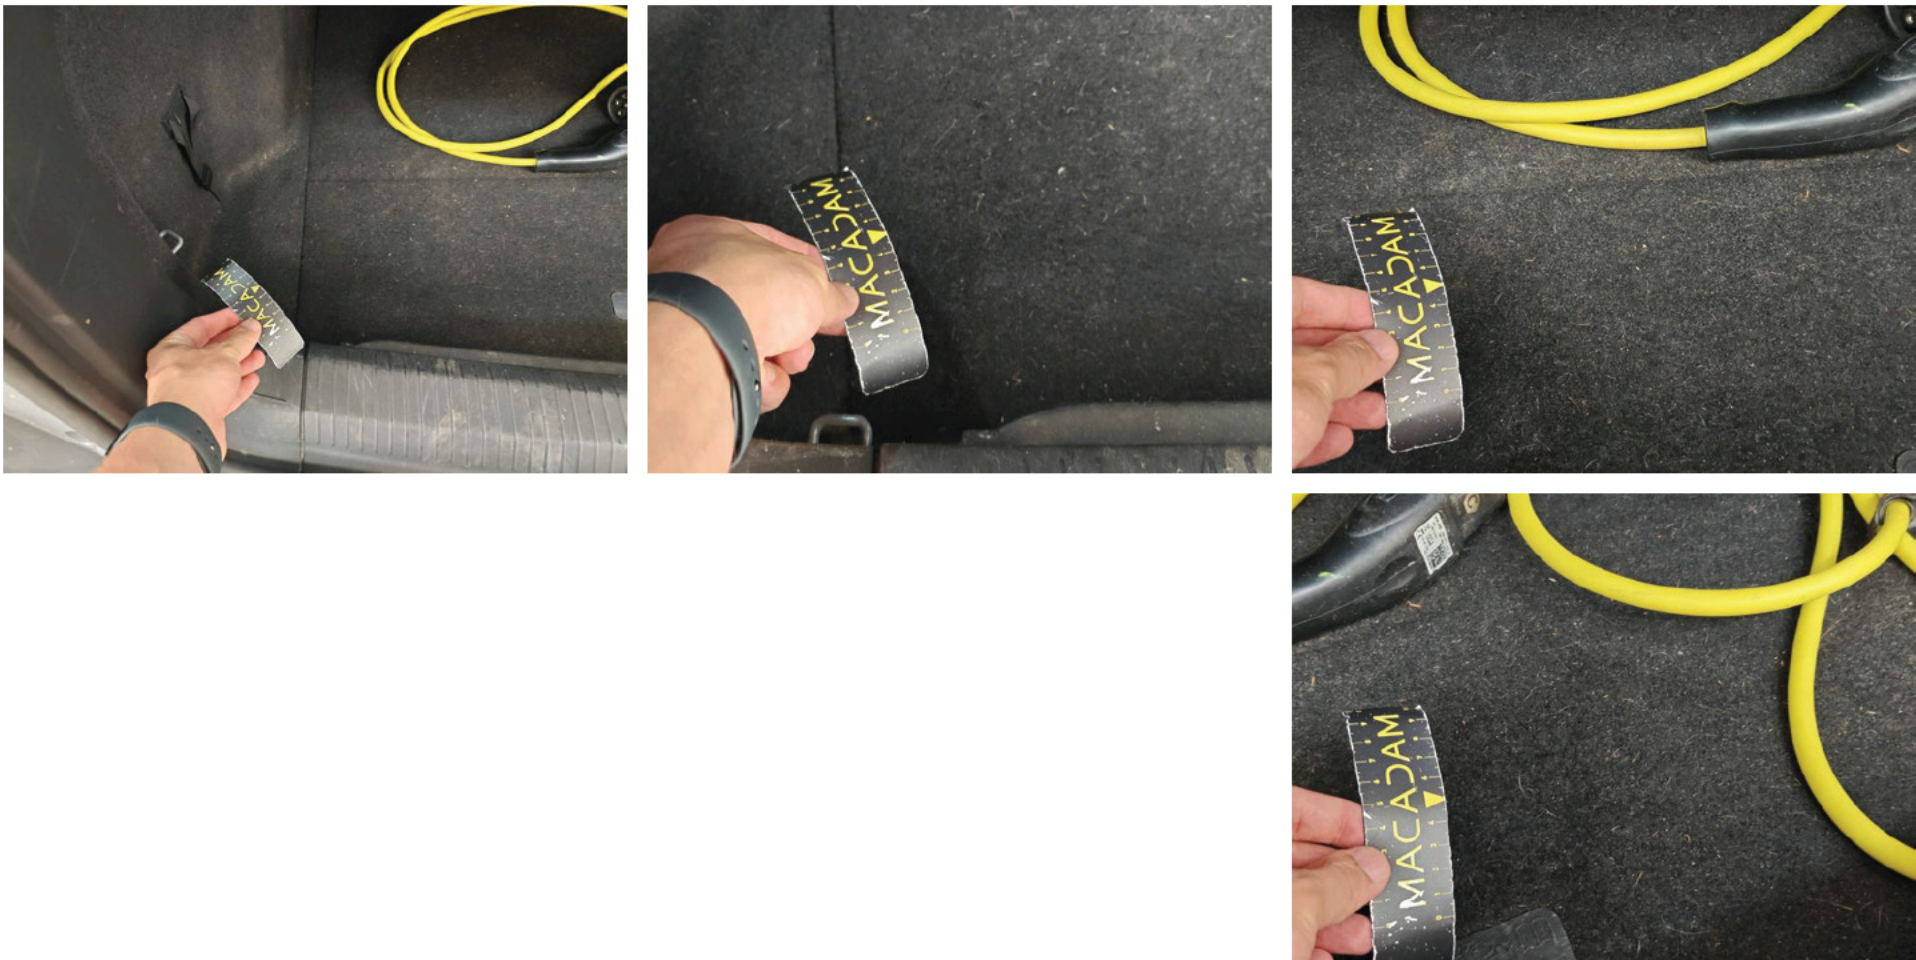

Roof
Hail damage
Paintless dent repair (hail)
Roof & others



Wing trim RR
Scratch(es)
Replace
Right



Tyres	
	Front Left
	Summer
	235/55/19/105/W
	Bridgestone
	5.4 mm
	Front Right
	Summer
	235/55/19/105/W
	Bridgestone
	5.2 mm
	Rear Left
	Summer
	235/55/19/105/W
	Bridgestone
	4.2 mm
	Rear Right
	Summer
	235/55/19/105/W
	Bridgestone
	3.9 mm

Checks			
CO2 Emission	0	Digital maintenance	Yes
GPS storage	Yes	Luggage cover	Yes
Number head rests	5	Number of charging cables (rapid charge)	1
Number of keys total	2	Service book	N/A
User's manual	Yes		

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.