DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	VR3FCYHZ5 RY556434	Registration date	12/07/2024	Exterior Color	Unknown
Brand	PEUGEOT	Licence Plate	N-TG 240	Odometer	56 112 km
Model	308 BlueHDi 130 EAT8 Allure SW				

Inspection Details

Arrival Date	21/08/2026	Inspection ID	7129616	Inspection date	27/08/2026
Assign Date	21/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys SLC Essen



Generic equipment

GPS system	✔
Alloy wheel rims	✔

Removable element

Spare wheel kit	✔
Toolkit	✔
Load cover	✔
Separation net	✔
Floor mat BR	✔
Floor mat BL	✔
Floor mat FR	✔
Floor mat FL	✔
Hook /Hicth ball	✔


Technical Document

User manual	✔
Warranty booklet	✔
Log books	✔
Spare key	✔
Key	✔
Remote key	✔
Service	✔

Tyres

Michelin 205/55/16 V All seasons 7.0 mm

Michelin 205/55/16 V All seasons 7.0 mm

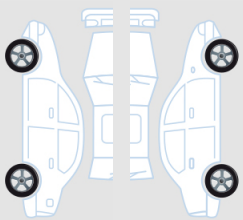

Michelin 205/55/16 V All seasons 7.0 mm

Michelin 205/55/16 V All seasons 7.0 mm

DEKRA

DEKRA Automotive Solutions

Appraisal Report

Exception / Damage

1



Part	Bonnet	Repair Time	2.50	Part Cost	-
Position	-	Repair Cost	350.00€	Gross Cost	755.00€
Damages	Dented	Paint Time	2.70	Depreciation %	15.00%
Severity	-	Paint cost	405.00€	Depreciation	- 113.25
Repair mode	Repair	Flat Rate	-	**Net Cost**	**641.75€**

mehrere dellen.

2



Part	Roof	Repair Time	3.50	Part Cost	-
Position	-	Repair Cost	490.00€	Gross Cost	1,165.00€
Damages	Dented	Paint Time	4.50	Depreciation %	15.00%
Severity	-	Paint cost	675.00€	Depreciation	- 174.75
Repair mode	Repair	Flat Rate	-	**Net Cost**	**990.25€**

mehrere dellen.

3



Part	Alloy wheel 16"	Repair Time	0.50	Part Cost	-
Position	Front right	Repair Cost	70.00€	Gross Cost	190.00€
Damages	Scratched	Paint Time	0.80	Depreciation %	-
Severity	-	Paint cost	120.00€	Depreciation	-
Repair mode	Lumpsum repair	Flat Rate	190.00€	**Net Cost**	**190.00€**

4



Part	Alloy wheel 16"	Repair Time	0.30	Part Cost	-
Position	Back right	Repair Cost	42.00€	Gross Cost	162.00€
Damages	Scratched	Paint Time	0.80	Depreciation %	-
Severity	-	Paint cost	120.00€	Depreciation	-
Repair mode	Lumpsum repair	Flat Rate	162.00€	**Net Cost**	**162.00€**

5



Part	Roof post A/B/C	Repair Time	0.50	Part Cost	-
Position	Left	Repair Cost	70.00€	Gross Cost	70.00€
Damages	Dented	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	70.00€	**Net Cost**	**70.00€**

6



Part	Sticker removal	Repair Time	0.20	Part Cost	-
Position	-	Repair Cost	28.00€	Gross Cost	28.00€
Damages	-	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Lumpsum	Flat Rate	28.00€	**Net Cost**	**28.00€**

7



Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	150.00€
Damages	-	Paint Time	1.00	Depreciation %	15.00%
Severity	-	Paint cost	150.00€	Depreciation	- 22.50
Repair mode	Paintworks	Flat Rate	-	**Net Cost**	**127.50€**

Comments

rundum erhöhte lackschichtdicke, ca.170my.
1. insp. überzogen.

DEKRA Automotive Solutions

Summary Inspection

Gross Price	2,520.00€	Depreciation	-310.50€	Net Price	2,209.50€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	7.50	1,050.00€	12.00 %	-126.00€	924.00€
Paintwork	150.00€	8.80	1,320.00€	12.27 %	-162.00€	1,158.00€
Paint preparation	150.00€	1.00	150.00€	15.00 %	-22.50€	127.50€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	0.00€	-	-	0.00€
Flat Rate	0.00€	-	-	0.00€