Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

Front Left 3/4

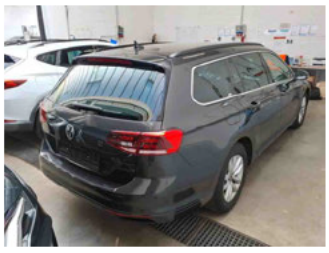

Rear Right 3/4

Mileage

» Costs & Value Summary

	Without tax	19% VAT	Total with tax
Repair costs (estimated)	€ 3,772.01	€ 716.68	€ 4,488.69
Net cost (estimated)	€ 3,072.73	€ 583.82	€ 3,656.55

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Vehicle Data

Vehicle category:	Passenger Car
Vehicle type:	EstateCar
Make:	Volkswagen
Model:	Passat
Manufacturers and type code:	0603 / BQS
Date of first registration:	05.03.2024
Mileage:	114,959 km
Proof of mileage:	ReadOff
Exterior colour:	Mangangrau Metallic
Roof colour:	Mangangrau Metallic
Propulsion:	Front
Fuel:	Diesel
Engine size (cc):	2,000 ccm
Performance:	110 kW (150 PS)
Length:	
Height:	
Width:	
Permitted total weight:	
Wheelbase:	
Number of powered axles:	2
Cylinders:	4
Euronorm:	Euro 6
Number of doors:	4
Number of seats:	5
Gearbox:	Automatic 7-speed
Upholstery type:	Lining fabrics
Interior colour:	Titanschwarz/Titanschwarz/Titanschwarz
Number of keys:	1

» Documents & Maintenance

Statutory inspection date:	
Registration certificate available:	No
Registration certificate received:	No
License plate:	None
Maintenance book:	Digital
Maintenance:	Not testable
Maintenance last date:	
Maintenance last mileage:	
Remainder until next maintenance:	5,100 KM

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

12-V outlet in center console in rear and in luggage compartment

2 beverage holders in front with cover

2 USB-C ports in the front, charging capacity up to 45 W

3 head restraints in rear

3-point seat belt for center rear seat

3-point seat belts for outer rear seats

3-point seat belts in front with height adjustment and seat belt pretensioners

4 AirStop® all-season tires 215/60 R16

4 alloy wheels "Sepang" 6.5J x 16

4-cylinder diesel engine 2.0 l

4-cylinder diesel engine 2.0 l TDI, 110 kW

7-speed automatic transmission or dual-clutch transmission DSG, note: PR family EDF

8 speakers

Adaptive Cruise Control ACC stop & go incl. speed limiter

Air Care Climatronic 3 zone automatic climate control with enhanced air filterwith activated carbon

AirStop® all-season tires 215/60 R16

Alloy spare wheel with original equipment tire

Alternator 140 A

App-Connect Wireless for Apple CarPlay and Android Auto

Aspherical exterior mirror on driver side

Aut. headlight control with separate daytime running light, entry lighting and manual exit lighting

Auto-dimming interior rearview mirror

Automatically-heated washer nozzles in front

Autonomous Emergency Braking Front Assist (for Adaptive Cruise Control ACC up to 210 km/h)

Basic equipment variant

Battery 420 A (70 Ah)

Black roof rails

Body-colored lower side trims

Bumpers with body-colored decorative trims

Business

Carpet mats in front and rear

Carrier frequency 433.92 MHz-434.42 Mhz

Category 0

Child safety lock

Chrome trims on the side windows

Comfort seats in front

Curtain airbag system for front and rear passengers incl. side airbags in front

Decorative inserts "Cross Hatch" for dashboard and door trim panels

Decorative inserts "Piano Black" for center console

Digital radio reception DAB+

Disc brakes in front

Disc brakes in rear

Diversity antenna for FM reception

Door and side trim panel in foam film and woven fabric

Driver alert system

Driver and front passenger airbag with front passenger airbag deactivation

Driving on the right

Dual-clutch transmission DSG DQ381

Dynamic Road Sign Display

Electric auxiliary air heater

Electromechanical parking brake with Auto Hold function

Electromechanical speed-sensitive power steering

Electronic engine sound

Electronic immobilizer

Electronic Stability Control and electromechanical brake booster

Elimination of nameplate for model designation on luggage compartment lid

Emergency call service,10-year contract duration as of initial delivery, condition: mob. phone network available

Emission standard EU6 AP

Equipment options subset for Germany

Ext. mirror w/surround lighting a. frontpassenger ext. mirror lowering function,folding/heated,auto-dimming on dr. side

First aid kit, warning triangle and safety vest

Folding luggage compartment floor

Folding trailer hitch, with electric release

Front center armrest, height- and longitudinally adjustable, w/ storage comp., 2 vents w/ chrome louvers in rear

Front seats with height adjustment, ergoComfort seat on driver side, with electrical backrest adjustment

Front vent and rotary light switch illuminated, with chrome bezel

Front-wheel drive

Fuel system for diesel engine

Fuel tank with a volume of 66 l

Gearshift knob in leather

Headlight range control

Heated front seats

Hill Start Assist

Illuminated vanity mirror in sun visors, extractable sun visors

Initial standard fuel filling

Inserts of front seats and outer rear seats in fabric "Business"

Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer

Interior lights with switch-off delay and dimmer, 2 LED reading lights in front and 2 in rear

ISOFIX anchorage points for mounting of 2 child seats on rear bench seat, also for i-Size child seats

Keyless Start without SAFELOCK

Laminated safety glass windshield, heat- and sound-insulating

Lane keeping system Lane Assist

Leather-wrapped multi-function steering wheel with shifting paddles

LED entry/warning lights in front doors

LED front fog lamps and cornering light

LED headlamps with LED separate daytime running light

LED light unit in front footwell

LED rear combination lamps

Left-hand drive

LongLife Service Regime

Luggage compartment cover extractable and removable

Lumbar supports in front, power-adjustable on driver side

Manual in German (Germany)

Mass damper for steering wheel, 36 Hz

Mistral Gray headliner

Mobile phone interface "Comfort" with inductive charging feature

Multifunction camera

Multi-function display "Premium" with multi-color display

Navigation system "Discover Media" incl. Streaming & Internet

Net partition

No special edition

No special purpose vehicle, standard equipment

Non-folding front passenger seat backrest

Not hot country

Online service, with OCU, with head unit coding, without engine immobilizer interconnection

Operating permit, alteration

Operating voltage 12 V

Park Distance Control - warning signals for obstacles in the front and rear

Part set without country-specific prescriptive standard

Pedestrian Monitoring

Plastic loading edge protection

Plastic scuff plates in door apertures

Preparation for We Connect and We Connect Plus or VW Connect and VW Connect Plus

Privacy glass for rear side windows and rear window

Proactive passenger protection system in combination with Front Assist

Radio

Rain sensor

Rear exhaust tailpipe (standard)

Rear fog light on one side, back-up light on both sides

Rear shock absorption, basic version 1

Refrigerant R1234yf

Regional code " ECE " for radio

Remote unlocking for tailgate/trunk lid

Right exterior mirror, convex

Safety-optimized front head restraints, longitudinally and height adjustable

Service indicator 30 000 km or 2 years (variable)

Shock absorption in front

Small navigation system M&I (Media & Internet package)

Smoker's package: Ashtray and cigarette lighter in front

Special identification label for EC for M1 passenger vehicles

Standard battery/alternator capacity

Standard climatic zones

Standard engine starter

Standard manufacturing sequence

Standard paint coating

Standard pedal cluster

Standard roof

Standard wheel bolts

Start-stop system with regenerative braking

Suspension range 34 installation control only, no requirement forecast

Textile luggage compartment lining

Tire Pressure Monitoring System

Tires without specification of tire brand

Tool kit and jack

Two-tone horn

Type approval country Germany

Unsplit rear bench seat, asymmetric folding backrest, center armrest with storage comp. and load-through hatch

Vehicle class differentiation -3G0-

Vehicles with special upgrade measures

Wagon

Warning signal and warning lamp for front and rear seat belts not fastened

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

Weight range 4 installation control only, no requirement forecast

Wheelbase

Winter package

With electronic steering column lock

Without activated carbon canister with SCR

Without Adaptive Chassis Control

Without add. lights (interior lighting)

Without additional front underbody guard

Without additional tires

Without alternative drive system

Without auxiliary heater/parking heater

Without camera systems/accident sensors

Without CD/DVD for navigation

Without charging cable

Without child seat

Without clock

Without delivery equipment

Without differential lock

Without ECO function

Without electric motor (hybrid)

Without fire extinguisher

Without front passenger seat control

Without garage door opener

Without headlamp washer system

Without head-up display

Without integrated toll system

Without lane change assist

Without light control

Without locking and starting systems

Without preparation for rotating beacon/siren combination

Without preparation for two-way radio installation

Without preparation for VTS (vehicle tracking system)

Without rear spoiler

Without roll-up sunshade

Without seat ventilation/massage seat

Without second battery

Without special body measures

Without surface protection, with additional transport protection measures

Without tie down straps/net/pocket

Without vehicle inlet

Without voice control

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Tyres

MOUNTED TYRES

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Kleber	Front	Left	All season	Aluminium	215/60 R 16 99 H	4.0 mm
Kleber	Front	Right	All season	Aluminium	215/60 R 16 99 H	4.0 mm
Kleber	Rear	Left	All season	Aluminium	215/60 R 16 99 H	5.0 mm
Kleber	Rear	Right	All season	Aluminium	215/60 R 16 99 H	5.0 mm

Permitted: Yes

Roadworthy: Yes

SPARE/EMERGENCY TYRE & ACCESSORIES

Toolkit present: No

Jack present: No

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Devaluation Factors

Nr	Location	Damage type	Repair type	Repair cost	Net cost
1	Windscreen	Stone chip(s)	Replace	€ 831.00	€ 831.00
2	Tyres	Deviation from delivery condition/scope	Replace	€ 720.00	€ 453.60
3	Bonnet	Stone chip(s)	Paint	€ 507.50	€ 319.73
4	Bumper F	Stone chip(s)	Paint	€ 342.75	€ 215.93
5	Preparationtime metal painting	Paint preparation	Execute	€ 244.87	€ 154.27
6	Brand badge F	Broken	Replace	€ 207.06	€ 207.06
7	Headlight L	Scratch(es)	Visual depreciation	€ 150.00	€ 150.00
8	Bumper R	Scratch(es)	Smart repair	€ 120.00	€ 120.00
9	Door FL	Dent(s)	Paintless dent repair	€ 84.00	€ 84.00
10	Outside rear-view mirror housing L	Stone chip(s)	Paint	€ 74.83	€ 47.14
11	12V power outlet cover	Broken	Replace	€ 20.00	€ 20.00
			Total without VAT:	**€ 3,302.01**	**€ 2,602.73**

» Usage Damages

The vehicle shows signs of wear consistent with its age, mileage and purpose.

» Missing Parts

Nr	Location	Damage type	Repair type	Repair cost	Net cost
1	Ignition key	Missing	Replace	€ 300.00	€ 300.00
2	Jack	Missing	Replace	€ 50.00	€ 50.00
3	Tool box	Missing	Replace	€ 50.00	€ 50.00
4	Floor mat(s)	Missing	Replace	€ 50.00	€ 50.00
5	Center hub cap	Missing	Replace	€ 20.00	€ 20.00
			Total without VAT:	**€ 470.00**	**€ 470.00**

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Commercial devaluation

Known previous damages:	No
Previous damages detectable:	No
Repainting present:	No
Paint thickness measurement performed:	Yes - no abnormalities/deviations

PAINTTHICKNESS MEASUREMENT RESULTS

The measured values were in the usual range.

At least 3 measurements were carried out per component.

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Notes On The Assessment

Details of the assignment and the scope of the assessment:	The order was placed to prepare a condition report on the described vehicle. The vehicle condition assessment was carried out in accordance with the order on the basis of the standards for vehicle assessments specified by the client. The expert makes the findings in the individual case on the basis of his own expertise and at his own expert discretion.
Vehicle identification:	WVWZZZ3C5RE033325 VIN checked and matches documentation
Vehicle condition:	Average general condition
Inspection condition:	Restricted
Lifting platform/lifting equipment used:	No
Testdrive carried out:	No
Engine test carried out:	Yes

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Remarks

This copy was generated electronically. It is valid without an original signature.

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Commercial Pictures

Front Left 3/4

Front Right 3/4

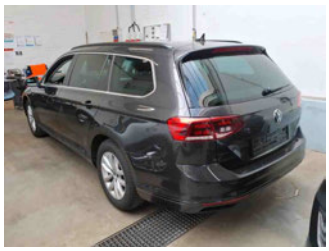

Rear Left 3/4

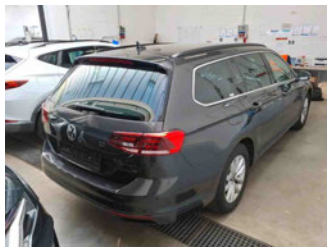

Rear Right 3/4

Mileage

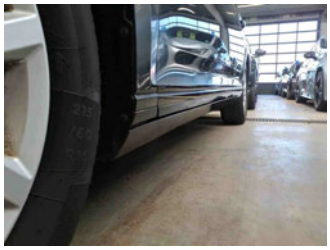

Sill outer L

Sill outer R

Chassis nr

Wheel FL

Wheel FR

Wheel RL

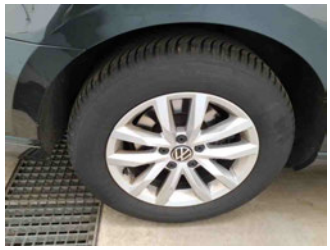

Wheel RR

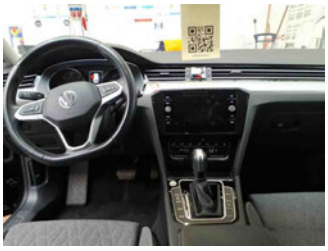

Central console

Engine compartment

Documents

Interior arrangement

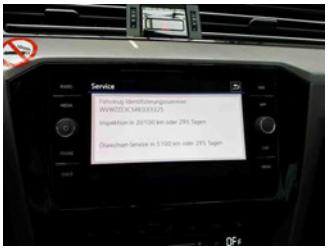

Maintenance

Towbar

History Maintenance

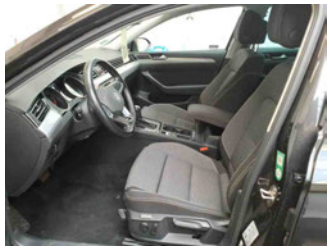

Interior - front

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

Interior - rear

GPS/Radio

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

» Devaluation Damages

DEVALUATION FACTORS

1 - Windscreen - Stone chip(s) - Replace		Repaircosts:	€ 831.00
		Net cost:	€ 831.00
Parts Price			€ 479.00
Body work	32 WU		€ 352.00
Comment	Mehrere Steinschläge im Sichtbereich		

2 - Tyres - Deviation from delivery condition/scope - Replace		Repaircosts:	€ 720.00
		Net cost:	€ 453.60
Parts Price			€ 180.00
Quantity	4		
Comment	Keine AirStop Reifen		

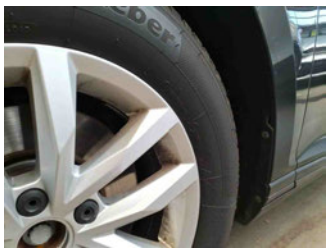

3 - Bonnet - Stone chip(s) - Paint		Repaircosts:	€ 507.50
		Net cost:	€ 319.73
Paint material			€ 147.50
Paint work	30 WU		€ 360.00

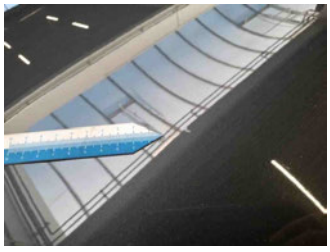

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

4 - Bumper F - Stone chip(s) - Paint		Repaircosts:	€ 342.75
		Net cost:	€ 215.93
Paint material			€ 78.75
Paint work	22 WU		€ 264.00

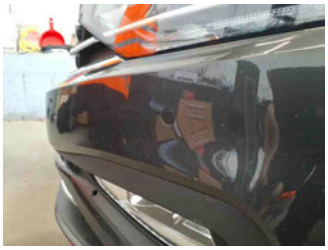

5 - Preparationtime metal painting - Paint preparation - Execute		Repaircosts:	€ 244.87
		Net cost:	€ 154.27
Fixed Price			€ 244.87

6 - Brand badge F - Broken - Replace		Repaircosts:	€ 207.06
		Net cost:	€ 207.06
Parts Price			€ 185.06
Body work	2 WU		€ 22.00

7 - Headlight L - Scratch(es) - Visual depreciation		Repaircosts:	€ 150.00
		Net cost:	€ 150.00
Fixed Price			€ 150.00

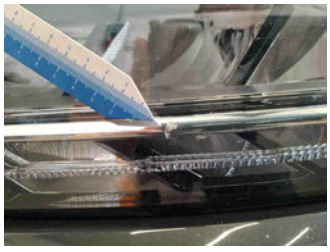

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

8 - Bumper R - Scratch(es) - Smart repair		Repaircosts:	€ 120.00
		Net cost:	€ 120.00
Fixed Price			€ 120.00

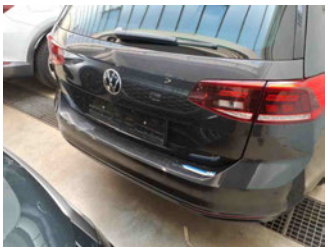

9 - Door FL - Dent(s) - Paintless dent repair		Repaircosts:	€ 84.00
		Net cost:	€ 84.00
Fixed Price			€ 40.00
Other work	4 WU		€ 44.00
Quantity	1		

10 - Outside rear-view mirror housing L - Stone chip(s) - Paint		Repaircosts:	€ 74.83
		Net cost:	€ 47.14
Paint material			€ 14.83
Paint work	5 WU		€ 60.00

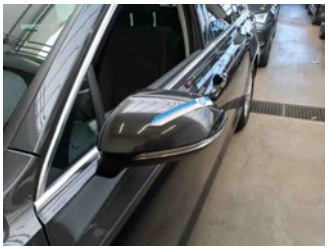

11 - 12V power outlet cover - Broken - Replace		Repaircosts:	€ 20.00
		Net cost:	€ 20.00
Parts Price			€ 20.00

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

MISSING PARTS

1 - Ignition key - Missing - Replace		Repaircosts:	€ 300.00
		Net cost:	€ 300.00
Parts Price			€ 300.00
Quantity	1		

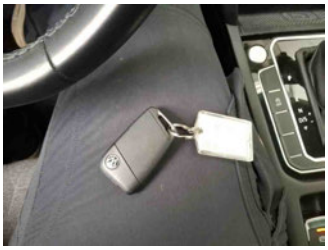

2 - Jack - Missing - Replace		Repaircosts:	€ 50.00
		Net cost:	€ 50.00
Parts Price			€ 50.00

3 - Tool box - Missing - Replace		Repaircosts:	€ 50.00
		Net cost:	€ 50.00
Parts Price			€ 50.00

4 - Floor mat(s) - Missing - Replace		Repaircosts:	€ 50.00
		Net cost:	€ 50.00
Parts Price			€ 50.00

Assessment

- Vehicle Inspection Report -

Number: 10281176
From: 24.03.2026

5 - Center hub cap - Missing - Replace	Repaircosts:	€ 20.00
	Net cost:	€ 20.00
Parts Price		€ 20.00
Comment	2 Stück	