



Expertise

Protocol number: 46594656
Order No. / Reference: 26712362
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Caddy 2.0 TDI BMT (7-Si.) Caddy Maxi

VIN: WV2ZZZSK1PX038274



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy 2.0 TDI BMT (7-Si.) Caddy Maxi	
Vehicle Identification number	WV2ZZZSK1PX038274
Mileage (Read)	132,914 km
First registration	12 Dec 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	75 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	Yes (not ozone-treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,600 km
Last service on / at	04/2026 at 125,801 km		
Key is / should be	2 / 4	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP864488
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLG 00351		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,450 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96W	Summer tyres on Steel rim with wheel cover	Continental	4mm / 4mm
2)	205/60 R16 96W	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Continental	4mm / 3mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/60 R16 98V	Summer tyres on Steel	Sonstige	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments: Storage tray on the headliner with 2 roof grab handles in the driver's cab
- Airbag: Side and head airbags for driver and front passenger (head airbags for the outer rear seats - center airbag in the front)
- Reinforced battery (70 Ah/ 420 A)
- Floor coverings, carpeting in the driver's cab and passenger compartment (carpeting in the driver's cab and passenger compartment)
- Three-phase generator 140 A
- Electronic Stability Program with Brake Assist (including Anti-lock Braking System (ABS), Traction Control System (ASR), (EDS and MSR) - Evasive Steering Assist and Turn Assist)
- Window: Side window in the passenger/cargo compartment, rear right, permanently installed
- Window: Side window in the passenger/cargo compartment, front right, permanently installed
- Windows: Green heat-insulating glass
- Luggage compartment cover, foldable and removable
- Transmission: 6-speed transmission
- Tailgate with window cutout
- Interior lighting: in the passenger compartment (LED reading lights)
- Electric child safety lock for sliding doors
- Child seat anchorage (I-Size) and top tether (for seats in the passenger compartment (except the middle seat of the 2nd row))
- Steering wheel: Multifunction steering wheel
- Steering column adjustable in height and tilt
- Center console with 2 universal cup holders
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Upholstery: Fabric, "Double Grid" design
- Radio "Composition Audio" with 16.51 cm (6.5 inch) touch color display (4 speakers - mobile phone interface - 1 USB (Type C) interface)
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tires: Steel wheels 6.5J x 16, in black
- reversing light
- Gearshift lever in plastic
- Sliding door, left side in the passenger/cargo area
- Side paneling for comfort in the passenger compartment
- Speed-sensitive power steering (Servotronic)
- Seat belts: in the passenger compartment (with belt tensioners for the outer seats in the 2nd row)
- Driver's cab seats: Height adjustment for left seat, manual
- Seats: Seat left and right, in the 1st row
- Sun visors with mirrors, airbag label on passenger sun visor
- Lane keeping assistant "Lane Assist"
- Power outlets: 12-volt socket in the cargo area
- First aid kit, warning triangle and high-visibility vest
- Towing eye front and rear, screw-in
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Exterior mirror housings in black, door handles in body color and sliding door rail in silver
- Operating voltage 12 V
- Brake booster
- third brake light
- Roof rail/roof rack preparation
- Electronic parking brake including auto-hold function
- Automatic headlight control with daytime running lights
- Windows: Heated rear window
- Window: Side window in the passenger/cargo compartment, rear left, permanently installed
- Window: Side window in the passenger/cargo compartment, front left, permanently installed
- Windows: Laminated glass front pane in heat-insulating glazing
- electric window regulator
- Cruise control system including speed limiter
- Glove compartment with lid, illuminated
- Rear window wiper/washer system with intermittent function
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Headrests (2), height adjustable
- Paint protection/transport protection film (transport protection film (minimum protection) with additional transport protection measures)
- Headlight range control
- Multifunction display "Plus"
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Radio accessories: Digital radio reception DAB+
- Wheels, tires: Wheel covers
- Wheels/Tires: 205/60 R 16 96 H XL, optimized for low rolling resistance
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Windscreen wiper intermittent control with light sensor
- Sliding door, on the right in the passenger/cargo area
- Side indicator lights
- Seat belts: Three-point automatic seat belts (front with belt height adjustment and electric belt tensioners)
- dimmable interior safety mirror
- Seats in the passenger compartment: 3-seater bench in the 2nd row (foldable, rollable and removable) (ISOFIX and Top Tether on outer seats in the passenger compartment - 2 individual seats in the 3rd row)
- Start-stop system (with brake energy recuperation)
- Telephone: Mobile phone interface
- Lashing points: 6 lashing points for securing cargo



- Warning tone and light for unfastened front seat belts
- Central locking with remote control and interior operation
- Additional dust protection seal on the outside

- Electronic immobilizer
- Auxiliary heating: Electric auxiliary air heater

Extra equipment

- Exterior mirrors, electrically adjustable, heated and folding
- Electrical interface for external use (2 USB ports (Type C) in the center console, front - 2 USB charging ports (Type C) on the center armrest at the rear)
- Windows: Front side windows in heat-insulating glass (rear side windows and rear window tinted, 74% light-absorbing)
- Air conditioning system "Air Care Climatronic" with 2-zone temperature control and air purification function
- LED headlights with LED daytime running lights
- Navigation system "Discover Media" (Caddy) (25.4 cm (10 inch) touch color display - streaming & internet - 2 USB interfaces (Type C) in the center console, front)
- Package: Winter package (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Keys for locking system: 4 remote control flip keys
- Seats in the driver's cab: AGR ergoComfort seat, left (Caddy) (Folding tables on the backrests of the seats in the 1st row - front seats height-adjustable, seat surface tilt and depth adjustment for the left seat - 4-way electrically adjustable lumbar support on the left and manually adjustable lumbar support on the right)
- Parking assistance (parking distance control, front and rear)
- Deletion: Lettering on the rear (excluding lettering for type/model designation - excluding promotional lettering and decals)
- Mesh partition for headrests
- Rear door: Rear wing doors with window cutout, asymmetrically divided
- Paint finish: Metallic
- Front center armrest (height and length adjustable with 2 cup holders in the front and 2 air vents in the rear)
- Package: Light and Sight (Safety interior mirror, automatically dimming - Windscreen wiper interval control with light and rain sensor - Automatic headlight control, with daytime running lights and welcome and farewell lights)
- Wheels/Tires: Spare wheel in driving tire size, steel (spare wheel in driving tire size, steel - on-board tools and jack)
- Seats: Deletion of the 3rd row of seats (3-seater bench in the 2nd row (foldable, rollable and removable), preparation for 2 seats in the 3rd row, ISOFIX and Top Tether on outer seats in the 2nd row)
- Bumpers in body color
- Partition net: Luggage net in the cargo/passenger compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Instrument panel	Indicator light (Reifendruck) - on - Perform diagnosis
3	Sliding door - left side	Sliding door - dent(s) - Smooth repair work
4	Bonnet	Bonnet - dent(s) - Smart repair
5	Body	Body - Glued / labelled - De-glue / neutralise
6	Interior	Interior (Rauch) - Odour - Ozone treatment
7	Wing mirror - right side	Cap - Scratch(es) - Paint
8	Front bumper	Front bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
3	Side panel - rear right side	Side panel - dent(s) - No deduction
4	Roof	Roof - dent(s) - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Professionally repaired	

Repainting

No. Repainting

1 Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side, Professionally carried out

Paint coat thickness measurement

Mudguard - left side	209 µm	Side panel - rear left side	185 µm
Door - rear left side	176 µm	Door - front left side	181 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

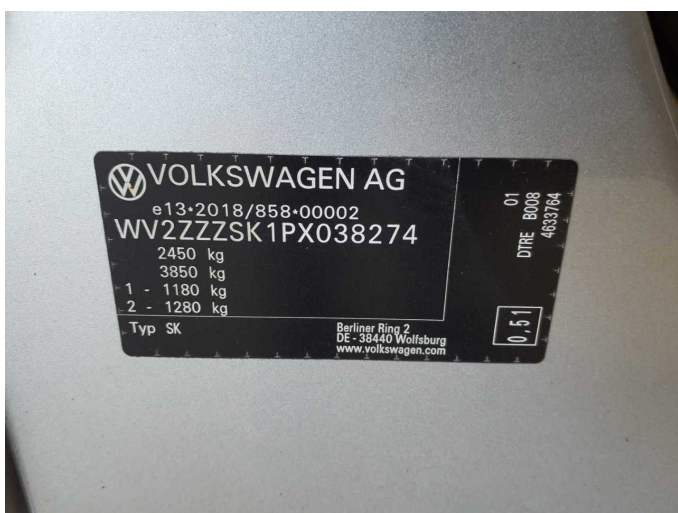


Figure 11: VIN



Figure 12: Mounted tyres

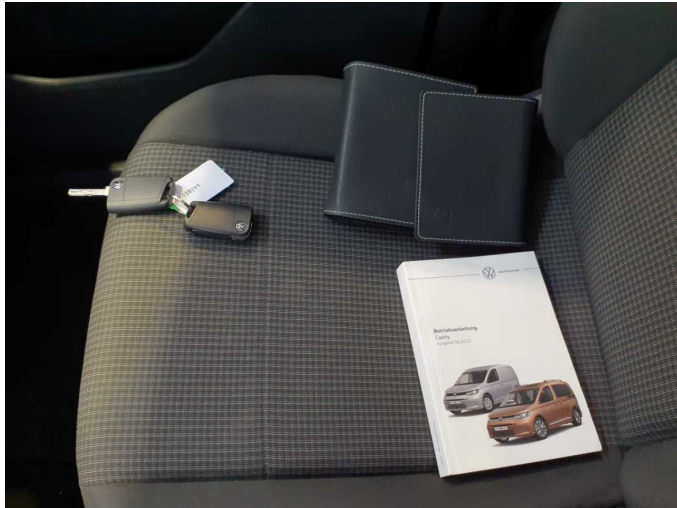


Figure 13: Documents



Figure 14: Additional tyres

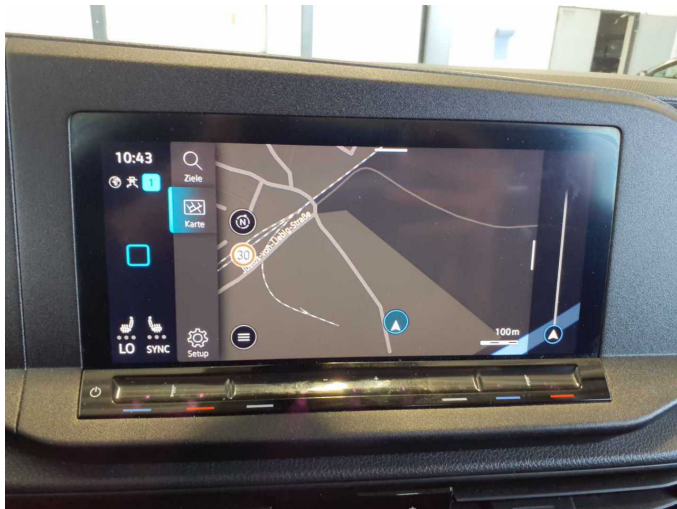


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Damage 2: Instrument panel: Indicator light (Reifendruck) - on - Perform diagnosis



Damage 3: Sliding door - left side: Sliding door - dent(s) - Smooth repair work



Damage 3: Sliding door - left side: Sliding door - dent(s) - Smooth repair work

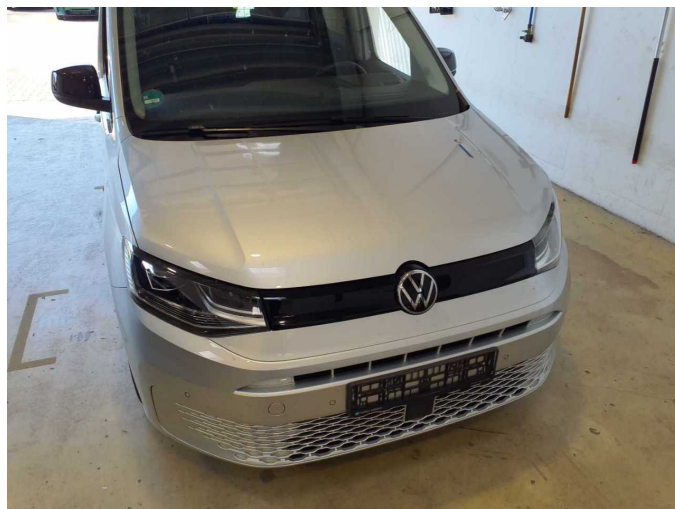

Damage 4: Bonnet: Bonnet - dent(s) - Smart repair




Damage 4: Bonnet: Bonnet - dent(s) - Smart repair



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise




Damage 5: Body: Body - Glued / labelled - De-glue / neutralise

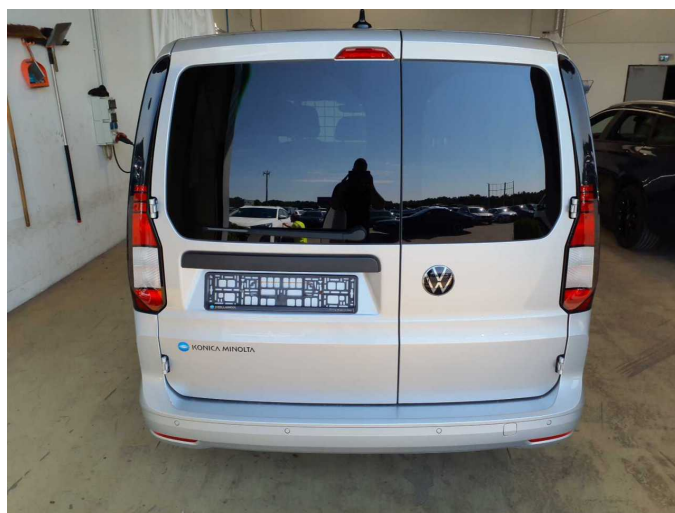


Damage 5: Body: Body - Glued / labelled - De-glue / neutralise




Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint

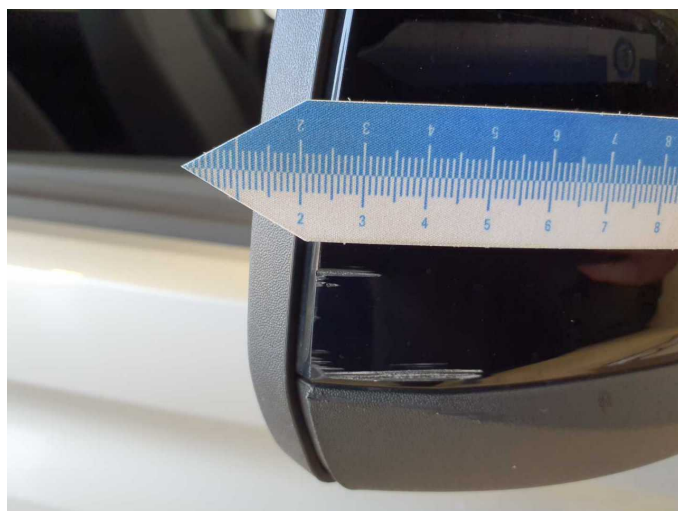

Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint

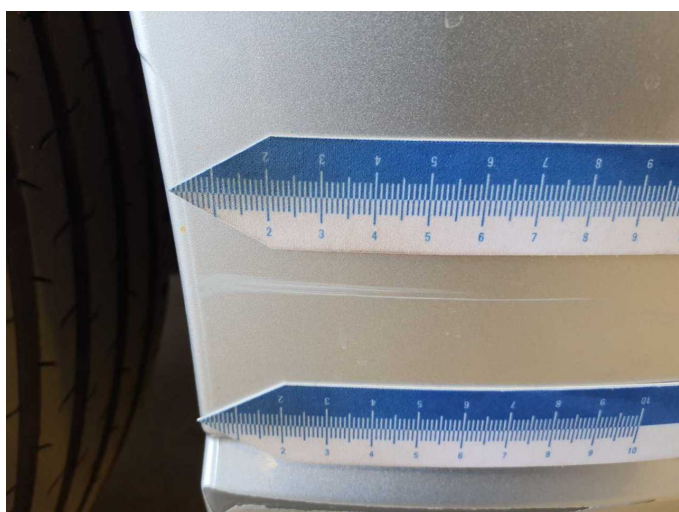


Damage 8: Front bumper: Front bumper - Scratch(es) - Paint

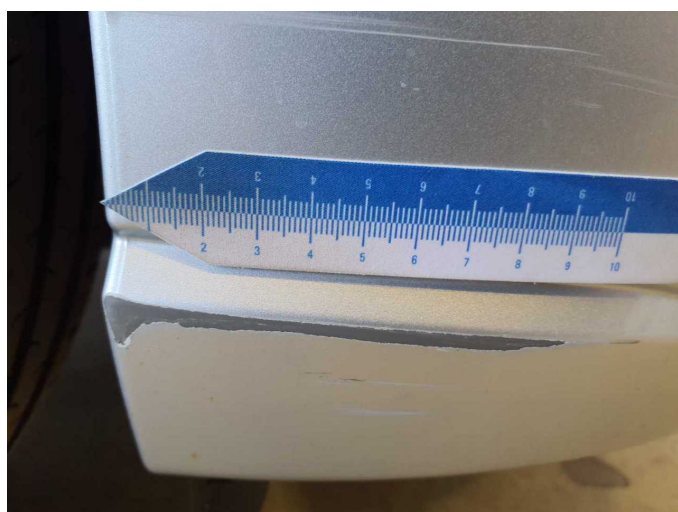

Damage 8: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Front bumper: Front bumper - Scratch(es) - Paint

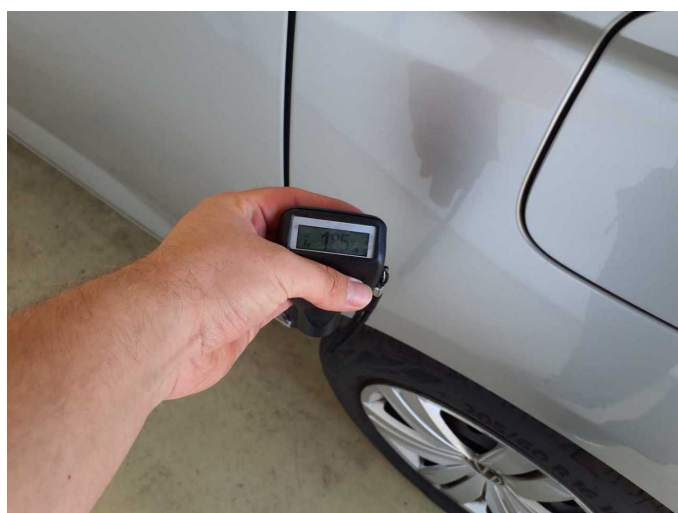

Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side




Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side

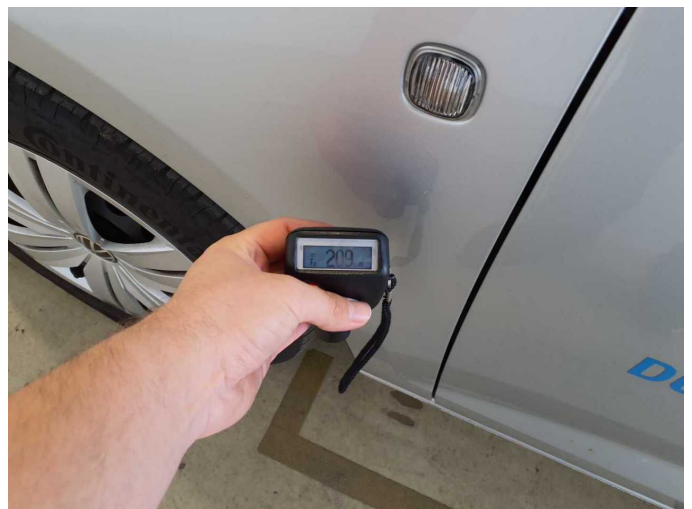

Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - rear left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZSK1PX038274

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy 2.0 TDI BMT (7-Si.) Caddy
Maxi

Datum	KM-Stand	Beschreibung
16.04.2026	125.801	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
24.02.2026	120.779	Regelwartungsdienst; Wartung Sonstiges
19.01.2026	118.192	Systemtest/Eigendiagnose
01.12.2025	114.255	AU
16.09.2025	106.464	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.04.2025	90.881	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
21.01.2025	83.104	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.05.2024	60.534	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.10.2023	40.242	Motoröl b. Wartung; Ölwechsel
01.09.2023	33.589	Regelwartungsdienst
21.04.2023	15.888	Motoröl b. Wartung; Ölwechsel