



Expertise

Protocol number: 46708804
Order No. / Reference: 26597112
Inspection date: 24 Jul 2026

Manufacturer: Opel	Model: Astra 1.5 D Start/Stop Sports Tourer Business Edition
VIN: W0VBD8EU2N8043891	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Business Edition	
Vehicle Identification number	W0VBD8EU2N8043891
Mileage (Read)	169,325 km
First registration	9 Sept 2022
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,496 ccm / 3
Power	77 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Quarz Grau Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	82 %
Last service on / at	10/2025 at 150,765 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	GJ671617
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALJ 00129		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,945 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Steel	Continental	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Steel	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	205/55 R16 94V	Winter tyres on Light alloy	Dunlop	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

Standard equipment

- 2 ignition keys
- Airbag for driver and passenger side
- Airbag: Head airbags, 1st and 2nd row (outer seats)
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- black roof rails
- Diesel particulate filter (DPF)
- Electronic Stability Program Plus (ESP Plus)
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear
- trunk light
- Rear headrests (3)
- Cargo area cover
- LED daytime running lights
- Steering column, height and reach adjustable
- Fog light
- Upholstery: Cloth
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire repair kit
- Wheels: Designer wheels, 7 J x 16 with tires 205/55 R16
- Power steering
- Luggage compartment safety net
- Seats: Comfort seats, front
- 12V power outlet in the center console
- Pre-installation for child seat mounting system "ISOFIX"
- Heat-insulating glazing, green tinted, and windshield

Extra equipment

- Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Radio: Multimedia Navi (Multimedia Radio, 7" touchscreen color display with USB port, hands-free system, voice control, Bluetooth audio streaming, smartphone integration via Apple CarPlay and Android Auto - Navigation system with integrated memory - Road map for over 30 European countries - Map display in 2D and 3D - Dynamic route guidance via map and/or arrow display and voice prompts - Dynamic destination guidance via enhanced Traffic Message Channel (TMCpro))

- Storage compartments
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Roof design line, above in black
- Decorative trim strips Antelao Sand/Polar Silver
- Tachometer
- Electric windows front and rear
- Transmission: 6-speed manual transmission
- rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Front headrests
- LED headlights
- Steering wheel: Leather steering wheel
- Lighting equipment
- Pedals: Disengaging safety pedals
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" touchscreen color display
- Tire pressure monitoring system
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Start/Stop System
- Traction Control (TC) Plus
- Immobiliser
- Central locking with remote control and interior switches

- Automatic climate control, two zones (with separate temperature control for driver and front passenger, including: - recirculation mode, manual - particle/activated carbon filter - automatic air distribution - sun position sensor - humidity sensor)
- Detachable trailer hitch (including trailer stability program TSP)
- Paint finish: Pearl effect
- Rear view camera



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Door - rear right side	Door - dent(s) - Smooth repair work
3	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
4	Roof	Roof rail - right side - Dent / paintcoat damage - Smart repair
5	Roof	Roof rail - left side - Dent / paintcoat damage - Smart repair
6	Side panel - rear left side	Elbow - Scratched - Smart repair
7	Sill - right side	Sill - Scratch(es) - Smart repair
8	Sill - left side	Sill - Scratch(es) - Smart repair
9	Interior	Boot cover / roller cover - Broken / torn - Replace
10	Front bumper	Front bumper - Stone chips - Paint
11	Door - front left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratch(es) - No deduction
2	Door - rear left side	Door - Scratch(es) - No deduction
3	Boot lid / rear door	Boot lid - Abrasion - No deduction
4	Boot lid / rear door	Trim - standard - lower - Scratched - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Wheel / tyres - Wheel cover set - complete

Equipment - Tirefit complete

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 16 May 2024	5.987,41 €



Repainting

No. Repainting

1 Boot lid / rear door, Professionally carried out

Paint coat thickness measurement

Boot lid / rear door 278 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

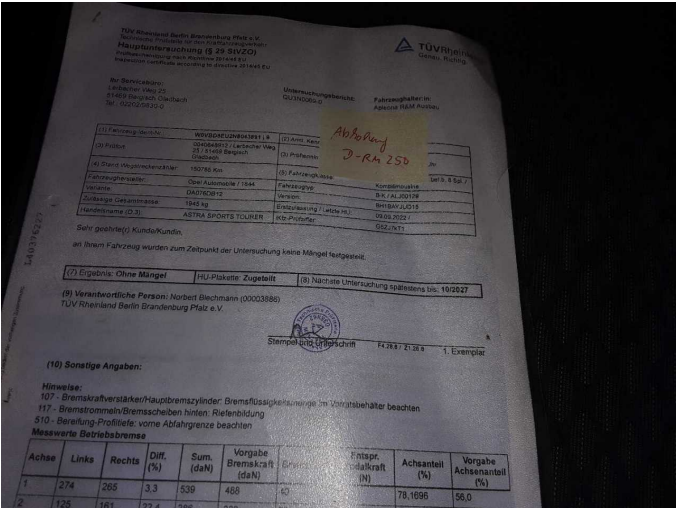


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

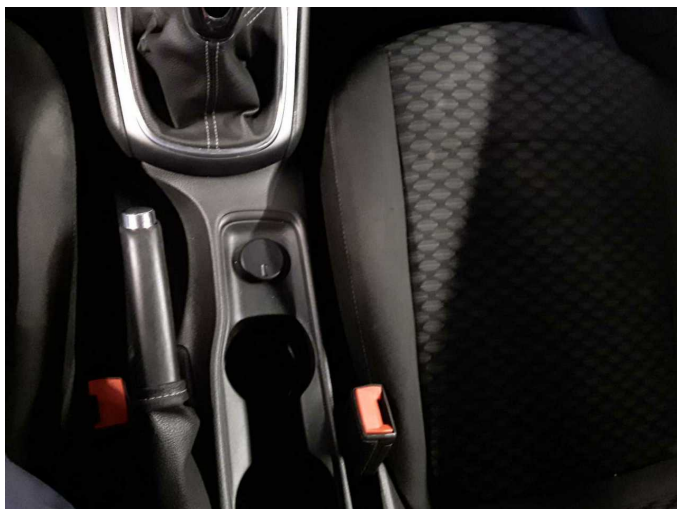


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

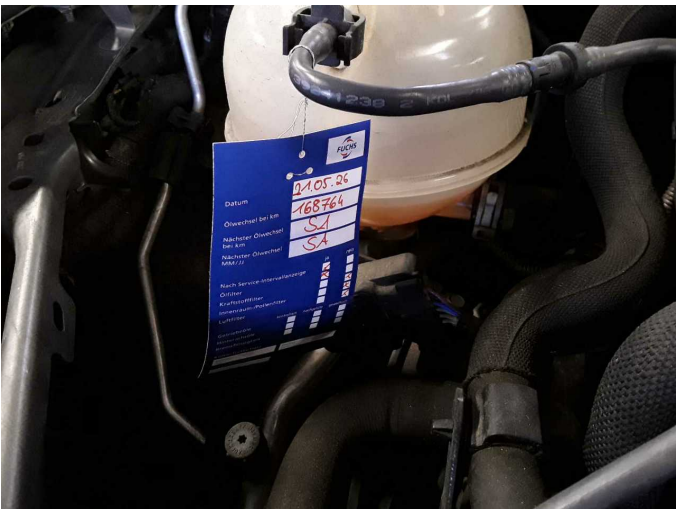


Figure 29: Misc.

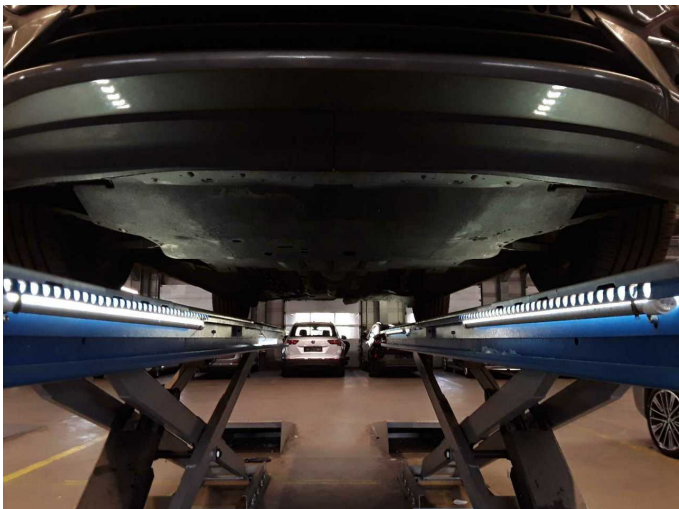


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

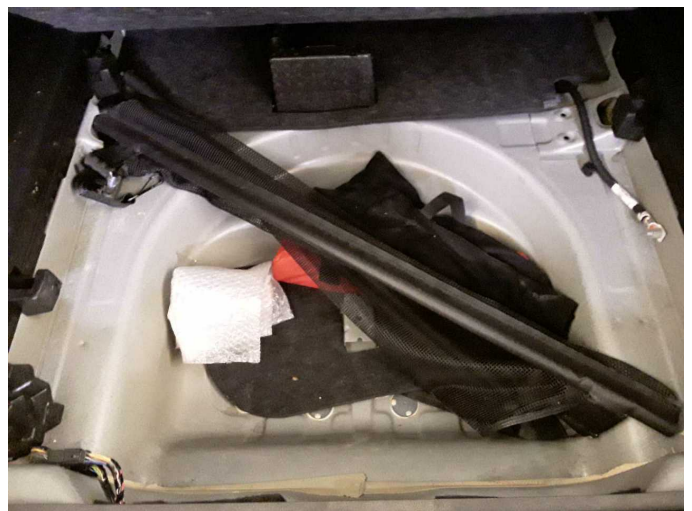



Figure 36: Misc.




Figure 37: Misc.



Damage 1: Roof: Roof - dent(s) - Smooth repair work

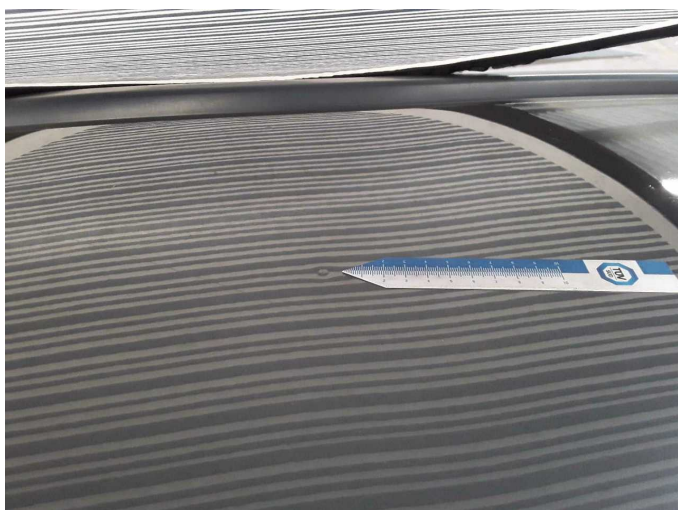


Damage 1: Roof: Roof - dent(s) - Smooth repair work

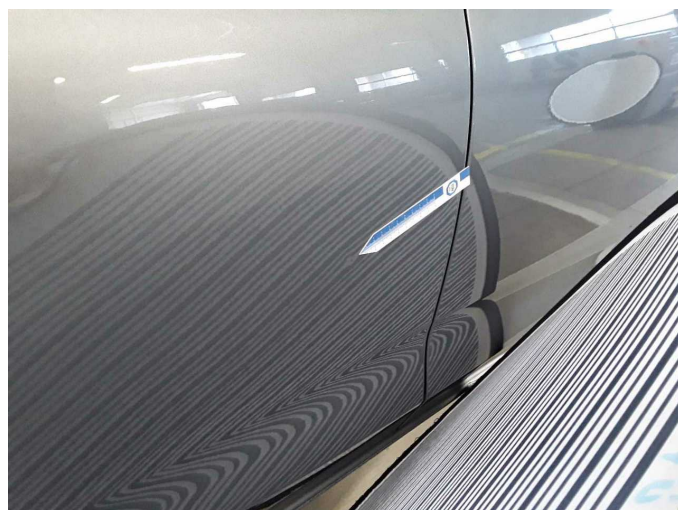

Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work

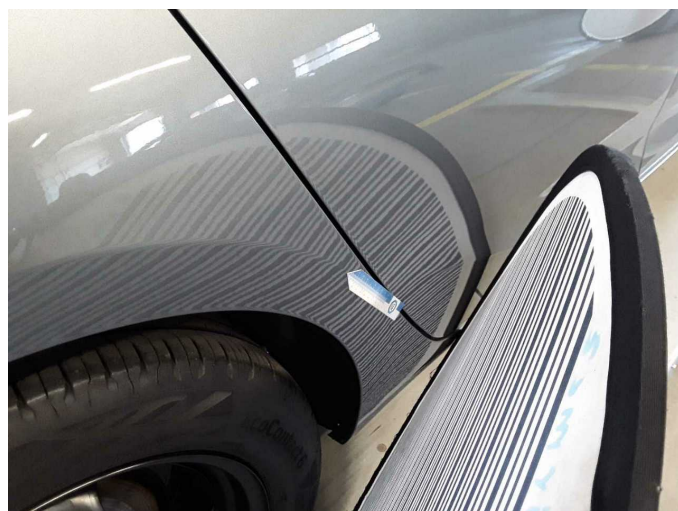

Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

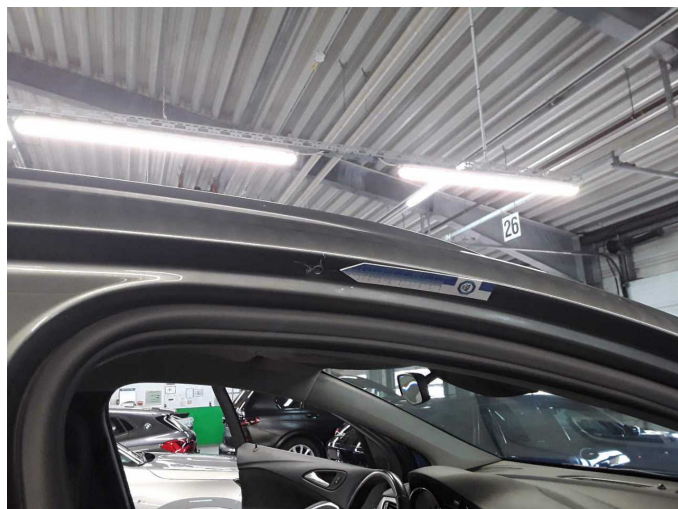

Damage 4: Roof: Roof rail - right side - Dent / paintcoat damage - Smart repair




Damage 4: Roof: Roof rail - right side - Dent / paintcoat damage - Smart repair

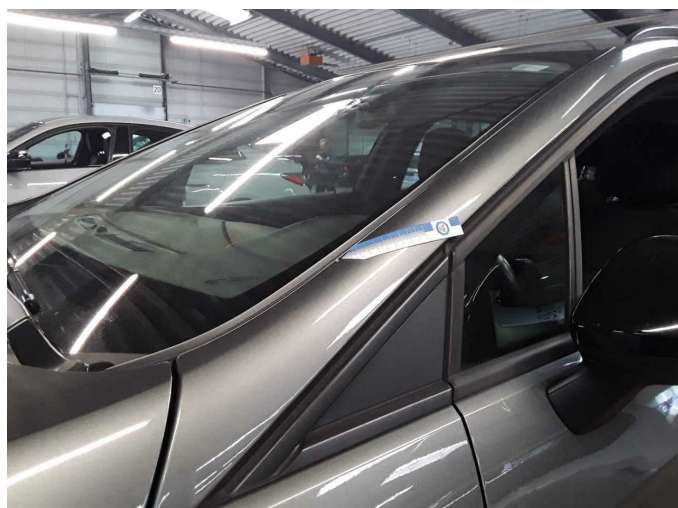

Damage 5: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 5: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair

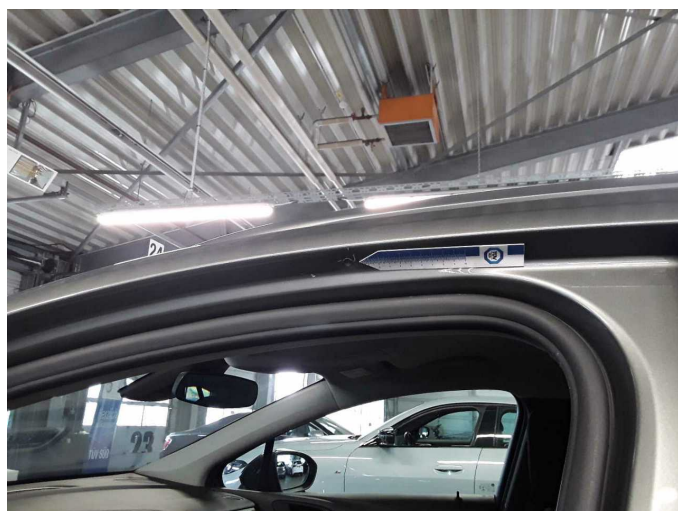

Damage 5: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 5: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Elbow - Scratched - Smart repair




Damage 6: Side panel - rear left side: Elbow - Scratched - Smart repair



Damage 6: Side panel - rear left side: Elbow - Scratched - Smart repair



Damage 6: Side panel - rear left side: Elbow - Scratched - Smart repair

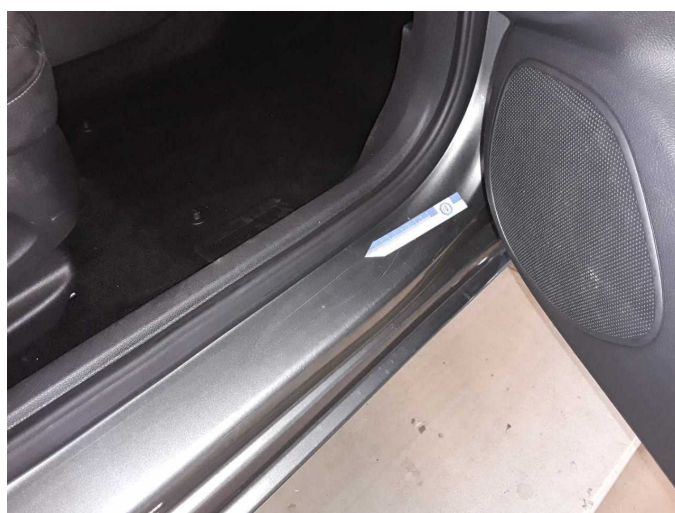

Damage 7: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 7: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 8: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 8: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 9: Interior: Boot cover / roller cover - Broken / torn - Replace




Damage 9: Interior: Boot cover / roller cover - Broken / torn - Replace




Damage 9: Interior: Boot cover / roller cover - Broken / torn - Replace



Damage 10: Front bumper: Front bumper - Stone chips - Paint

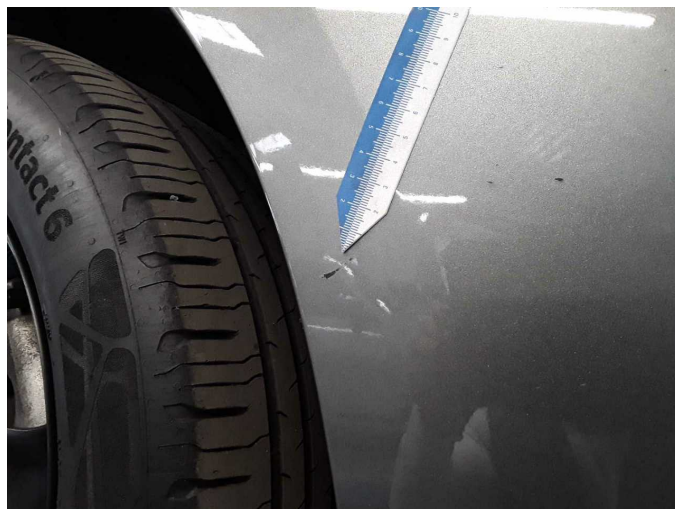

Damage 10: Front bumper: Front bumper - Stone chips - Paint

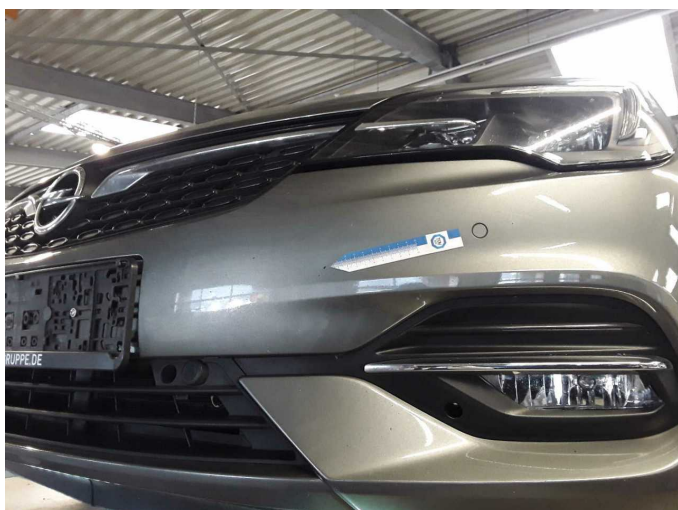


Damage 10: Front bumper: Front bumper - Stone chips - Paint



Damage 10: Front bumper: Front bumper - Stone chips - Paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

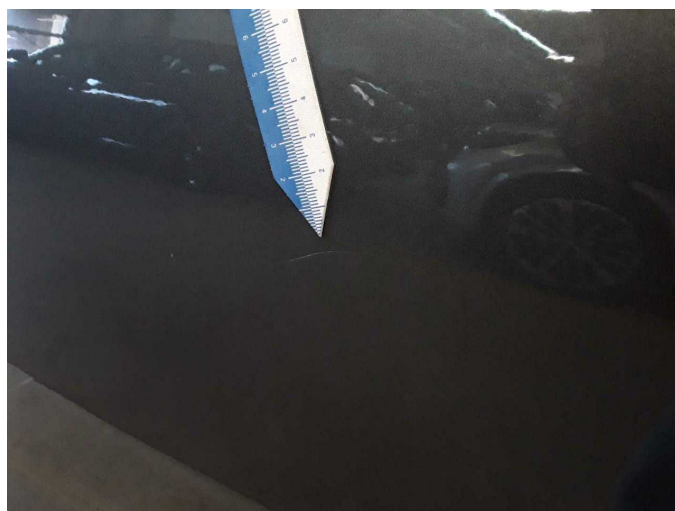

Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - No deduction

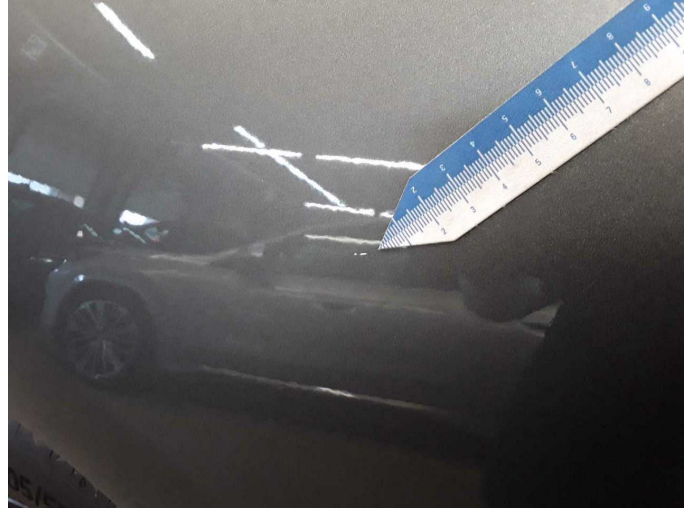


Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door - Scratch(es) - No deduction

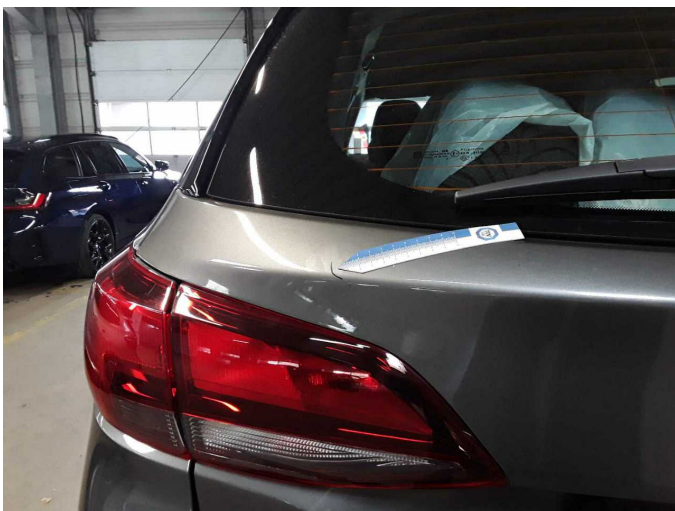


Wear and tear 3: Boot lid / rear door: Boot lid - Abrasion - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid - Abrasion - No deduction




Wear and tear 4: Boot lid / rear door: Trim - standard - lower - Scratched
- No deduction

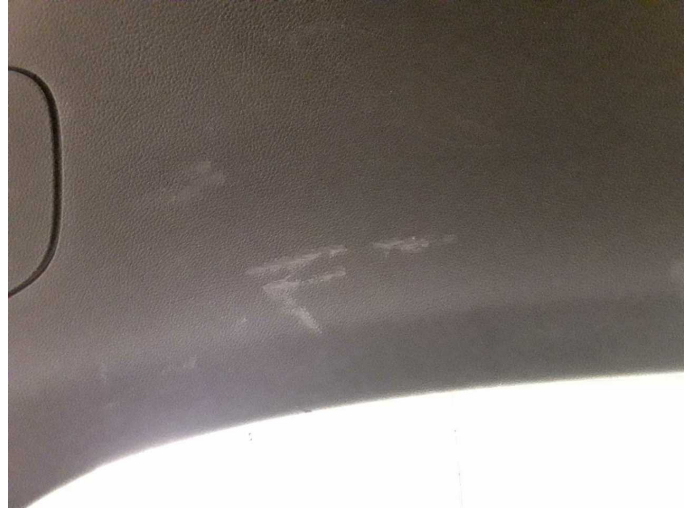

Wear and tear 4: Boot lid / rear door: Trim - standard - lower - Scratched
- No deduction



Wear and tear 5: Vehicle glazing: Windscreen - Stone chips - No deduction

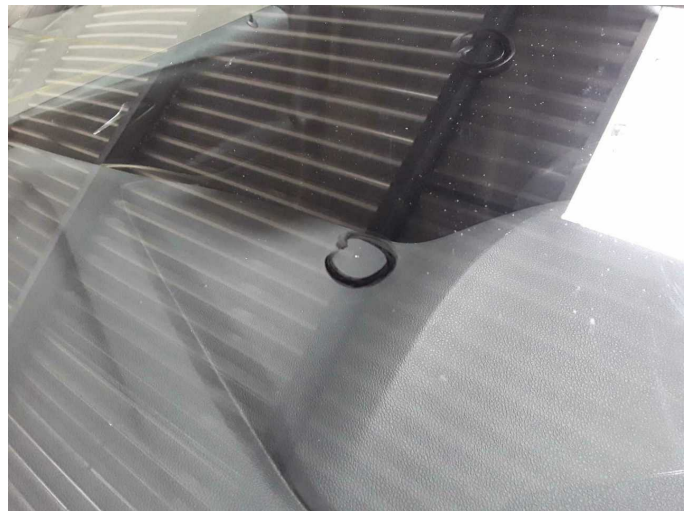

Wear and tear 5: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 5: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 5: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 6: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 6: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 6: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 6: Bonnet: Bonnet - Stone chips - No deduction



Boot lid / rear door: 278 µm



Boot lid / rear door: 278 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EU2N8043891

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Business Edition

Datum	KM-Stand	Beschreibung
28.10.2025	150.765	HU + AU; Keilrippenriemen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.11.2024	103.422	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.10.2024	103.422	Systemtest/Eigendiagnose
19.06.2024	75.244	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.02.2024	54.713	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.09.2023	39.098	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges