



Expertise

Protocol number: 46487319
Order No. / Reference: 26663508
Inspection date: 9 Jul 2026

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVVZZZ3CZME136664



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVVZZZ3CZME136664
Mileage (Read)	123,693 km
First registration	1 Jul 2021
Number of holders	1
Next periodical technical inspection	10/2026
(Report not on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	11,300 km
Last service on / at	05/2026 at 119,929 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC382209
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / BRZ 00080		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	215/55 R17 94H	Winter tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Electrically adjustable and heated exterior mirrors, ambient lighting (automatically dimming on the driver's side)
- Chrome trim on the side windows
- Tachometer
- Parking aid - warning signals for obstacles in the front and rear area
- Electronic parking brake including auto-hold function
- Remote release for luggage compartment lid
- Windscreen made of laminated safety glass, heat and sound insulating
- Adjustable luggage compartment floor
- Interior lights with delayed shut-off and dimming function (2 LED reading lights each at the front and rear)
- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Rear headrests (3)
- LED taillights
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box (2 rear air vents with chrome slats)
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Package: Light and Sight Package "Plus" (LED lights in the front footwell - Electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side - Entry/warning lights in the front doors, in LED technology - Automatic headlight control, with daytime running lights, "Leaving Home" function and manual "Coming Home" function - Interior light with delayed shut-off and dimming function, 2 LED reading lights each in the front and rear - Automatically dimming interior mirror - Illuminated vanity mirrors - Extendable sun visors - Rain sensor)
- Tire pressure monitoring system (passive)
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest (and pass-through option)
- Keyless start system without safe locking
- Power steering (electromechanical, speed-dependent)
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Cup holders (2) front
- Hill start assist
- third brake light
- black roof rails
- e-Sound (artificially generated engine noise to inform other road users about the approach of the e-vehicle)
- Entry/warning lights in LED technology in the front doors
- Automatic headlight control (with daytime running lights, "Leaving home" function and manual "Coming home" function)
- Pedestrian detection
- Transmission: 6-speed DSG (6-speed dual-clutch transmission DSG)
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic" with 3-zone temperature control and allergen filter
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- Steering wheel: Multifunction sports steering wheel in leather, with paddle shifters (gearshift knob in leather)
- Multifunction display "Premium" with multi-color display (showing, among other things: - Outside temperature - Average consumption - Average speed - Trip distance - Trip time - Gear recommendation - Speed warning - Comfort - Current consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature display - Lights & visibility - Language - Auxiliary heater - Winter tires)
- Mains charging cable for household socket
- Mesh partition
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Fabric "Weave" (center panels of the front seats and outer rear seats in fabric "Weave")
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)



- Seats: Comfort seats in the front
- Seats: Lumbar support in the front (driver's side electrically adjustable)
- Lane Assist (warns with a corrective steering intervention if the vehicle unintentionally leaves the lane)
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer

Extra equipment

- Active Info Display
- Roof headliner in titanium black (with custom installation)
- Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated make-up mirror in the sun visors, extendable sun visors)
- Cable for AC charging station (incl. standard mains charging cable for household socket)
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, 1 USB-C charging port in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping system, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: Ambient lighting "Plus" (multicoloured ambient lighting - LED entry/warning lights in all doors - interior lights with switch-off delay and dimming function, 2 LED reading lights each in the front and rear)
- Wheels: 4 light alloy wheels 8 J x 18 "Dartford" (AirStop tires 235/45 R 18, optimized for rolling resistance - With individual installation - Wheel locks with enhanced theft protection - Rear disc brakes, brake calipers in blue (only for GTE))
- Sunshade roller blind on the rear door windows
- Auxiliary heating and ventilation (with radio remote control and timer)

- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs - improved reception performance)
- Seat belts: Three-point automatic seat belt (seat belt for middle rear seat - seat belts for outer rear seats - front seat belts with height adjustment and belt tensioner)
- Seats: Front seats are height-adjustable (ergoComfort seat on the driver's side - with electric backrest adjustment)
- 12V power outlet on the rear center console (and in the luggage compartment)
- Textile floor mats (front and rear)
- Warning tone and light for unfastened seat belts front and rear

- Exterior mirrors with ambient lighting and passenger-side mirror lowering function (foldable and heated - dimming on the driver's side)
- Removable luggage compartment protective mat (back of the rear seat backrest with black rubber coating)
- Paint finish: Pearl effect
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Package: "Design and Comfort" in conjunction with "Business Premium" (silver anodized roof rails - stainless steel door sill trims front and rear - automatically heated windshield washer nozzles in the front - "ArtVelours" seat center panels of the front seats and outer rear seats, - inner side bolsters in "Vienna" leather - sport comfort seats in the front - heated front seats)
- Package: "Easy Open & Close" package including safe locking (extendable and removable luggage compartment cover with electric opening - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking)
- Proactive occupant protection system and lane change assistant "Side Assist" (Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - lane change assistant "Side Assist" and parking assistant)
- Rear side windows and rear window tinted
- Voice control



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
3	Roof	Roof rail - right side - dent(s) - Smooth repair work
4	Wing mirror - right side	Cap - Scratch(es) - Smart repair
5	Door - front left side	Door handle - outside - Scratch(es) - Paint
6	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
7	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
8	Tail light	Tail lamp - left side - Broken / torn - Replace
9	Tail light	Tail lamp - right side - Broken / torn - Replace
10	Front structure	Emblem - Broken / torn - Replace
11	Side panel - rear right side	Side panel (Wellig) - Unprofessionally repaired - Paint
12	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Repair and paint
13	Front bumper	Front bumper - Scratch(es) - Paint
14	Rear bumper	Rear bumper - Scratch(es) - Paint
15	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
16	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
17	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
18	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Replace
19	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
20	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint
21	Roof	Roof (Anätzung) - Paint defect - Repair and paint
22	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Seat - front	Seat cover - left side - Scratch(es) - No deduction
2	Side panel - rear left side	Sill - dent(s) - No deduction
3	2nd wheel set	2 tyres - does not meet manufacturer specifications - No deduction
4	2nd wheel set	1 alloy rim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 17 Apr 2024	1.595,17 €
2	Front, Provided by user / customer, from 3 Apr 2025	1.861,64 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	375 µm	Door - rear right side	172 µm
------------------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

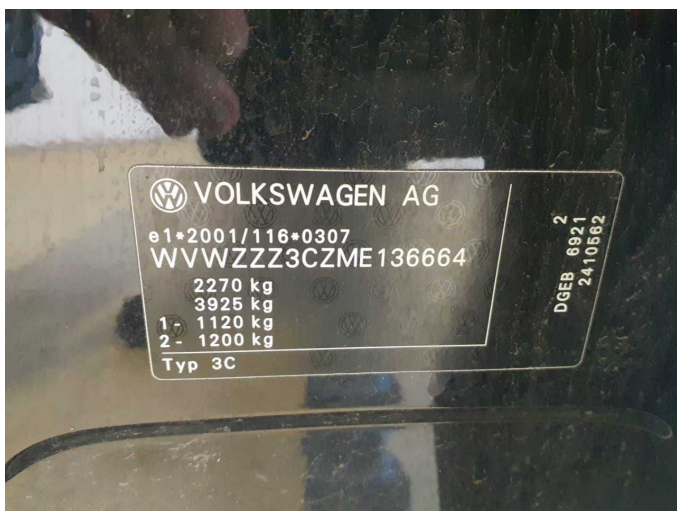


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

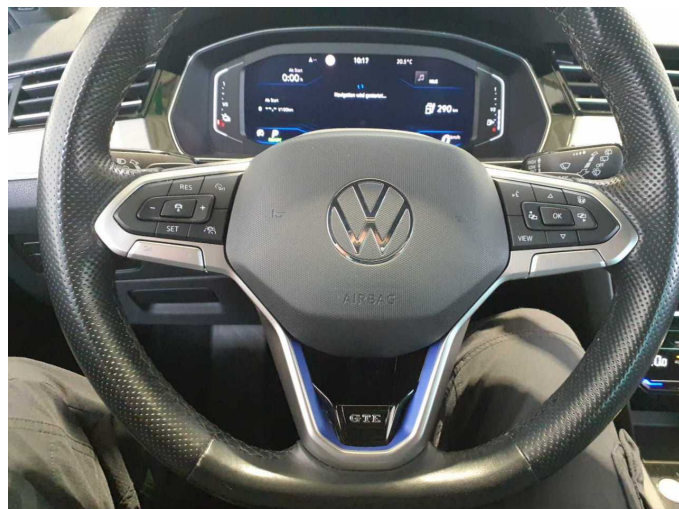


Figure 20: Misc.

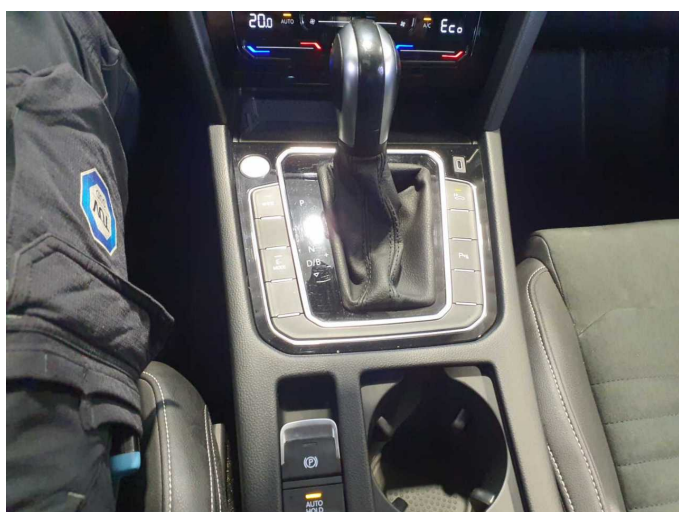


Figure 21: Misc.

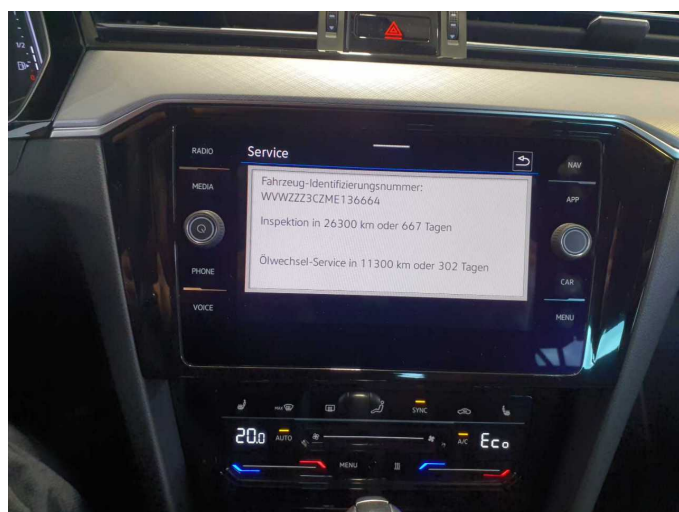


Figure 22: Misc.



Figure 23: Misc.

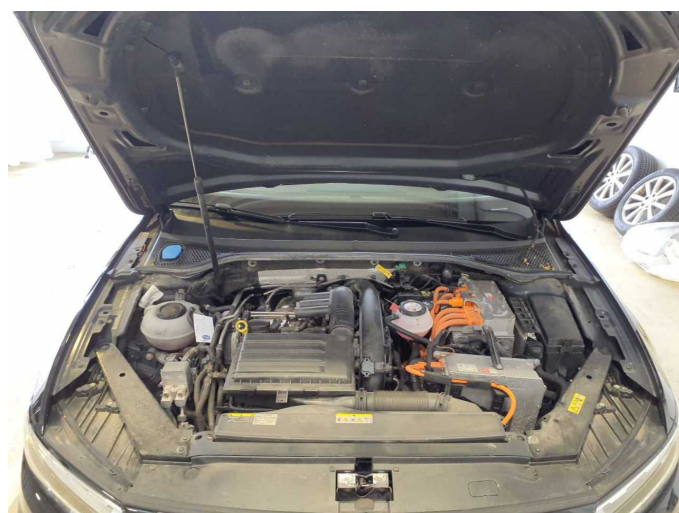


Figure 24: Misc.

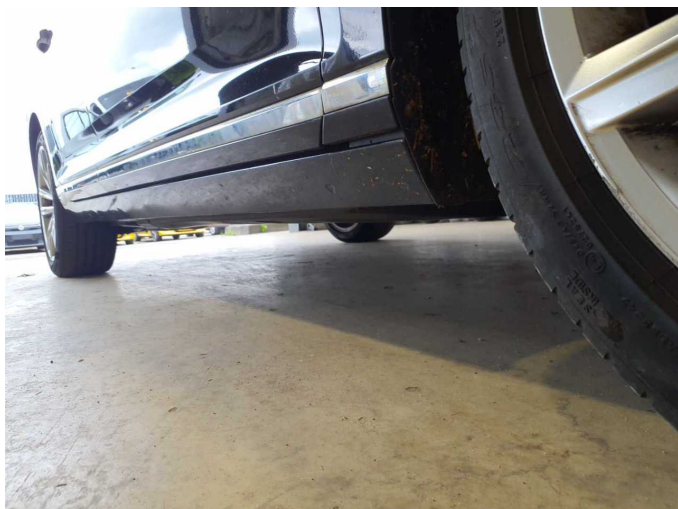


Figure 25: Misc.



Figure 26: Misc.

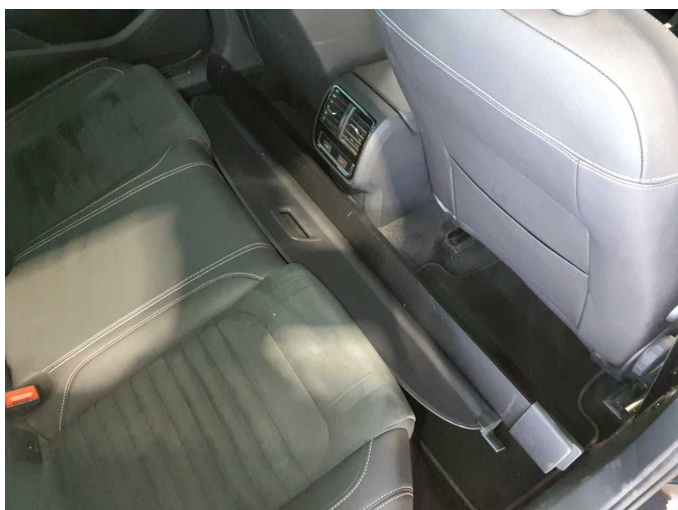


Figure 27: Misc.



Figure 28: Misc.

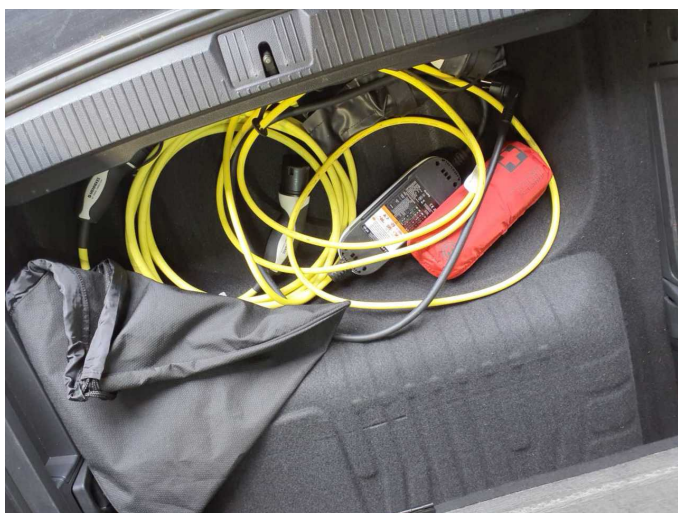



Figure 29: Misc.




Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace

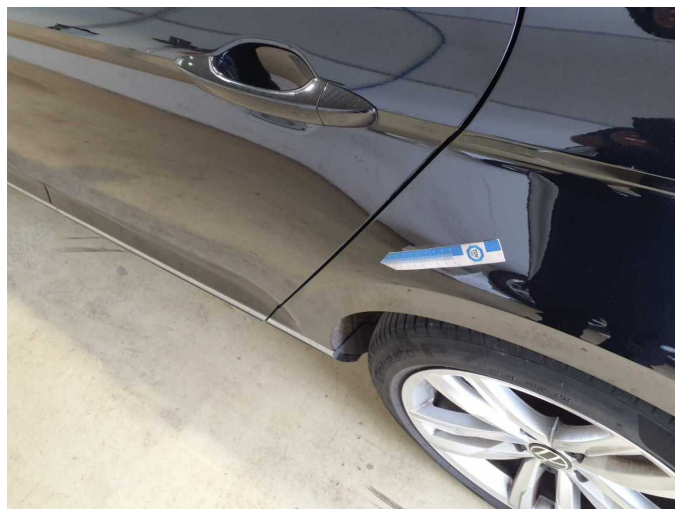


Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

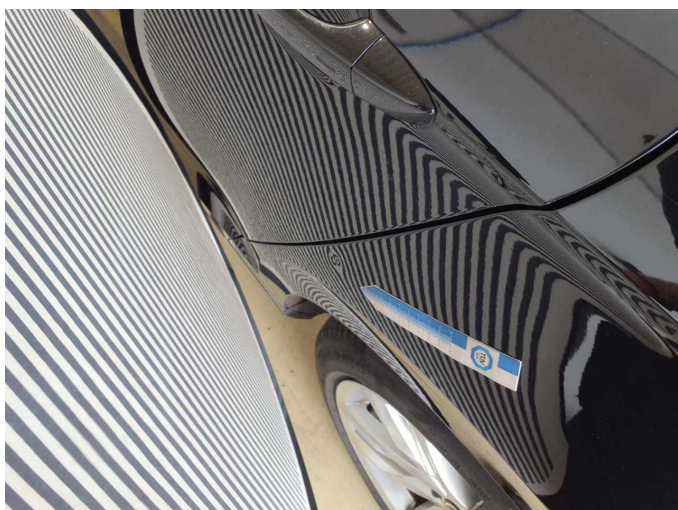


Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 3: Roof: Roof rail - right side - dent(s) - Smooth repair work

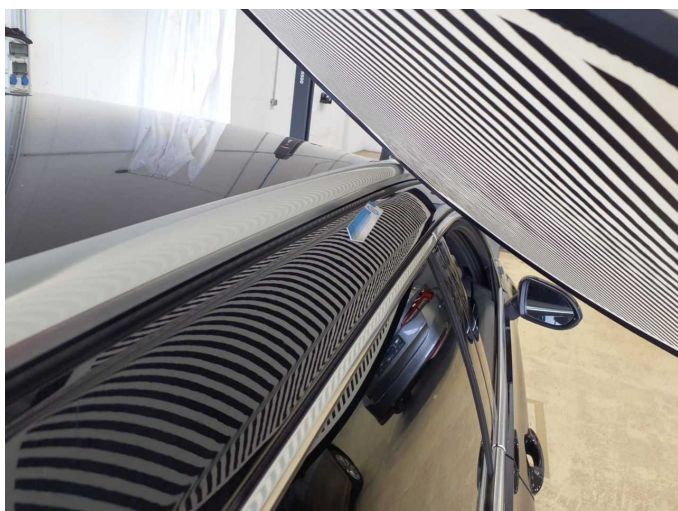

Damage 3: Roof: Roof rail - right side - dent(s) - Smooth repair work

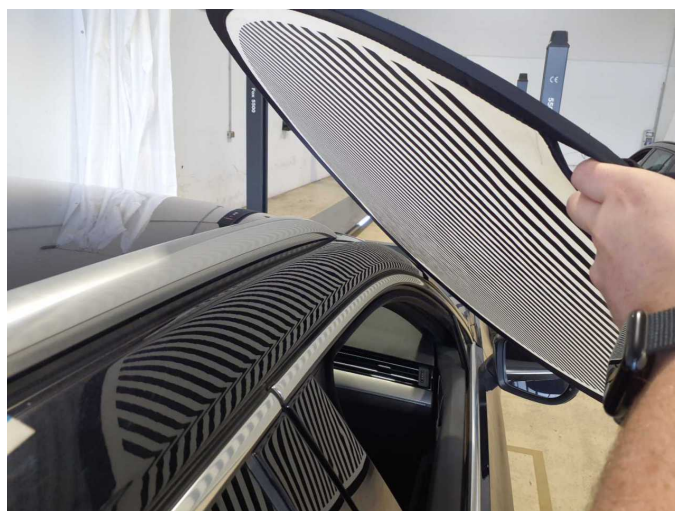

Damage 3: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 4: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 4: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 5: Door - front left side: Door handle - outside - Scratch(es) - Paint



Damage 5: Door - front left side: Door handle - outside - Scratch(es) - Paint



Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace

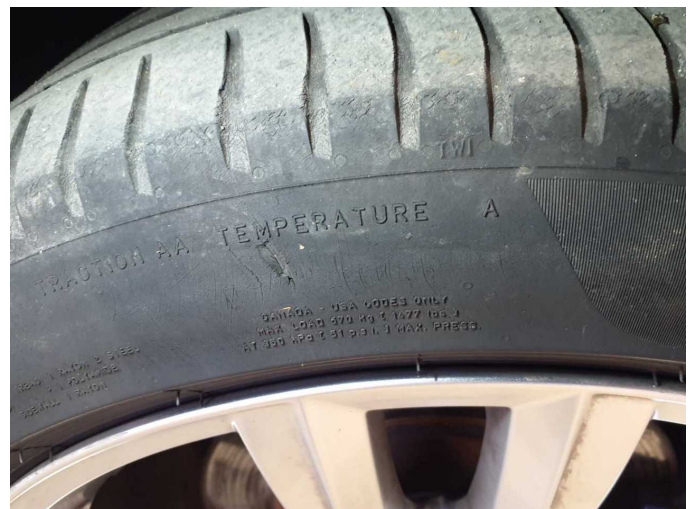


Damage 6: Wheel / tyres: Tyre - front right side - Broken / torn - Replace




Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

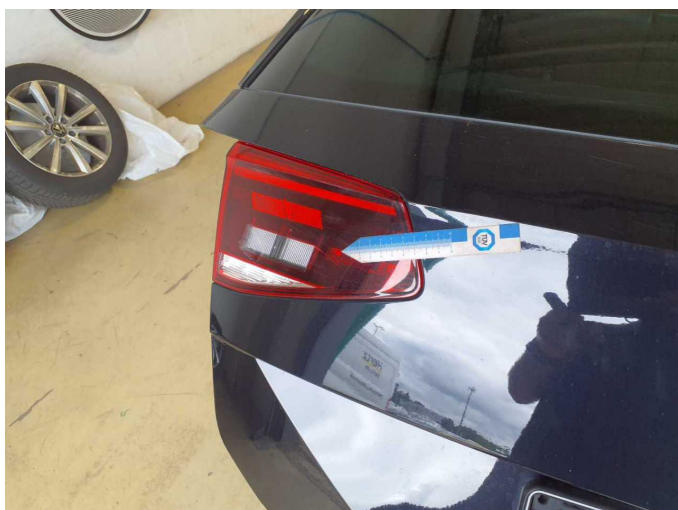


Damage 8: Tail light: Tail lamp - left side - Broken / torn - Replace

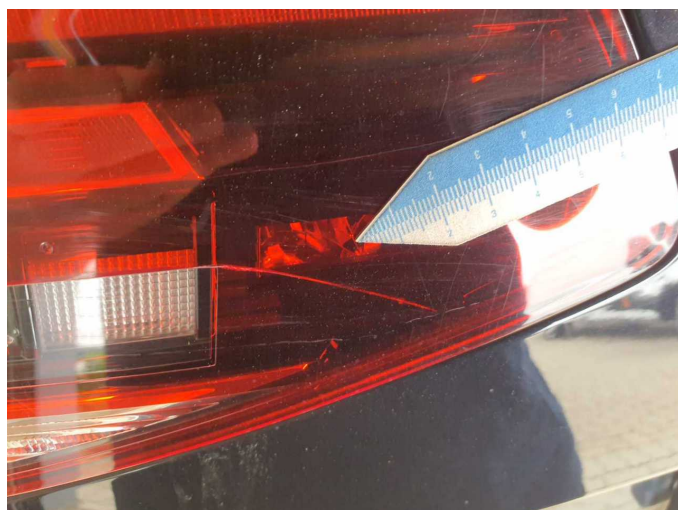


Damage 8: Tail light: Tail lamp - left side - Broken / torn - Replace



Damage 9: Tail light: Tail lamp - right side - Broken / torn - Replace

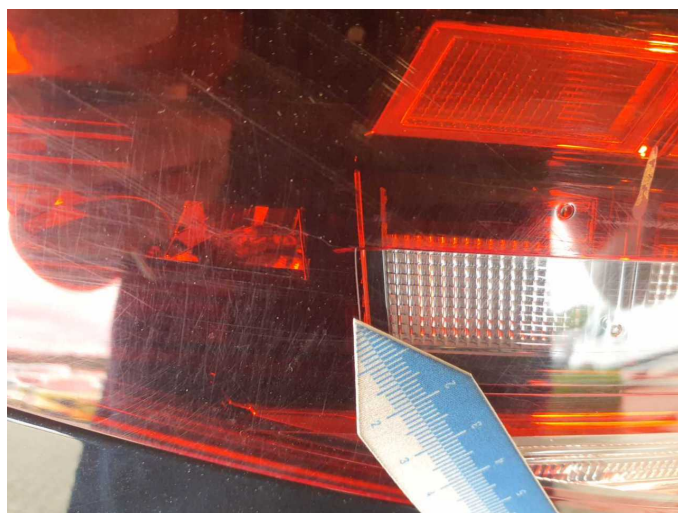


Damage 9: Tail light: Tail lamp - right side - Broken / torn - Replace

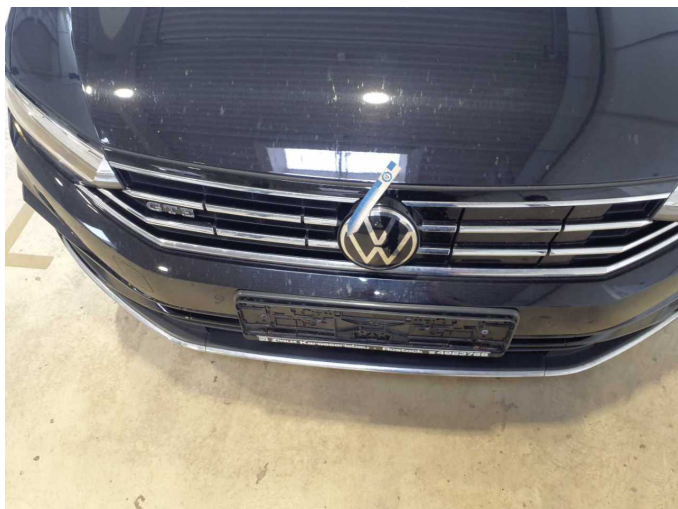


Damage 10: Front structure: Emblem - Broken / torn - Replace



Damage 10: Front structure: Emblem - Broken / torn - Replace

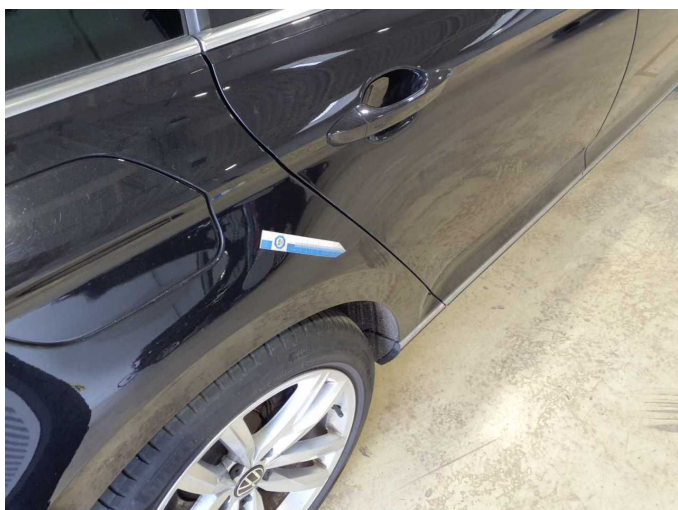


Damage 11: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Paint

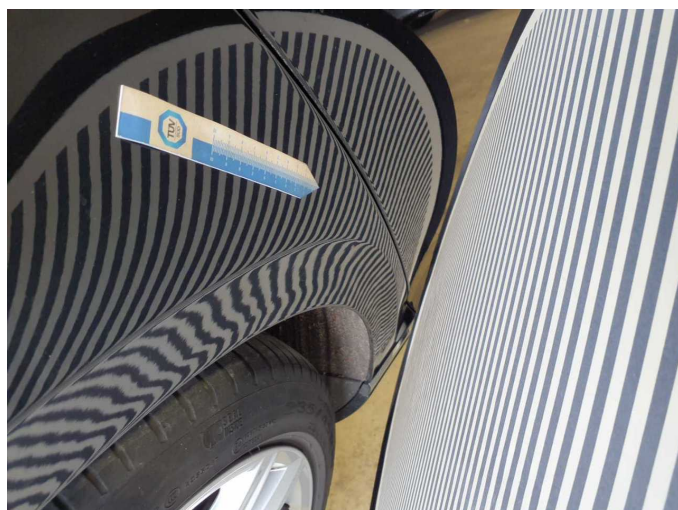


Damage 11: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Paint



Damage 11: Side panel - rear right side: Side panel (Wellig) - Unprofessionally repaired - Paint

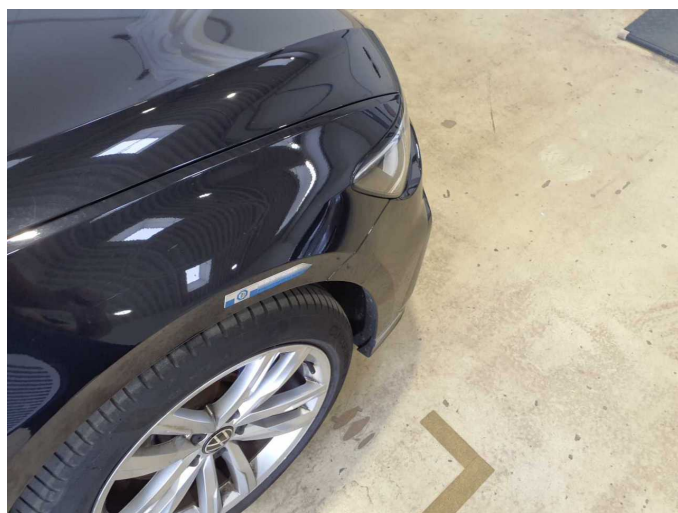


Damage 12: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint

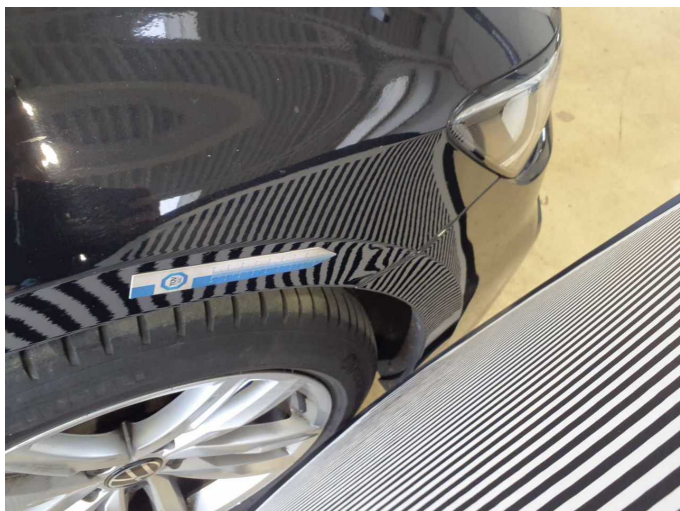

Damage 12: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 12: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint

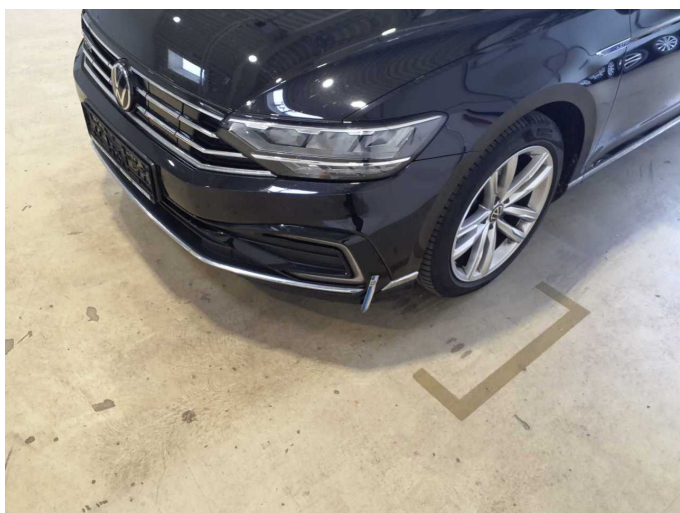


Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint




Damage 13: Front bumper: Front bumper - Scratch(es) - Paint

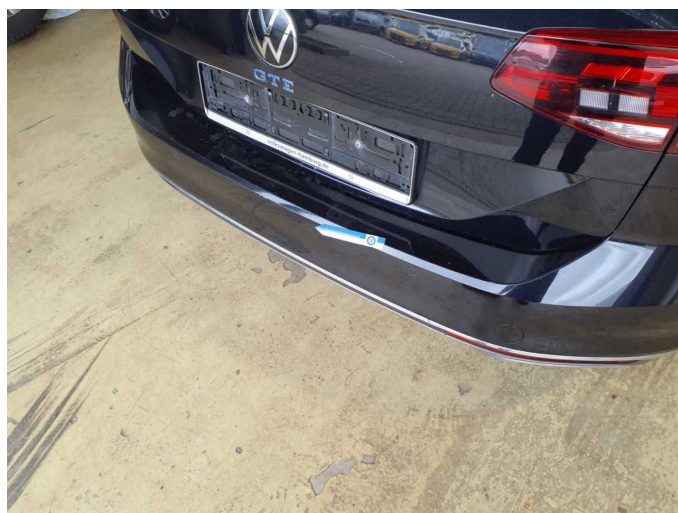

Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint

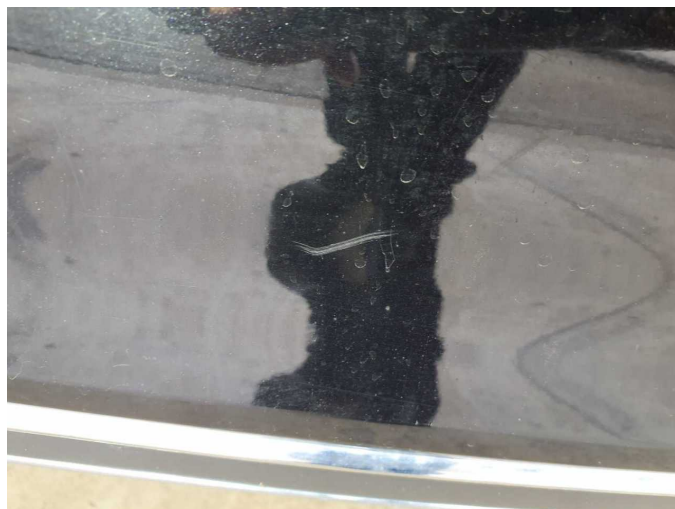

Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 14: Rear bumper: Rear bumper - Scratch(es) - Paint

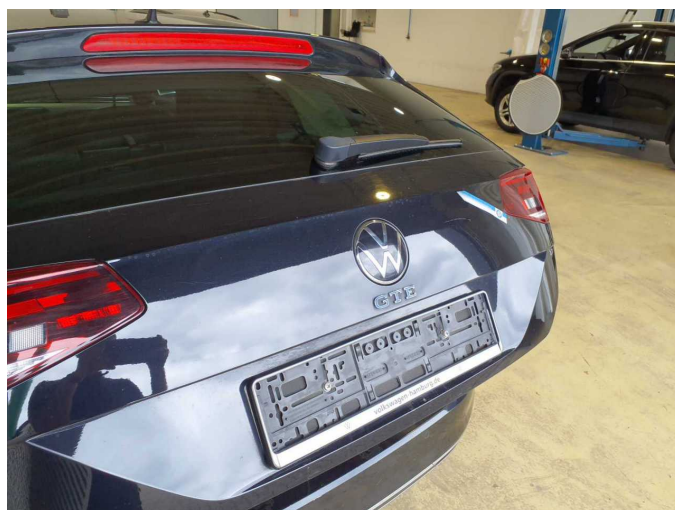


Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

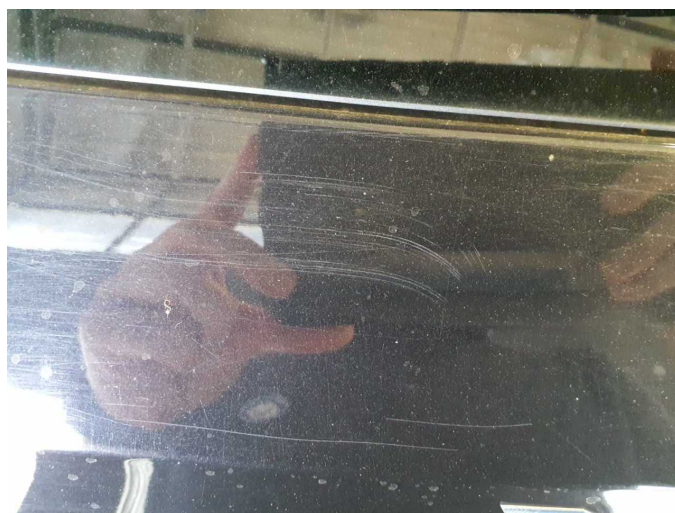

Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

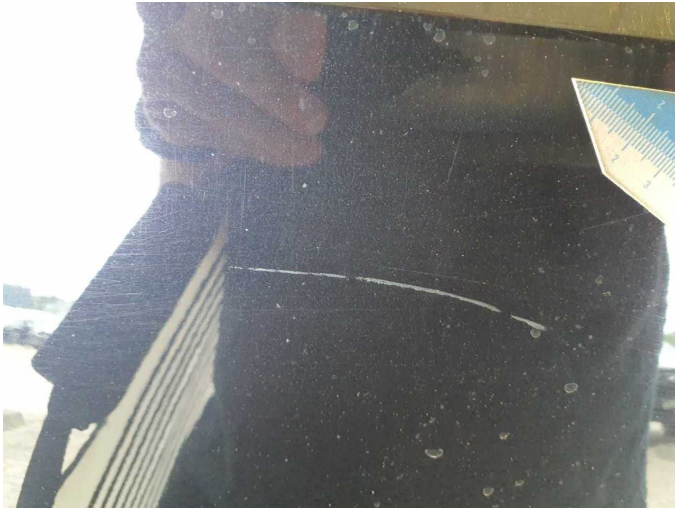


Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 16: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

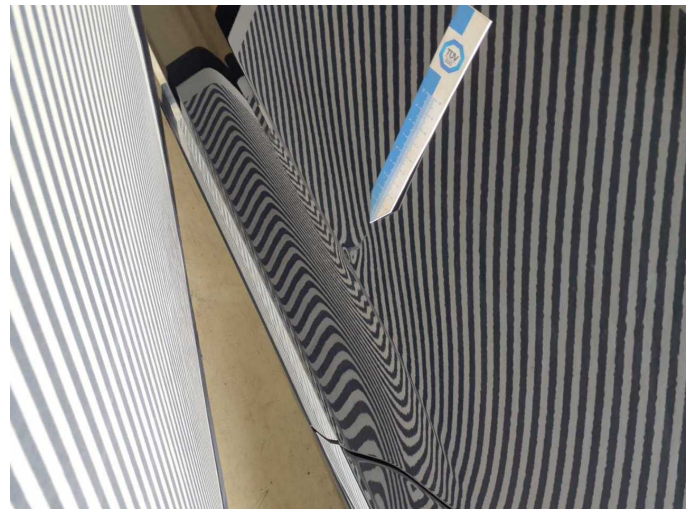


Damage 16: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 16: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

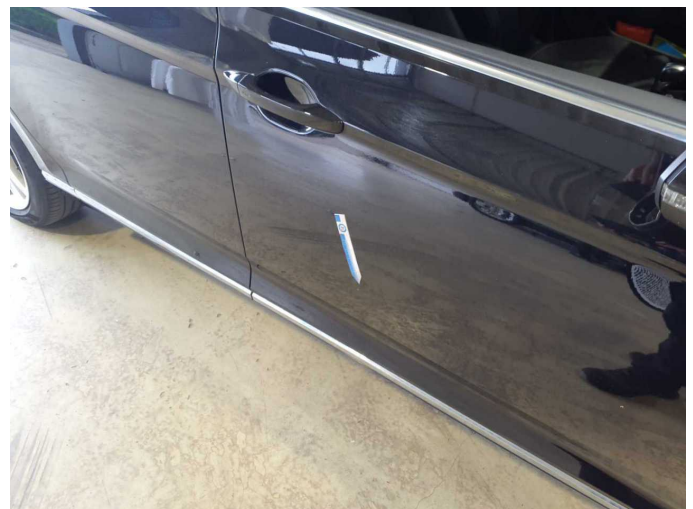


Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

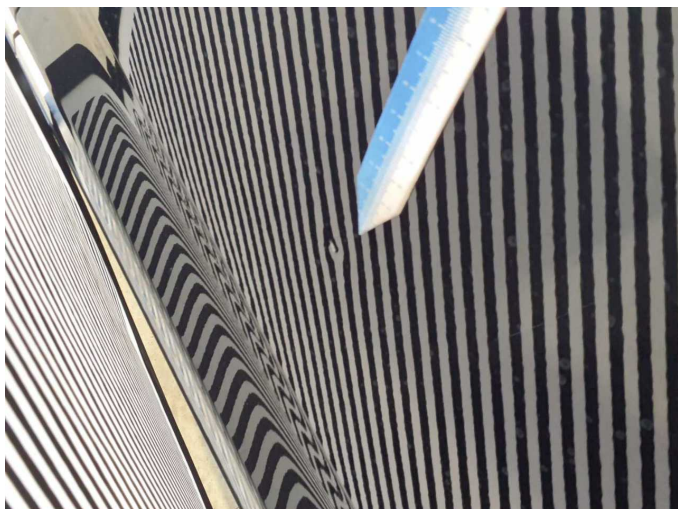


Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

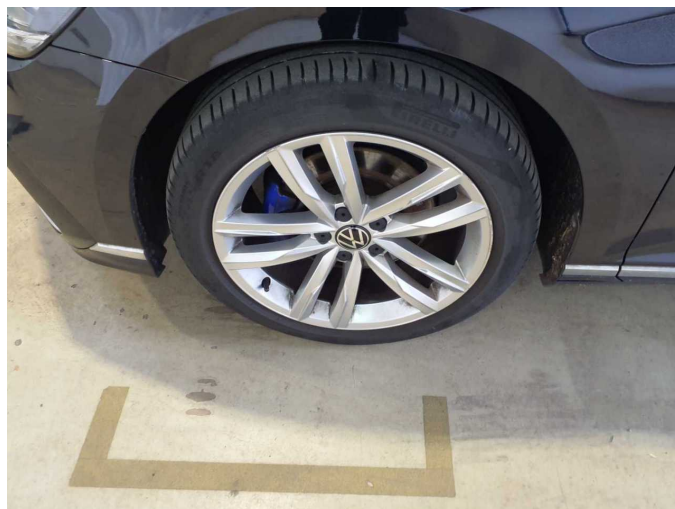


Damage 18: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace

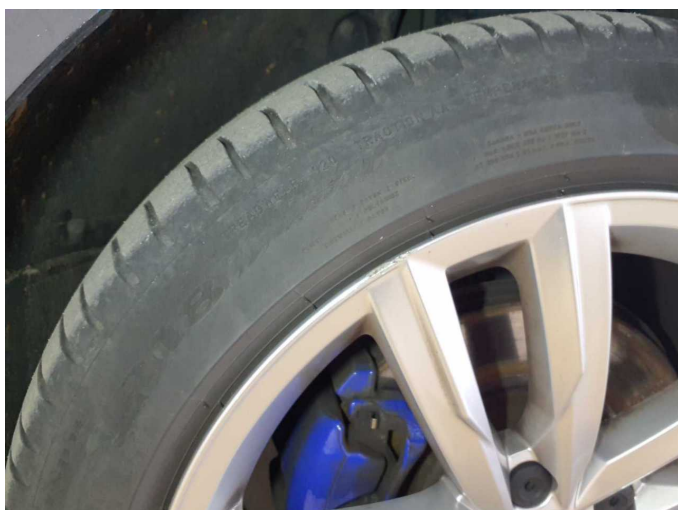


Damage 18: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace

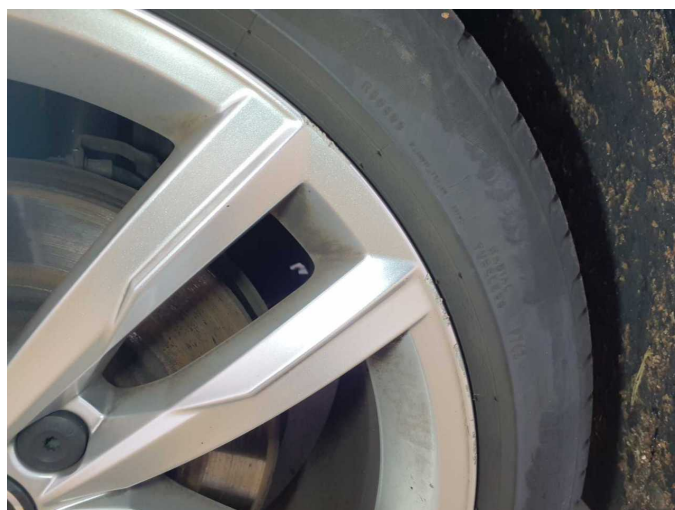


Damage 18: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Replace

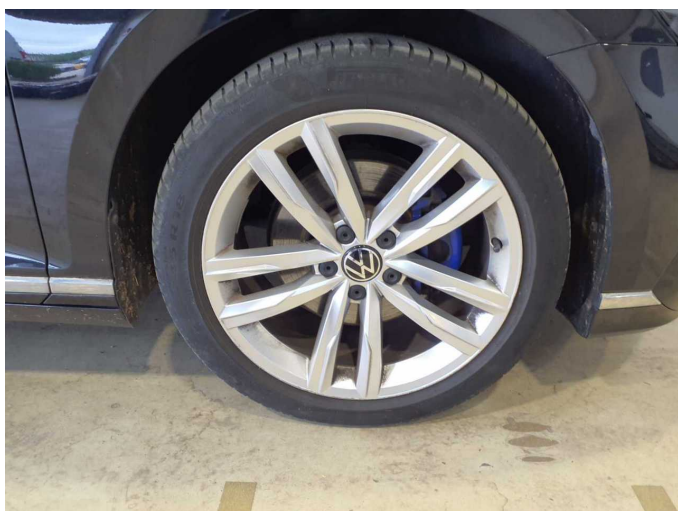

Damage 19: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

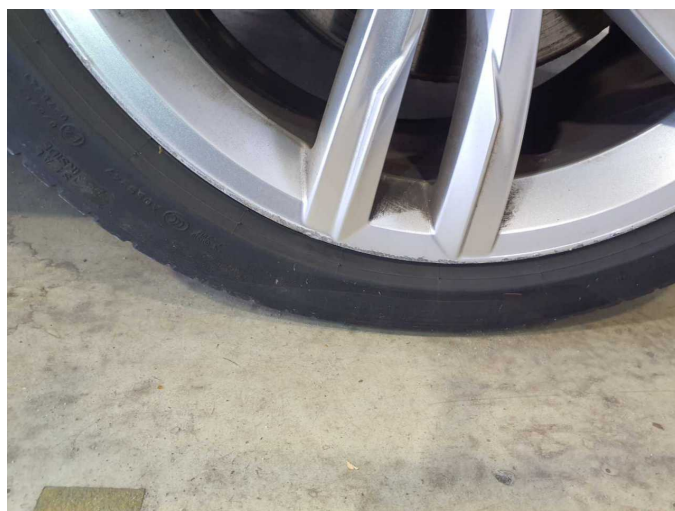

Damage 19: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

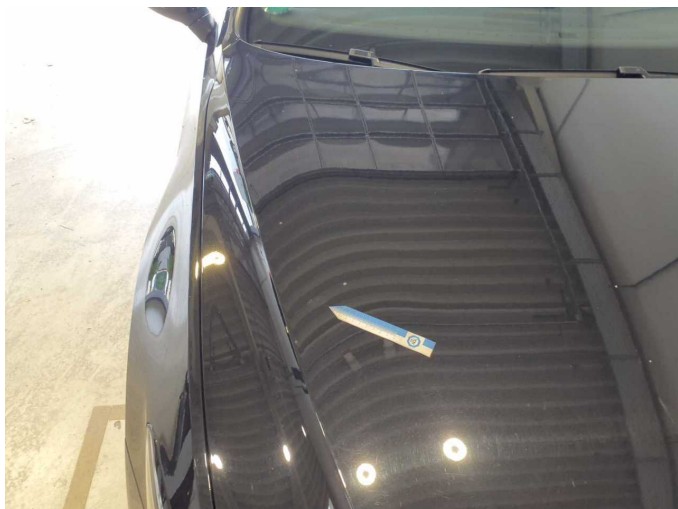


Damage 20: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint




Damage 20: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 20: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

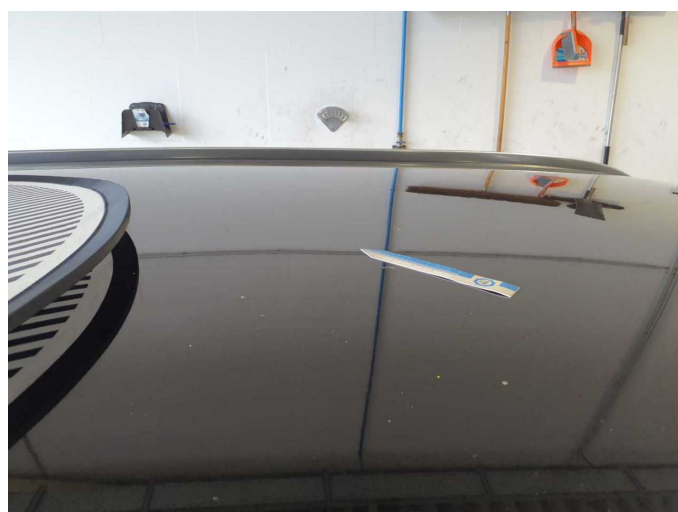

Damage 21: Roof: Roof (Anätzung) - Paint defect - Repair and paint

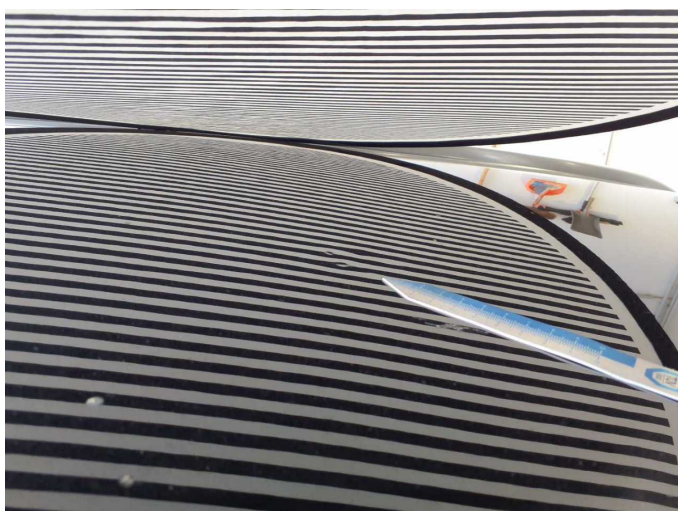

Damage 21: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 21: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 21: Roof: Roof (Anätzung) - Paint defect - Repair and paint



Damage 22: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 22: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 3: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - No deduction



Wear and tear 3: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - No deduction




Wear and tear 4: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side

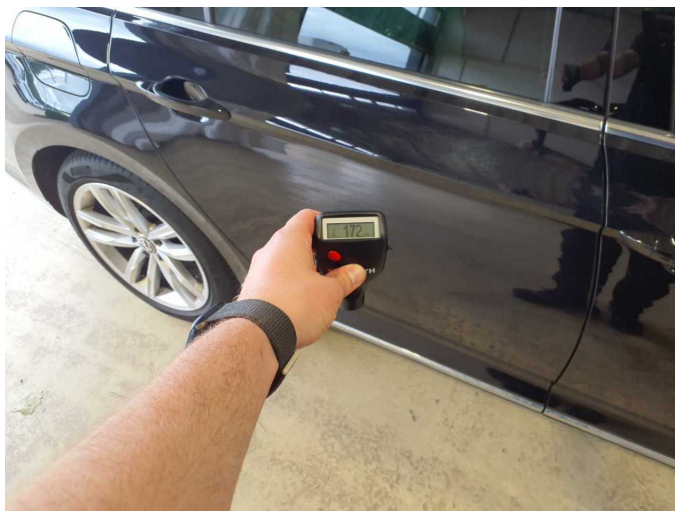

Repainting 2: Door - rear right side



Repainting 2: Door - rear right side