



Expertise

Protocol number: 46462250
Order No. / Reference: 26545855
Inspection date: 9 Jul 2026

Manufacturer: Seat

Model: Arona 1.0 TSI OPF Xperience

VIN: VSSZZKJZNR024334



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Arona 1.0 TSI OPF Xperience	
Vehicle Identification number	VSSZZKJZNR024334
Mileage (Read)	120,258 km
First registration	22 Apr 2022
Number of holders	1
Power / Engine displacement	70 kw / 999 ccm
Fuel type / Cylinder	Petrol / 3
Gearbox / Number of gears	Manual / 5
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Asphalt Blau Metallic/ Dach schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,600 km
Last service on / at	02/2026 at 110,803 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD039252
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
Manufacturer key number/ type code number	7593 / ANP 00494		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,670 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	All-season tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/55 R17 95V	All-season tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket at the front
- Storage pocket on the back of the front seats
- Ambient lighting (two-tone) in the front doors
- Exterior mirror housings in body color
- Lighting in the storage compartment of the center console and front footwell
- On-board computer
- Black headliner
- Tachometer
- Three-point automatic seat belts, front and rear
- Electronic Stability Control (ESC)
- Luggage compartment cover
- Speed limiter
- Transmission: 5-speed transmission
- LED taillights
- Rear window wiper/washer system with intermittent function
- Illuminated trunk
- Radiator grille in chrome diamond design
- Steering wheel: Steering column with height and reach adjustment
- Light sensor
- Multi-collision brake
- Emergency call service
- Package: Storage Package
- Pollen filter
- Radio: 8.25" Media System
- Tire pressure monitoring system
- Wheels: Tyre fit
- Keyless locking and starting system "Kessy"
- Seats: Passenger seat with height adjustment
- Seats: Rear seat backrest split 1/3 to 2/3, foldable
- Start-stop technology
- Door handles in car color
- Front Assist area monitoring system with City Emergency Braking function and pedestrian detection
- Central locking with remote control and comfort closing
- Storage compartment in the front doors
- Airbags
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HHC)
- Turn signals in the wing mirrors
- Chrome trim on the side windows
- Roof rails and design element in the C-pillar in chrome colors
- Third brake light integrated into the rear spoiler
- Electric window regulator with anti-pinch protection and one-touch function
- Cruise control
- Cup holders, 2 front
- Heated rear window with timer function
- ISOFIX child seat restraint system
- Child safety locks on the rear doors
- Height-adjustable headrests, front and rear
- LED technology for headlights and daytime running lights
- Steering wheel: Multifunction steering wheel in nappa leather
- Air vents in the dashboard
- Fatigue detection
- Otto particulate filter
- Package: Climate Comfort Package
- Upholstery: Cloth
- Radio: Digital radio reception DAB+
- Wheels: 4 alloy wheels "Dynamic 20/1"
- Front windshield wipers with intermittent function
- Electromechanical power steering
- Seats: Driver's seat with height adjustment
- Lane departure warning system
- Bumpers in body color
- Ultrasonic rear parking aid
- Electronic immobilizer
- Thermal insulation glazing

Extra equipment

- Deletion of the colored air vents in the dashboard (air vents in neutral, unlit grey)
- Paint finish: Metallic with vehicle roof in a different color
- Package: Winter (passenger seat with height adjustment - heated front seats)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motor Rasselt

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Damaged - Replace
2	Side panel - rear right side	Wheel arch - Scratched - Replace
3	Front bumper	Front bumper - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Engine	Clutch (Ausdrucklager, Folgekosten Möglich) - Noise - Perform diagnosis
6	Boot lid / rear door	Trim - standard - lower - Damaged - Replace
7	Engine	Engine (Rasselt) - Noise - Perform diagnosis
8	Mudguard - right side	Mudguard - right side - Scratched - Paint
9	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
10	Rear bumper	Rear bumper - Scratched - Paint
11	Door - rear right side	Door - Deformed - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Spoiler - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Interior	Interior - Soiled - No deduction
6	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Side - left



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden

Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

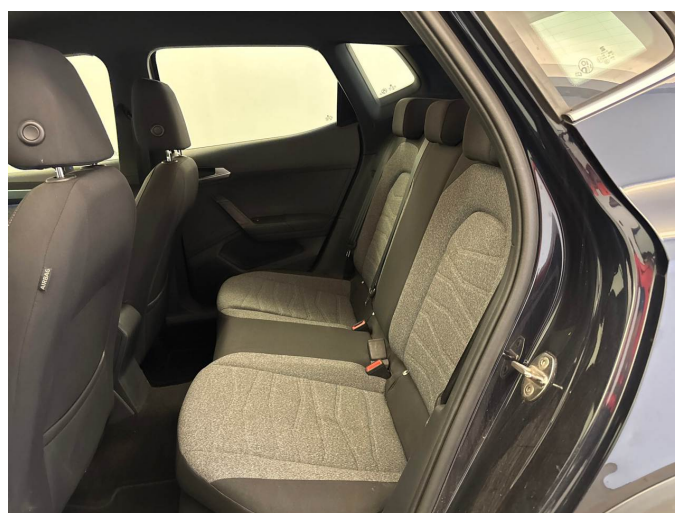


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

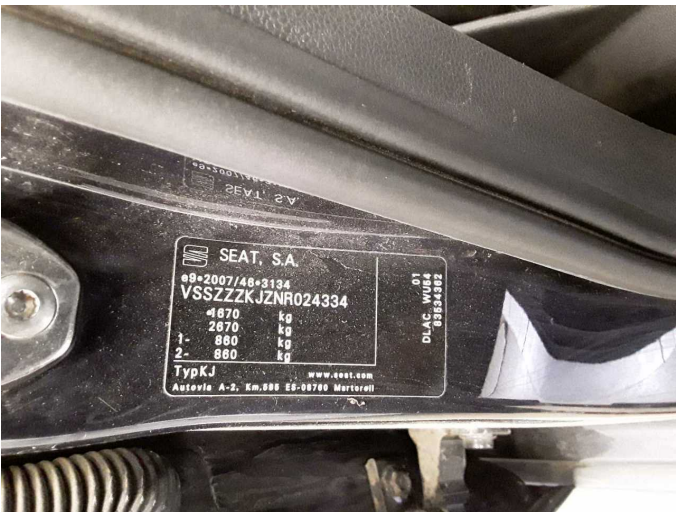


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.




Figure 20: Misc.



Figure 21: Misc.




Damage 1: Trim / covers: Floor mats - Damaged - Replace

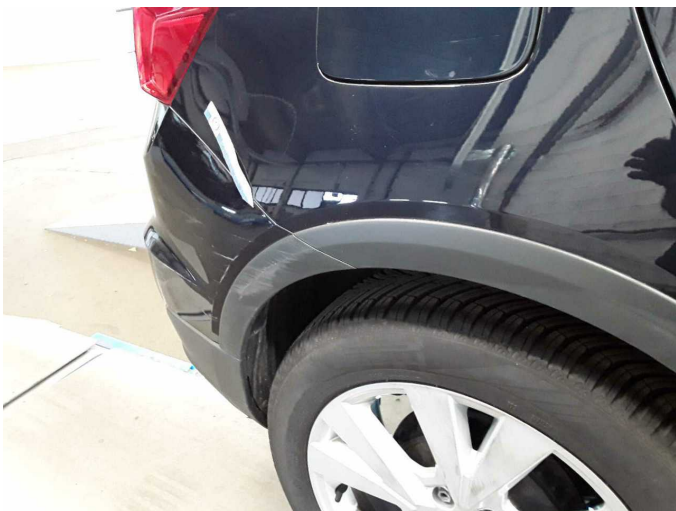

Damage 2: Side panel - rear right side: Wheel arch - Scratched - Replace



Damage 2: Side panel - rear right side: Wheel arch - Scratched - Replace

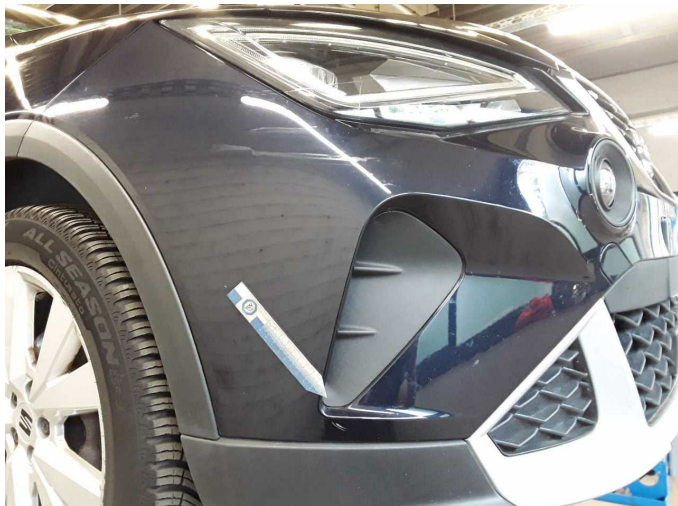

Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 6: Boot lid / rear door: Trim - standard - lower - Damaged - Replace



Damage 6: Boot lid / rear door: Trim - standard - lower - Damaged - Replace

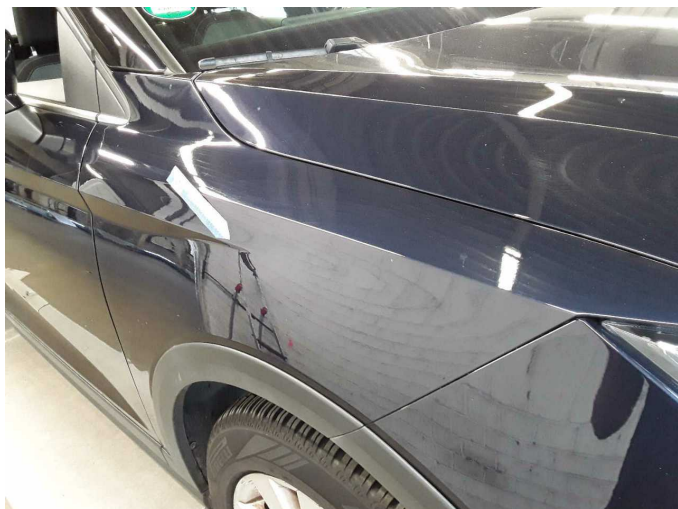

Damage 8: Mudguard - right side: Mudguard - right side - Scratched - Paint

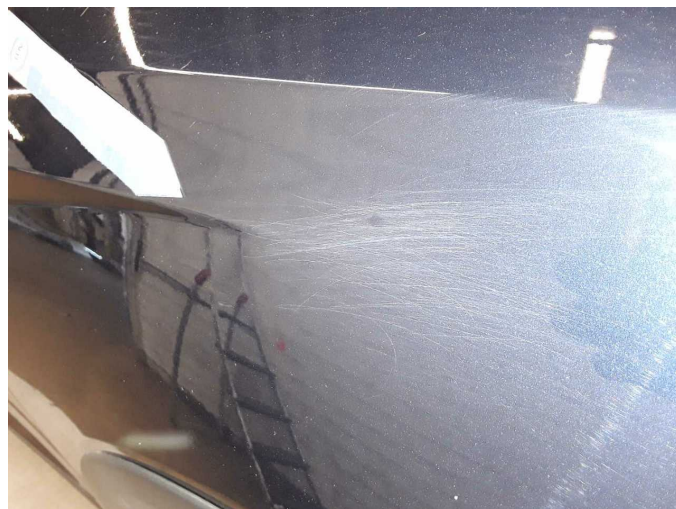


Damage 8: Mudguard - right side: Mudguard - right side - Scratched - Paint



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

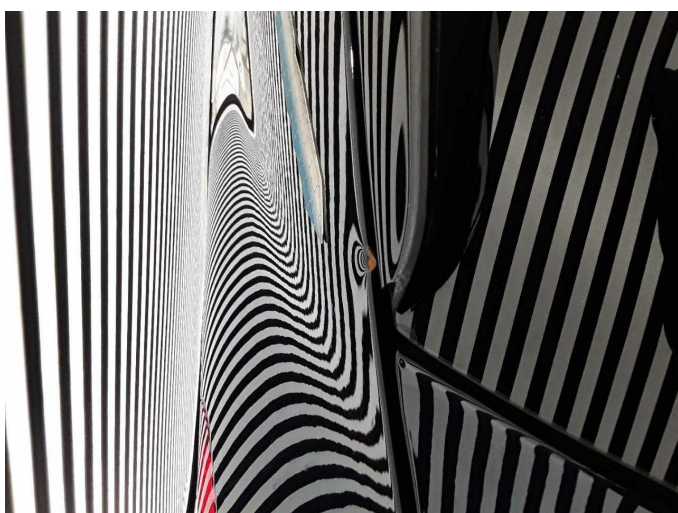

Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 10: Rear bumper: Rear bumper - Scratched - Paint



Damage 10: Rear bumper: Rear bumper - Scratched - Paint




Damage 10: Rear bumper: Rear bumper - Scratched - Paint

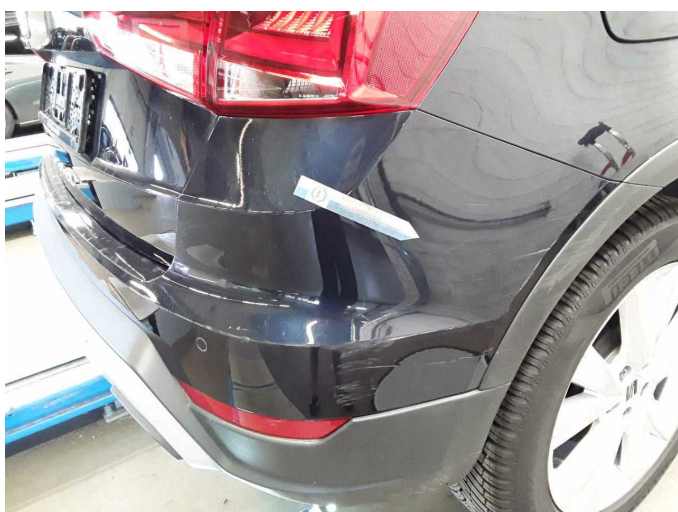

Damage 10: Rear bumper: Rear bumper - Scratched - Paint



Damage 11: Door - rear right side: Door - Deformed - Paint

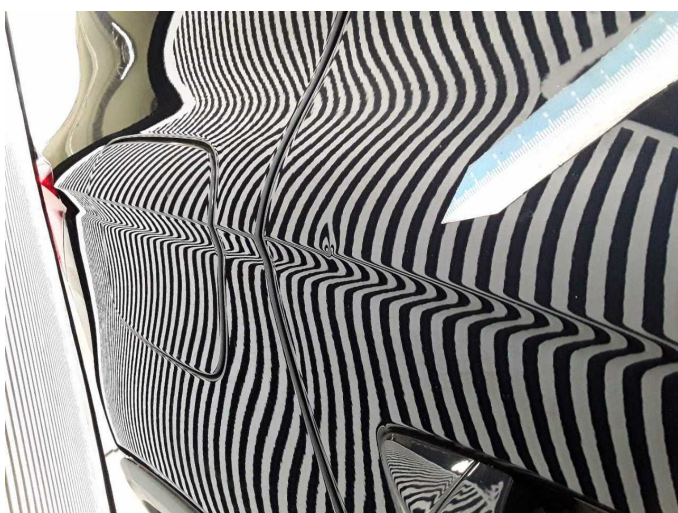

Damage 11: Door - rear right side: Door - Deformed - Paint



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZKJZNR024334

Hersteller / Modell: SEAT SEAT Arona 1.0 TSI OPF Xperience BEATS

Datum	KM-Stand	Beschreibung
06.02.2026	110.803	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
05.09.2025	102.342	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
14.07.2025	97.000	Batterie ern; Systemtest/Eigendiagnose
24.01.2025	79.283	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
21.02.2024	52.055	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
14.11.2023	34.973	Regelwartungsdienst; Wartung Sonstiges
01.03.2023	15.173	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges