



Expertise

Protocol number: 46445222
Order No. / Reference: 26673515
Inspection date: 10 Jul 2026

Manufacturer: MAN
VIN: WMA03VUYXP9019944

Model: TGE 3.140 4X2F SB



Vehicle details	
Manufacturer / Type / Model / Equipment	
MAN TGE 3.140 4X2F SB	
Vehicle Identification number	WMA03VUYXP9019944
Mileage (Read)	72,997 km
First registration	11 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	103 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Candy weiß
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,000 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GU300824
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1516 / AYN 61613		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/75 R16 113R	All-season tyres on Steel rim with wheel cover	Sonstige	9mm / 9mm
2)	205/75 R16 113R	All-season tyres on Steel rim with wheel cover	Sonstige	9mm / 9mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/75 R16 113R C	All-season tyres on Steel	Continental	9 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Extra equipment

- Airbag for driver and front passenger with passenger
- C-rails on the side walls in the loading area
- All-season tyres
- MAN Media Van package with 4 speakers
- Center wheel cover with chrome emblem
- Spare wheel in driving tire size, steel as well as
- Side interior paneling in the cargo area (plastic)
- 'Comfort' seat on the left, in the 1st row.
- Battery with increased capacity
- Cab doors, additionally reinforced
- Wooden floor in the cargo area with wheel arch trim
- National registration documentation (German)
- Smoker's version: 12V socket with cigarette lighter
- Rear View camera
- Single airline points sliding door
- Rear step, across the entire width

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Rear bumper	Reflector - left side - Broken / torn - Replace
2	Drive train	Sleeve prop shaft - front left side - Broken / torn - Replace

Missing parts

Description

Interior - Ashtray - front

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 5 Aug 2023	3.236,53 €

Repainting

No. Repainting

- | | |
|---|---|
| 1 | Side panel - rear left side, Professionally carried out |
|---|---|

Paint coat thickness measurement

Side panel - rear left side	1,130 µm
-----------------------------	-------------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

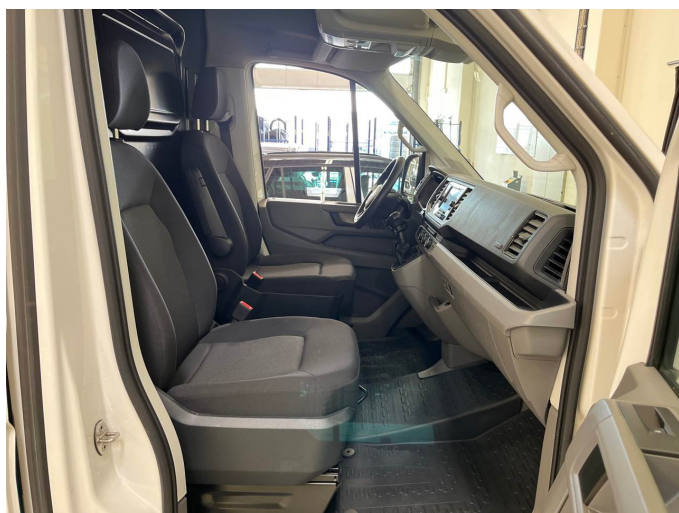


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

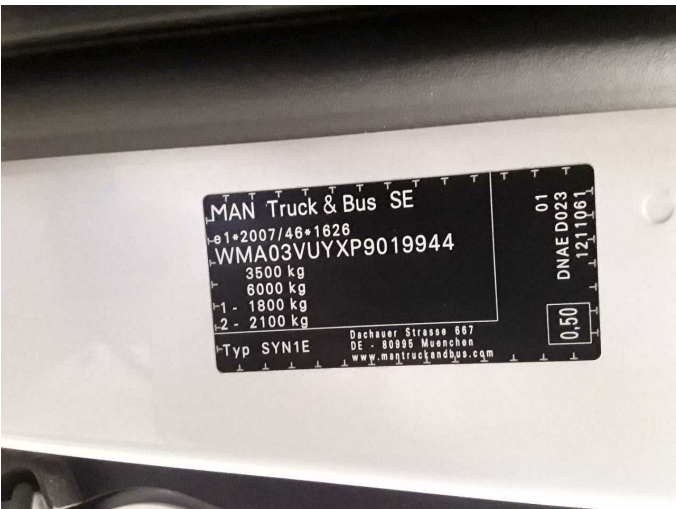


Figure 11: VIN



Figure 12: Mounted tyres

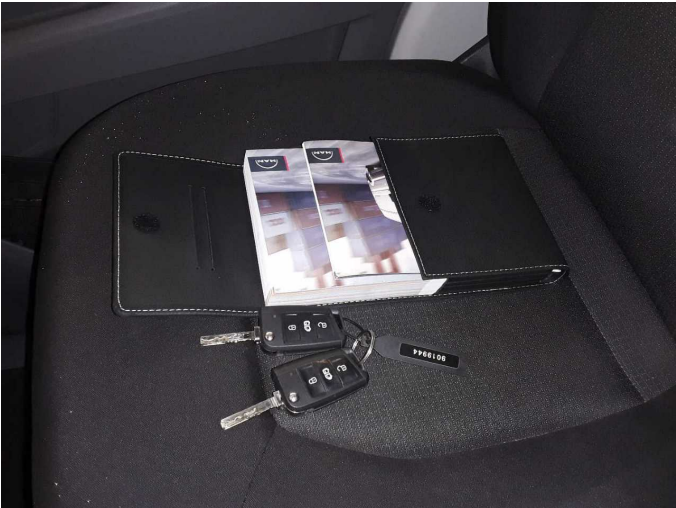


Figure 13: Documents

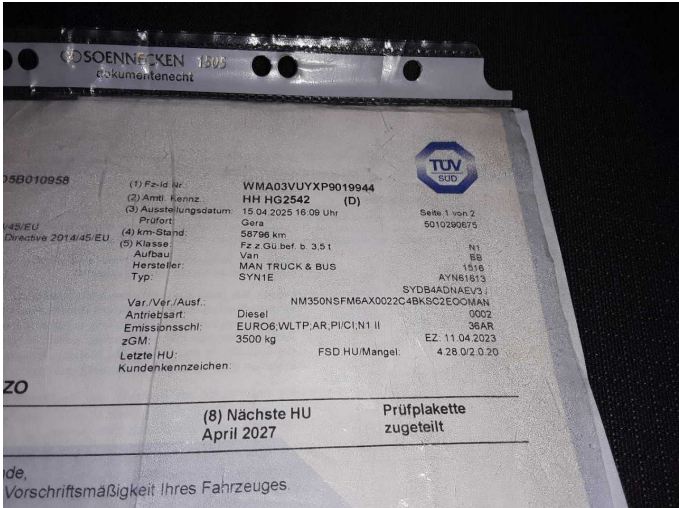


Figure 14: Documents



Figure 15: Documents

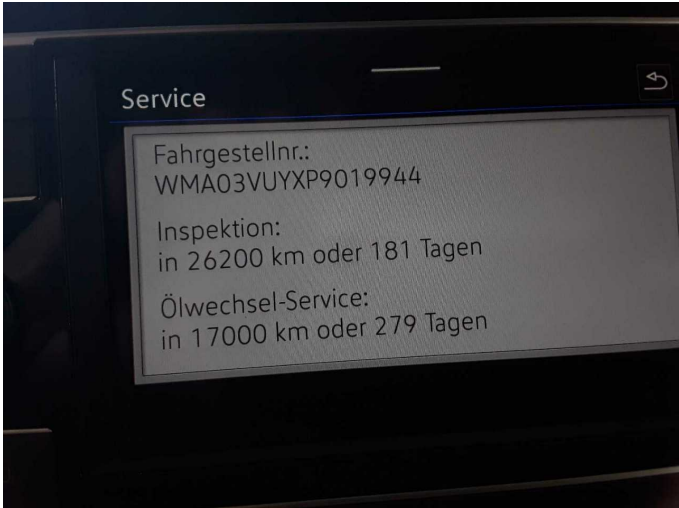


Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

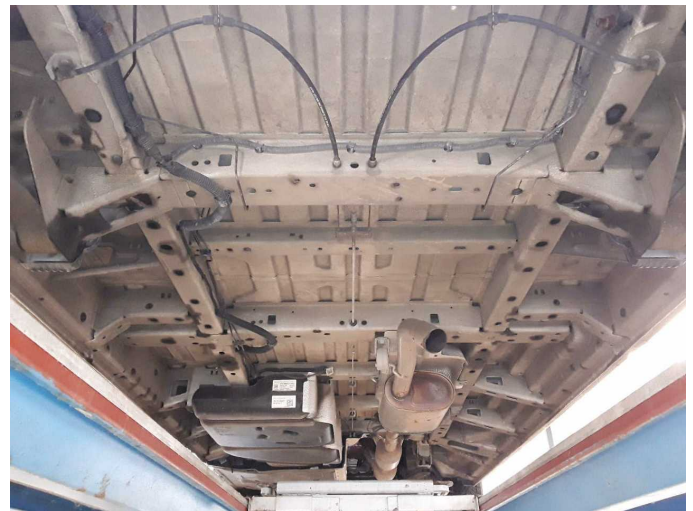


Figure 28: Misc.




Figure 29: Misc.



Figure 30: Misc.



Damage 1: Rear bumper: Reflector - left side - Broken / torn - Replace

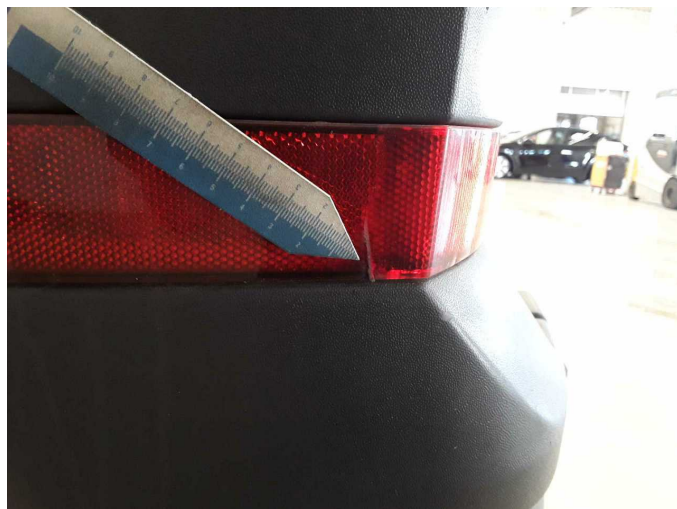

Damage 1: Rear bumper: Reflector - left side - Broken / torn - Replace



Damage 1: Rear bumper: Reflector - left side - Broken / torn - Replace



Damage 2: Drive train: Sleeve prop shaft - front left side - Broken / torn - Replace



Damage 2: Drive train: Sleeve prop shaft - front left side - Broken / torn - Replace



Missing part 1: Interior: Ashtray - front - Missing - Replace



Side panel - rear left side: 1,130 µm



Side panel - rear left side: 1,130 µm



Side panel - rear left side: 1,130 µm



Side panel - rear left side: 1,130 µm



Side panel - rear left side: 1,130 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WMA03VUYXP9019944

Hersteller / Modell: MAN MAN TGE 3.140 4X2F SB

Datum	KM-Stand	Beschreibung
17.04.2025	58.796	AU; Motoröl b. Wartung; Ölwechsel
07.01.2025	49.149	Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsklötze hinten; Bremsklötze vorne; Reparatur Sonstiges
24.04.2024	30.257	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges