



Expertise

Protocol number: 47188246
Order No. / Reference: 26765966
Inspection date: 20 Aug 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1T4PW011600



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ1T4PW011600
Mileage (Read)	73,464 km
First registration	5 Apr 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Delfingrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	16,100 km
Last service on / at	05/2026 at 69,918 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP938985
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWR 00467		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96W	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Semperit	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- third brake light
- black roof rails
- Decorative inlays "Piano Black"
- Digital Cockpit, multicoloured
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- Pedestrian and cyclist detection as well as active front hood
- luggage compartment cover
- Height-adjustable luggage compartment floor
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Lane change assistant "Side Assist" and parking assistant
- 12V power outlet on the rear of the center console
- Telephone interface
- USB-C interface
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Electrically folding exterior mirrors
- Exterior mirror housings and door handles in body color
- Headliner in Storm Grey
- Decorative inlays "New Brushed Design"
- Diesel particulate filter
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control with daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Baggage management package
- Additional luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Air conditioning
- Front headrests
- Paint finish: Solid
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Non-smoking version
- Emergency call service
- Upholstery in fabric
- Radio "Composition"
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: Tire pressure monitoring system
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system
- Bumpers in body color
- Textile floor mats
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Black trim strips on the side windows



Extra equipment

- Towbar, foldable with electric release
- Paint finish: Metallic in combination with R-Line
- Navigation system "Discover Pro" incl. "Streaming & Internet" (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Radio - Voice control)
- Package: Business Premium incl. Navigation (DSG) (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel with shift paddles - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- Radio accessories: "DYNAUDIO Contour Surround" sound system (8+1 speakers - total output 330 watts - digital 16-channel amplifier)
- Traffic sign recognition in conjunction with the "IQ.DRIVE" assistance package including IQ.LIGHT
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Package: Assistance package "IQ.DRIVE" incl. IQ.LIGHT (DSG) (Dynamic Light Assist high beam - Travel Assist, Lane Assist and Emergency Assist - LED headlights with LED daytime running lights and cornering lights - Dynamic headlight range control with dynamic cornering lights)
- Package: Family (foldable and removable reversible luggage compartment mat - electric child safety lock for rear doors, operable from the driver's seat - sunshade roller blind on the rear door windows)
- Package: Mirror in conjunction with. Active Lighting System P19
- Electric panoramic tilt/slide sunroof (interior lights with delayed shut-off and dimming function, 2 LED reading lights front and rear - panoramic tilt/slide sunroof with rear panoramic roof)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratched - Loss in value
2	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
3	Indicator - front	Mirror - left side - Broken / torn - Replace
4	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
5	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Front bumper	Front bumper - Scratch(es) - Smart repair
8	Interior	Interior (Laderaum Verkleidung) - Scratch(es) - Loss in value
9	Instrument panel	Air nozzle - centre (Hinten/Einsteller fehlt) - Broken / torn - Replace
10	Rear bumper	Rear bumper (Ladekante) - Scratched - Repair and paint



Wear and tear

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - No deduction
2	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - No deduction
3	Body	Body - Scratch(es) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Body	Underbody panelling - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Repainting

No. Repainting

- 1 Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door 193 μm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

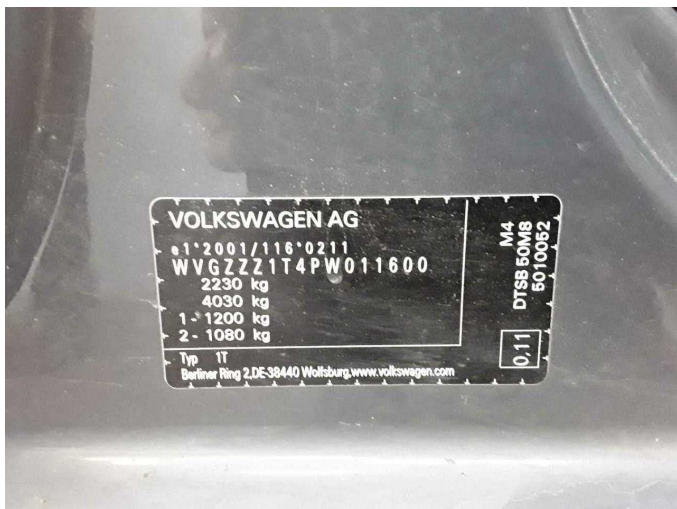


Figure 11: VIN



Figure 12: Mounted tyres

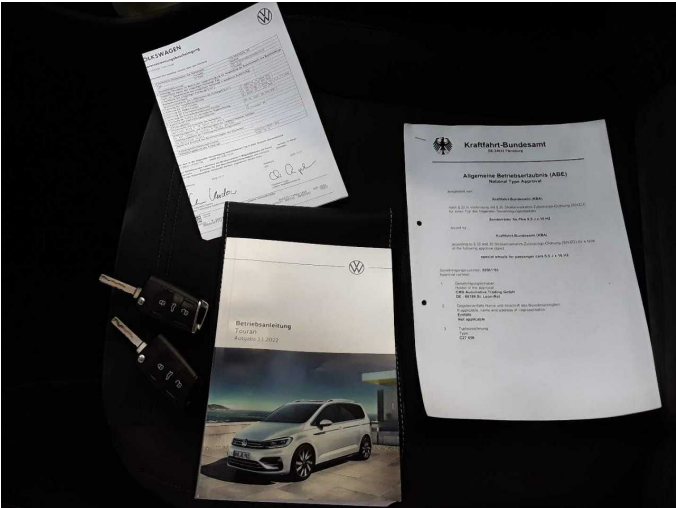


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.




Damage 1: Trim / covers: Boot lid - interior trim - Scratched - Loss in value



Damage 1: Trim / covers: Boot lid - interior trim - Scratched - Loss in value

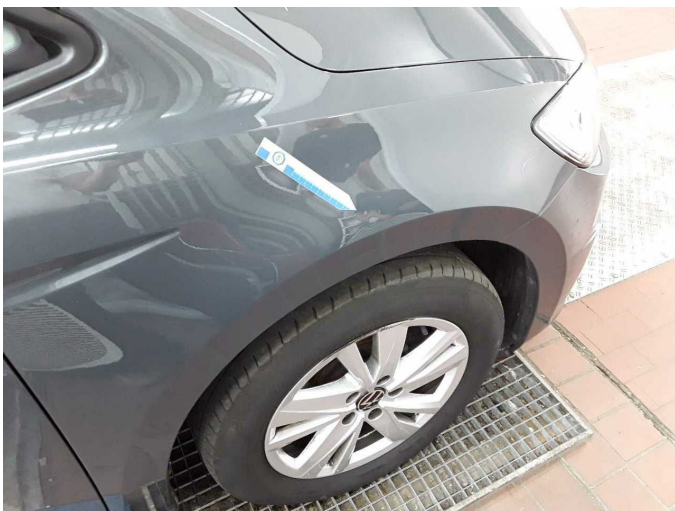

Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work

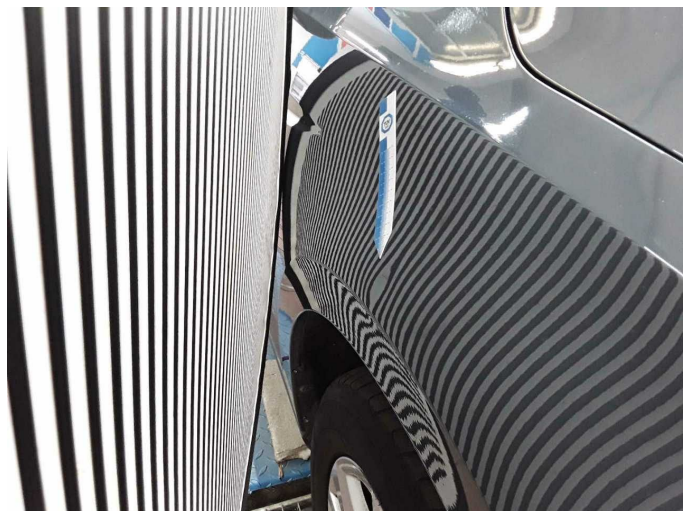

Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work




Damage 3: Indicator - front: Mirror - left side - Broken / torn - Replace



Damage 3: Indicator - front: Mirror - left side - Broken / torn - Replace



Damage 3: Indicator - front: Mirror - left side - Broken / torn - Replace

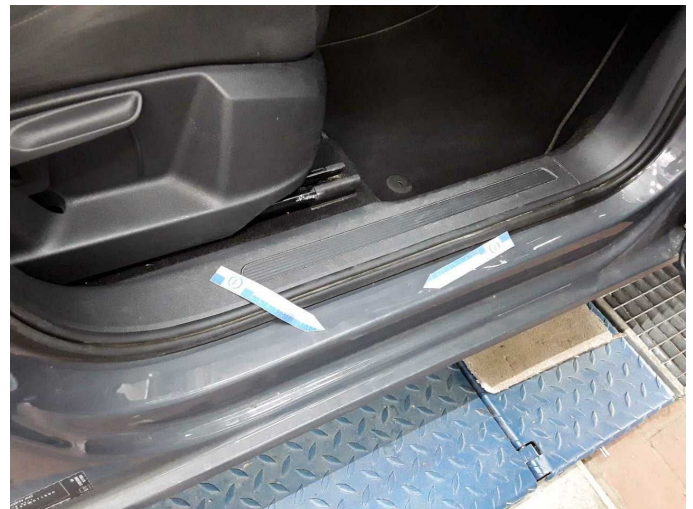

Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 7: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 8: Interior: Interior (Laderaum Verkleidung) - Scratch(es) - Loss in value



Damage 8: Interior: Interior (Laderaum Verkleidung) - Scratch(es) - Loss in value



Damage 8: Interior: Interior (Laderaum Verkleidung) - Scratch(es) - Loss in value



Damage 9: Instrument panel: Air nozzle - centre (Hinten/Einsteller fehlt) - Broken / torn - Replace




Damage 9: Instrument panel: Air nozzle - centre (Hinten/Einsteller fehlt) - Broken / torn - Replace




Damage 10: Rear bumper: Rear bumper (Ladekante) - Scratched - Repair and paint



Damage 10: Rear bumper: Rear bumper (Ladekante) - Scratched - Repair and paint

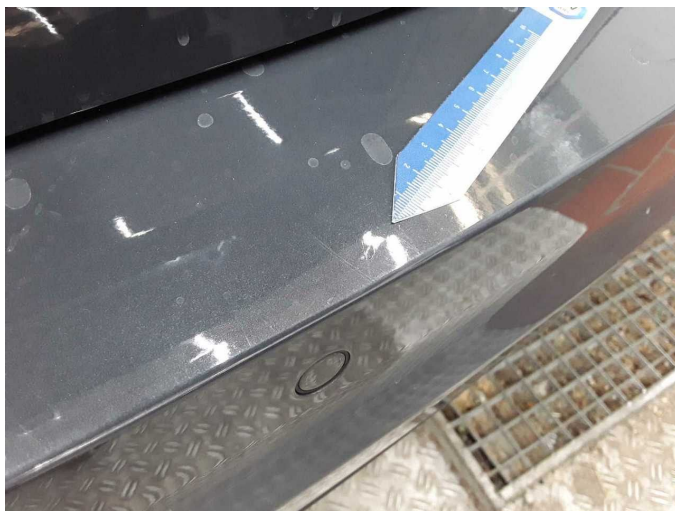

Damage 10: Rear bumper: Rear bumper (Ladekante) - Scratched - Repair and paint

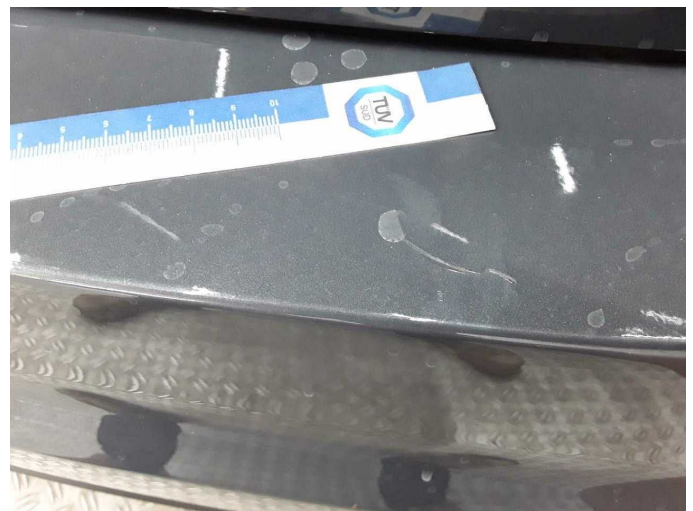

Damage 10: Rear bumper: Rear bumper (Ladekante) - Scratched - Repair and paint



Missing part 1: Equipment: Tirefit complete - Missing - Replace



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1T4PW011600

Hersteller / Modell: VOLKSWAGEN VW Touran 2.0 TDI SCR DSG Comfortline

Datum	KM-Stand	Beschreibung
22.05.2026	69.918	AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
10.12.2025	59.410	Regelwartungsdienst; Wartung Sonstiges
03.12.2025	59.225	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
20.05.2025	48.347	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
15.07.2024	30.396	Regelwartungsdienst; Wartung Sonstiges
03.05.2024	24.834	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges