



Expertise

Protocol number: 46520478
Order No. / Reference: 26513140
Inspection date: 15 Jul 2026

Manufacturer: Opel	Model: Astra 1.5 D Start/Stop Sports Tourer Business Edition
VIN: W0VBD8EV1N8028632	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Business Edition	
Vehicle Identification number	W0VBD8EV1N8028632
Mileage (Read)	47,600 km
First registration	9 Dec 2021
Number of holders	1
Next periodical technical inspection	01/2027
(Report on hand)	
Power / Engine displacement	90 kw / 1,496 ccm
Fuel type / Cylinder	Diesel / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	40 %
Last service on / at	01/2025 at 33,120 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HF791487
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALL 00259		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,945 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • 2 ignition keys • Airbag for driver and passenger side • Airbag: Head airbags, 1st and 2nd row (outer seats) • Anti-lock braking system (ABS) • Electrically adjustable and heated exterior mirrors for driver and passenger side • third brake light • black roof rails • Diesel particulate filter (DPF) • Electronic Stability Program Plus (ESP Plus) • Speed controller with limiter • Back window, heater • Interior lighting, front and rear • Air conditioning • trunk light • Front headrests • LED headlights • Steering wheel: Leather steering wheel • Lighting equipment • Pedals: Disengaging safety pedals • Quickheat rapid heating system • Tire repair kit • Rear seat backrest folds forward in a 60:40 split • Seat belts: Three-point seat belts in all seats • Visibility equipment • Start/Stop System • Traction Control (TC) Plus • Immobiliser • Central locking with remote control and interior switches | <ul style="list-style-type: none"> • Storage compartments • Airbag: Chest-pelvis side airbag for driver and front passenger side • Automatic activation of the hazard warning lights • Hill Start Assist • On-board computer • Roof design line, above in black • Decorative trim strips Antelao Sand/Polar Silver • Tachometer • Electric windows front and rear • Transmission: 6-speed manual transmission • rear window wiper • Instruments, black, with high-gloss chrome rings, 3.5" driver information display • Rear headrests (3) • Cargo area cover • LED daytime running lights • Steering column, height and reach adjustable • Fog light • Upholstery: Cloth • Radio: Digital radio reception DAB/DAB+/DMB-R • Tire pressure monitoring system • Power steering • Luggage compartment safety net • Seats: Comfort seats, front • 12V power outlet in the center console • Pre-installation for child seat mounting system "ISOFIX" • Heat-insulating glazing, green tinted, and windshield |
|---|---|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Light alloy wheels 7 J x 16 in "10-spoke" design (with tires 205/55 R 16) • Sliding center armrest, front (with storage compartments and cup holders) • Radio: Multimedia Navi (Multimedia Radio, 7" touchscreen color display with USB port, hands-free system, voice control, Bluetooth audio streaming, smartphone integration via Apple CarPlay and Android Auto - Navigation system with integrated memory - Road map for over 30 European countries - Map display in 2D and 3D - Dynamic route guidance via map and/or arrow display and voice prompts - Dynamic destination guidance via enhanced Traffic Message Channel (TMCpro)) | <ul style="list-style-type: none"> • Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including rear footwell heating) • Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards) • Seats: Ergonomic active seat (certified by the Campaign for Healthy Backs (AGR) Driver's seat: - Length, height and tilt adjustable - Electropneumatic lumbar support adjustable in height and length - Extendable thigh support - Pocket on the back of the front seats, driver and front passenger) |
|--|--|



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Sill - left side	Sill - dent(s) - Smart repair
3	Side panel - rear left side	Sill - Scratch(es) - Smart repair
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Door - front right side	Door edge - Scratch(es) - Smart repair
8	Body	Body (Flugrost) - Soiled - Clean
9	Side panel - rear right side	Elbow - Dent / paintcoat damage - Repair and paint
10	Vehicle glazing	Windscreen with rain sensor - Stone chips - Replace

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

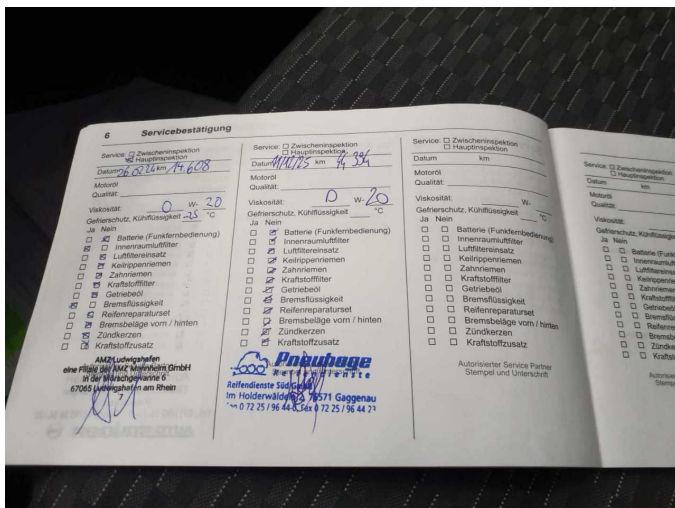


Figure 15: Documents



Figure 16: Documents

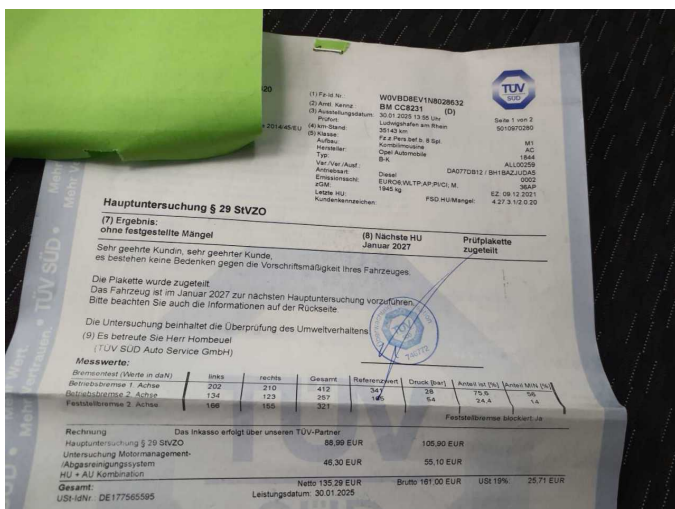


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

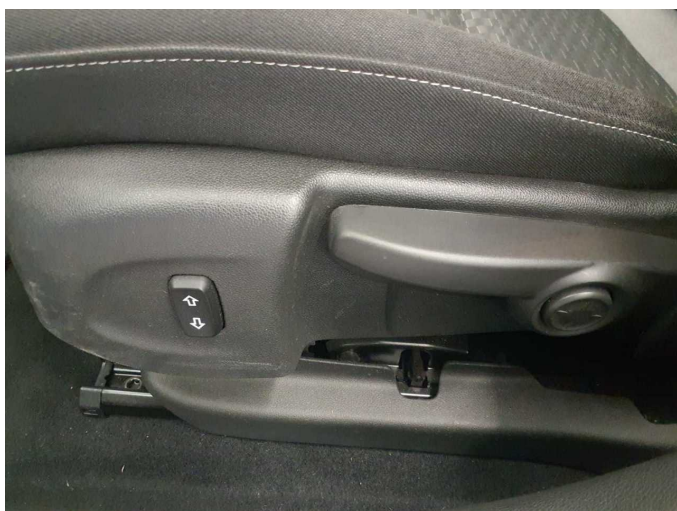


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

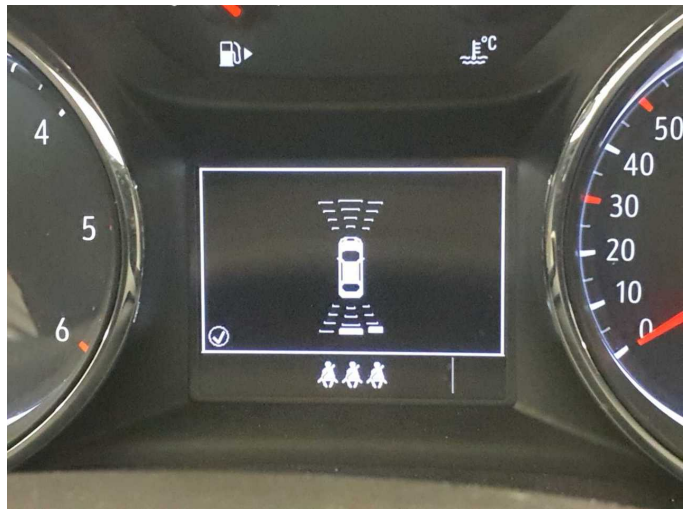


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

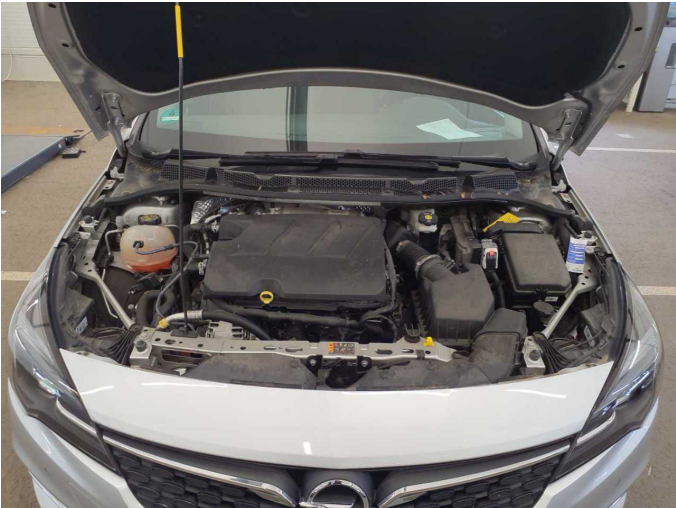


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.




Figure 35: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

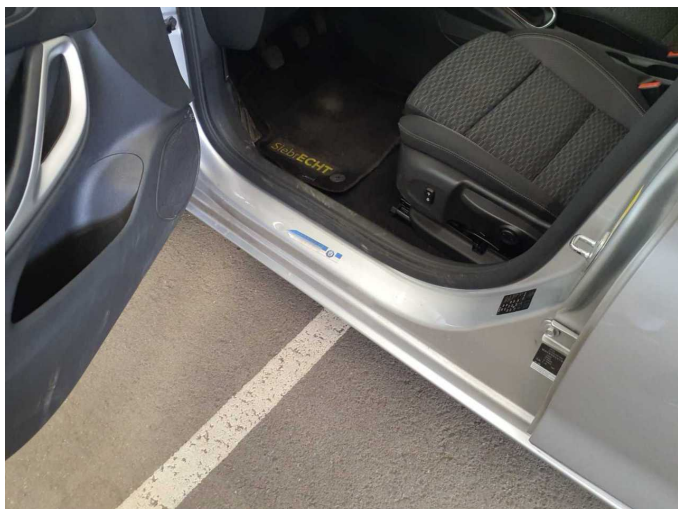

Damage 2: Sill - left side: Sill - dent(s) - Smart repair

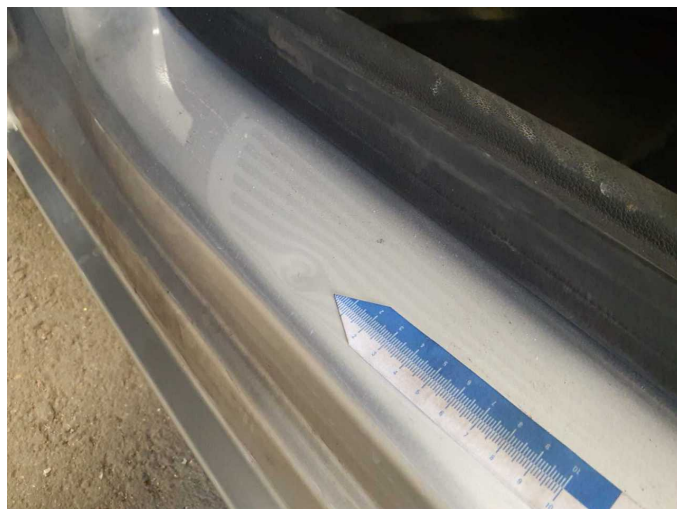

Damage 2: Sill - left side: Sill - dent(s) - Smart repair

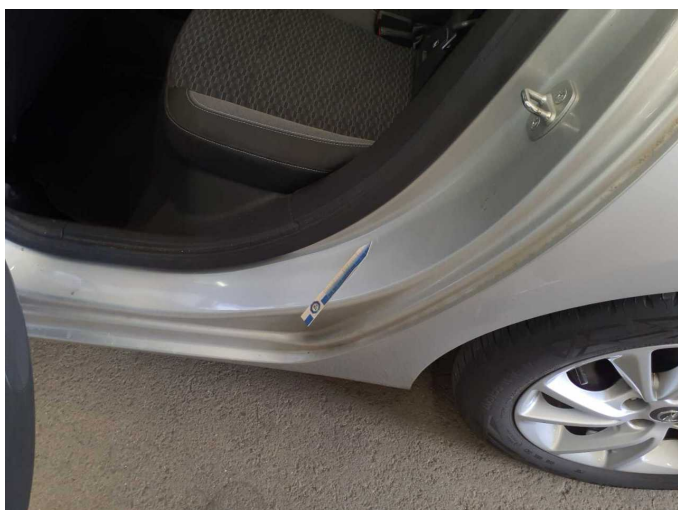


Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair

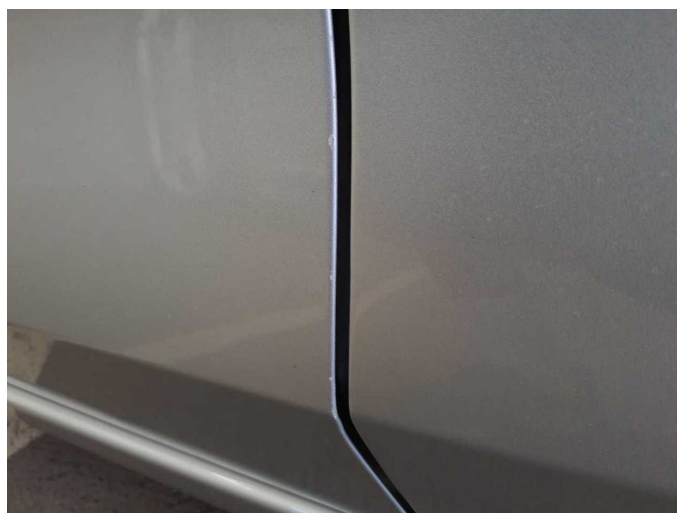

Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

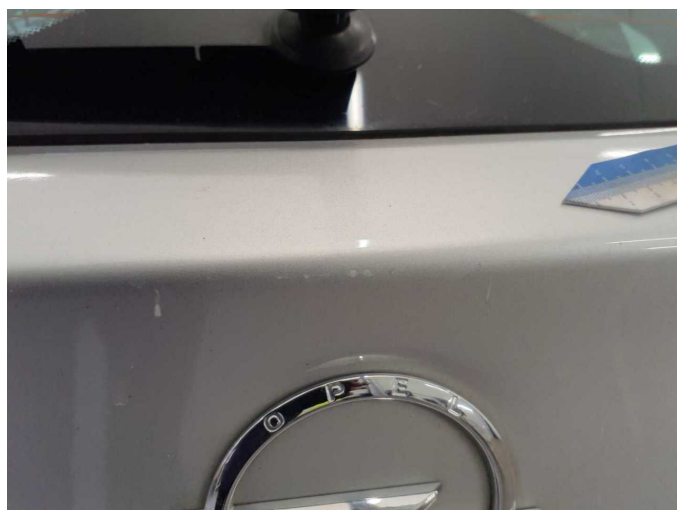

Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

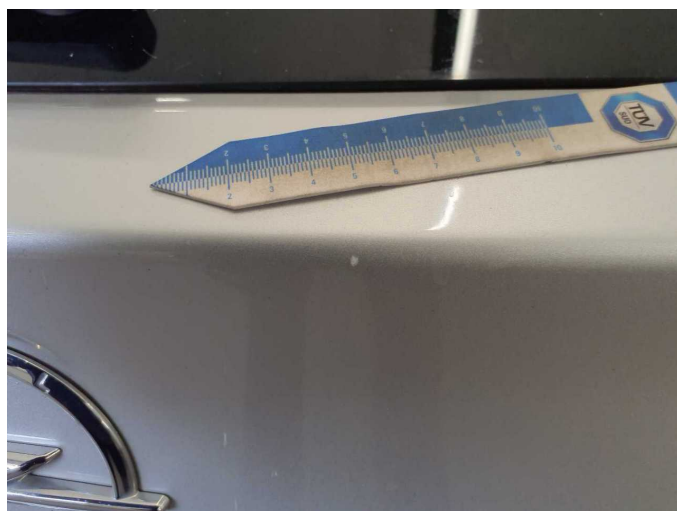

Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 7: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 7: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 8: Body: Body (Flugrost) - Soiled - Clean

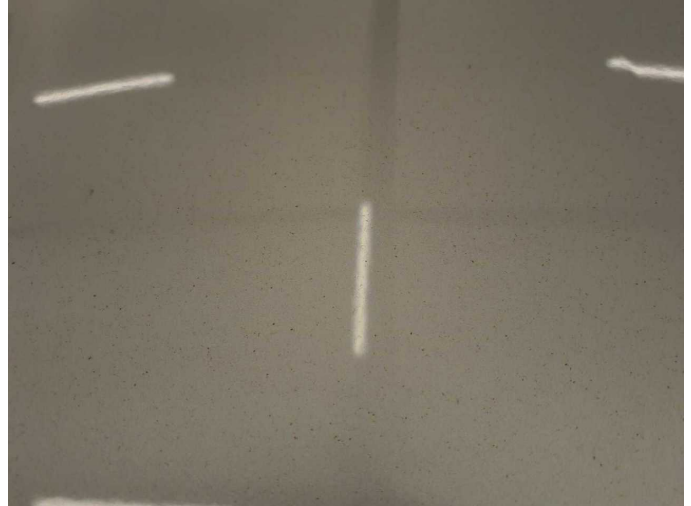


Damage 8: Body: Body (Flugrost) - Soiled - Clean



Damage 8: Body: Body (Flugrost) - Soiled - Clean



Damage 8: Body: Body (Flugrost) - Soiled - Clean

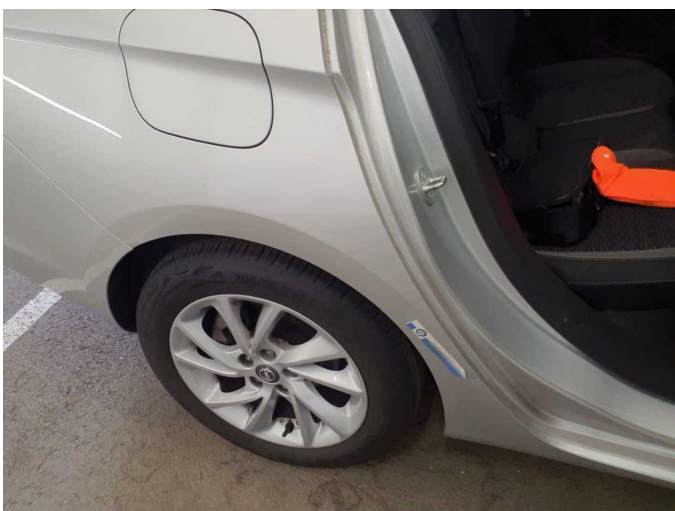

Damage 9: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Repair and paint



Damage 9: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Repair and paint



Damage 9: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Repair and paint



Damage 9: Side panel - rear right side: Elbow - Dent / paintcoat damage
- Repair and paint



Damage 10: Vehicle glazing: Windscreen with rain sensor - Stone chips -
Replace



Damage 10: Vehicle glazing: Windscreen with rain sensor - Stone chips -
Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EV1N8028632

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Business Edition

Datum	KM-Stand	Beschreibung
30.01.2025	33.120	HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.02.2024	14.608	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.12.2022	7.800	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges