



Expertise

Protocol number: 46139819
Order No. / Reference: 26484122
Inspection date: 16 Jun 2026

Manufacturer: Skoda
VIN: TMBJF9NU3PC213679

Model: Karoq 2.0 TDI SCR DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 2.0 TDI SCR DSG Style	
Vehicle Identification number	TMBJF9NU3PC213679
Mileage (Read)	90,561 km
First registration	21 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report not on hand)	
Power / Engine displacement	85 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Black Pearl effect
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	11,100 km
Last service on / at	01/2026 at 83,367 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ543268
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8004 / AVU 01474		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,008 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 96W	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	215/50 R18 96W	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, high-visibility vest compartment in the front doors, glasses compartment in the headliner, storage compartments in the front door panels with 1.5l bottle holders, cup holders in the front center console)
- Allergen filter
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Exterior mirrors and door handles painted in body color
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Decorative inlay style
- Digital Cockpit Plus (10")
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Closed storage compartment on the dashboard
- Cruise control
- Tinted windows
- Heated rear window
- Rear window wiper/washer system
- ISOFIX preparation on the outer rear seats (including top tether)
- LED brake light in the rear spoiler
- LED taillights in crystal glass look (and animated turn signals)
- Reading lights at the front of the headliner
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Package: Winter BASIC (Heated front seats - Heated windshield washer nozzles - Headlight cleaning system)
- Radio accessories: 8 speakers
- Radio accessories: USB port in the center console (Type-C)
- Tire mobility kit (tire repair spray incl. compressor)
- Rear seat backrest split 60:40, foldable
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Illuminated trunk
- Hydraulic brake assist (HBA)
- Grey headliner
- Roof rails, black
- Diesel particulate filter
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Trunk cover, fixed
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED fog lights
- LED headlights with daytime running lights
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Package: Comfort PLUS (Adjustable lumbar support in the front seats - Climatronic air conditioning (2-zone) - Sunset - Kessy)
- Wheel arch cover (front and rear, made of plastic, black textured)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink (Android Auto and Apple CarPlay)
- Tire pressure monitoring
- Gear shift indicator
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)
- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter
- 12V socket - in the trunk
- 12V socket - in the center console
- Bumpers partially painted in body color
- Lashing eyes in the trunk
- Immobiliser



- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)

- Central locking with remote control

Extra equipment

- Electric tailgate operation with comfort opening
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Package: Amundsen Infotainment Package (Amundsen Dynamic Radio Navigation System - 8" Capacitive Color Display - Digital Cockpit Plus - Wireless SmartLink - Voice Control - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (3-year term) - Mapcare navigation data update)
- Upholstery: Glamour leather interior (seat surfaces made of fine nappa leather, combined with high-quality materials)
- VARIOFLEX seating system in the rear (sliding and repositionable outer rear seats with adjustable backrest angle, removable, middle seat with table function)
- Luggage net partition
- Paint finish: Pearl effect
- Steering wheel: Heated sports leather steering wheel (DSG) with multifunction buttons (including paddle shifters)
- Package: Safety (Proactive occupant protection - rear side airbags)
- Package: Traveller BASIC (Predictive Adaptive Cruise Control ACC (control range up to 210 km/h) - Adaptive Lane Keeping Assist - Traffic Sign Recognition - Capacitive Steering Wheel with Hands Off Detection - USB-C Charging Port on the Interior Mirror - Emergency and Traffic Jam Assist)
- Wheels: 18" Miran alloy wheels, black/silver, diamond-cut (wheels 7J x 18, ET 45 - tires 215/50 R18 92W)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
2	Door - rear right side	Door - Scratch(es) - Smart repair
3	Door - front left side	Brightware - lower - Scratched - Smart repair
4	Wheel / tyres	Tyre - front right side (Flanke) - Damaged - Replace
5	Misc.	Misc. (Stecker Sitzheizung, Mehrkosten möglich) - Broken / torn - Replace
6	Rear bumper	Rear bumper - Scratched - Paint
7	Door - rear left side	Door - Scratch(es) - Paint
8	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
9	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Rear bumper	Spoiler (Unlackiert) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 26 Sept 2025	3.570,16 €

Repainting

No.	Repainting
1	Roof, Professionally carried out, Invoice of repair done Non-existent
2	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
4	Bonnet, Professionally carried out, Invoice of repair done Non-existent
5	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
6	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
7	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
8	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
9	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
10	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	167 µm	Boot lid / rear door	174 µm
Mudguard - left side	262 µm	Bonnet	161 µm
Side panel - rear left side	177 µm	Side panel - rear right side	167 µm
Door - rear left side	156 µm	Door - rear right side	172 µm
Door - front left side	171 µm	Door - front right side	205 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

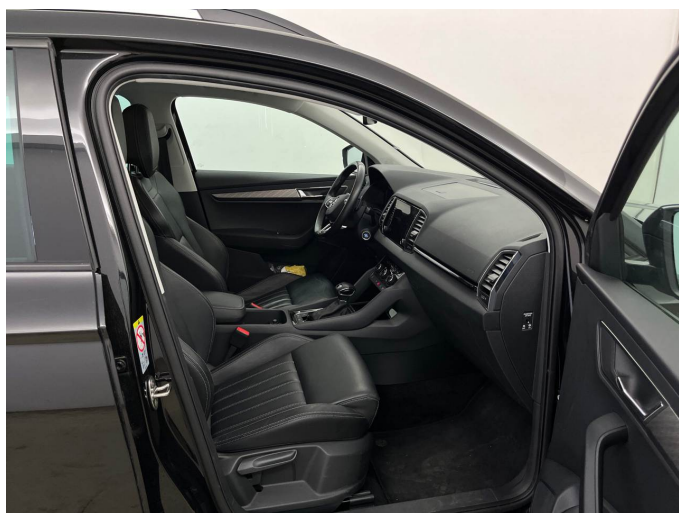


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

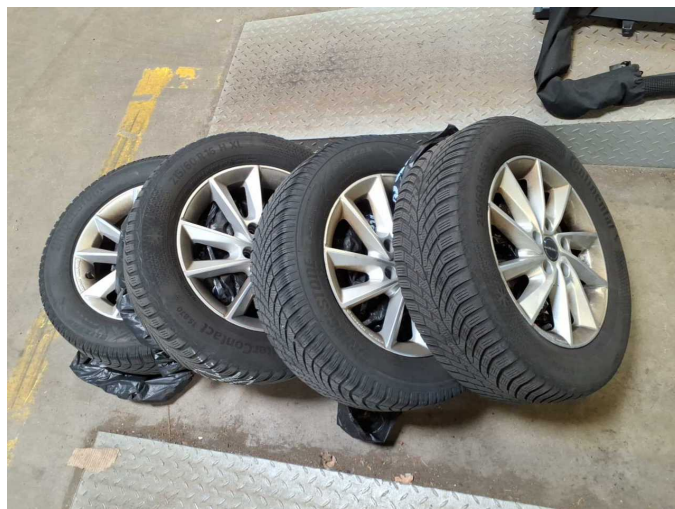


Figure 14: Additional tyres



Figure 15: Navigation

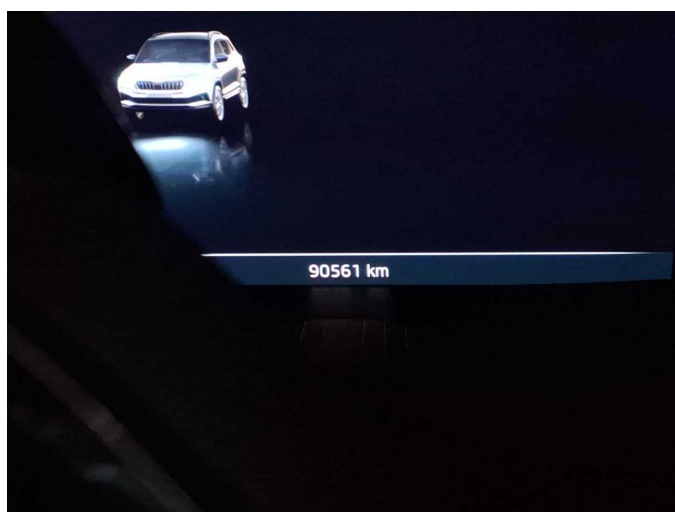


Figure 16: Misc.

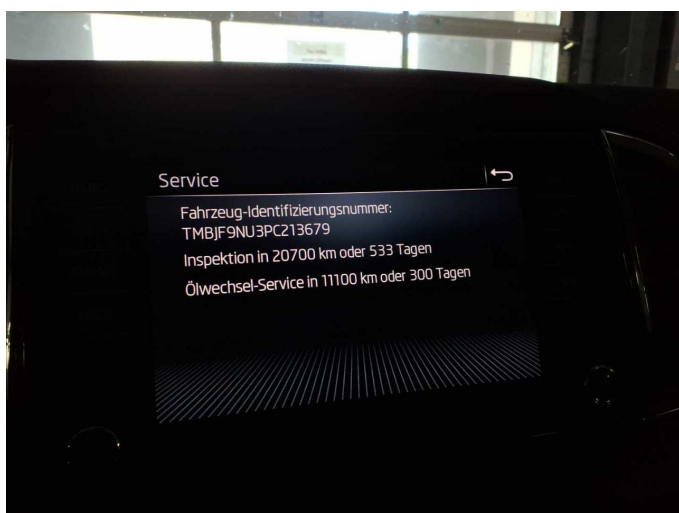


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

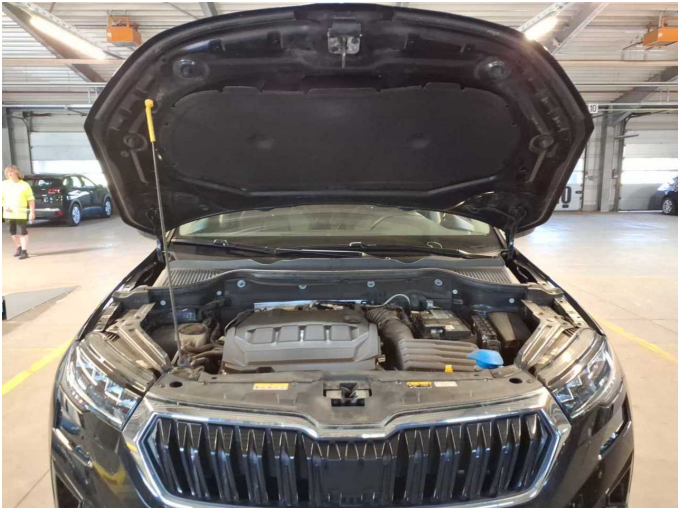


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.

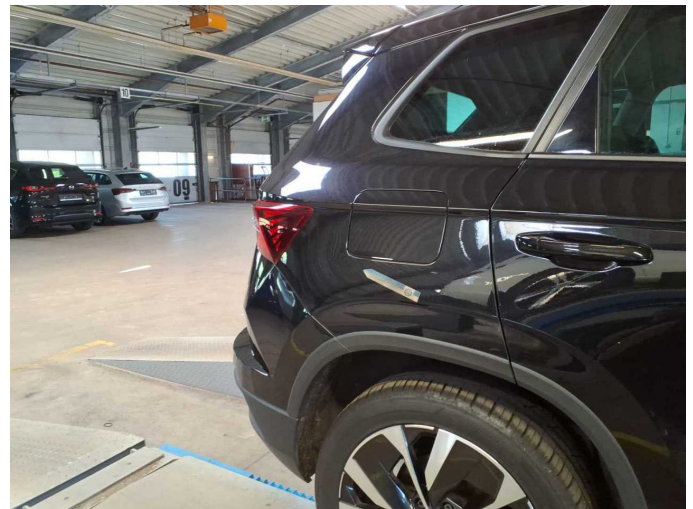


Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

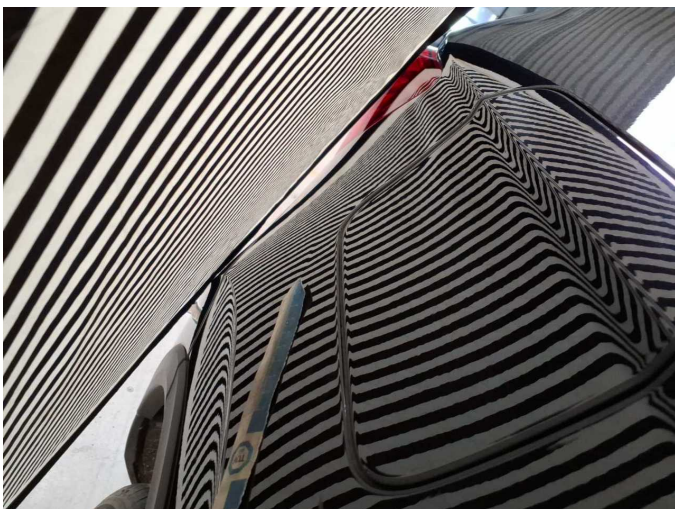

Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

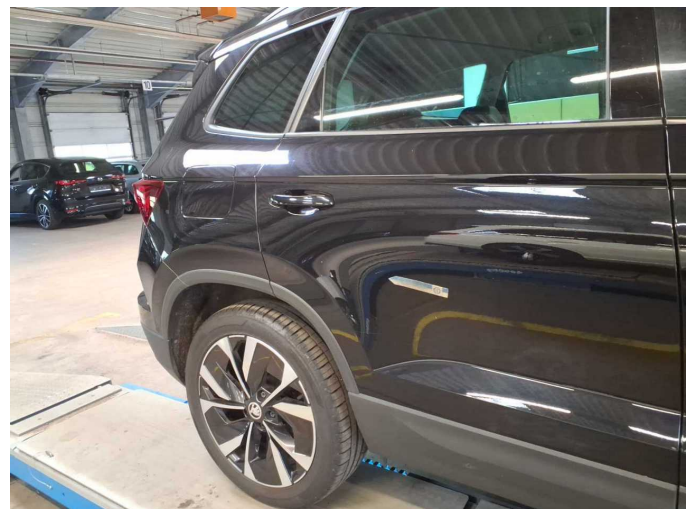


Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair

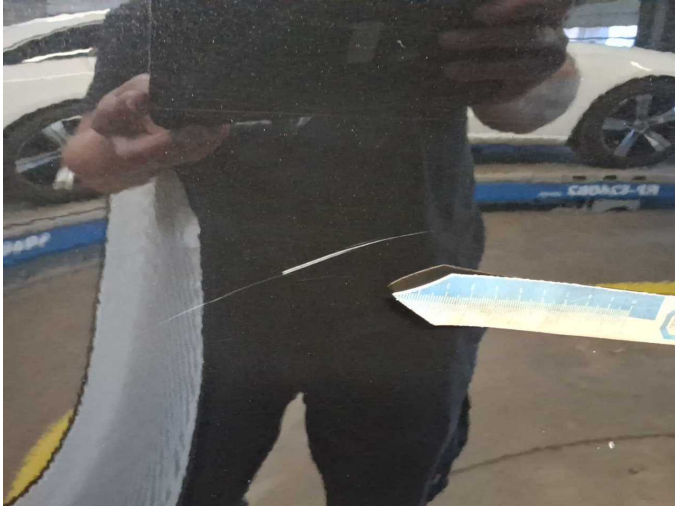

Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 3: Door - front left side: Brightware - lower - Scratched - Smart repair

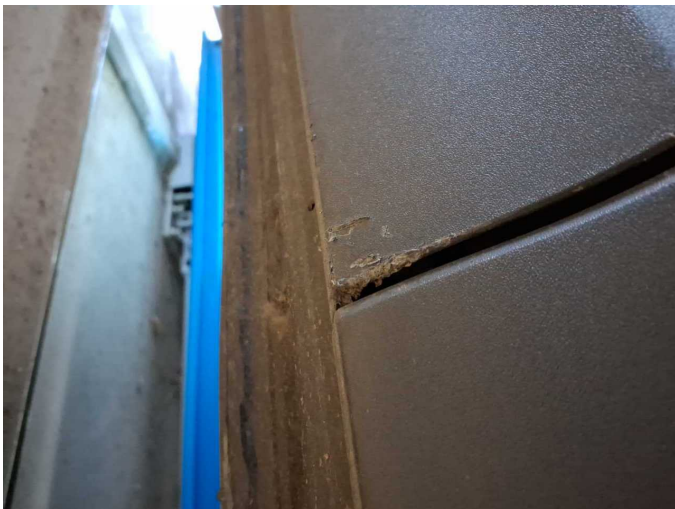

Damage 3: Door - front left side: Brightware - lower - Scratched - Smart repair



Damage 4: Wheel / tyres: Tyre - front right side (Flanke) - Damaged - Replace




Damage 4: Wheel / tyres: Tyre - front right side (Flanke) - Damaged - Replace



Damage 5: Misc.: Misc. (Stecker Sitzheizung, Mehrkosten möglich) - Broken / torn - Replace




Damage 5: Misc.: Misc. (Stecker Sitzheizung, Mehrkosten möglich) - Broken / torn - Replace

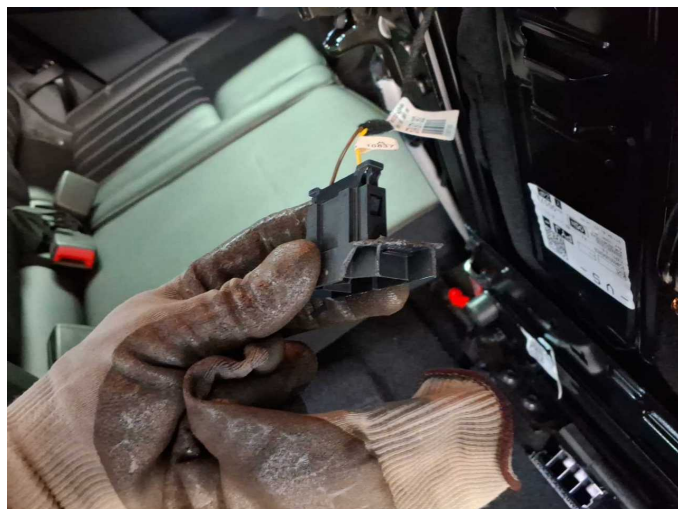

Damage 5: Misc.: Misc. (Stecker Sitzheizung, Mehrkosten möglich) - Broken / torn - Replace



Damage 5: Misc.: Misc. (Stecker Sitzheizung, Mehrkosten möglich) - Broken / torn - Replace

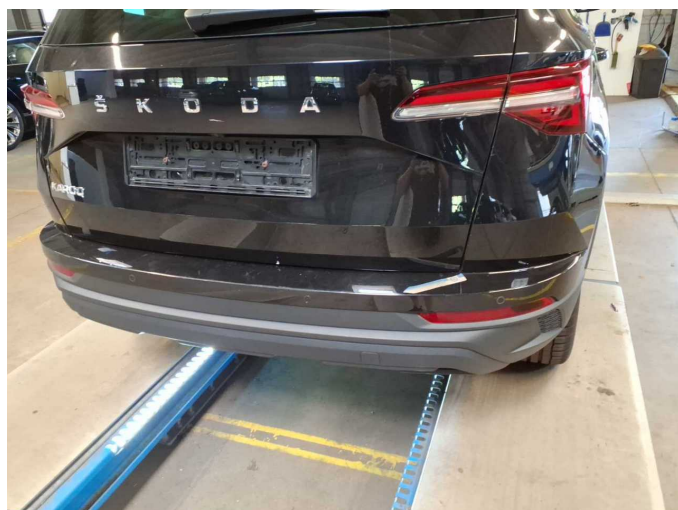

Damage 6: Rear bumper: Rear bumper - Scratched - Paint




Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint

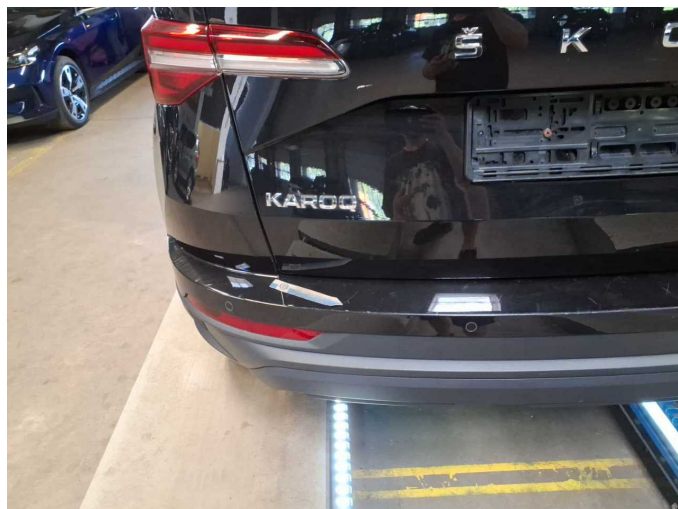

Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 7: Door - rear left side: Door - Scratch(es) - Paint




Damage 7: Door - rear left side: Door - Scratch(es) - Paint



Damage 7: Door - rear left side: Door - Scratch(es) - Paint




Damage 7: Door - rear left side: Door - Scratch(es) - Paint

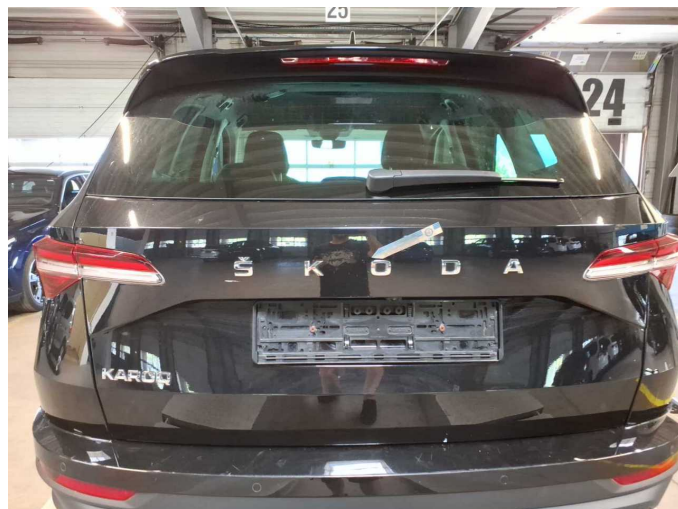

Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

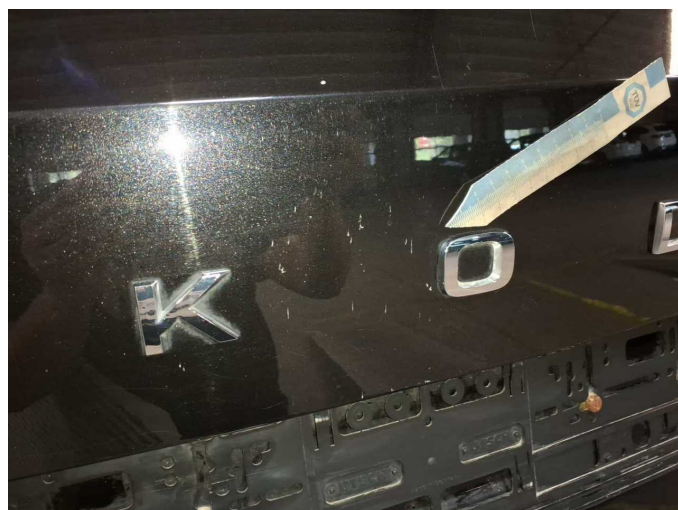

Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

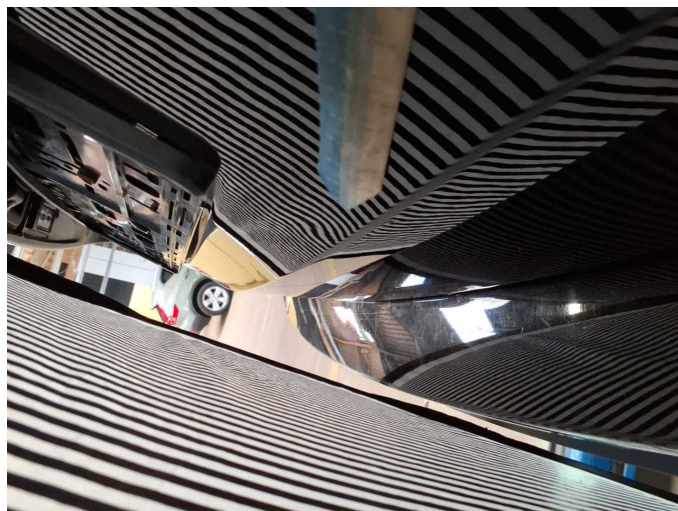

Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

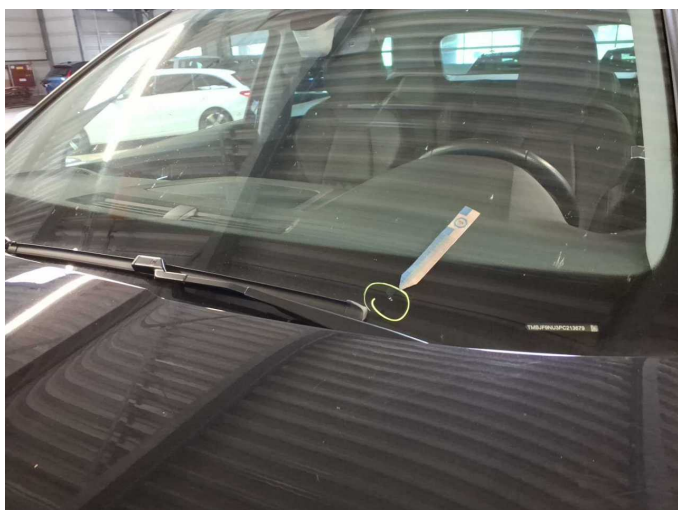

Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Roof

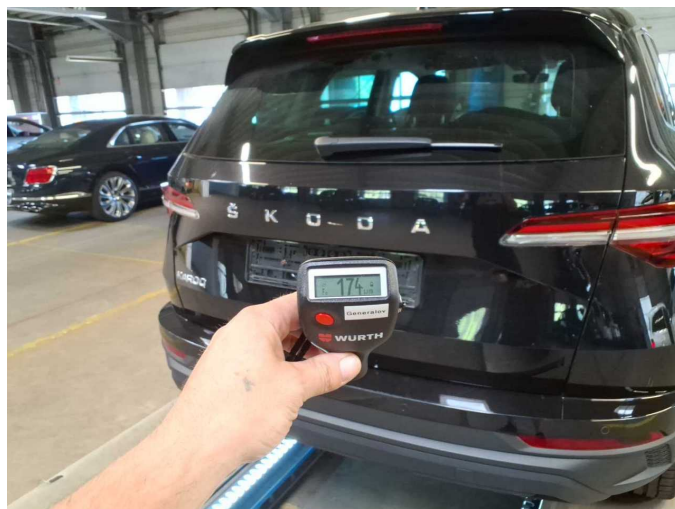

Repainting 2: Boot lid / rear door

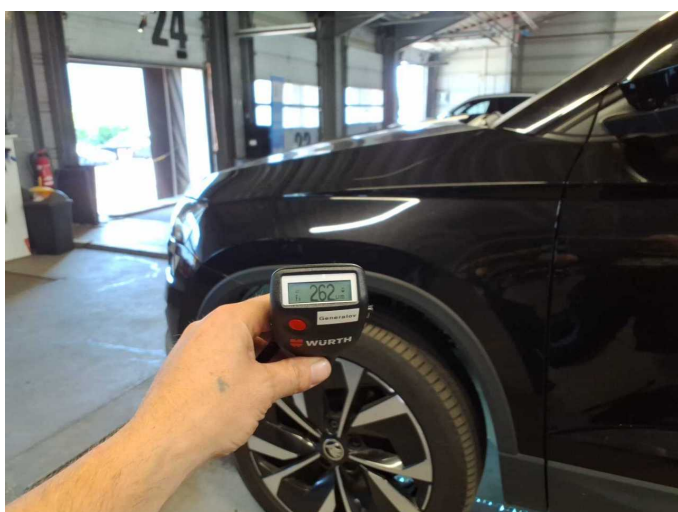

Repainting 3: Mudguard - left side



Repainting 4: Bonnet



Repainting 5: Side panel - rear left side



Repainting 6: Side panel - rear right side



Repainting 7: Door - rear left side



Repainting 8: Door - rear right side



Repainting 9: Door - front left side



Repainting 10: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJF9NU3PC213679
Hersteller / Modell: SKODA SKODA Karoq 2.0 TDI SCR DSG Style

Datum	KM-Stand	Beschreibung
18.03.2026	86.722	AU; Wartung Sonstiges
20.01.2026	83.367	Dieselpartikelfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose
09.12.2025	81.203	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
01.10.2025	76.250	Systemtest/Eigendiagnose
18.11.2024	54.699	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.12.2023	29.544	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges