



Expertise

Protocol number: 46621875
Order No. / Reference: 26653413
Inspection date: 21 Jul 2026

Manufacturer: Volkswagen

Model: Touran 1.5 TSI ACT OPF DSG Comfortline

VIN: WVGZZZ1T4PW013928



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Touran 1.5 TSI ACT OPF DSG Comfortline

Vehicle Identification number WVGZZZ1T4PW013928
Mileage (Read) 51,579 km
First registration 24 May 2023
Number of holders 1
Next periodical technical inspection 05/2026
(Report not on hand)

Fuel type Petrol
Engine displacement / Cylinder 1,498 ccm / 4
Power 110 kW
Gearbox / Number of gears Automatic / 7
Type of drive Front drive
Type of vehicle Van

Colour / colour code Carribean Blue Metallic
Doors / Seats 5 / 5
Upholstery type Alcantara / cloth
Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	8,900 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS377181
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CJB 00519		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,120 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment with lid on the instrument panel
- Active Cylinder Technology ACT
- Airbag, head airbag system for front and rear passengers
- Electrically folding exterior mirrors
- Exterior mirror housings and door handles in body color
- Headliner in Storm Grey
- Decorative inlays "New Brushed Design"
- Digital Cockpit, multicoloured
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover
- Height-adjustable luggage compartment floor
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats
- Front headrests
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Lane change assistant "Side Assist" and parking assistant
- 12V power outlet on the rear of the center console
- Telephone interface
- USB-C interface
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys
- Storage compartments in the overhead console
- Airbag for driver and front passenger
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- third brake light
- black roof rails
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control with daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Baggage management package
- Additional luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Non-smoking version
- Emergency call service
- Otto particulate filter
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Rain sensor
- Wheels: Tire pressure monitoring system
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system
- Bumpers in body color
- Textile floor mats
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Black trim strips on the side windows



Extra equipment

- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Paint finish: Metallic
- "Discover Media" navigation system including "Streaming & Internet" (radio)
- Package: Mirror package
- Park Assist (automatically steers the vehicle into parallel and perpendicular parking spaces and also parks out of parallel parking spaces)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- Seats: Front seats and outer rear seats of the 2nd row are heated.
- High beam assistant "Light Assist"
- Heated windshield (laminated safety glass windshield, noise-reducing and heated)
- Package: Business Premium incl. Navigation (DSG) (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel with shift paddles - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - Scratch(es) - Smart repair
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Side panel - rear right side	Sill - Scratch(es) - Smart repair

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 24 Apr 2024	559,54 €
2	Side right, Provided by user / customer, from 5 Aug 2023	1.404,23 €
3	Side right, Provided by user / customer, from 29 Jun 2024	4.026,77 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	440 µm
------------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

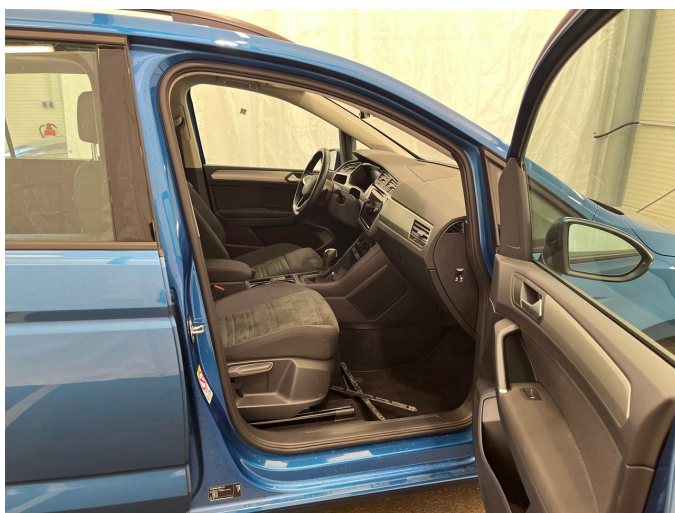


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

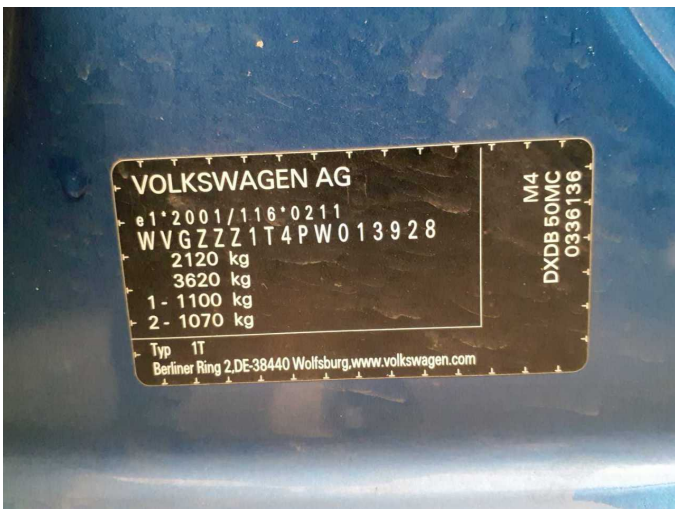


Figure 11: VIN



Figure 12: Mounted tyres

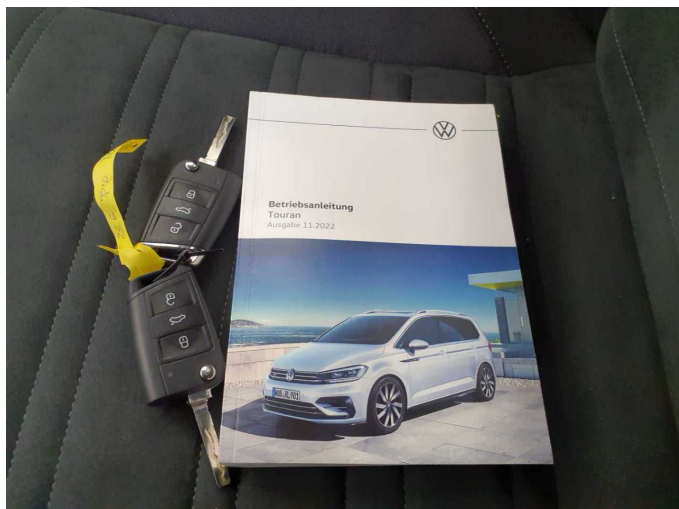


Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 1: Door - rear left side: Door - Scratch(es) - Smart repair




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

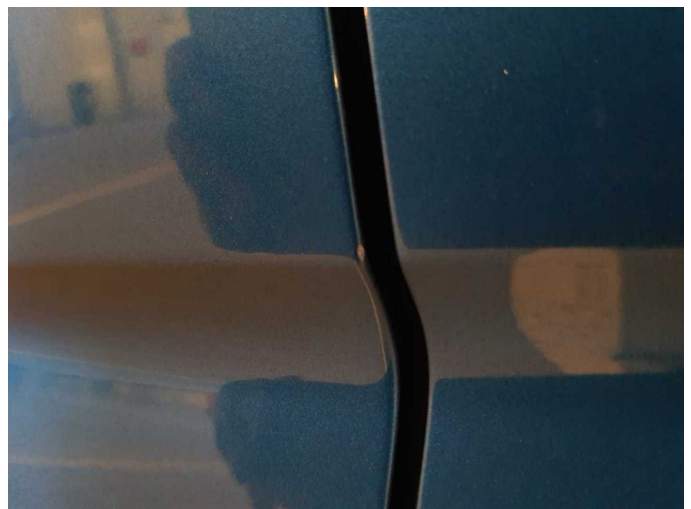


Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair

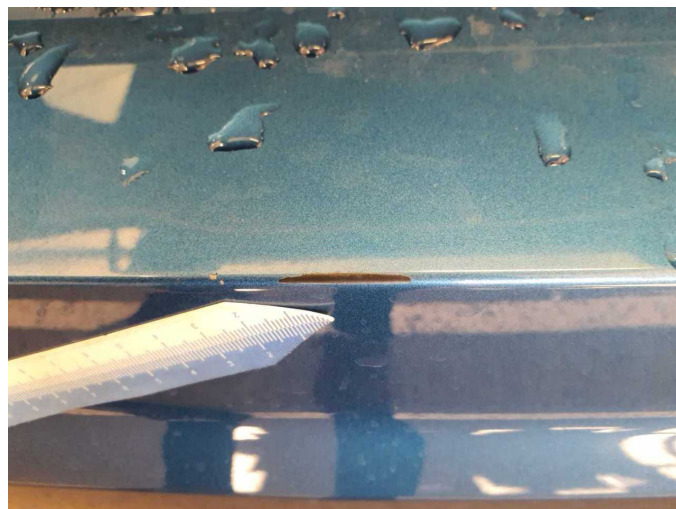

Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair

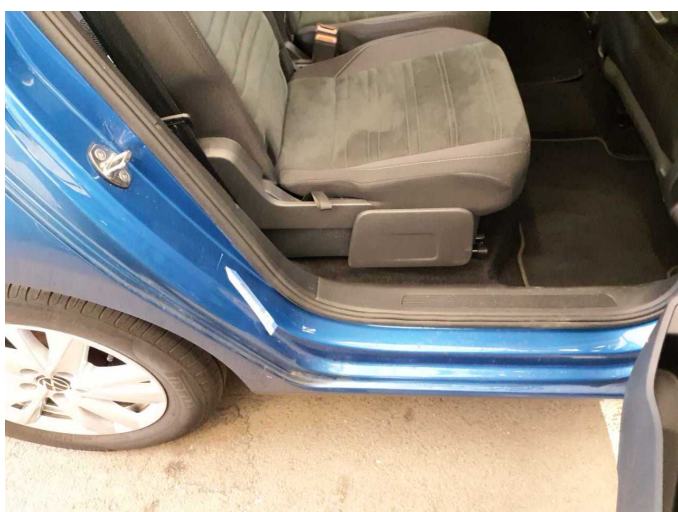

Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair

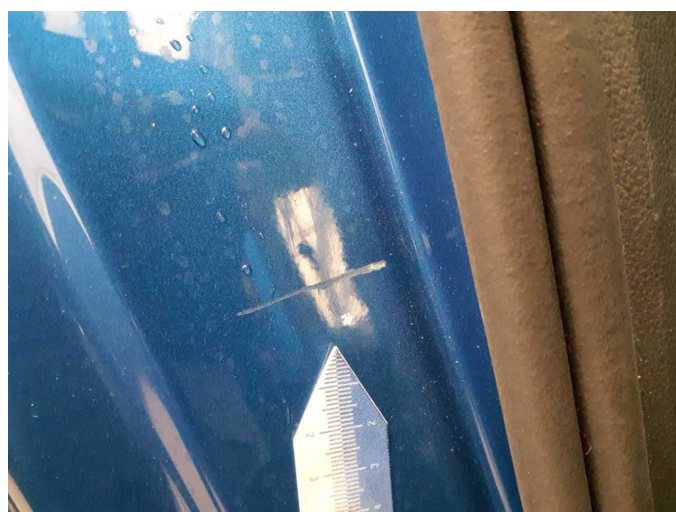

Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side