



Expertise

Protocol number: 46740280
Order No. / Reference: 26804302
Inspection date: 27 Jul 2026

Manufacturer: Volkswagen

Model: Transporter T6.1 4MOTION Lang

VIN: WV2ZZZ7HZPH018606



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Transporter T6.1 4MOTION Lang

Vehicle Identification number WV2ZZZ7HZPH018606

Mileage (Read) 131,874 km

First registration 8 Dec 2022

Number of holders 1

Fuel type Diesel

Engine displacement / Cylinder 1,968 ccm / 4

Power 110 kW

Gearbox / Number of gears Manual / 6

Type of drive All-wheel drive

Type of vehicle Van

Colour / colour code Reflexsilber-metallic (A7W)

Doors / Seats 4 / 4

Upholstery type Cloth

Colour of upholstery Black-Grey



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-4,200 km
Last service on / at	05/2025 at 87,610 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM763615
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BTY 30513		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Hankook	8mm / 8mm
2)	215/65 R16 106T	Summer tyres on Steel rim with wheel cover	Bridgestone	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Winter tyres on Steel	Goodyear	5mm / 5mm
2)	215/65 R16 109T	Winter tyres on Steel	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T	Summer tyres on Steel	Continental	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments and boxes (glove compartment with lockable flap)
- 4MOTION all-wheel drive (permanent)
- Electrically adjustable and heated exterior mirrors
- Hill Start Assist
- third brake light
- Three-phase generator 140 A
- Tachometer
- Chassis: 16" chassis with 16" brake system
- Windows: Fixed side windows in the cargo/passenger compartment, left and right
- Transmission: 6-speed transmission
- Tailgate with window cutout
- Child safety lock, electrically operated
- Air conditioning with manual control in the driver's cab
- Front headrests, height adjustable
- Headlight range control
- Non-smoking version (12V socket and cup holder in the dashboard)
- Upholstery: Seat covers in fabric, "Double Grid" design
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels/Tires: Steel wheels 6.5 J x 16 in 20-hole design
- Wheels/Tire Accessories: Wheel covers for 16" wheels
- Sliding door in the passenger/cargo compartment: sliding door on the right
- Electromechanical power steering (speed-dependent control, steering column height and length adjustable)
- Start-stop system (with brake energy recuperation)
- Telephone: Mobile phone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control and interior operation
- Airbag for driver and front passenger (with front passenger airbag deactivation - seat belt tensioners for the outer seats)
- Exterior mirrors, left and right convex
- Floor coverings: Rubber floor covering in the driver's cab
- Braking systems: Electronic Stability Program, ABS, ASR (with deactivation button), EDS (Hill Start Assist, Brake Assist)
- Windows: Heated rear window
- Electric windows, front
- Total weight: Permissible total weight 3000 kg
- Glove compartment with light
- Interior paneling: Side panels in the passenger/cargo area, made of hardboard (half-height in vehicles with window cutouts)
- Fuel tank with a 70-liter tank capacity
- Multi-collision brake
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- "Composition Audio" radio with TFT display (monochrome) (USB interface, Bluetooth interface)
- Wheels/Tires: 215/65 R 16 C 106/104 T rolling resistance optimized
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keys for locking system: 2 remote control flip keys
- Seat belts: Three-point automatic seat belts (height-adjustable on the outer seats in the driver's cab)
- Daytime running lights (continuously switched on while driving)
- Lashing eyes for securing cargo
- Green thermal insulation glazing
- Approval with up to 8 seats



Extra equipment

- Rigid towbar (including trailer stabilization)
- Floor coverings: Rubber floor in the passenger/cargo area (Rubber floor covering in the passenger/cargo area with loading edge protection, rear - Step lighting in the passenger/cargo area)
- Cruise control system including speed limiter
- Rear wing doors without windows (Rear wing doors without window cutouts - Rear wing door locking mechanism with internal unlocking function - Without rear window - Without interior safety mirror)
- Fog lights including cornering lights
- Package: Comfort Package Plus (2 12-volt sockets, air conditioning in the driver's cab with manual control, fabric seat covers, "Bricks" design, 1 waste bin for the door pockets in the driver's cab, height adjustment for the left single seat in the driver's cab, glove compartment lid with light, grab handle on the roof frame on the passenger side, foldable, storage compartments on the driver's cab seats, reading light, sun visors with mirrors (front/front), grab handle (front/front), lumbar support for the left single seat in the 1st row (manual).)
- Wheels/Tires: On-board tools and jack
- Seats 1st row: Swivel seat on the right (not height adjustable)
- Seat configuration - 4. Lumbar support: Lumbar support, left and right, manually adjustable for individual use.
- Batteries: 2nd battery with isolation relay, maintenance-free
- Chassis: Rear suspension reinforced
- Windows: Front window and closed rear side wall, in the cargo/passenger compartment, right
- Windows: Sliding window at the front and closed side wall at the rear, in the cargo/passenger compartment, left
- Child seat anchorage ISOFIX and Top Tether in the 2nd row of seats
- Paint finish: Metallic
- Multifunction display "Plus" with fatigue detection (Multifunction display "Plus" with black and white display)
- ParkPilot in the rear area
- Radio navigation system "Discover Media" including "Streaming & Internet" (voice control - 2 USB interfaces (Type C) in the dashboard - "Discover Media" radio navigation system with 20.3 cm (8 inch) touchscreen including "Streaming and Internet" - navigation function/preparation - 4 speakers: 2 tweeters, 2 woofers - Wired & Wireless App-Connect)
- Smoker's version: with cigarette lighter and ashtray in the dashboard
- Wheels/Tires: Spare wheel (steel rim) with driving tires
- Heated seats for the driver's cab, left and right, separately adjustable
- Seat configuration - 5. Armrests: Armrests for both seats in the driver's cab

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Interior	Sun visor - right side (Halter) - Broken / torn - Perform
2	Sliding door, right	Sliding door - Dent / paintcoat damage - Smart repair
3	Tail light	Tail lamp - left side - Scratch(es) - Replace
4	Seat - front	Seat cover - left side (Inklusive polster) - Broken / torn - Replace
5	Door - front left side	Door seal - Broken / torn - Replace
6	Misc.	Inspection / maintenance - Due - Perform
7	Sill - left side	Sill - Corrosion - Repair and paint
8	Headlight	Headlight - right side - Stone chips - Replace
9	Bonnet	Bonnet - Scratch(es) - Paint
10	Door - front right side	Door - Scratch(es) - Paint
11	Boot lid / rear door	Rear door - left side - Corrosion - Repair and paint
12	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - Repair and paint
13	Side panel - rear left side	Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratch(es) - No deduction
2	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - No deduction
3	Roof	Roof - Stone chips - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 7 Jan 2025	2.668,16 €
2	Rear, Provided by user / customer, from 3 Sept 2025	3.181,20 €

Repainting

No.	Repainting
1	Side panel - rear left side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side 300 µm |



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Das Fahrzeug befand sich zum Besichtigungszeitpunkt in nicht fachgerecht reparierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

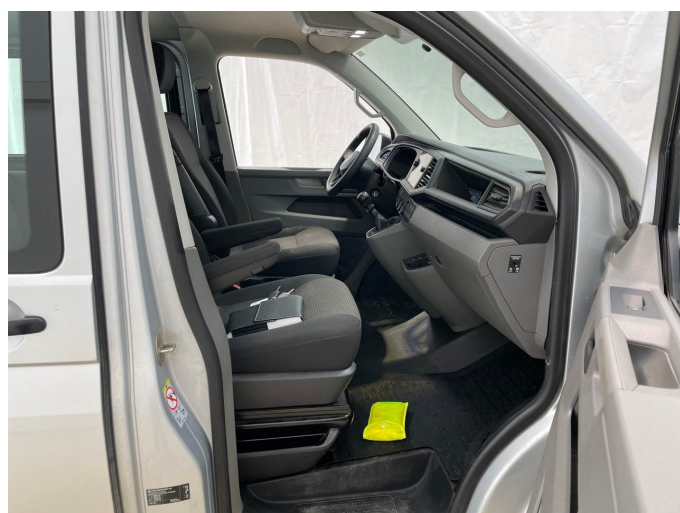


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

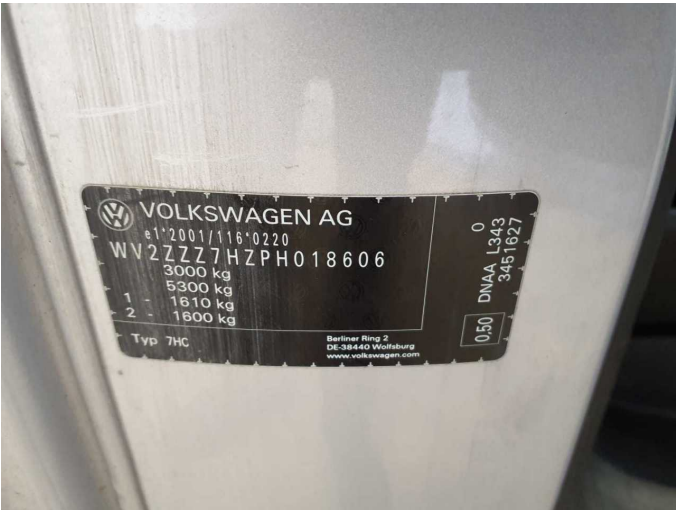


Figure 11: VIN



Figure 12: Mounted tyres

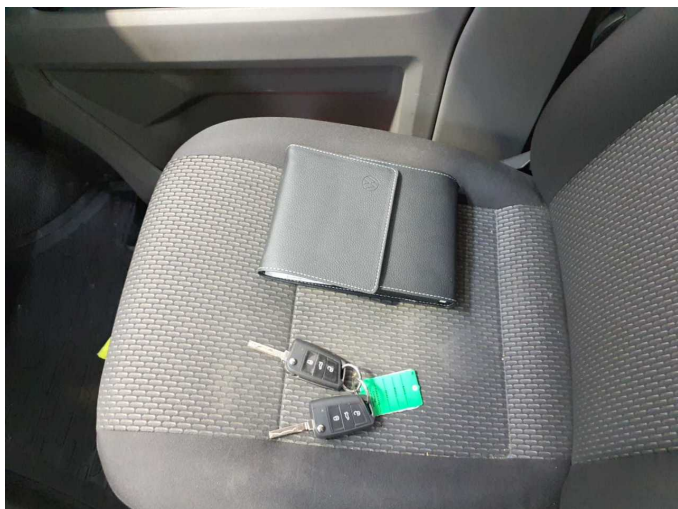


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

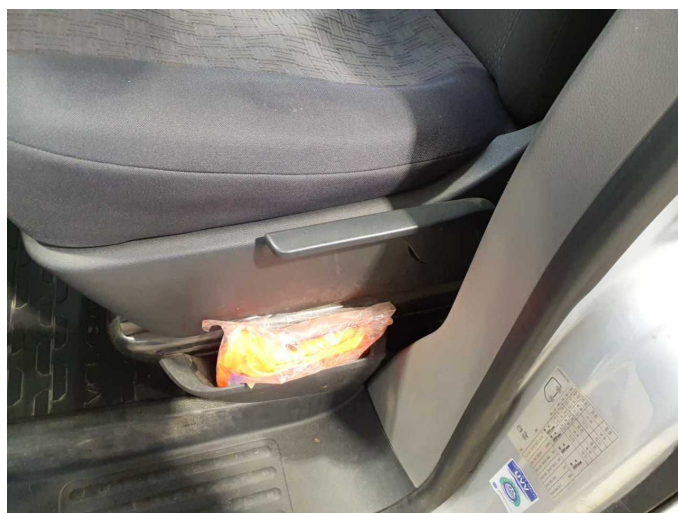


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

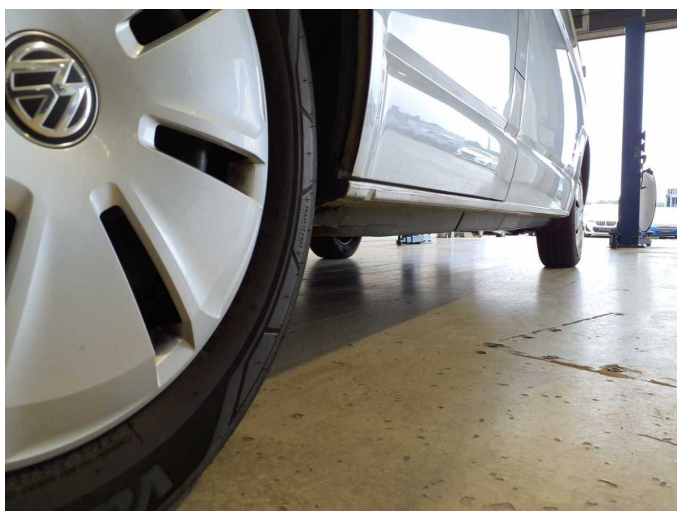


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

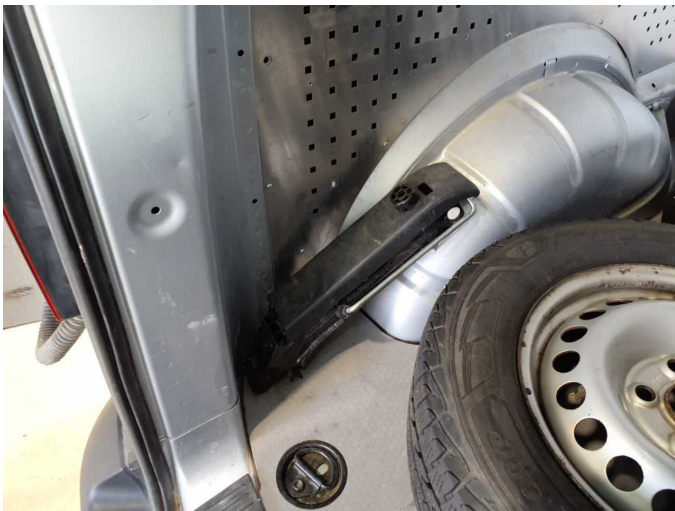


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

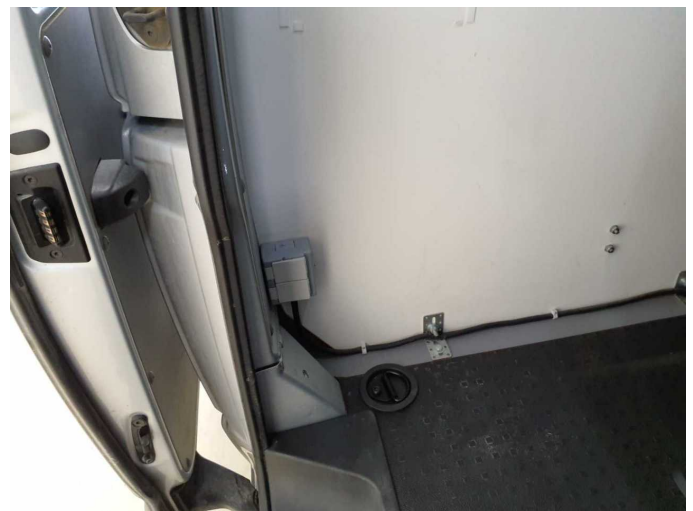


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

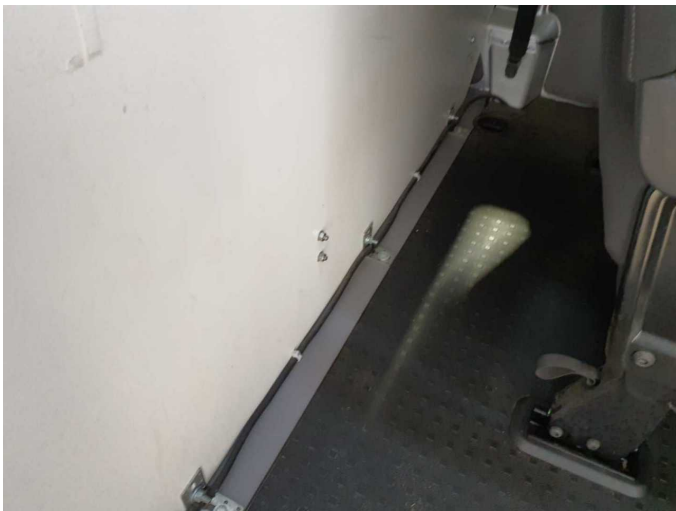


Figure 33: Misc.



Figure 34: Misc.


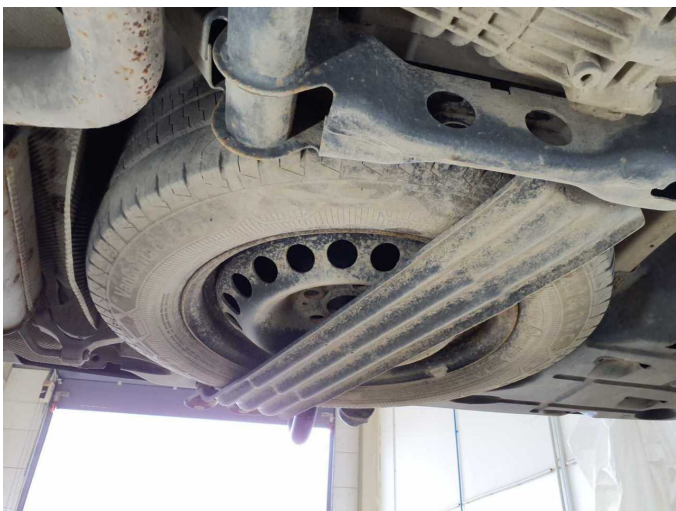


Figure 35: Misc.



Damage 1: Interior: Sun visor - right side (Halter) - Broken / torn - Perform

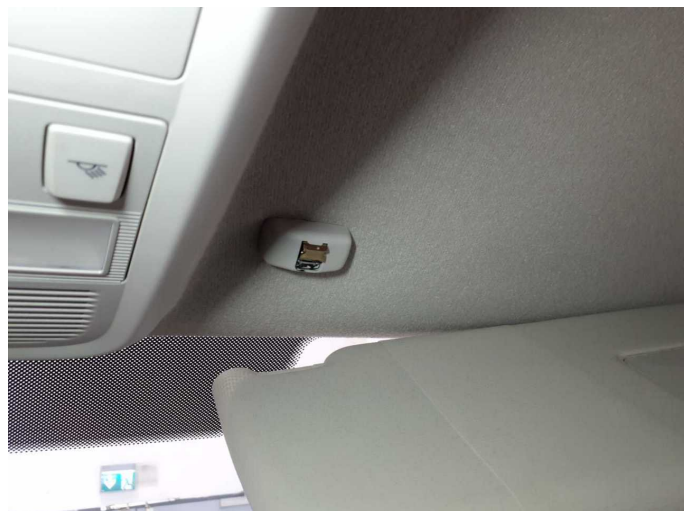

Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair




Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 3: Tail light: Tail lamp - left side - Scratch(es) - Replace



Damage 3: Tail light: Tail lamp - left side - Scratch(es) - Replace

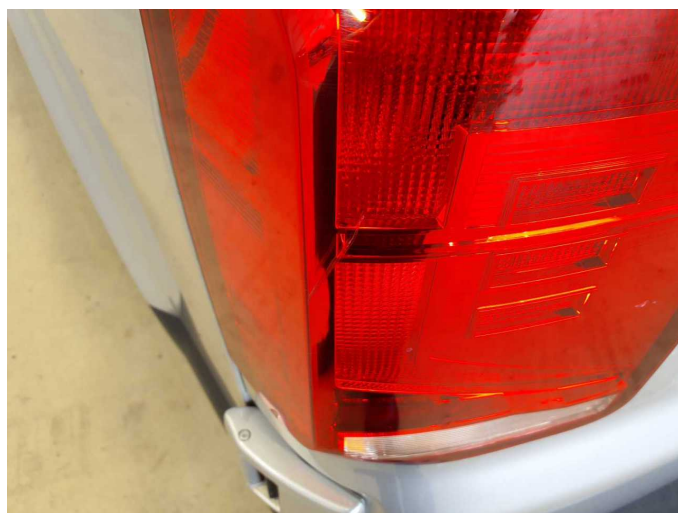

Damage 3: Tail light: Tail lamp - left side - Scratch(es) - Replace




Damage 4: Seat - front: Seat cover - left side (Inklusive polster) - Broken / torn - Replace



Damage 4: Seat - front: Seat cover - left side (Inklusive polster) - Broken / torn - Replace



Damage 4: Seat - front: Seat cover - left side (Inklusive polster) - Broken / torn - Replace

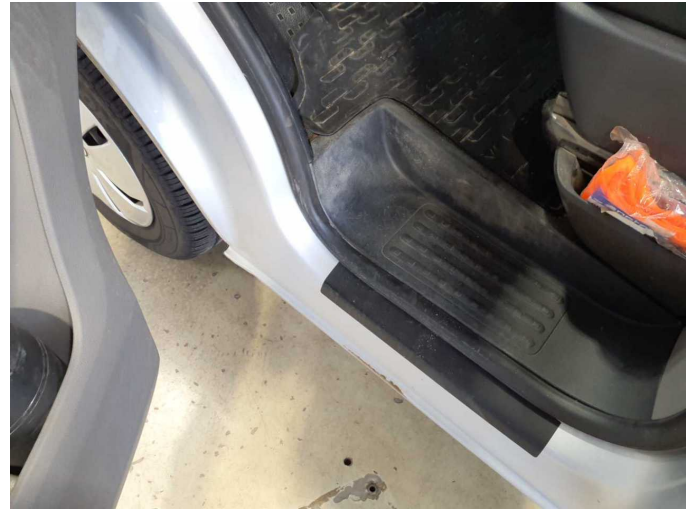


Damage 5: Door - front left side: Door seal - Broken / torn - Replace



Damage 5: Door - front left side: Door seal - Broken / torn - Replace




Damage 6: Misc.: Inspection / maintenance - Due - Perform

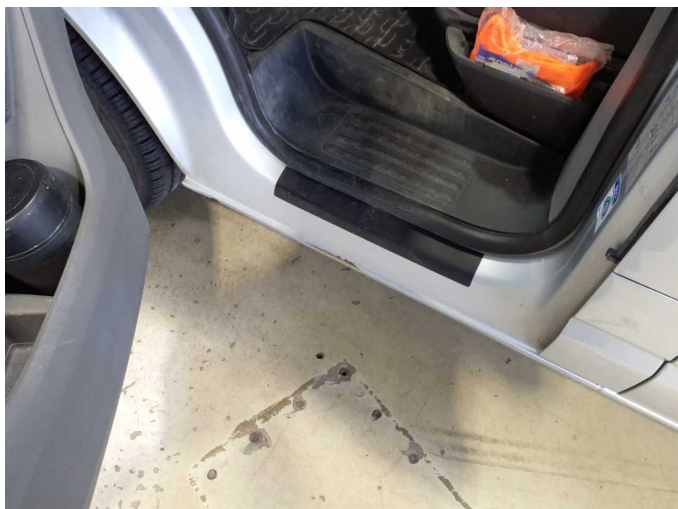

Damage 7: Sill - left side: Sill - Corrosion - Repair and paint




Damage 7: Sill - left side: Sill - Corrosion - Repair and paint

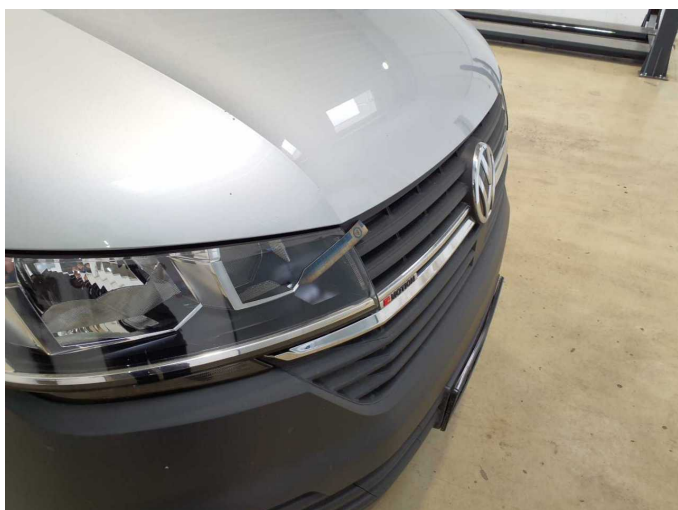

Damage 8: Headlight: Headlight - right side - Stone chips - Replace



Damage 8: Headlight: Headlight - right side - Stone chips - Replace

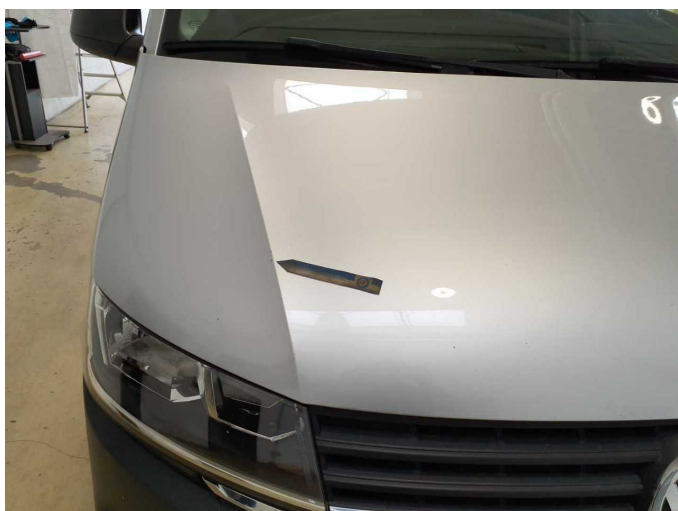


Damage 9: Bonnet: Bonnet - Scratch(es) - Paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Paint

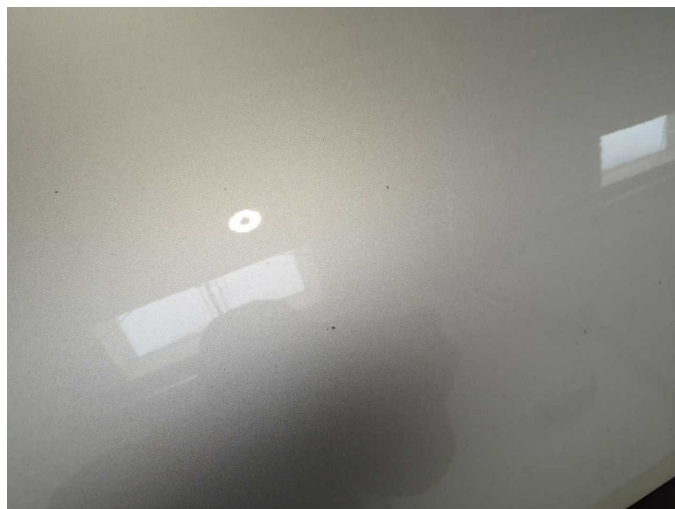


Damage 9: Bonnet: Bonnet - Scratch(es) - Paint




Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Door - front right side: Door - Scratch(es) - Paint

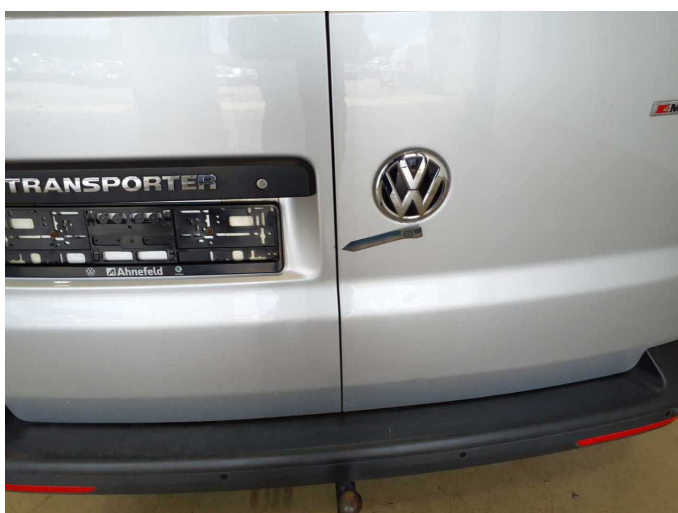

Damage 11: Boot lid / rear door: Rear door - left side - Corrosion - Repair and paint

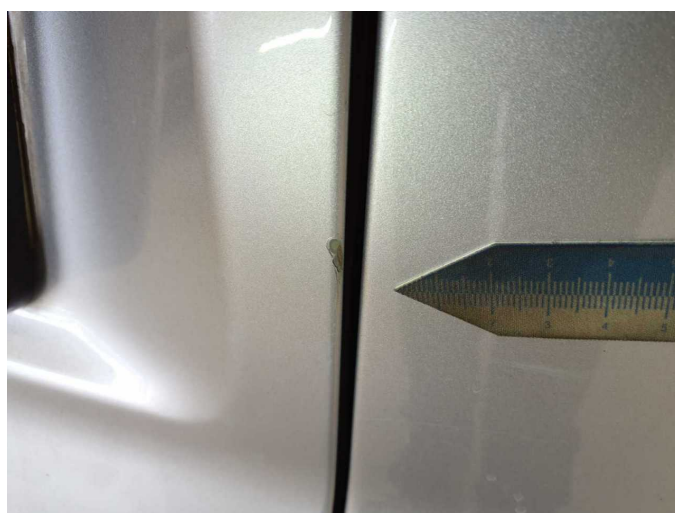

Damage 11: Boot lid / rear door: Rear door - left side - Corrosion - Repair and paint



Damage 12: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 12: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 12: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint



Damage 12: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - Repair and paint




Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

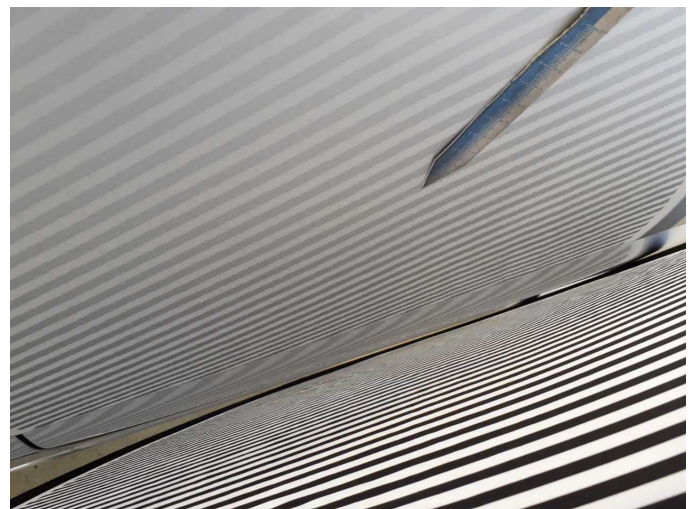


Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint




Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

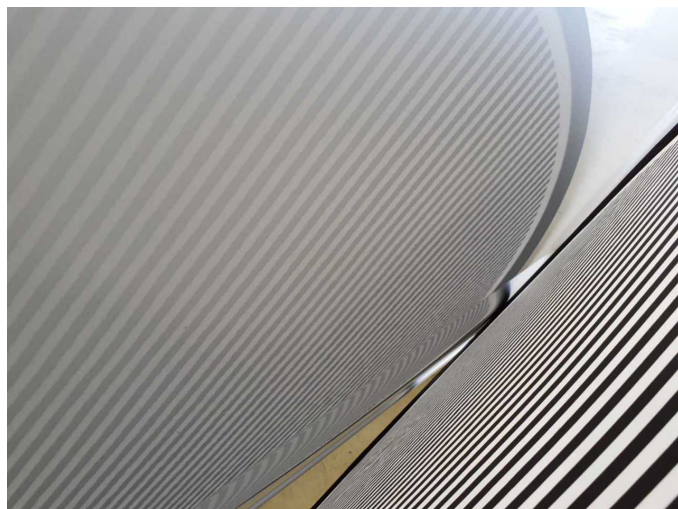

Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

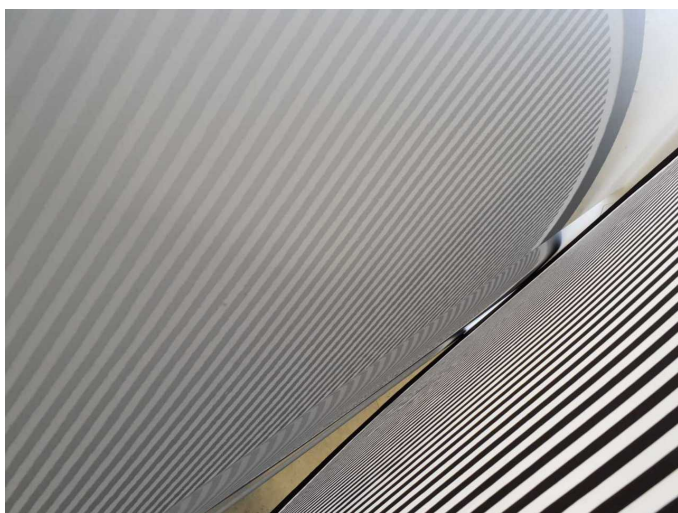

Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint

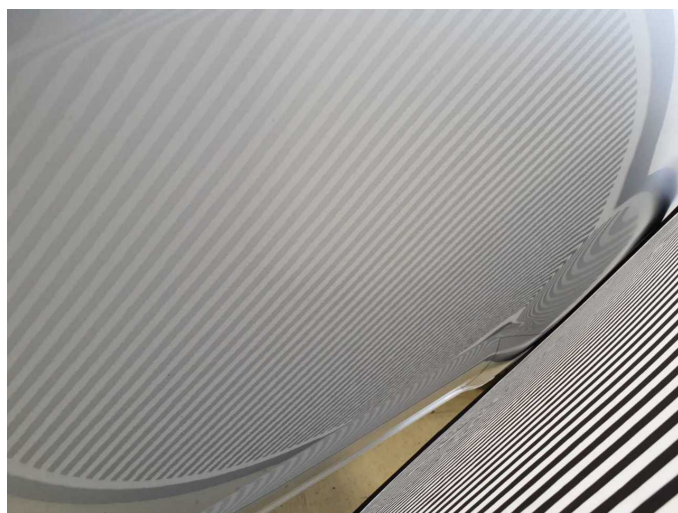

Damage 13: Side panel - rear left side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side