



Expertise

Protocol number: 46859330
Order No. / Reference: 26759332
Inspection date: 3 Aug 2026

Manufacturer: Seat

Model: Alhambra 1.4 TSI S&S DSG OPF XCELLENCE

VIN: VSSZZZ7NZMV506295



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Alhambra 1.4 TSI S&S DSG OPF XCELLENCE	
Vehicle Identification number	VSSZZZ7NZMV506295
Mileage (Read)	84,792 km
First registration	1 Jul 2021
Number of holders	1
Next periodical technical inspection	07/2026
(Report on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,395 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Reflex Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	
Last service on / at	01/2026 at 81,767 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD015066
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	7593 / AFG 00104		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 98H	Summer tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Equipment

- Klimaautomatik

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Storage compartments • Airbag: Driver's side knee airbag system • Airbag: Side airbag for driver and front passenger • Exterior mirror housings in body color • Outdoor temperature display • LED turn signals integrated into the side of the exterior mirrors • Roof rails in silver • Electronic Stability Program (ESP) with counter-steering support • Electric windows front and rear • Luggage compartment floor • Transmission: 6-speed DSG • Heated rear window • Interior lights front and rear with delayed shut-off • Instrument lighting • ISOFIX child seat restraint system, triple in the 2nd row of seats • Comfort turn signals • Rear headrests (3) • Steering column with height and reach adjustment • Illuminated makeup mirrors in the sun visors • Multifunction display with color screen • Navigation system • Otto particulate filter • Package: Smoker's Package • Radio accessories: Digital radio reception DAB+ • Tire pressure monitoring system • Rear view camera • Headlight cleaning system • Keyless locking and starting system Kessy • Power steering • Seat belts: 3 three-point automatic in the rear • Seats: 3 individual seats in the 2nd row • Seats: Front passenger seat backrest can be folded down completely • Seats: Front seats with height adjustment and lumbar support • Start-stop system with brake energy recuperation • Daytime running light • Blind spot assist • Ultrasonic parking aid, front and rear • Traffic sign recognition • Lashing eyes in the luggage compartment • Warning light for unclosed doors and luggage compartment • Central locking including tailgate with remote control | <ul style="list-style-type: none"> • Driver and passenger side airbags • Airbag: Head airbag system for front and rear passengers • Electrically adjustable, heated and folding exterior mirrors with ambient lighting, • Lighting • third brake light • Chrome interior applications • Electronic parking brake • Automatic headlight control • Chassis: Sport chassis • Luggage compartment cover • Cruise control system • LED taillights • rear window wiper • Interior mirror automatically dimming • Use of instruments • Electric child safety lock for the rear doors • "Climatronic" air conditioning system with 3 climate zones • Front headrests (2) are height adjustable • Steering wheel: Three-spoke leather steering wheel with multifunction controls • Front center armrest with storage box • Fatigue detection • Fog lights with cornering light function • Package: Chrome Package • Upholstery: Cloth • Rain sensor • Wheels: Alloy wheels (4) 7 J x 17 "Dynamic II" • Side and rear windows with heat-insulating glazing • Sliding doors at the rear left and right • Side windows from the 2nd row of seats and rear window are dark tinted. • Seat belts: Three-point automatic front belts, height-adjustable • Seats: Driver's seat with electric backrest adjustment • Seats: Sport comfort seats in the front • Sunshade roller blind on the rear door windows • Lane departure warning system • 12V socket • Bag hooks in the luggage compartment • Front door sill trims • Front Assist area monitoring system with City Emergency Braking function • Automatic hazard warning lights during emergency braking • Electronic immobilizer • Xenon lights: Bi-xenon with cornering lights |
|--|---|



Extra equipment

- Paint finish: Metallic paint
- Package: Business COMFORT (Automatic distance control - High beam assist - External antenna connection in the storage compartment of the center armrest - DAB+ - Full Link - Android Auto - Apple CarPlay - Anti-theft alarm system with interior monitoring including backup horn and tow-away protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Interior	Sun visor - left side (Halterung) - Broken / torn - Replace
2	Misc.	Main inspection - Due - Replace
3	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
4	Bonnet	Bonnet - Stone chips - Paint
5	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Sliding door, right	Sliding door - Abrasion - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book

Trim / covers - Cargo area - lining -left side (Halterung erneuern)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 14 Sept 2021	10.733,65 €

Repainting

No. Repainting

- 1 Roof rail - right side, Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - right side	223 µm	Side panel - rear right side	226 µm
------------------------	--------	------------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

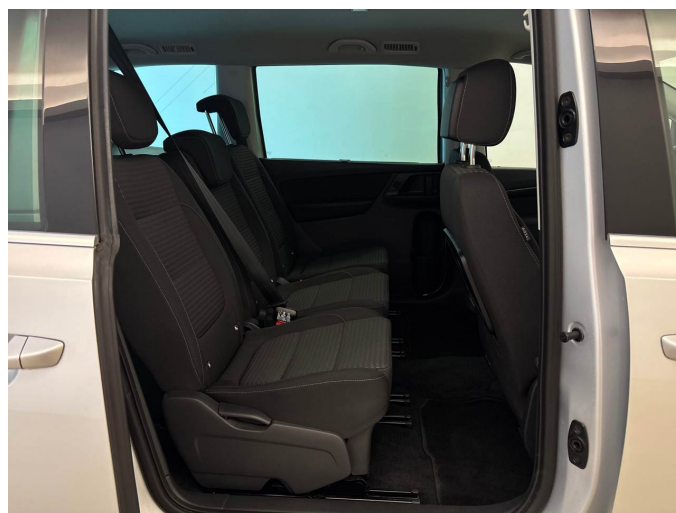


Figure 6: Interior - rear

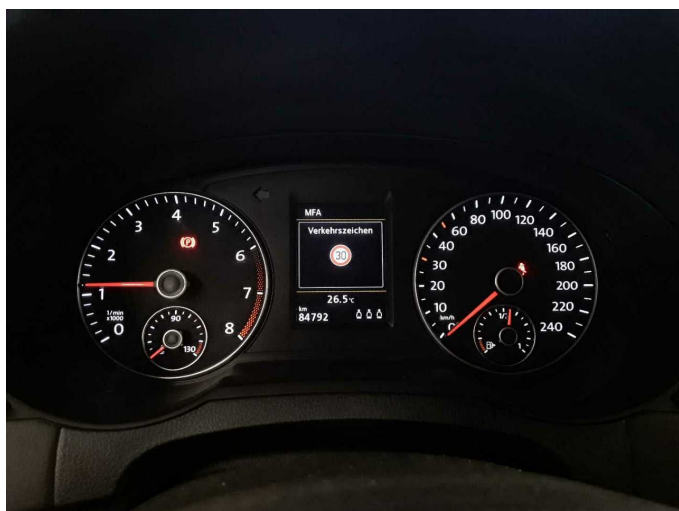


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

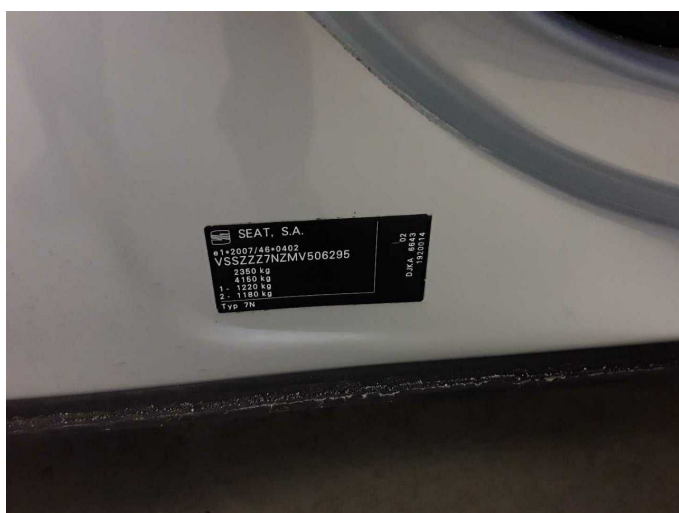


Figure 11: VIN



Figure 12: Mounted tyres

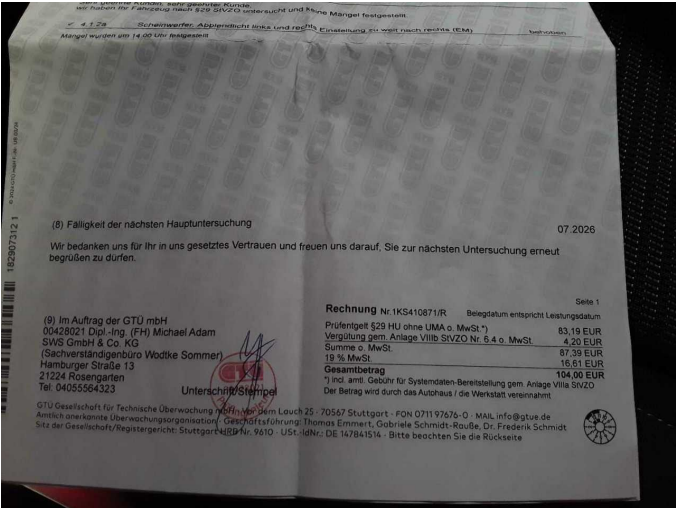


Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

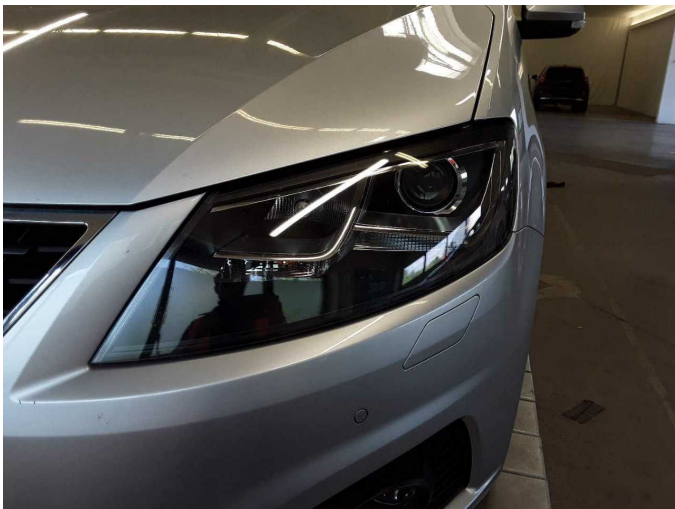


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


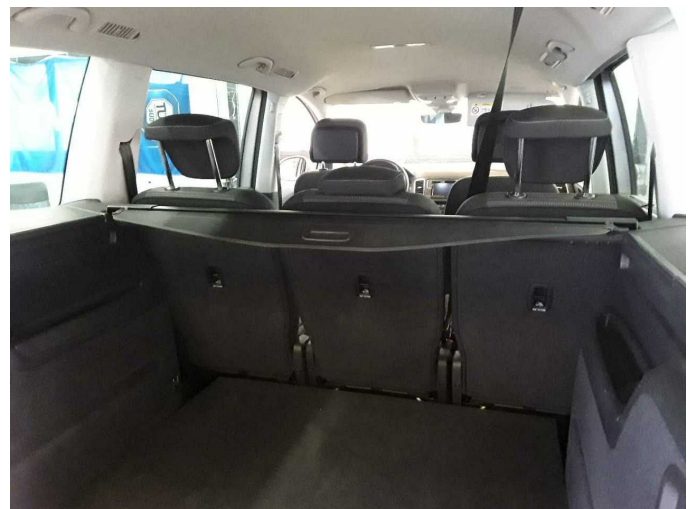



Figure 30: Misc.




Figure 31: Misc.

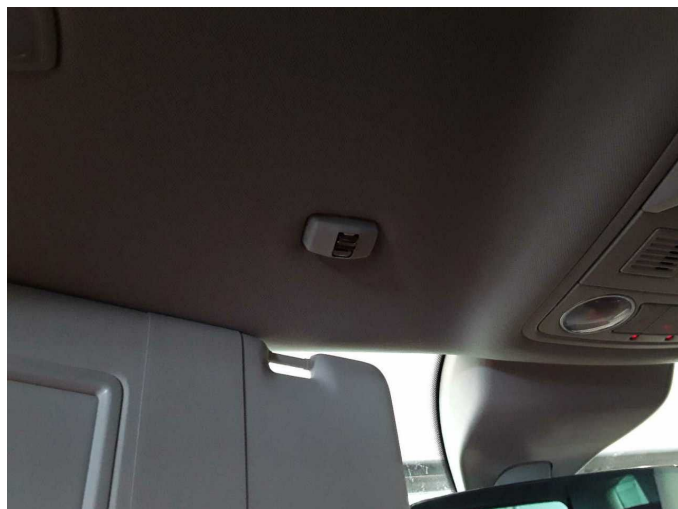

Damage 1: Interior: Sun visor - left side (Halterung) - Broken / torn - Replace

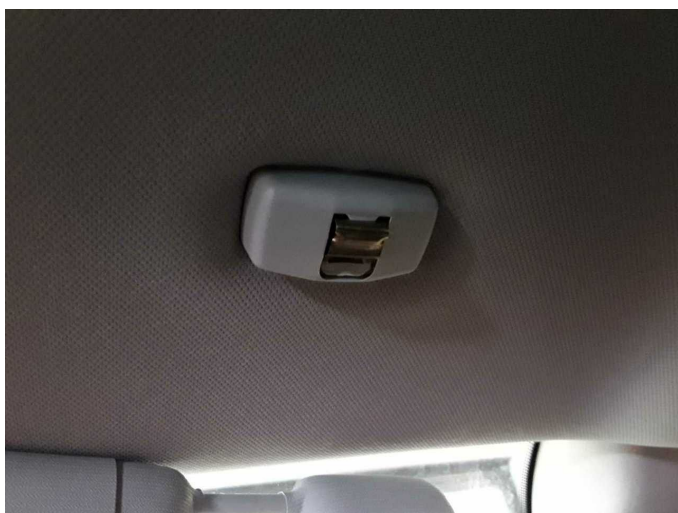

Damage 1: Interior: Sun visor - left side (Halterung) - Broken / torn - Replace

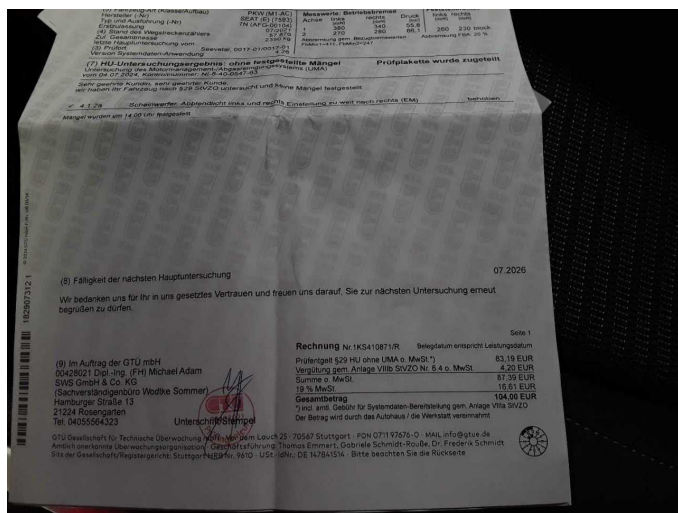


Damage 2: Misc.: Main inspection - Due - Replace



Damage 3: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

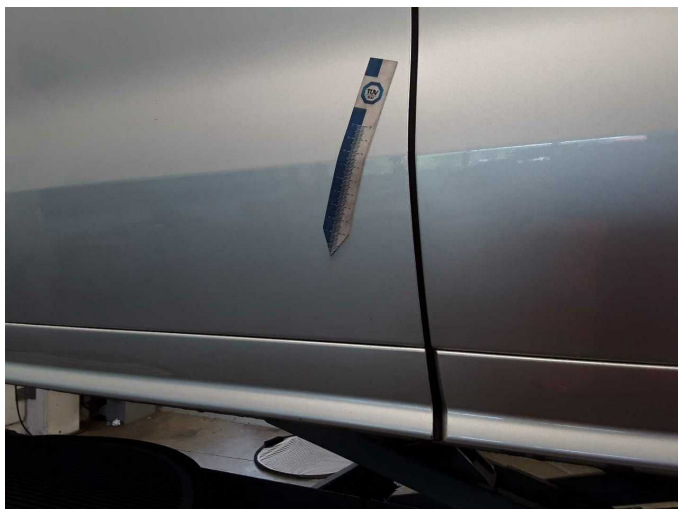

Damage 3: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 3: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 4: Bonnet: Bonnet - Stone chips - Paint



Damage 4: Bonnet: Bonnet - Stone chips - Paint

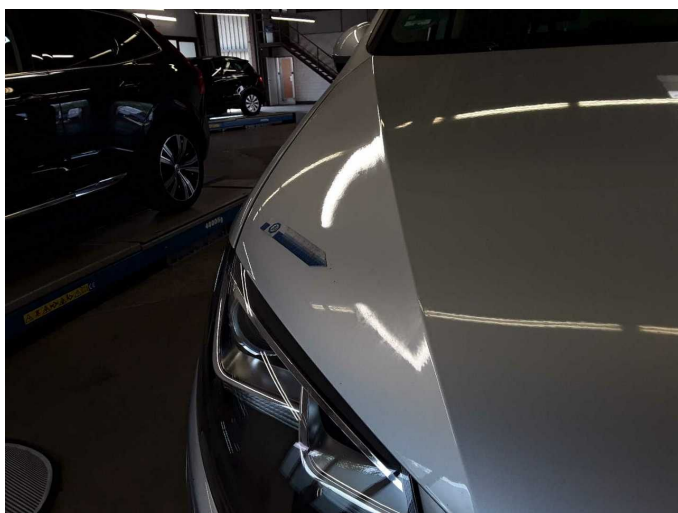

Damage 4: Bonnet: Bonnet - Stone chips - Paint




Damage 4: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint

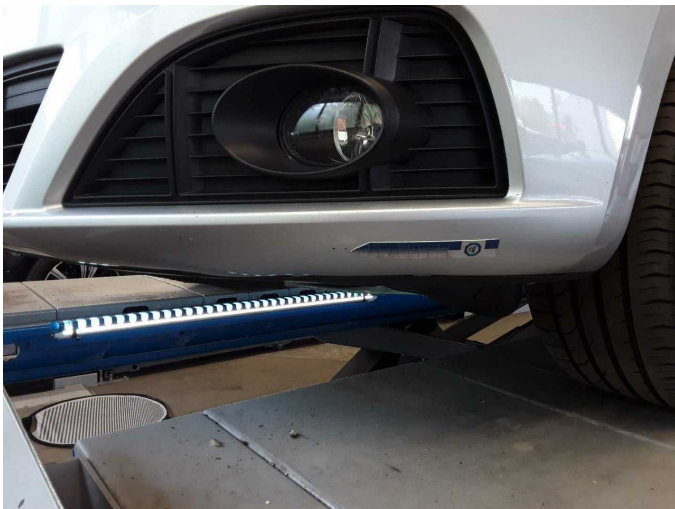


Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Wear and tear 1: Sliding door, right: Sliding door - Abrasion - No deduction

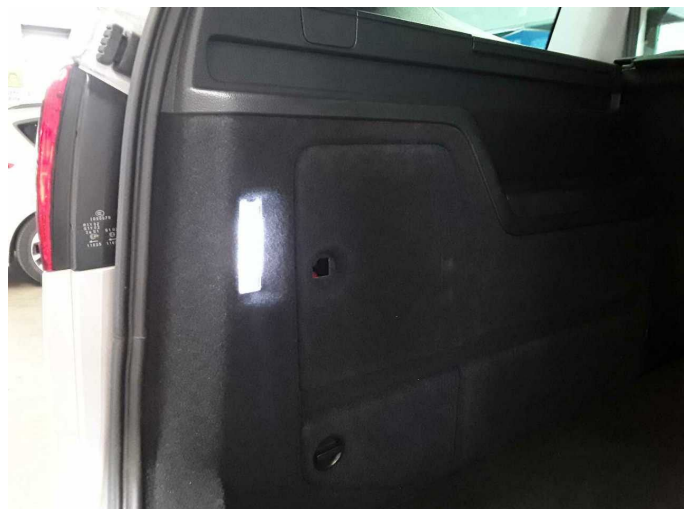


Missing part 2: Trim / covers: Cargo area - lining -left side (Halterung erneuern) - Missing - Replace



Missing part 2: Trim / covers: Cargo area - lining -left side (Halterung erneuern) - Missing - Replace



Roof rail - right side: 223 µm

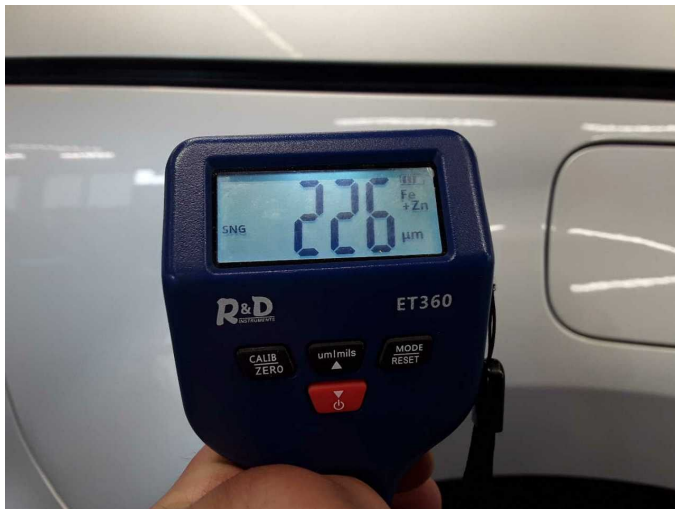

Side panel - rear right side: 226 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZ7NZMV506295

Hersteller / Modell: SEAT SEAT Alhambra 1.4 TSI S&S DSG OPF XCELLENCE

Datum	KM-Stand	Beschreibung
28.01.2026	81.767	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges; Wartung Sonstiges
28.01.2025	67.166	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
04.07.2024	57.876	AU; Wartung Sonstiges
22.01.2024	46.053	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.12.2022	30.648	Motoröl b. Wartung; Regelwartungsdienst