



Expertise

Protocol number: 46545629
Order No. / Reference: 26539771
Inspection date: 16 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.0 EcoBoost Hybrid COOL&CONNECT

VIN: WF0PXXGCHPMK02940



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.0 EcoBoost Hybrid COOL&CONNECT	
Vehicle Identification number	WF0PXXGCHPMK02940
Mileage (Read)	102,652 km
First registration	8 Feb 2022
Number of holders	1
Power / Engine displacement	92 kw / 999 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Race Rot
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	92 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH386674
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUC 00110		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,940 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	All-season tyres on Light alloy	Bridgestone	3mm / 3mm
2)	205/60 R16 96H	All-season tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R16 96M	Summer tyres on Steel	Hankook	5 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires
- Fabric headliner
- Roof spoiler painted in car color
- Electronic Safety and Stability Program (ESP)
- Driving mode switch, selective
- Electric windows front and rear
- Ford Easy Fuel
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot
- Speed limiter
- Transmission: 6-speed manual transmission
- Back window, heater
- Interior lighting with LED technology
- Intelligent security system
- air conditioning, manual
- Paint finish: Solid
- Leather gear knob
- Adjustable steering column
- Center console "Premium" front
- Navigation: Ford Navigation, Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+
- Otto particulate filter
- Pollen filter and dust filter
- Post-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Headlight assistant with day/night sensor
- Seats: Passenger seat, 2-way adjustable
- Seats: Map grid on the driver's and front passenger's seat backrests
- Start-stop system
- Carpet floor mats in the front
- Black trim around the side windows
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Central/Double Locking

Extra equipment

- Cargo area tray mat
- rear floor mats
- Sani combination bag
- Spare wheel: Emergency wheel (when in use, a maximum speed of 80 km/h is permitted.)
- Tires: 4 all-season tires instead of summer tires

- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Mounting points behind the second row of seats
- Chrome decor
- Roof rails, aluminum
- Tachometer
- Driver information system
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto-hold function
- Ford ECO-Coach
- Luggage compartment lighting
- Luggage compartment floor, adjustable in two ways
- Cruise control
- Illuminated glove compartment
- rear window wiper
- Instrument lighting, adjustable
- Isofix bracket
- Headrests: 2 front and 3 rear, height adjustable
- LED daytime running lights
- Steering wheel: 3-spoke design
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Front and rear parking pilot system
- Upholstery: Cloth
- Pre-Collision Assist
- Rear view camera
- Electromechanical power steering
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Child safety lock on the rear doors, manual
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Heat-insulating glazing, tinted

- Package: Technology (Cool&Connect) (Intelligent Adaptive Cruise Control (iACC) with traffic sign recognition - Wrong-way driver warning - Evasive Steering Assist (ESA) - High Beam Assist (in conjunction with intelligent LED headlights with glare-free high beam assist) - Driver alert system - Rain-sensing wipers with variable sensitivity - Auto-dimming rearview mirror - Headlights with delayed shut-off - Distance indicator and distance warning)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Wheel / tyres	Alloy rim - front right side - Scratched - Smart repair
3	Wheel / tyres	Alloy rim - rear left side - Scratched - Smart repair
4	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
5	Door - front left side	Door (Dichtung) - Damaged - Replace
6	Wheel / tyres	Tyre - front - Does not meet the leasing specifications - Replace
7	Front bumper	Spoiler - Damaged - Replace
8	Bonnet	Radiator grille (inkl PDC links) - Damaged - Replace
9	Rear bumper	Rear bumper - Scratched - Paint
10	Front bumper	Front bumper - Damaged - Paint
11	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

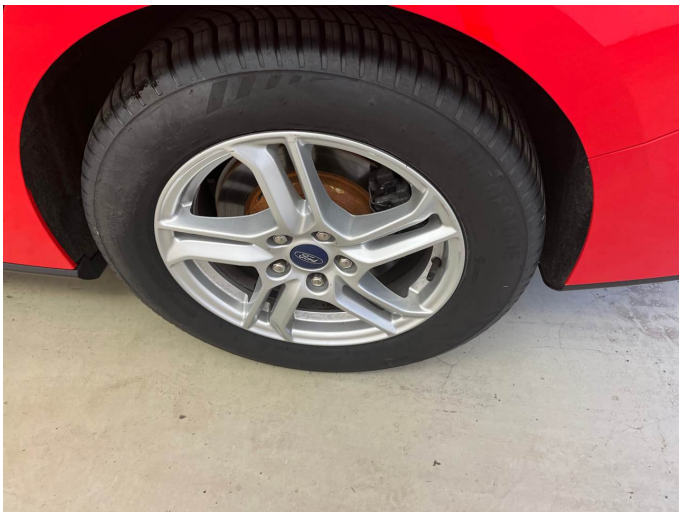


Figure 12: Mounted tyres

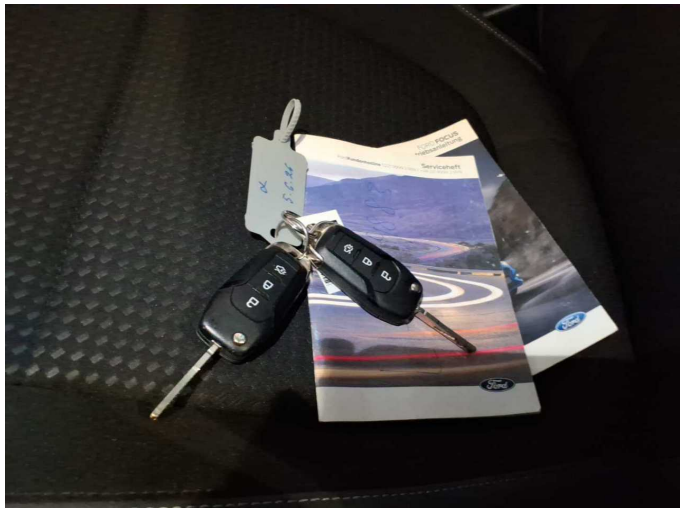


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.

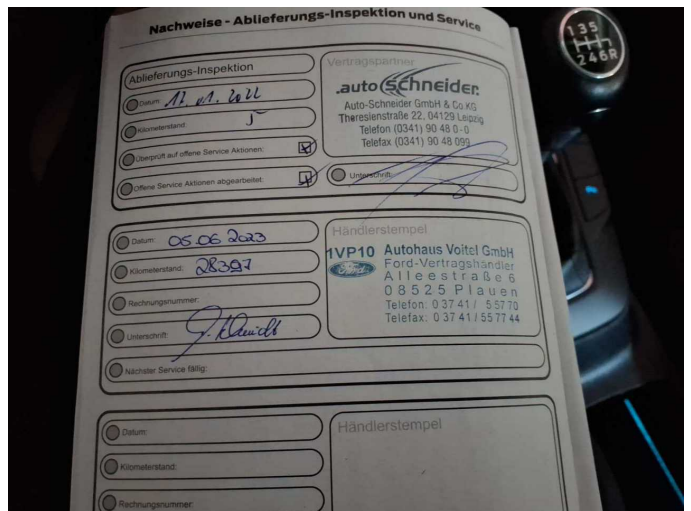


Figure 16: Misc.

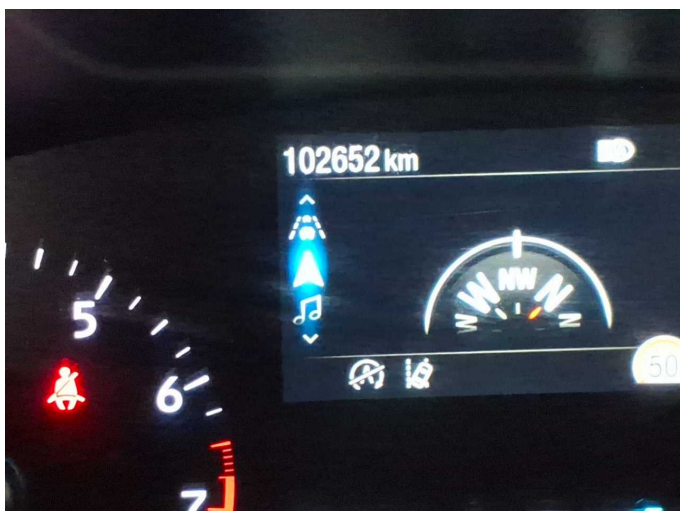


Figure 17: Misc.



Figure 18: Misc.

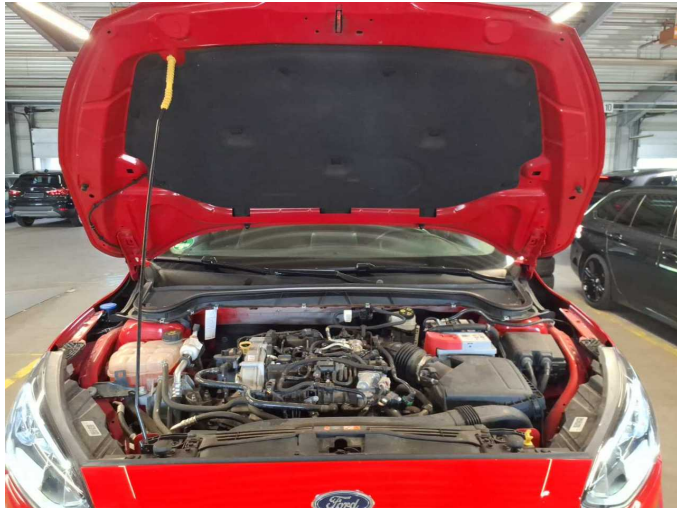


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

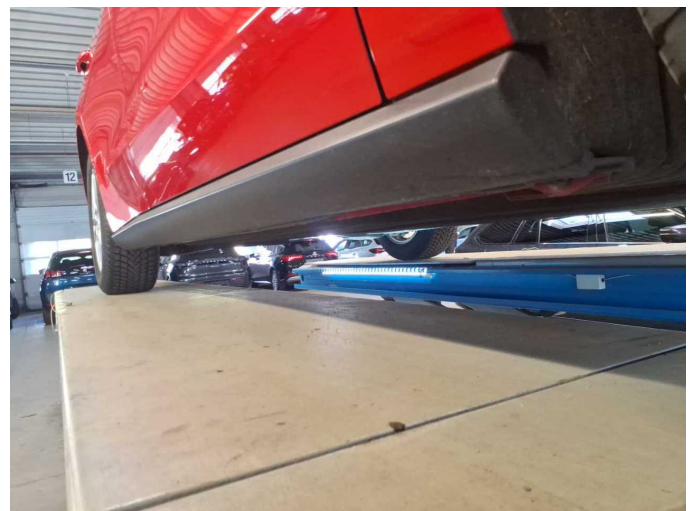


Figure 22: Misc.




Figure 23: Misc.



Damage 1: Roof: Roof - dent(s) - Smooth repair work



Damage 1: Roof: Roof - dent(s) - Smooth repair work

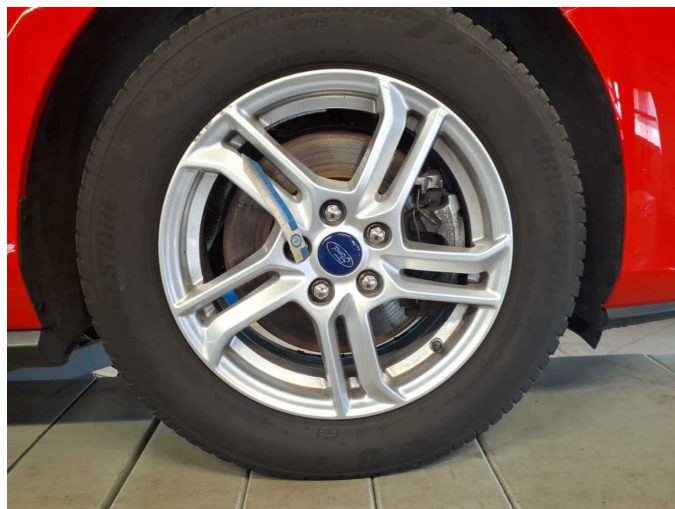

Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratched - Smart repair




Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratched - Smart repair




Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratched - Smart repair



Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

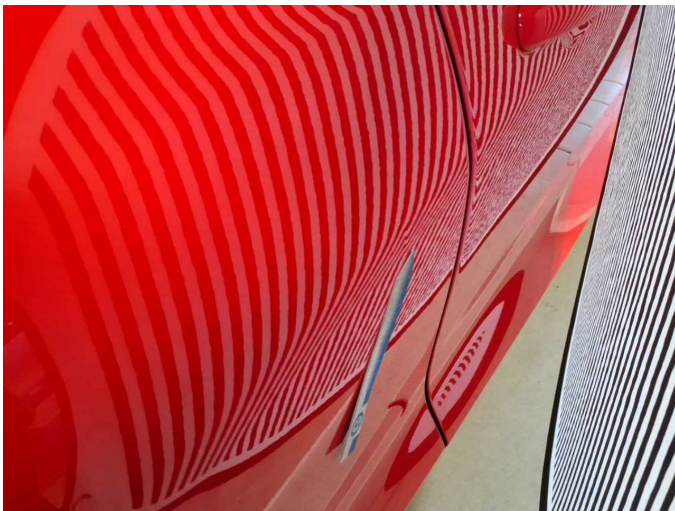


Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

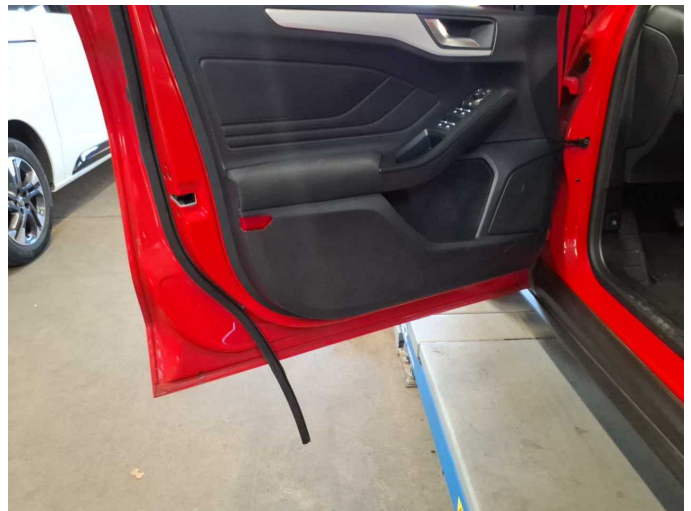

Damage 5: Door - front left side: Door (Dichtung) - Damaged - Replace




Damage 5: Door - front left side: Door (Dichtung) - Damaged - Replace

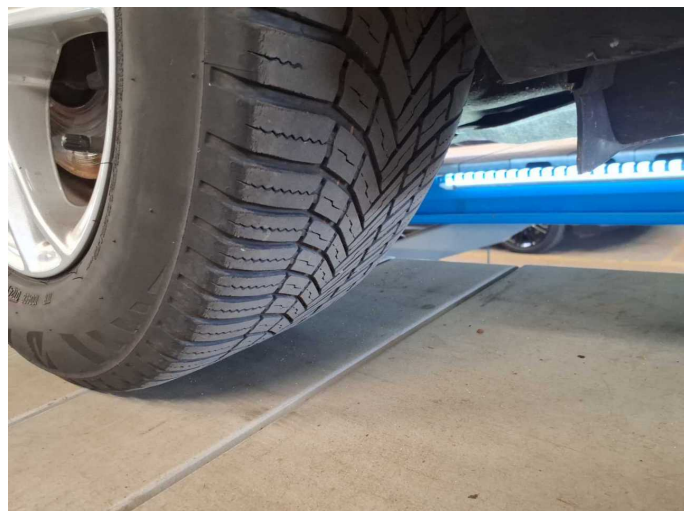


Damage 6: Wheel / tyres: Tyre - front - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - front - Does not meet the leasing specifications - Replace

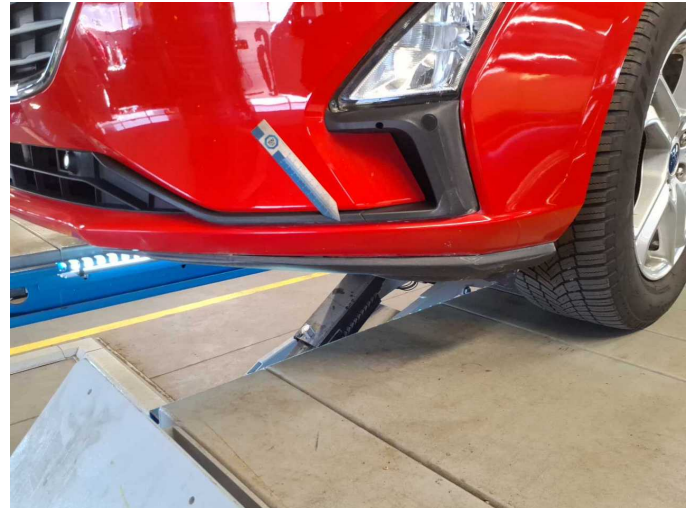


Damage 7: Front bumper: Spoiler - Damaged - Replace

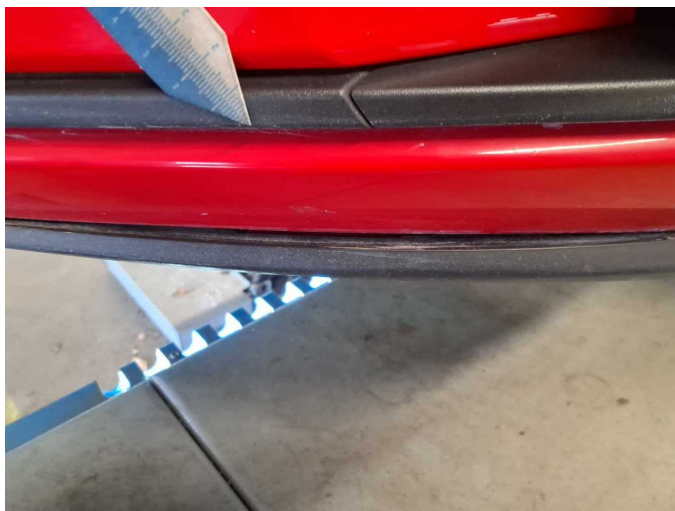


Damage 7: Front bumper: Spoiler - Damaged - Replace



Damage 7: Front bumper: Spoiler - Damaged - Replace

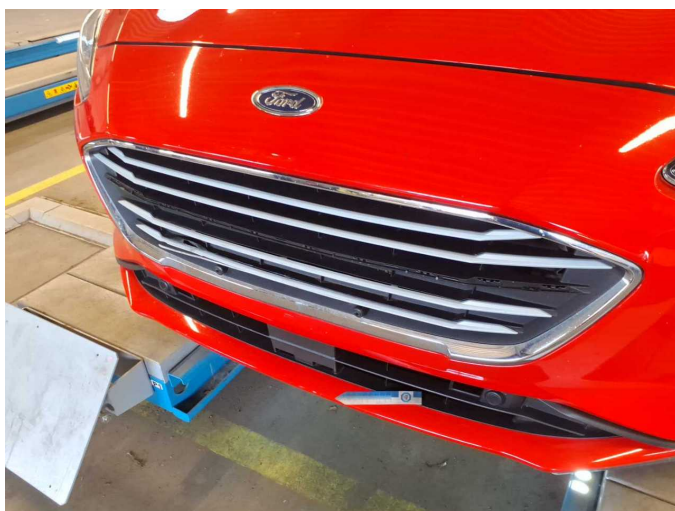

Damage 8: Bonnet: Radiator grille (inkl PDC links) - Damaged - Replace

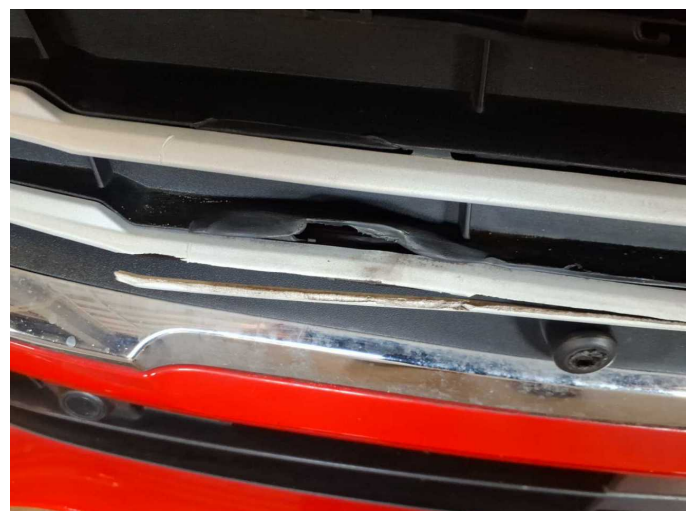

Damage 8: Bonnet: Radiator grille (inkl PDC links) - Damaged - Replace



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 10: Front bumper: Front bumper - Damaged - Paint



Damage 10: Front bumper: Front bumper - Damaged - Paint




Damage 10: Front bumper: Front bumper - Damaged - Paint



Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

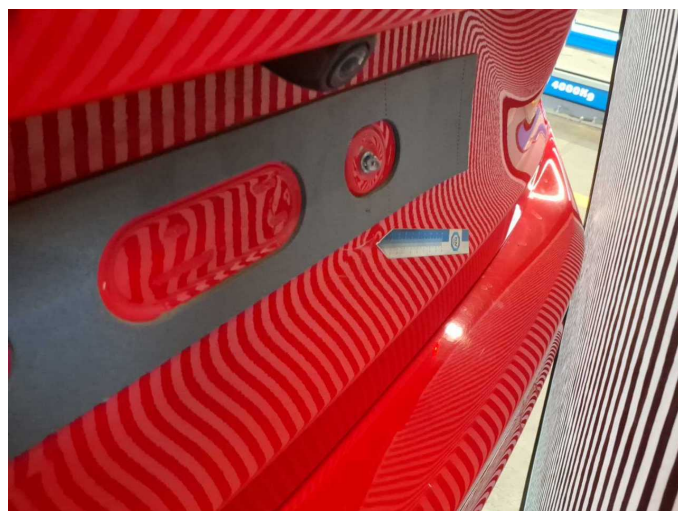

Damage 11: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint