



Expertise

Protocol number: 46541856
Order No. / Reference: 26657046
Inspection date: 15 Jul 2026

Manufacturer: Nissan

Model: Navara DC 4x4 Autm. N-Guard

VIN: VSKCTND23U0168980



Vehicle details	
Manufacturer / Type / Model / Equipment	
Nissan Navara DC 4x4 Autm. N-Guard	
Vehicle Identification number	VSKCTND23U0168980
Mileage (Read)	182,892 km
First registration	17 Dec 2021
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	140 kw / 2,298 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Pearl White
Doors / Seats	4 / 5
Upholstery type	Part leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,970 km
Last service on / at	07/2025 at 167,986 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX890216
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2228 / AAI 00002		
Emission standard	EURO6;WLTP;CI;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/60 R18 112H	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	255/60 R18 112H	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/60 R18 112H	Winter tyres on Light alloy	Nokian	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E				

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with electronic brake force distribution
- Driver's side airbag
- Airbag: Front head airbags
- All-wheel drive (switchable all-wheel drive with low-range gearing)
- Autonomous emergency braking assistant
- Outdoor temperature display
- Hill Descent Assist
- Electronic limited-slip differential (eLSD)
- Tachometer
- Rear parking assist (4 sensors)
- Driver information system with 5" color display
- Windows: dark tinted windows from the B-pillar back
- electric front windows
- Cruise control system and speed limiter
- Electric glass sunroof
- Interior mirror, automatically dimming
- Front headrests (2)
- Paint finish: Metallic
- Loading tray coating
- Steering wheel remote control for audio system
- Multi-link rear suspension
- NISSAN Connect navigation system including AROUND VIEW MONITOR for 360° surround view (navigation system with 8" color touchscreen display including TMC (Traffic Message Channel) - DAB radio/CD player with MP3 playback and 6 speakers - USB interface, iPod gateway and Bluetooth audio streaming - Google Services - color reversing camera - smartphone integration - Bluetooth streaming - MapCare: 3 years of free map updates (valid from the date of first registration) - Apple CarPlay and Android Auto)
- Wheels: Alloy wheels 7J x 18 with 255/60 R 18
- Side running boards
- Seats: Driver's seat with lumbar support (electrically adjustable)
- Seats: Comfort seats in the front
- Seats: Heated front seats
- Rear bumper, chrome-plated, with step
- LED daytime running lights
- Lashing system with 3 rails and sliding lashing carriages
- Central locking with INTELLIGENT KEY (incl. start/stop button)
- Passenger airbag (can be deactivated)
- Airbag: Driver's knee airbag
- Airbag: Side airbags driver and passenger side
- Ambient lighting
- Towbar (13-pin)
- Electrically adjustable, heated and folding exterior mirrors (with integrated LED indicator - chrome-plated)
- Hill Start Assist
- Differential lock
- Third brake light
- ESP including trailer stability assist
- Automatic headlights with Friendly Lighting
- Electric rear windows
- Floor mats (N-GUARD Design)
- Transmission: 7-speed automatic transmission
- Back window, heater
- Automatic climate control, 2 zones
- Headrests (3), in the rear
- Paint finish: Pearl effect
- leather steering wheel
- rear air vents
- Center armrest, front, with storage compartment (armrests on the doors)
- Fog lights with chrome surround
- Package: N-Guard Package (Black exterior styling elements)
- Package: Optics (DC) (Roof rails - headlights, full LED - automatic headlight range control)
- Particulate filter: Soot particle filter for diesel engines
- Upholstery: Partial leather interior (with blue decorative stitching)
- Wheels: Spare wheel 16" steel rim
- Mud flaps front and rear
- Electric power steering
- Seats: Driver's seat, height adjustable
- Seats: Isofix child seat attachment points (on the outer rear seats)
- 12-volt socket, 3x
- Front bumper in body color
- Chrome-plated door handles and front grille
- Immobiliser

Extra equipment

- Differential lock



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	C-pillar - left side - Scratch(es) - Smart repair
2	Front bumper	Spoiler - Loose - Replace
3	Instrument panel	Air nozzle - centre (Hinten) - Broken / torn - Replace
4	Rear bumper	Rear bumper (Linke Blende) - Scratch(es) - Paint
5	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
6	Front bumper	Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Side panel - rear right side	Side panel - Scratch(es) - No deduction
4	Body	Body - Scratch(es) - No deduction
5	Body	Underbody - Corrosion - No deduction
6	2nd wheel set	2nd wheel set (2 Kompleträder fehlen 2x abgefahren) - No deduction
7	Seat - front	Seat cover - left side - Abrasion - No deduction
8	Boot lid / rear door	Boot lid - Dent / paintcoat damage - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Das Fahrzeug kann nicht ordnungsgemäß angehoben werden.

Das Fahrzeug weist der Laufzeit entsprechende Gebrauchsspuren auf.

Winterräder sind kein Bestandteil des Lieferumfangs

- Das Fahrzeug befand sich zum Besichtigungszeitpunkt in nicht fachgerecht reparierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

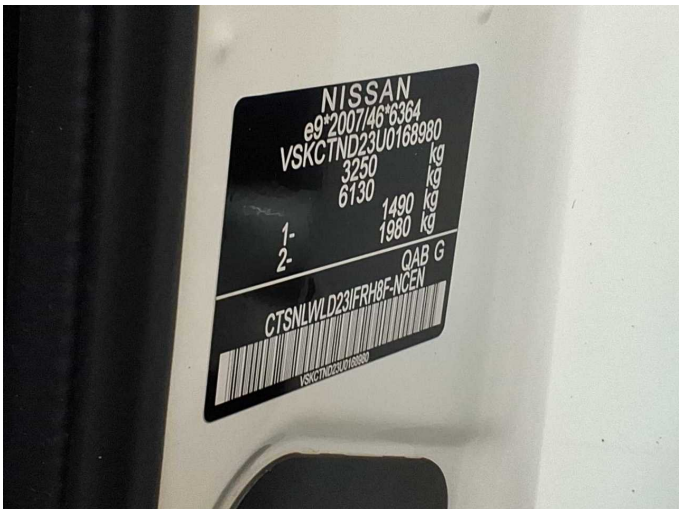


Figure 12: VIN



Figure 13: Mounted tyres

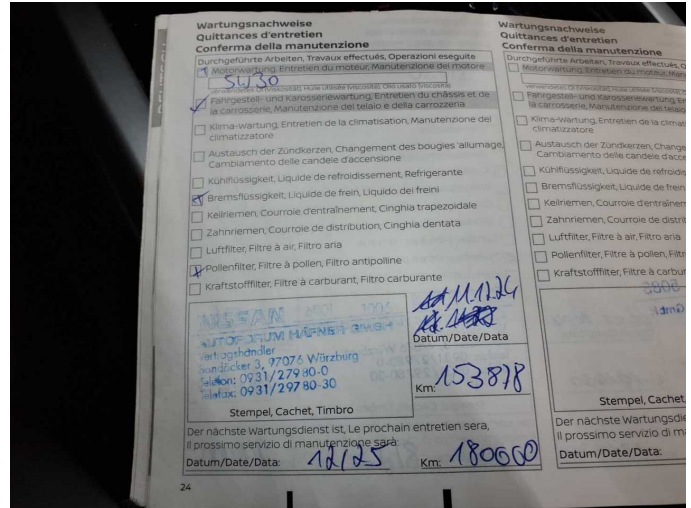


Figure 14: Documents

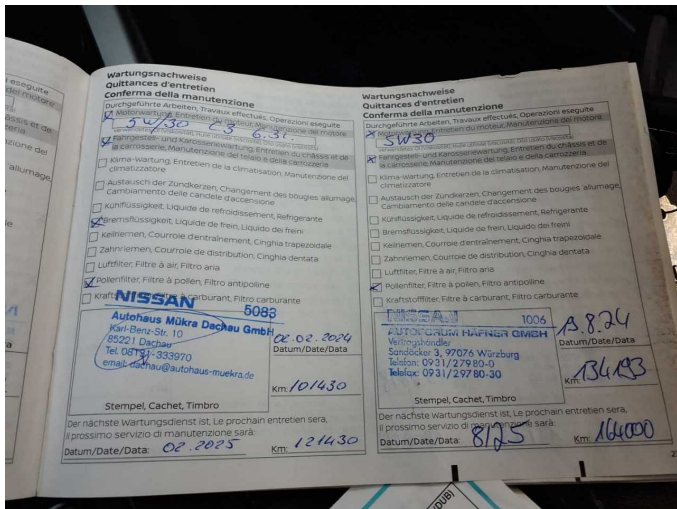


Figure 15: Documents

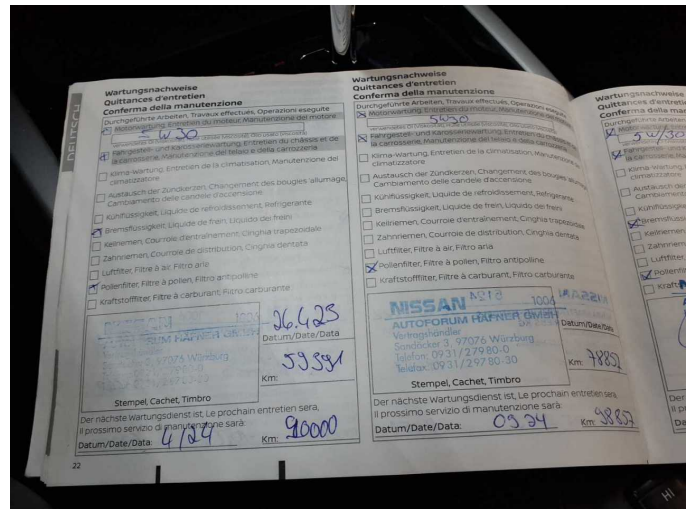


Figure 16: Documents

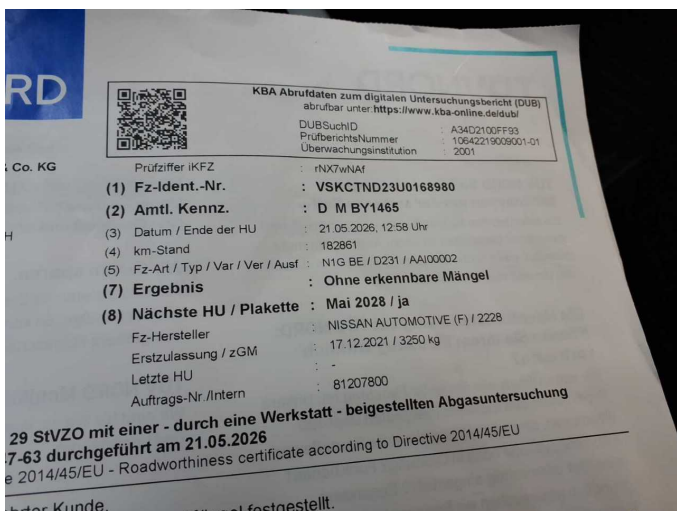


Figure 17: Documents

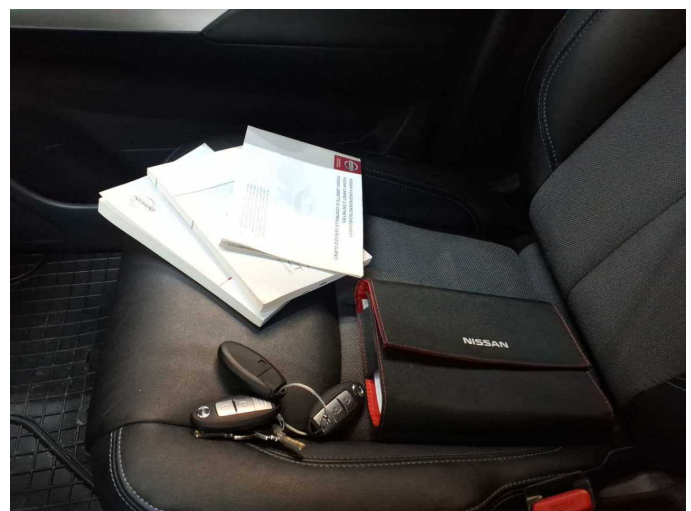


Figure 18: Documents



Figure 19: Documents



Figure 20: Additional tyres



Figure 21: Navigation

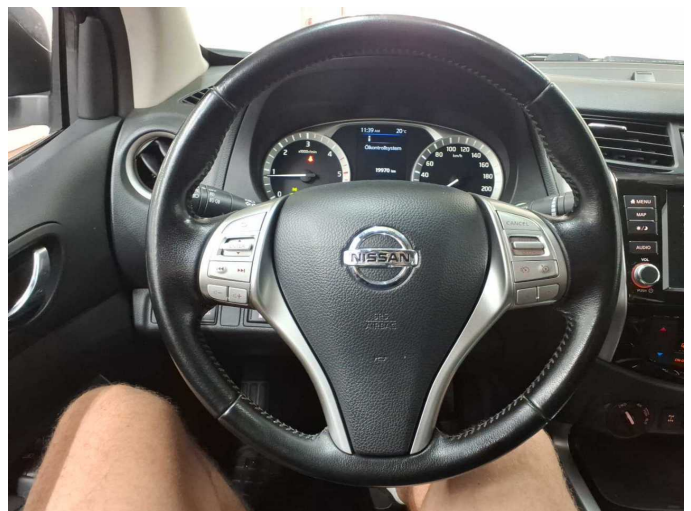


Figure 22: Misc.



Figure 23: Misc.

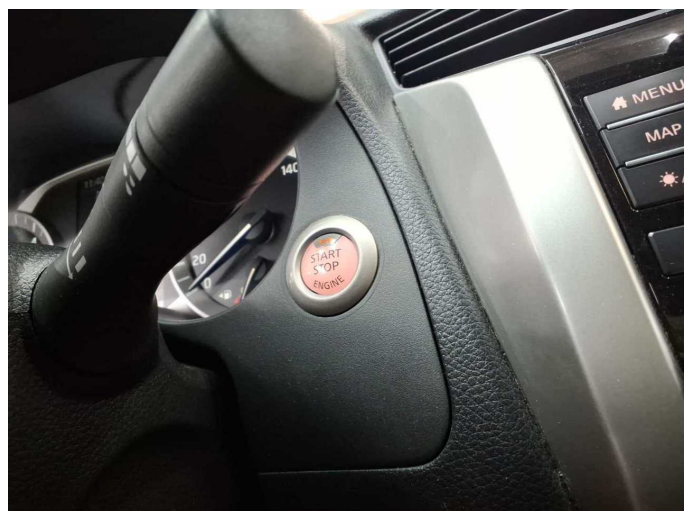


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

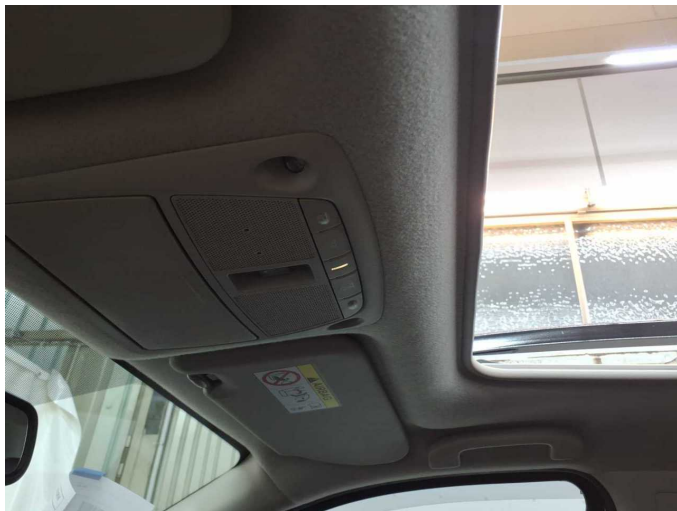


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

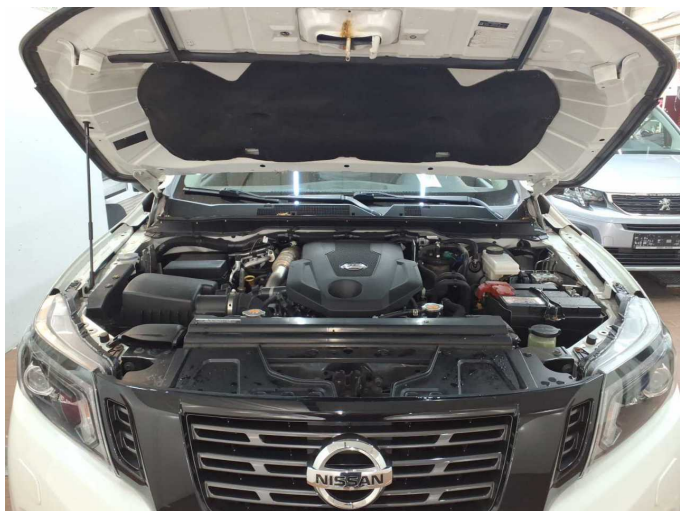


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.




Figure 37: Misc.



Damage 1: Body: C-pillar - left side - Scratch(es) - Smart repair



Damage 1: Body: C-pillar - left side - Scratch(es) - Smart repair

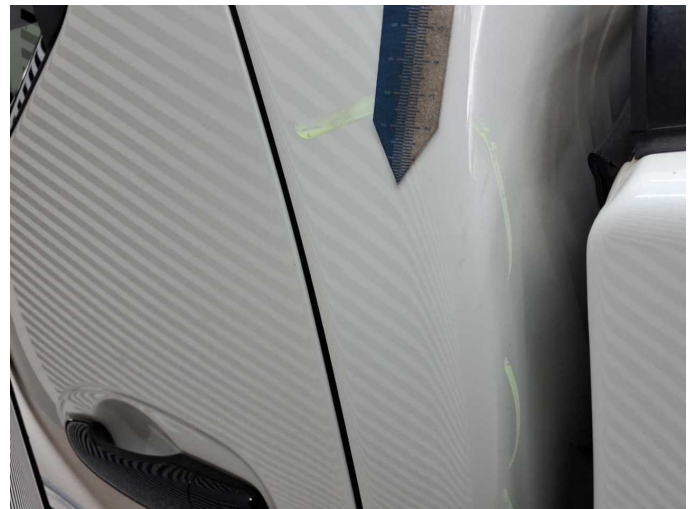

Damage 1: Body: C-pillar - left side - Scratch(es) - Smart repair




Damage 2: Front bumper: Spoiler - Loose - Replace



Damage 2: Front bumper: Spoiler - Loose - Replace



Damage 2: Front bumper: Spoiler - Loose - Replace

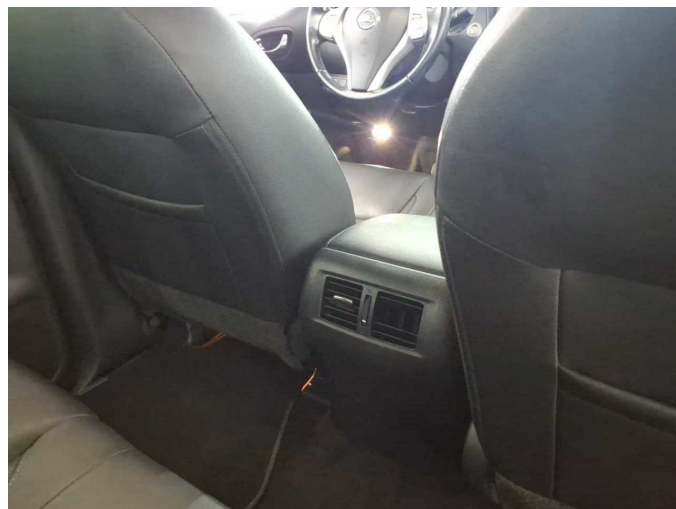

Damage 3: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 3: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 4: Rear bumper: Rear bumper (Linke Blende) - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper (Linke Blende) - Scratch(es) - Paint




Damage 4: Rear bumper: Rear bumper (Linke Blende) - Scratch(es) - Paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

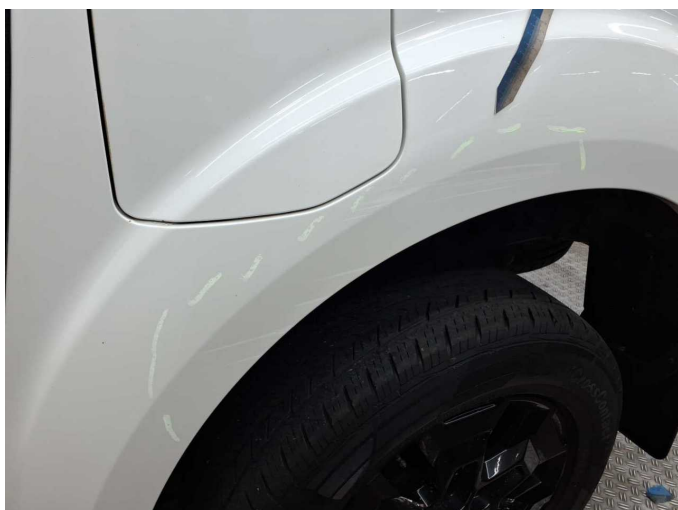

Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace



Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace



Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace




Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace



Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace



Damage 6: Front bumper: Front bumper (gerissen, schlecht lackiert, Fehlstellung) - Unprofessionally repaired - Replace

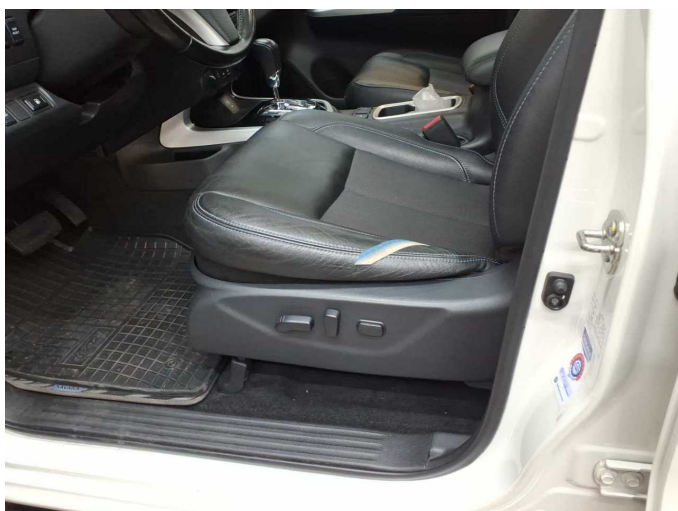

Wear and tear 7: Seat - front: Seat cover - left side - Abrasion - No deduction



Wear and tear 7: Seat - front: Seat cover - left side - Abrasion - No deduction



Wear and tear 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage -
No deduction



Wear and tear 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage -
No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSKCTND23U0168980

Hersteller / Modell: NISSAN NISSAN Navara DC 4x4 Autm. N-Guard

Datum	KM-Stand	Beschreibung
05.06.2026	182.545	AU; Systemtest/Eigendiagnose
16.07.2025	167.986	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.01.2025	0	Reparatur Sonstiges
11.12.2024	153.878	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst; Reparatur Sonstiges
29.08.2024	134.193	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
14.02.2024	101.430	Bremsflüssigkeit; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.09.2023	78.867	Motoröl b. Wartung; Regelwartungsdienst
02.05.2023	59.391	Motoröl b. Wartung; Regelwartungsdienst
20.10.2022	38.642	Motoröl b. Wartung; Regelwartungsdienst
30.05.2022	18.457	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst