



Expertise

Protocol number: 46635525
Order No. / Reference: 26733581
Inspection date: 15 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Business
VIN: W0VZT8GP3N1004616	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business	
Vehicle Identification number	W0VZT8GP3N1004616
Mileage (Read)	95,378 km
First registration	21 Jun 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Nautic Blau
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	98 %
Last service on / at	01/2023 at 18,886 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ650308
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00274		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Replacement

Type	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag: Front airbags and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Noise-reducing, laminated front side windows
- Speed controller
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests (height adjustable)
- LED headlights (automatic headlight range control)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid
- Upholstery: Billy fabric, black
- Radio: Digital radio reception DAB+
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Bumpers painted in body color
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Immobiliser
- Thermal insulation glazing, green tinted
- Central locking with remote control (and interior switches)
- Adaptive brake light
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Glasses compartment in the headliner
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Luggage compartment cover (extendable with comfort operation)
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces) (height adjustable)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - Heated ThermoTec windshield)
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Power steering (speed-dependent)
- Safety net (for installation behind the 1st or 2nd row of seats)
- Visibility equipment (rain sensor, front)
- Seats: Ergonomic active seat (AGR) driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Traffic sign assistant (recognition of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the recognized sign in the driver information display (depending on traffic sign quality, visibility and weather conditions).)



Extra equipment

- Upholstery: Alcantara trim, black including Winter Package 3 (Active Seat (AGR), front (length, height, backrest angle manual, seat angle electrically adjustable, lumbar support electro-pneumatic), Alcantara/ leatherette, side airbags, rear center armrest, rear cup holders and pass-through, rear seat with FlexFold, 40:20:40 split-folding, heated front/rear seats, heated leather steering wheel, heated ThermoTec windscreen, Seat Comfort Package 1 (driver's seat 8-way electrically adjustable, memory function for driver's seat and exterior mirrors, massage function for driver, exterior mirrors with ambient lighting, electrically adjustable, heated and folding), Charging Package (wireless charging, USB)
- Paint finish: Metallic
- Swiveling trailer hitch (including trailer stability program)
- Wheels: 8.5 J x 18 alloy wheels in high-gloss black (multi-spoke) (with 245/45 R 18 tires)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Documents	Service book (Unvollständig - Wartung 2025 fehlt)
2	Equipment	Tirefit filler - Expired - Replace
3	Trim / covers	Carpet - front left side - Burn hole (cigarettes) - Smart repair
4	Side panel - rear right side	Sill - Scratch(es) - Smart repair
5	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
6	Body	A-pillar - right side - Scratch(es) - Smart repair
7	Door - rear right side	Door - Scratch(es) - Smart repair
8	Wing mirror - right side	Cap - Scratch(es) - Paint
9	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Door - front right side	Door - Scratch(es) - Paint
12	Side panel - rear left side	Side panel - Dent / paintcoat damage - Paint
13	Vehicle glazing	Windscreen - Broken / torn - Replace
14	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
15	Front bumper	Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint
16	Side panel - rear right side	Side panel (Spachtel rissig) - Unprofessionally repaired - Repair and paint
17	Body	Body - Damage by hail - Repair



Wear and tear

No.	Component group	Description
-----	-----------------	-------------

1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
---	---------------	--

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

1	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent
---	---

Paint coat thickness measurement

Side panel - rear right side	178 µm
------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

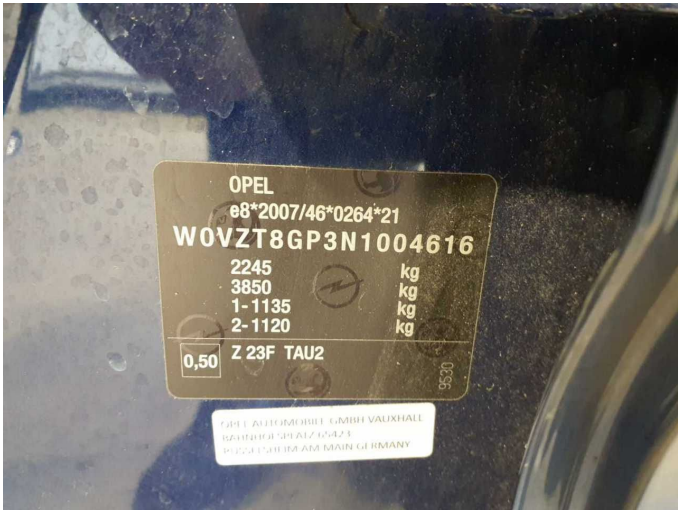


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

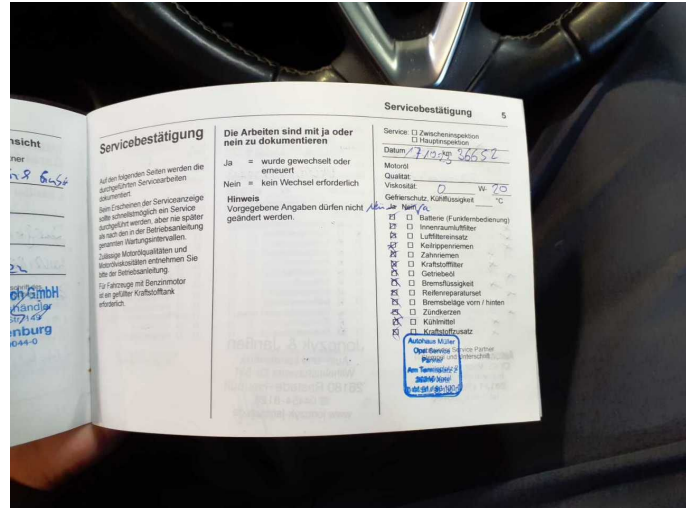


Figure 14: Documents

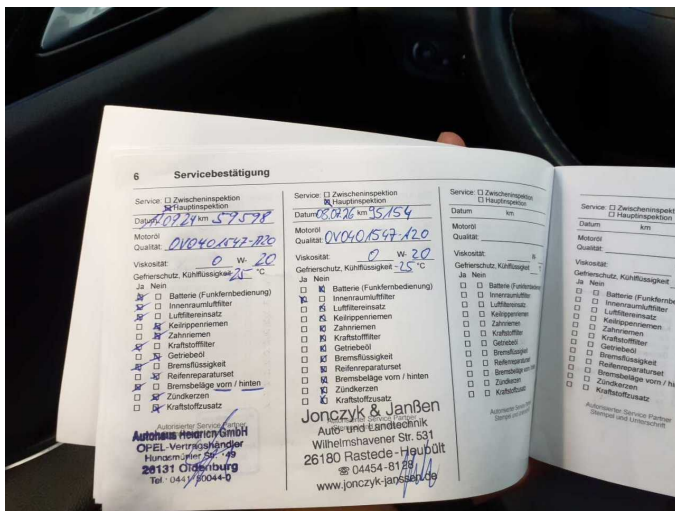


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.

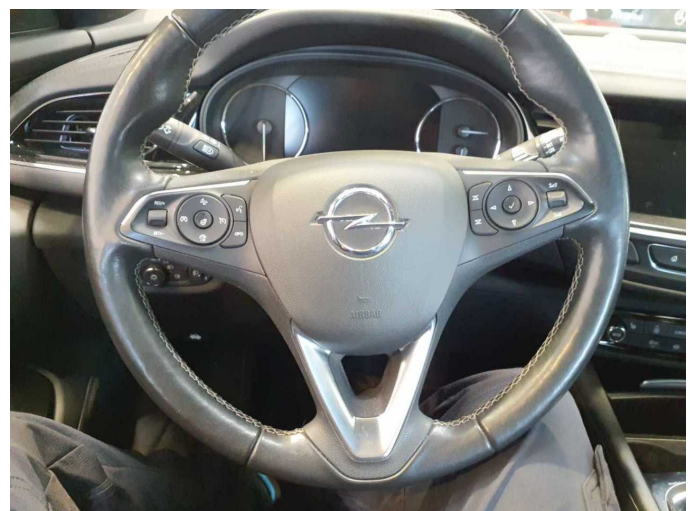


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

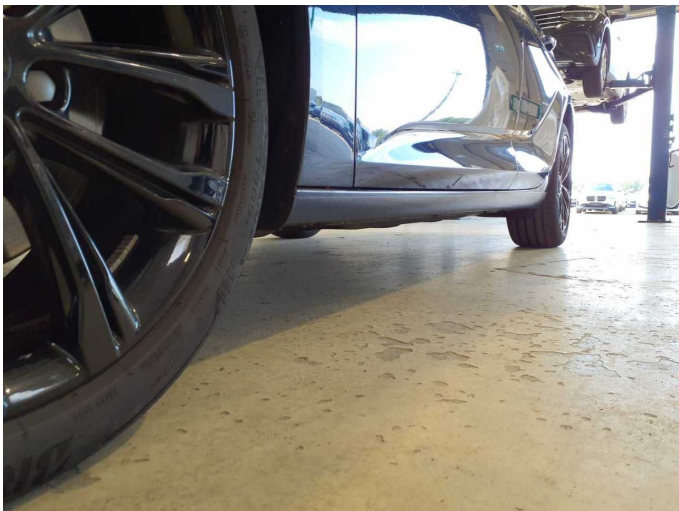


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.

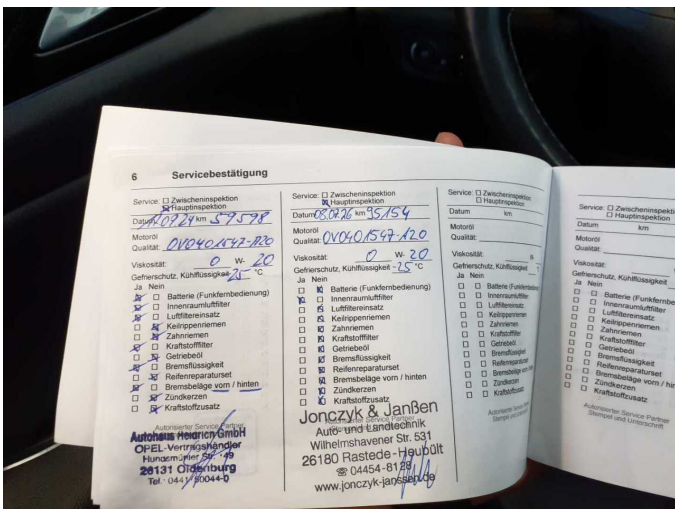


Damage 1: Documents: Service book (Unvollständig - Wartung 2025 fehlt)

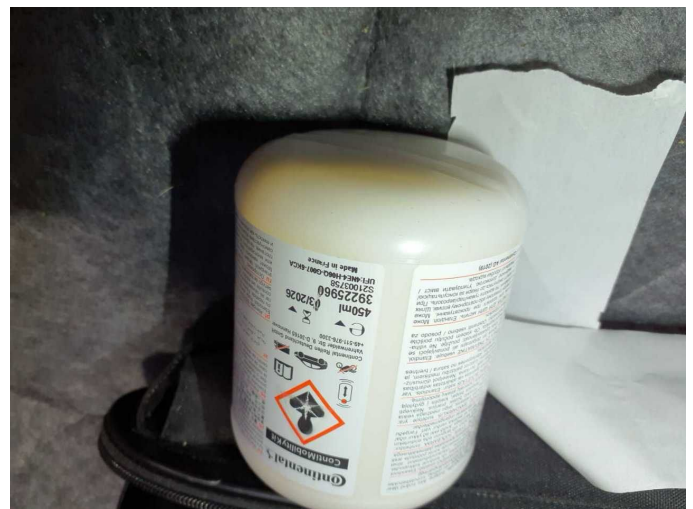


Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair

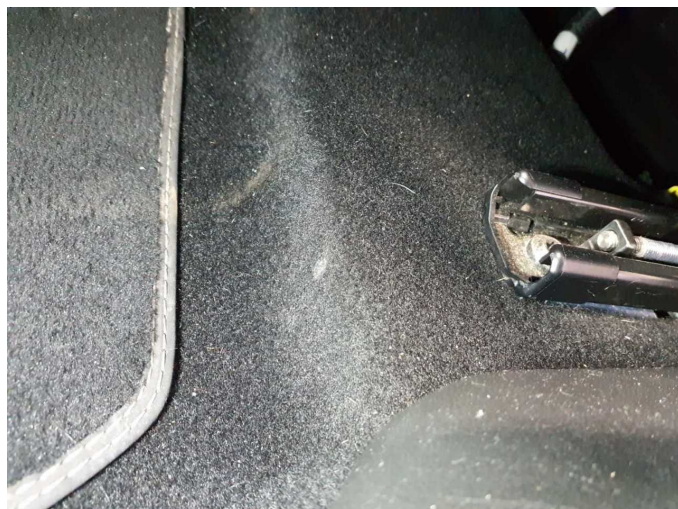

Damage 3: Trim / covers: Carpet - front left side - Burn hole (cigarettes) - Smart repair

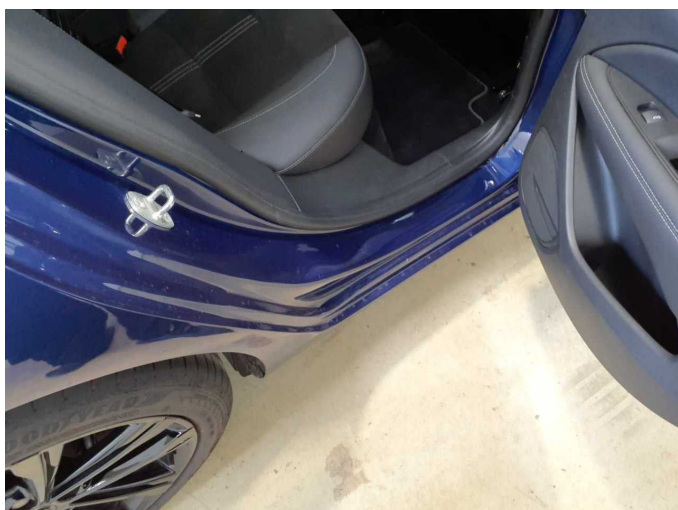


Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

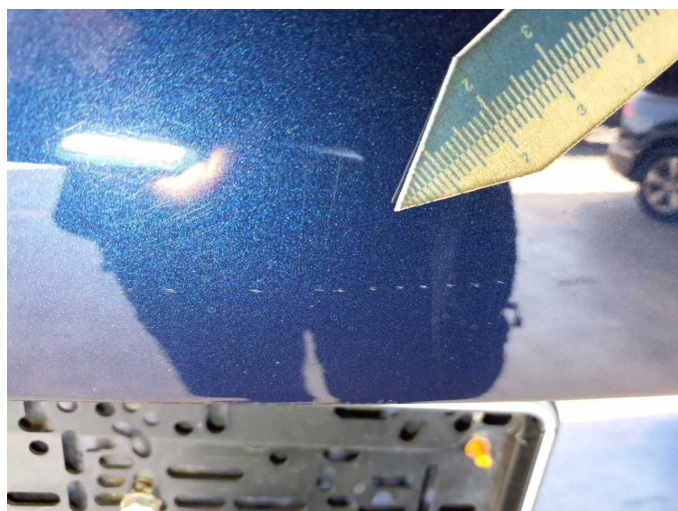


Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

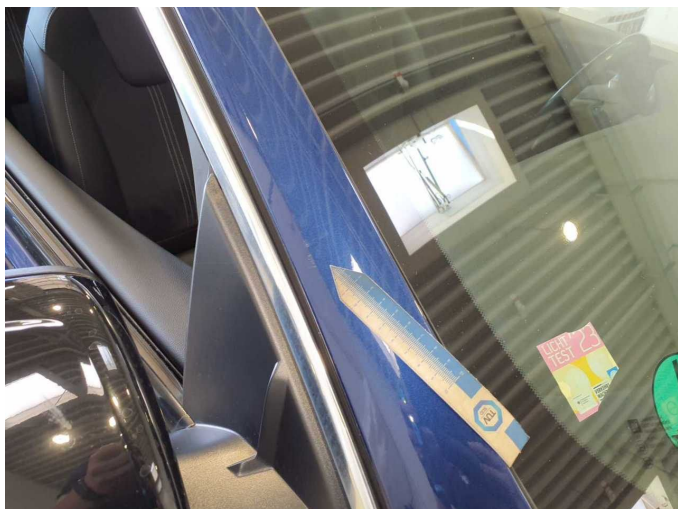


Damage 6: Body: A-pillar - right side - Scratch(es) - Smart repair




Damage 6: Body: A-pillar - right side - Scratch(es) - Smart repair

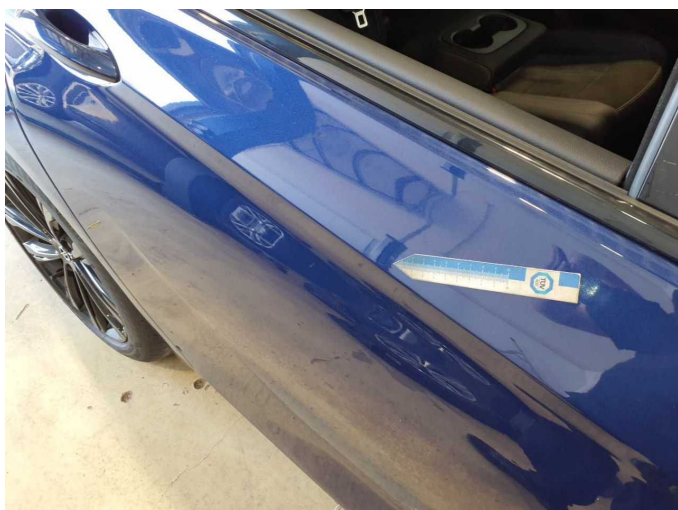

Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair

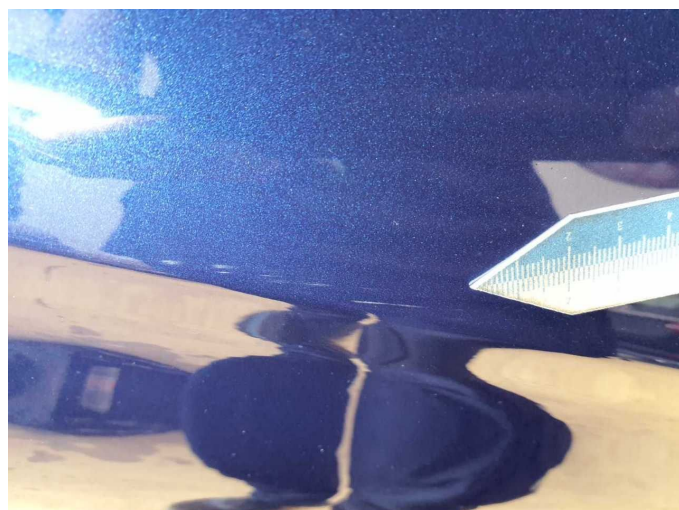

Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair

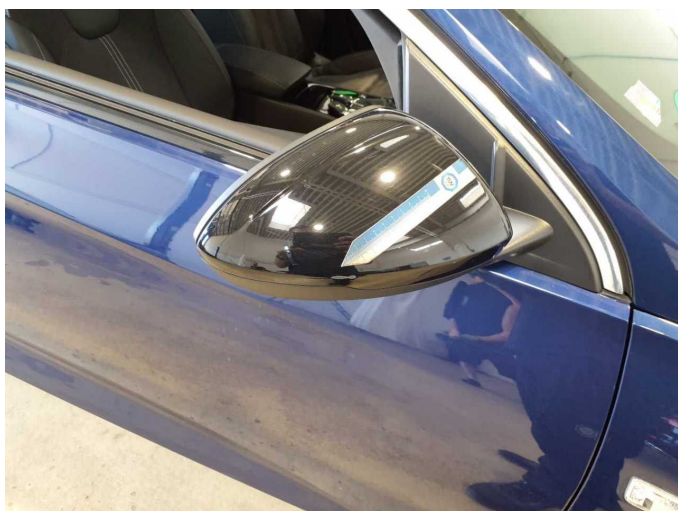

Damage 8: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 8: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 9: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace




Damage 9: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 9: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

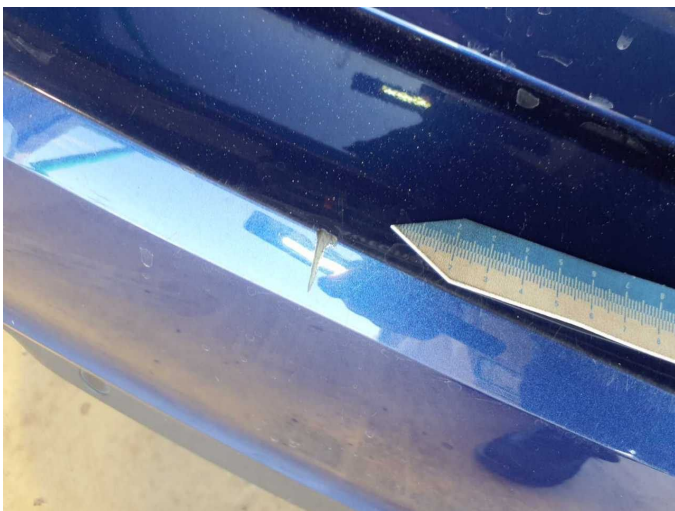

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Door - front right side: Door - Scratch(es) - Paint



Damage 11: Door - front right side: Door - Scratch(es) - Paint

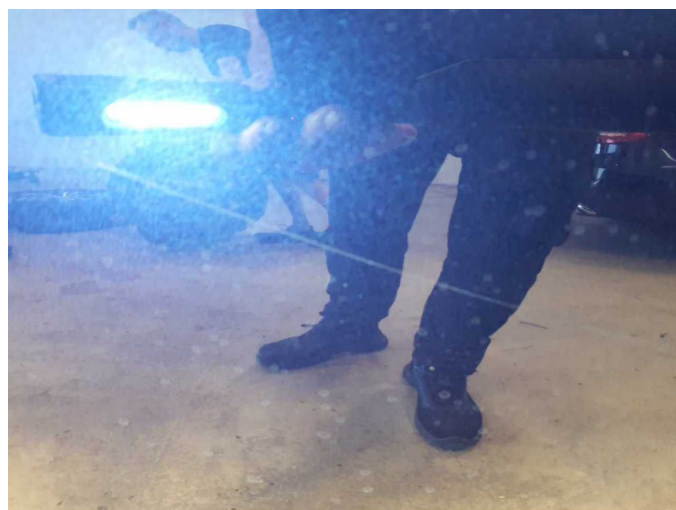

Damage 11: Door - front right side: Door - Scratch(es) - Paint

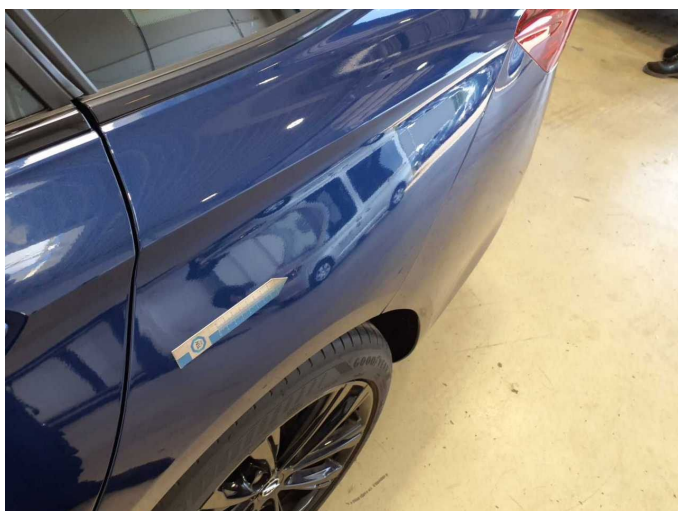


Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Paint



Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Paint



Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Paint

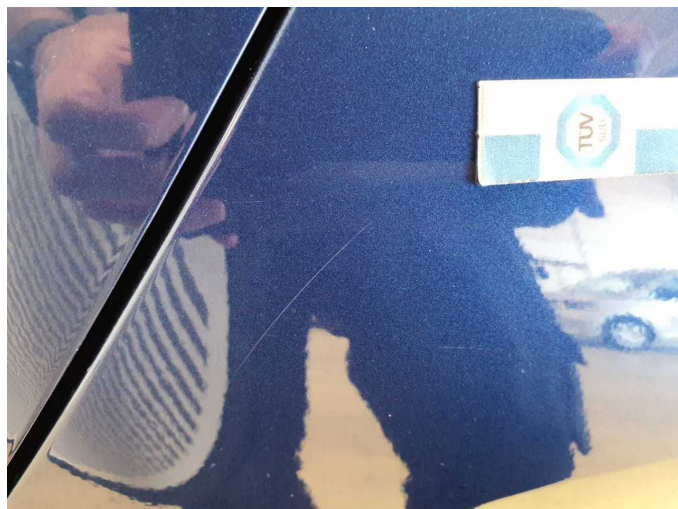


Damage 12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Paint



Damage 13: Vehicle glazing: Windscreen - Broken / torn - Replace




Damage 13: Vehicle glazing: Windscreen - Broken / torn - Replace

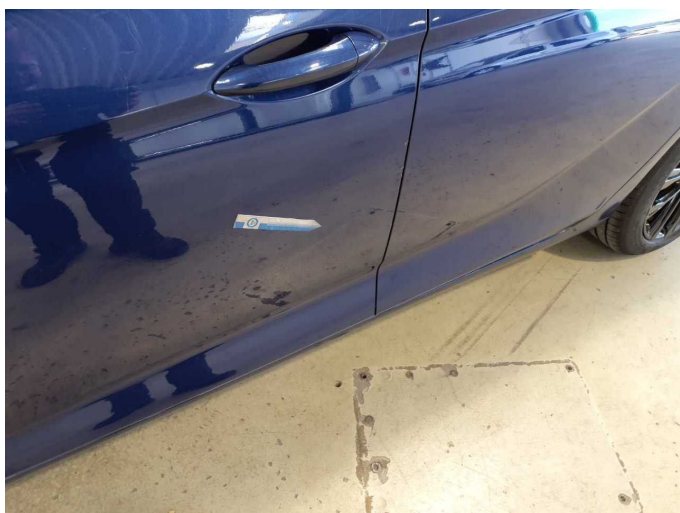


Damage 14: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

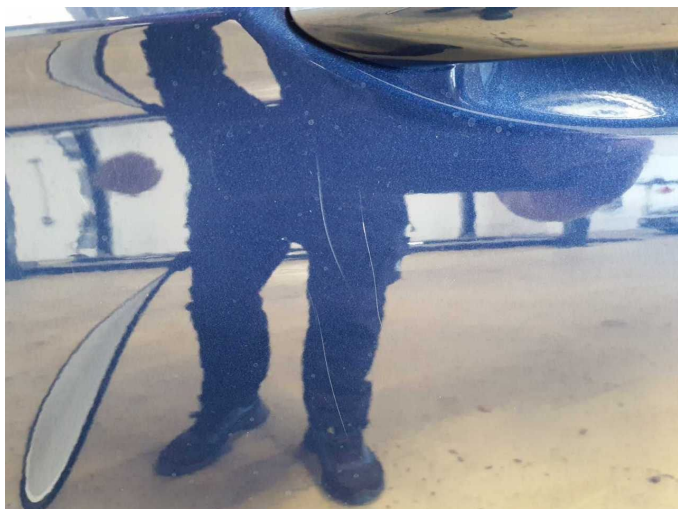


Damage 14: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

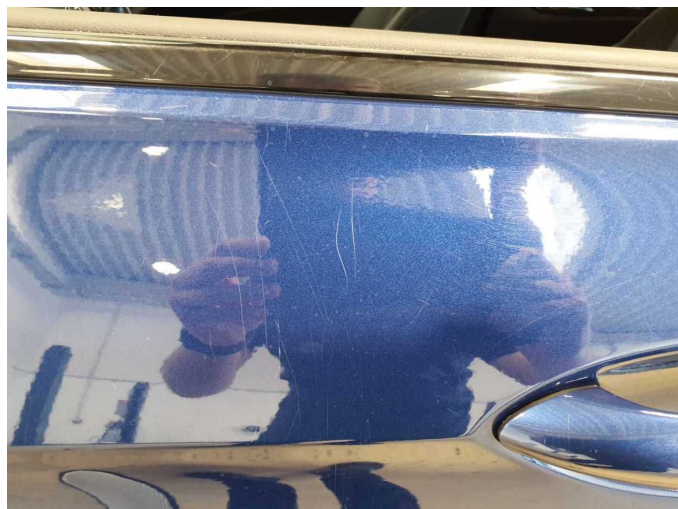

Damage 14: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

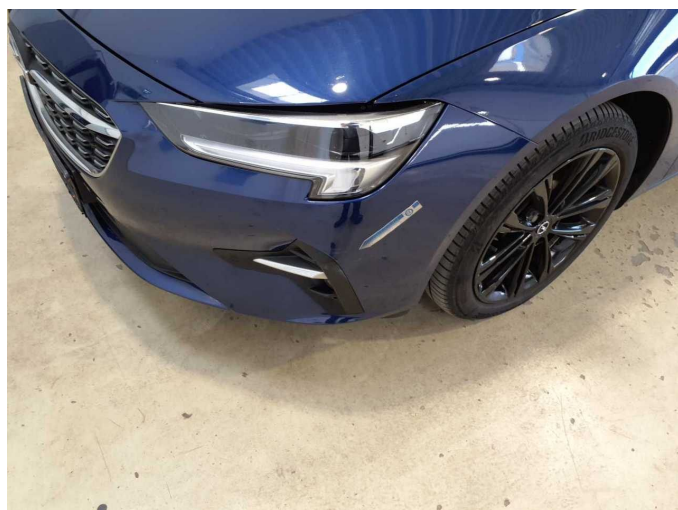

Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Dent / paintcoat damage - Repair and paint

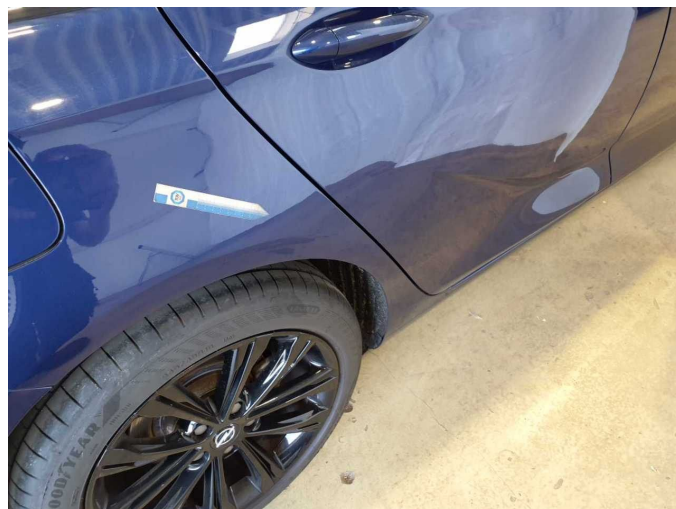

Damage 16: Side panel - rear right side: Side panel (Spachtel rissig) - Unprofessionally repaired - Repair and paint

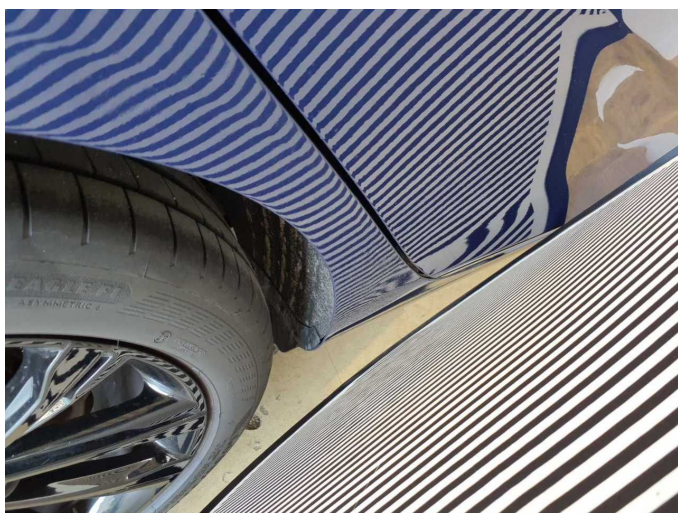


Damage 16: Side panel - rear right side: Side panel (Spachtel rissig) - Unprofessionally repaired - Repair and paint

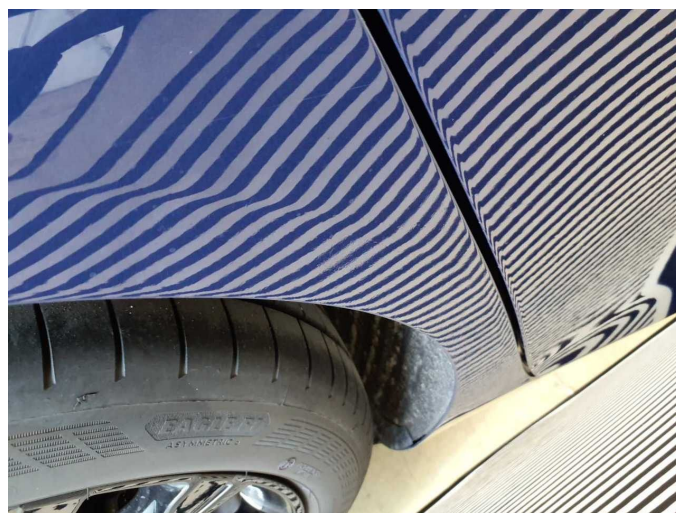

Damage 16: Side panel - rear right side: Side panel (Spachtel rissig) - Unprofessionally repaired - Repair and paint



Damage 17: Body: Body - Damage by hail - Repair

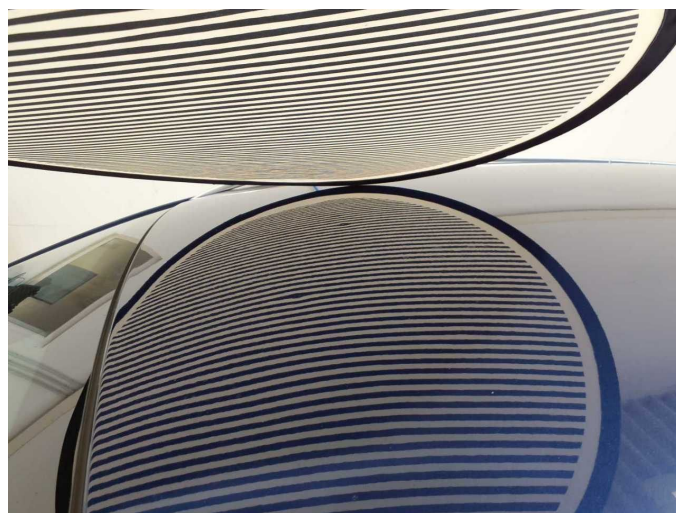

Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair




Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair




Damage 17: Body: Body - Damage by hail - Repair

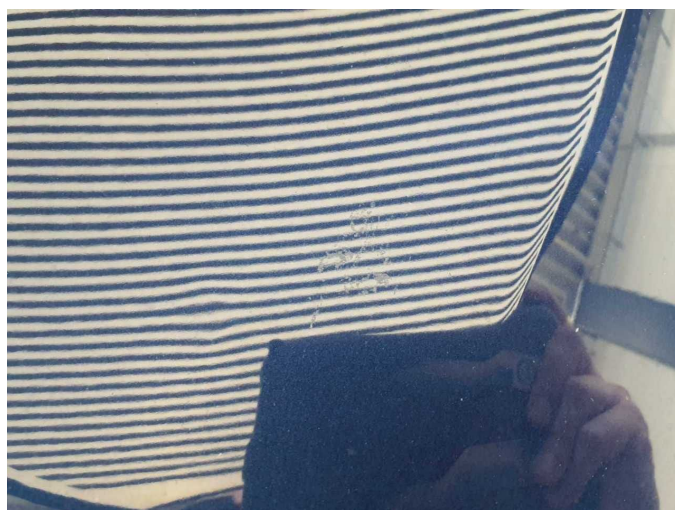

Damage 17: Body: Body - Damage by hail - Repair



Damage 17: Body: Body - Damage by hail - Repair

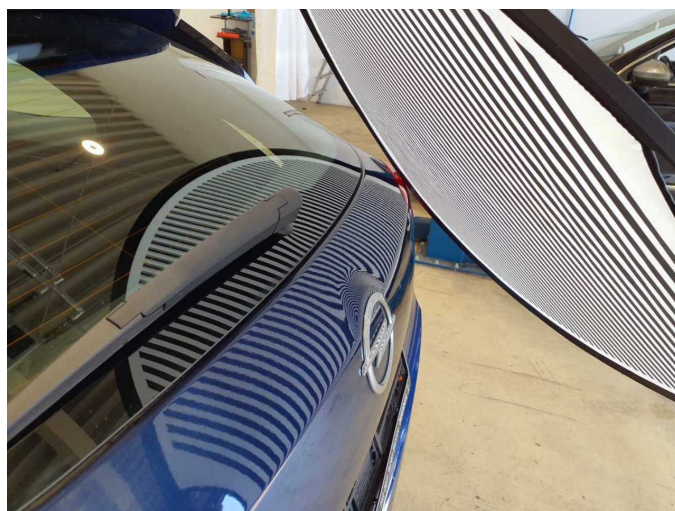

Damage 17: Body: Body - Damage by hail - Repair



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side