



Expertise

Protocol number: 46441555
Order No. / Reference: 26360101
Inspection date: 7 Jul 2026

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel Aut. Business

VIN: W0VZT8EP9M1032227



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Business	
Vehicle Identification number	W0VZT8EP9M1032227
Mileage (Read)	137,384 km
First registration	7 Feb 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	128 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	7 %
Last service on / at	12/2025 at 132,764 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF946398
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00242		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Sonstige	7mm / 7mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Sonstige	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable)
- third brake light
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Luggage compartment cover (extendable with comfort operation)
- Back window, heater
- Child safety lock in the rear doors, manual
- Front headrests (height adjustable)
- LED headlights (automatic headlight range control)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid
- Upholstery: Billy fabric, black
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Bumpers painted in body color
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Immobiliser
- Thermal insulation glazing, green tinted
- Central locking with remote control (and interior switches)
- Second folding ignition key
- Airbag: Front and side airbags, driver and front passenger (front and side airbag, passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- Ambient lighting (dashboard and doors (front))
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- Roof rails, silver anodized
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Speed controller
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control, two zones
- Rear headrests (3 pieces) (height adjustable)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (AGR, driver) (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - 60:40 split-folding rear seat backrest - Ergonomic active seat (AGR), driver (length, height and backrest angle manually adjustable, seat tilt electrically adjustable, electro-pneumatic lumbar support adjustable in height and length, extendable thigh support manually, headrest height and tilt adjustable) - Heated ThermoTec windshield)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Rear seat backrest folds forward in a 60:40 split
- Power steering (speed-dependent)
- Safety net (for installation behind the 1st or 2nd row of seats)
- Visibility equipment (rain sensor, front)
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Traffic sign assistant (recognition of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the recognized sign in the driver information display (depending on traffic sign quality, visibility and weather conditions).)



Extra equipment

- Swiveling trailer hitch (including trailer stability program)
- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Door trim - rear left side - Deformed - Loss in value
3	Side panel - rear right side	Elbow - dent(s) - Smart repair
4	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
5	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
8	Rear bumper	Spoiler - Deformed - Replace
9	Side panel - rear left side	Side panel - Scratch(es) - Paint
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Door - front right side	Door - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Front bumper	Front bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Unknown, Provided by user / customer, from 24 Apr 2025	933,55 €

Accident damages

No.	Accident
1	Front, Side right, Underbody



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

-Das Fahrzeug weist der Laufzeit entsprechende Gebrauchsspuren auf.

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden

Minderwerte höher als HEK

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

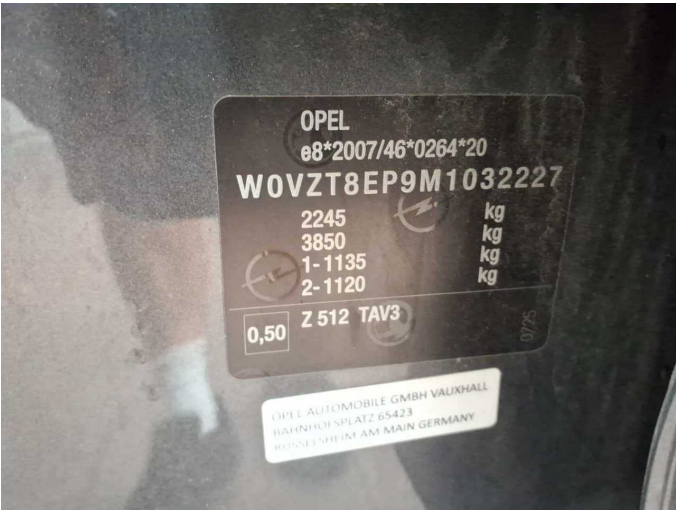


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

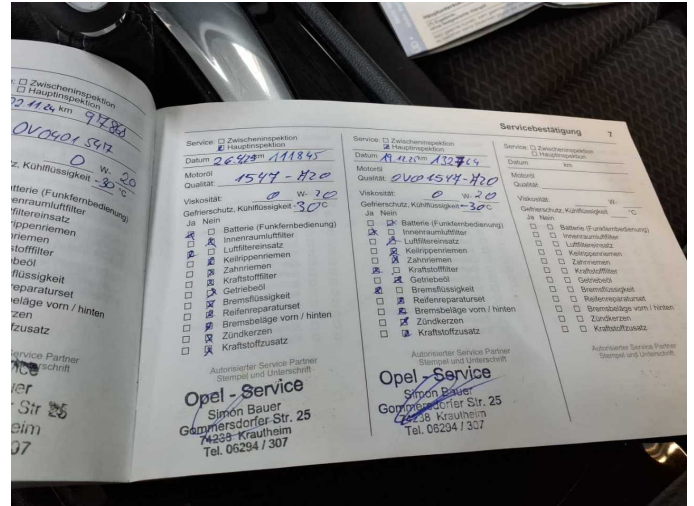


Figure 14: Documents

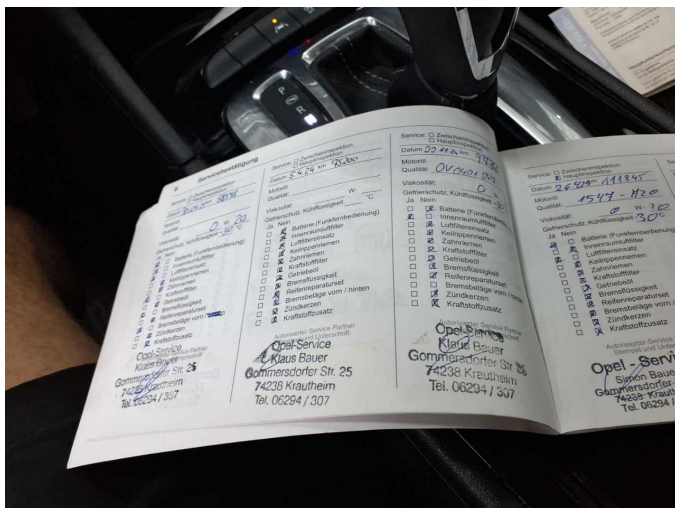


Figure 15: Documents

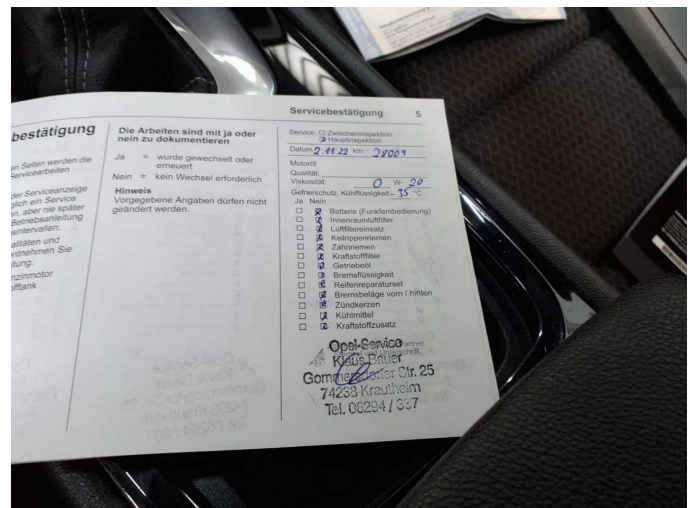


Figure 16: Documents

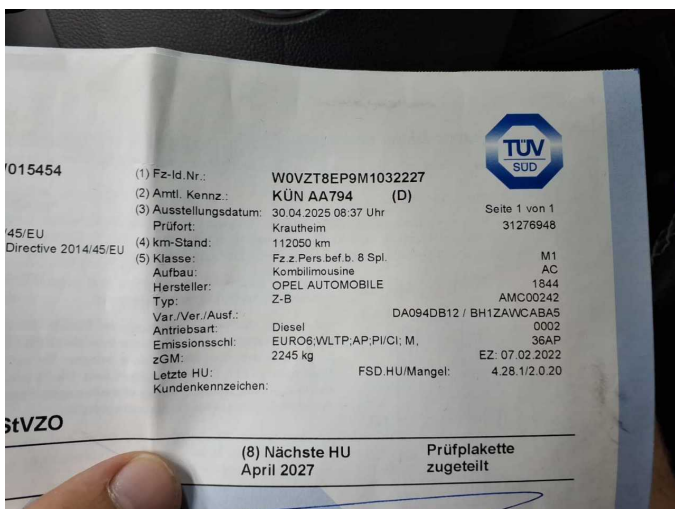


Figure 17: Documents

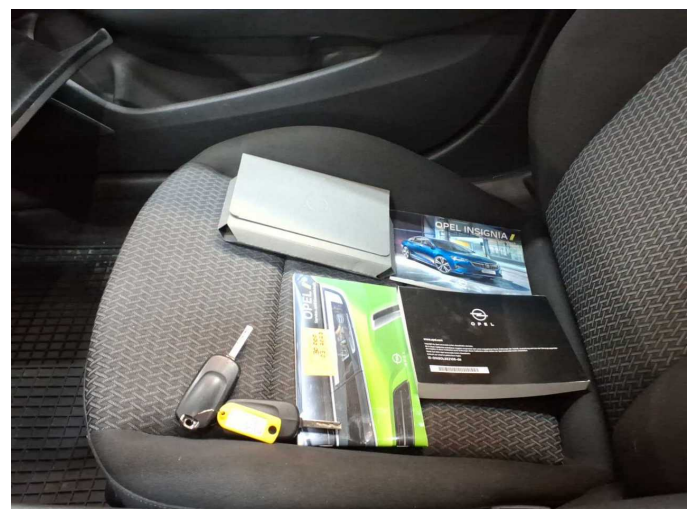


Figure 18: Documents



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

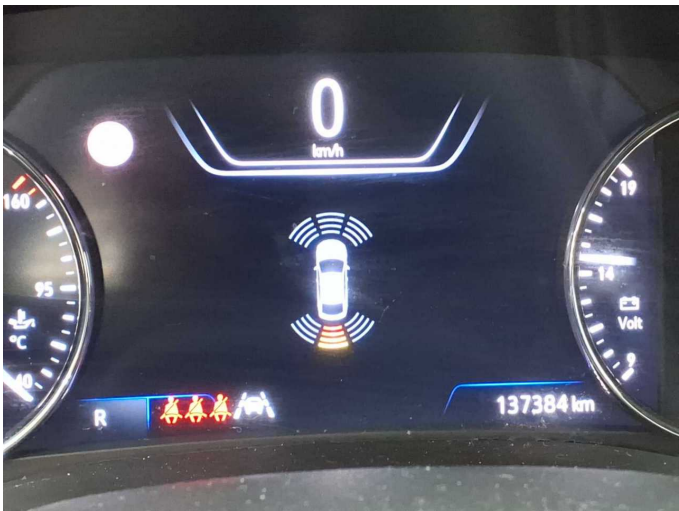


Figure 22: Misc.



Figure 23: Misc.

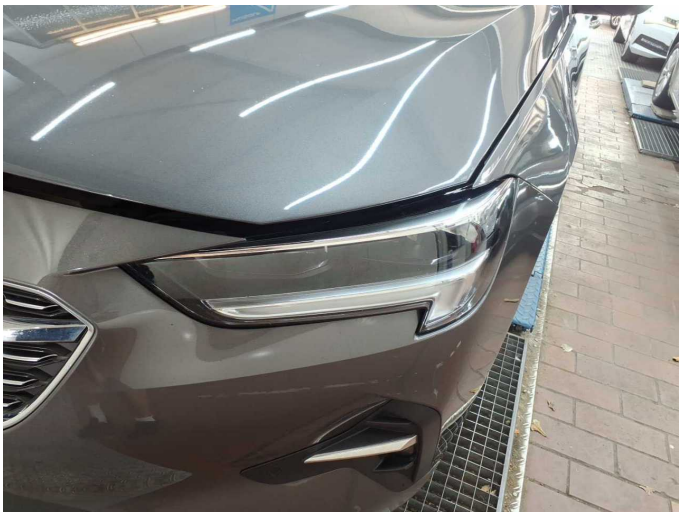


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.


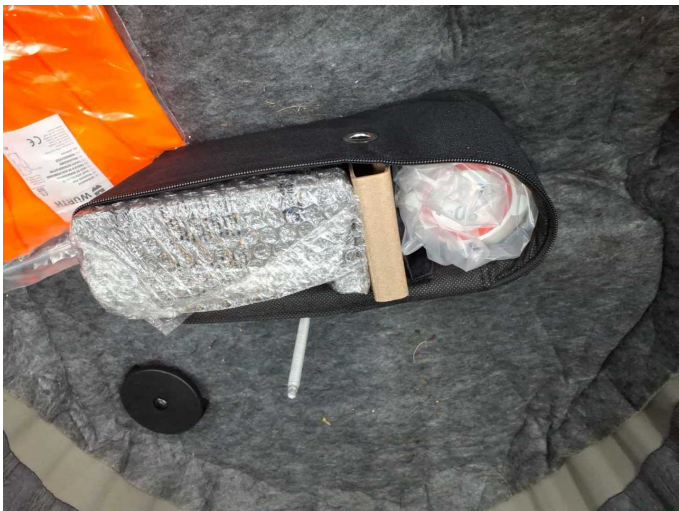


Figure 28: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

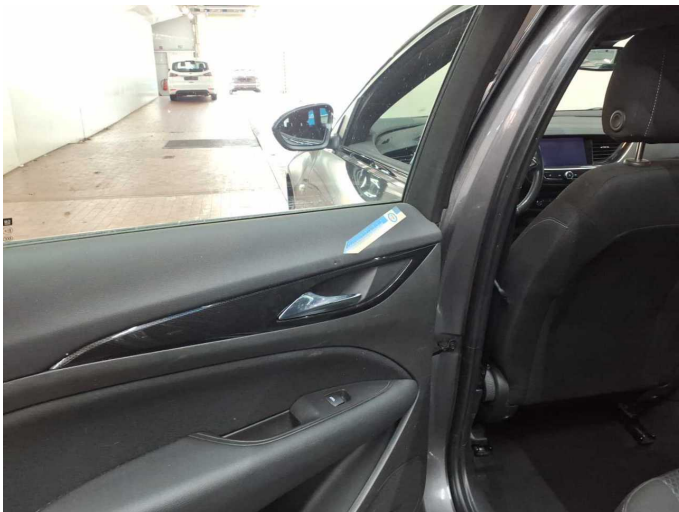


Damage 2: Trim / covers: Door trim - rear left side - Deformed - Loss in value



Damage 2: Trim / covers: Door trim - rear left side - Deformed - Loss in value

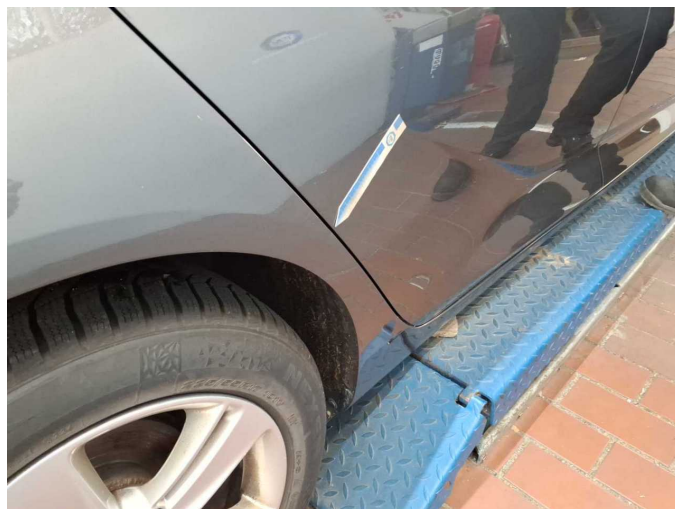

Damage 3: Side panel - rear right side: Elbow - dent(s) - Smart repair

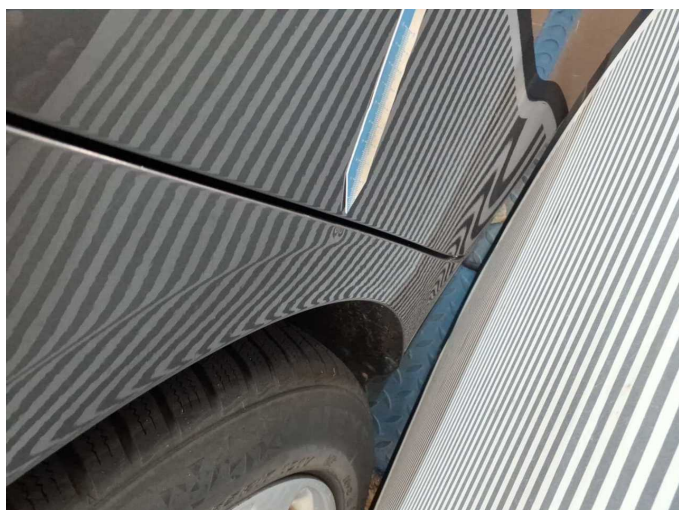

Damage 3: Side panel - rear right side: Elbow - dent(s) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

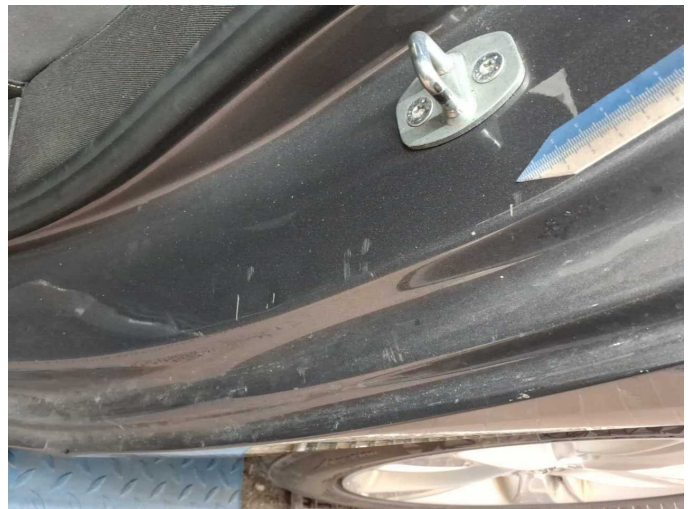

Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

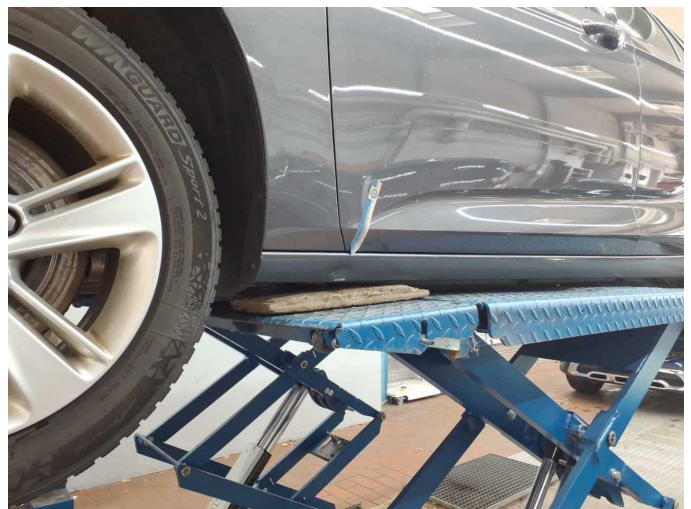

Damage 7: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Sill - left side: Sill - Dent / paintcoat damage - Smart repair




Damage 8: Rear bumper: Spoiler - Deformed - Replace




Damage 8: Rear bumper: Spoiler - Deformed - Replace



Damage 8: Rear bumper: Spoiler - Deformed - Replace

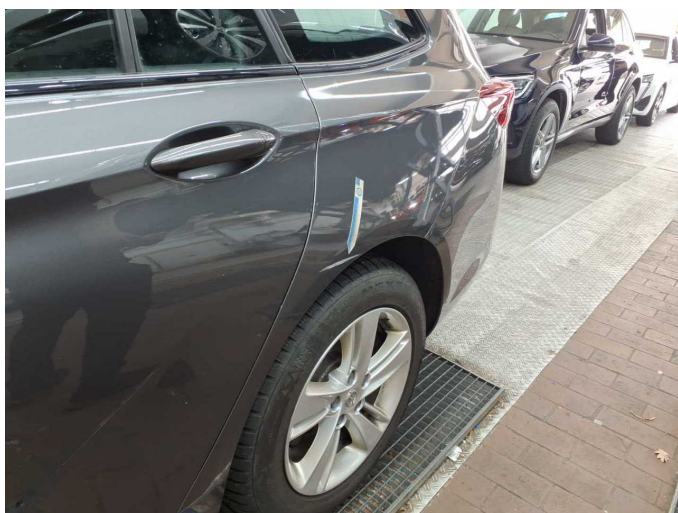

Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

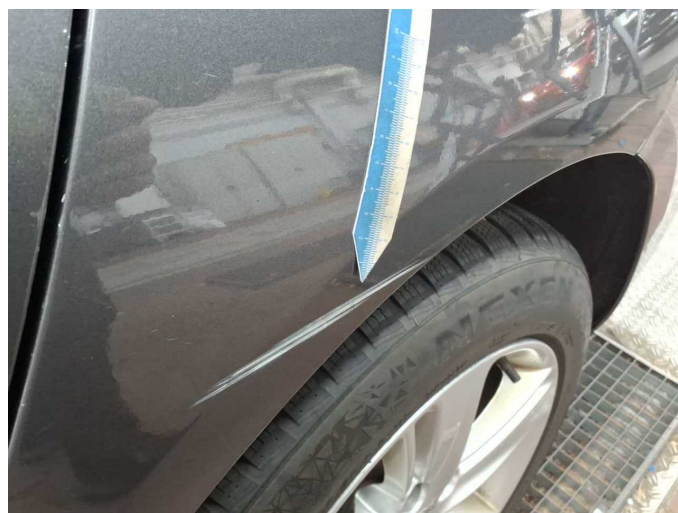

Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

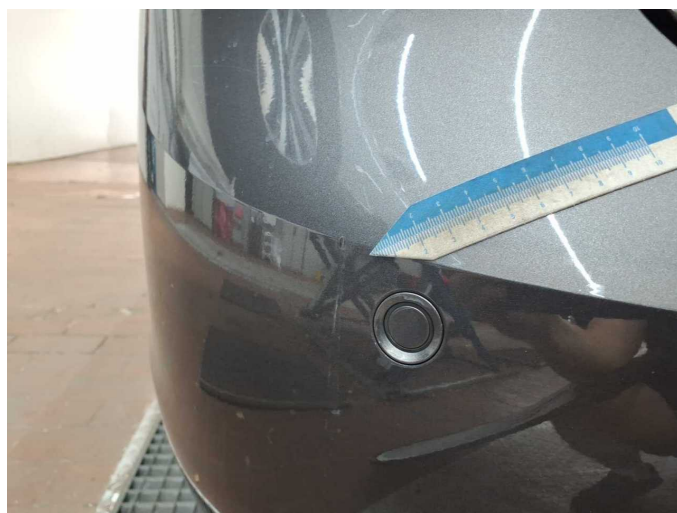

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

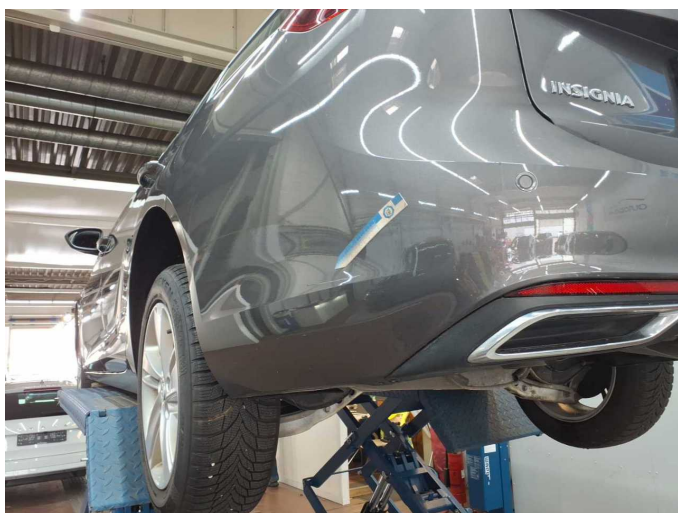

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

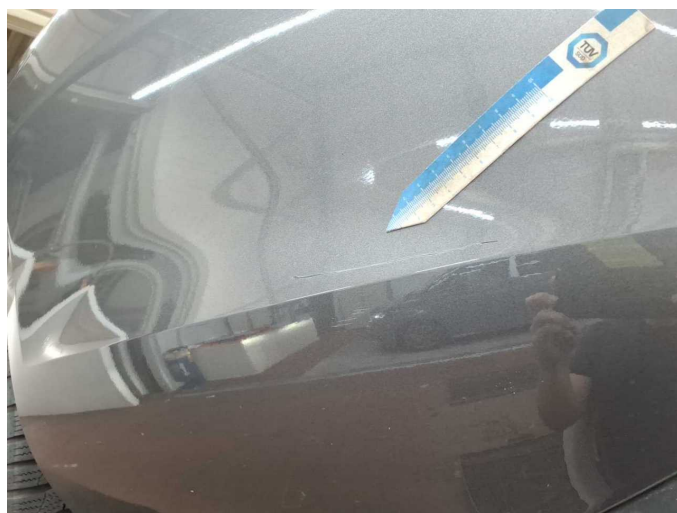

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Door - front right side: Door - Deformed - Repair and paint



Damage 11: Door - front right side: Door - Deformed - Repair and paint



Accident 1: Front, Side right, Underbody



Accident 1: Front, Side right, Underbody



Accident 1: Front, Side right, Underbody




Accident 1: Front, Side right, Underbody



Accident 1: Front, Side right, Underbody



Accident 1: Front, Side right, Underbody

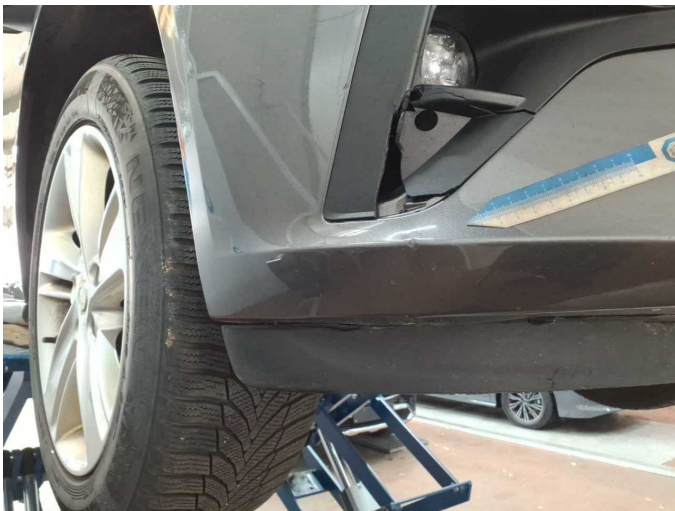

Accident 1: Front, Side right, Underbody



Accident 1: Front, Side right, Underbody