



Expertise

Protocol number: 46531055
Order No. / Reference: 26606820
Inspection date: 14 Jul 2026

Manufacturer: Opel

Model: Crossland 1.5 Diesel GS

VIN: W0V7D9EN5P4073823



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Crossland 1.5 Diesel GS
Vehicle Identification number W0V7D9EN5P4073823
Mileage (Read) 53,643 km
First registration 14 Jun 2023
Number of holders 1

Power / Engine displacement 81 kw / 1,499 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle SUV

Colour / colour code Nautik Blau Metallic/Dach
Karbon Schwarz
Doors / Seats 5 / 5
Upholstery type Cloth / leather
combination
Colour of upholstery Black-Red



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	25,660 km
Last service on / at	03/2026 at 49,307 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS833097
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMH 00131		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,835 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R17 95H	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	215/50 R17 95H	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R16 89H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	195/60 R16 89H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Front and rear outer head airbags
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- Roof spoiler
- Tachometer
- Electronic Stability Program (ESP Plus)
- Electric rear windows
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear, including reading lights, front
- Rear headrests (3)
- Paint finish: Roof in carbon black
- LED ambient lighting
- LED headlights
- Steering wheel: Leather steering wheel with chrome elements and steering wheel remote control
- Center armrest, front
- Parkpilot, rear parking aid
- Proactive driver assistance system
- Tire repair kit
- Wheels: Alloy wheels 6.5 J x 17 with tires 215/50 R17, in black (5 double spokes)
- Visibility equipment
- Seats: Seat backrest split 60:40, foldable
- Lane Assist
- 12V power outlet in the center console, front and rear
- Traffic sign assistant
- Immobiliser
- Airbag for driver and passenger side
- Airbag: Side airbag for driver and front passenger side
- Armrest, driver
- Hill Start Assist
- On-board computer
- Roof rails, silver
- Diesel particulate filter (DPF) maintenance-free
- Electronic brake force distribution (EBD)
- Driver information display, 3.5"
- Electric front windows
- Transmission: 6-speed manual transmission
- rear window wiper
- Instrument inserts, black with chrome rings
- Automatic climate control, two zones
- Front headrests
- Paintwork: Metallic Nautical Blue with contrasting roof
- LED taillights
- LED daytime running lights
- Headlight range adjustment, manual
- Makeup mirror, illuminated in sun visor
- Fog light
- Upholstery: Fabric/Premium leather look
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire pressure warning
- Power steering
- Seat belts: Three-point seat belts in all seats
- Seats: Ergonomic active seat (AGR) driver
- Solar Protect thermal insulation glazing
- Start/Stop System
- Traction control (TC Plus)
- Pre-installation for child seat mounting system "ISOFIX"
- Central locking with remote control

Extra equipment

- Navigation system: Multimedia Navi Pro with 8" color touchscreen display, voice control for audio, telephone, and navigation (Bluetooth audio streaming, hands-free calling via Bluetooth interface, phonebook and call list display, FM/AM radio, Autostore, RDS-EON, automatic music recognition, image display via USB port, Apple CarPlay, Android Auto, text message reading and dictation, up to 10 mobile phones can be paired, navigation with integrated memory, European road map (including Russia and Turkey), 3D map display, dynamic route guidance, 2 USB ports, 3.5" color driver information display).
- Detachable trailer hitch
- Reversing camera: 180-degree panoramic reversing camera and parking pilot, front and rear parking aid
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and passenger



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Fuel system	Tank cap - Scratch(es) - Smart repair
2	Door - rear right side	Door edge - Scratch(es) - Smart repair
3	Door - front left side	Door - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - front right side (Mit Materialabtrag) - Scratched - Replace
5	Rear bumper	Bumper - rear right side - Scratched - Paint
6	Door - rear left side	Door - Scratch(es) - Paint
7	Door - front right side	Door - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Rear of vehicle - Key trailer hitch (2x)

Accident damages

No. Accident

1 Front

Repainting

No. Repainting

- Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
- Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
- Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
- Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	200 µm	Side panel - rear right side	173 µm
Door - rear right side	214 µm	Door - front right side	193 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Fahrzeugmodellbezeichnung laut Rechnung: "Opel Crossland 1.5 Diesel GS".
- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

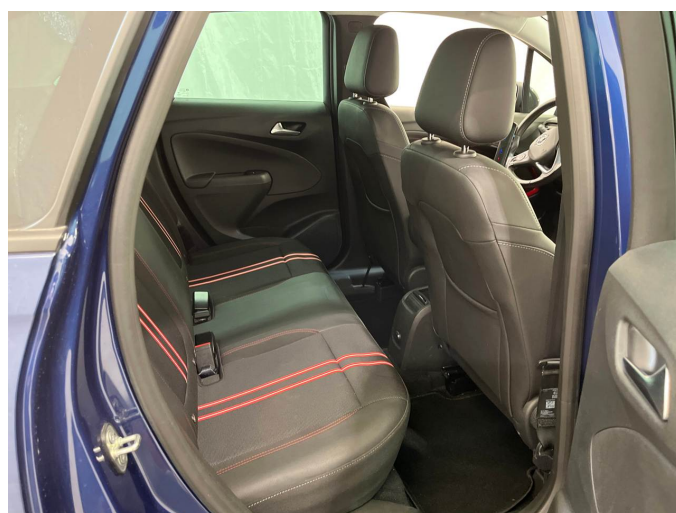


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

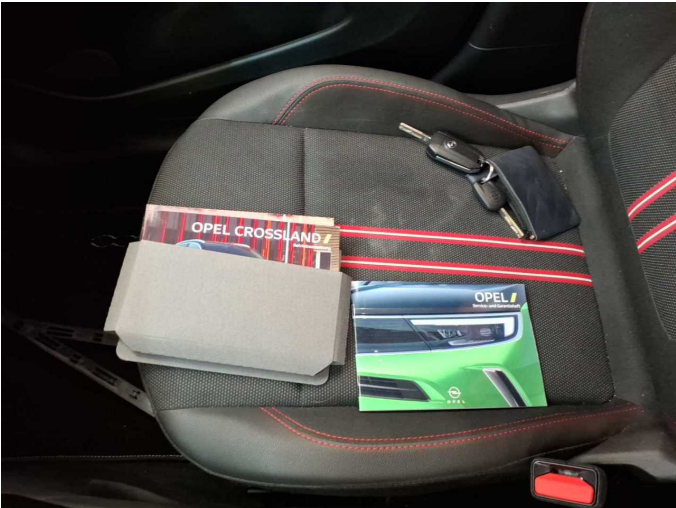


Figure 13: Documents



Figure 14: Documents

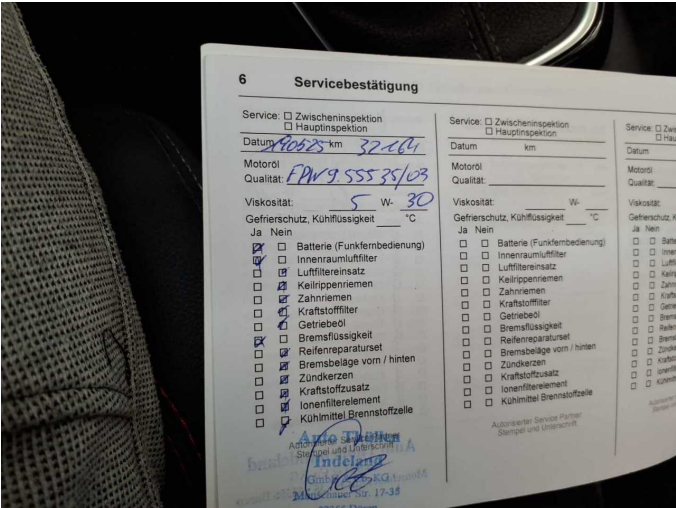


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

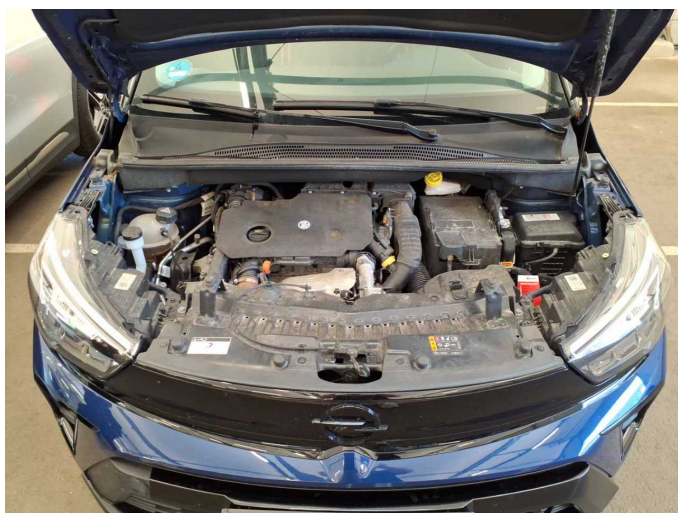


Figure 23: Misc.

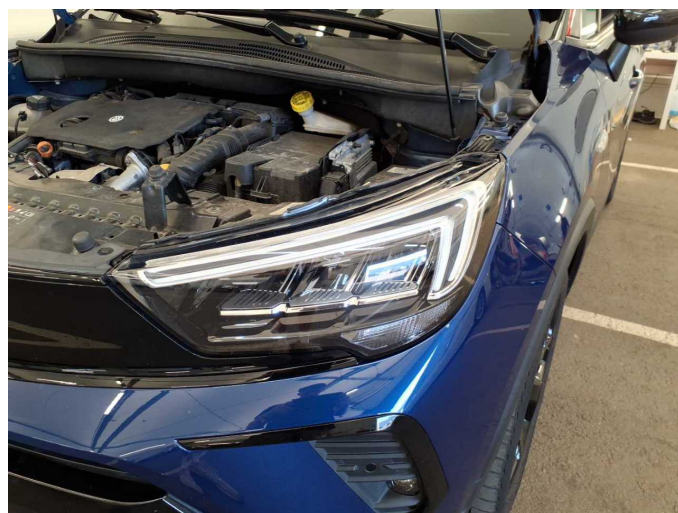


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

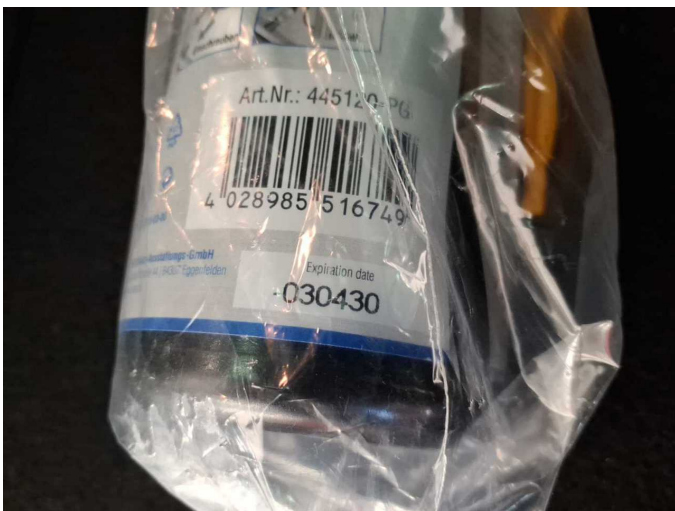


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Fuel system: Tank cap - Scratch(es) - Smart repair



Damage 1: Fuel system: Tank cap - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door edge - Scratch(es) - Smart repair

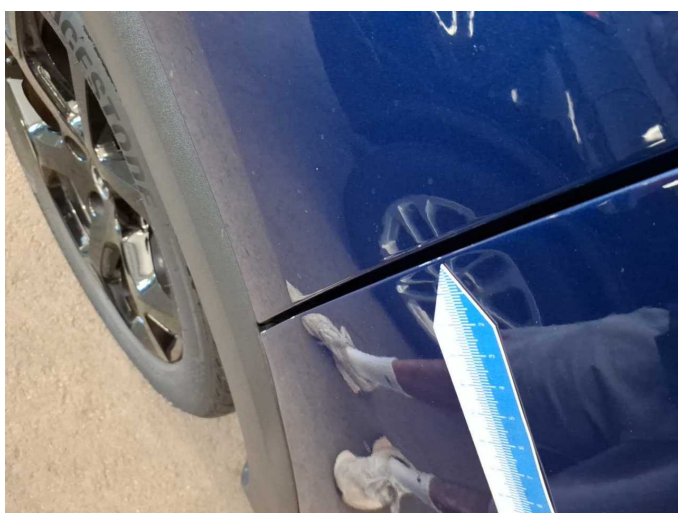


Damage 2: Door - rear right side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door - Scratch(es) - Smart repair

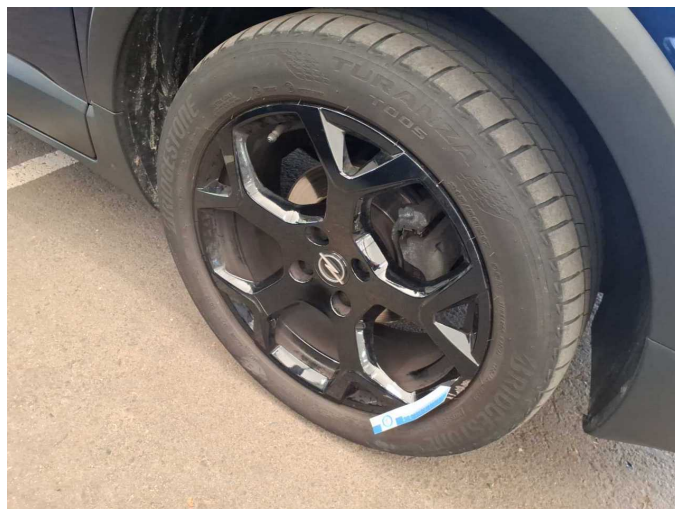


Damage 4: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side (Mit Materialabtrag) - Scratched - Replace




Damage 5: Rear bumper: Bumper - rear right side - Scratched - Paint

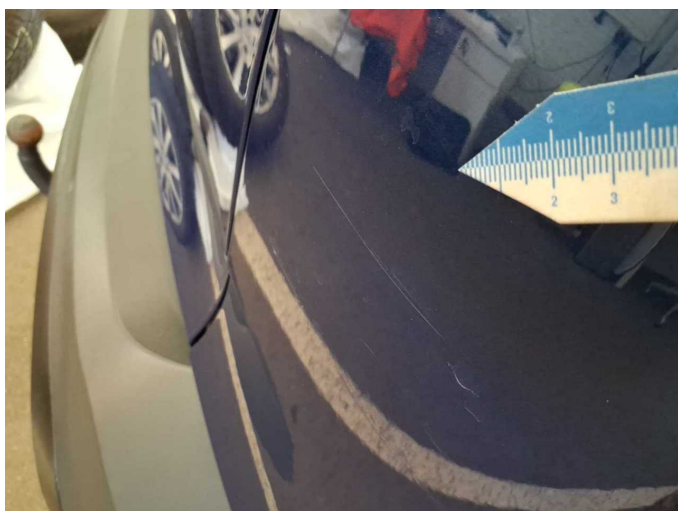

Damage 5: Rear bumper: Bumper - rear right side - Scratched - Paint




Damage 6: Door - rear left side: Door - Scratch(es) - Paint

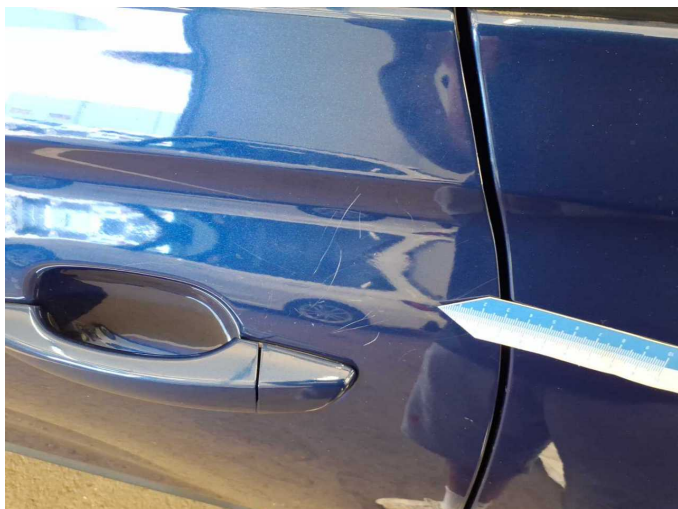

Damage 6: Door - rear left side: Door - Scratch(es) - Paint




Damage 6: Door - rear left side: Door - Scratch(es) - Paint

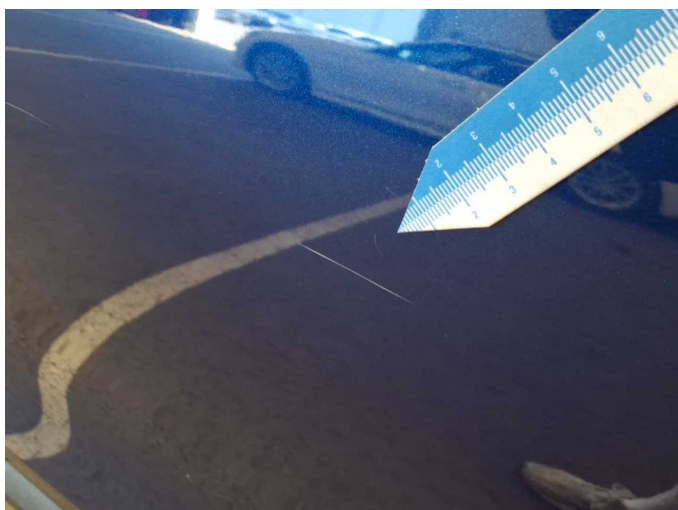


Damage 6: Door - rear left side: Door - Scratch(es) - Paint



Damage 7: Door - front right side: Door - Scratched - Repair and paint

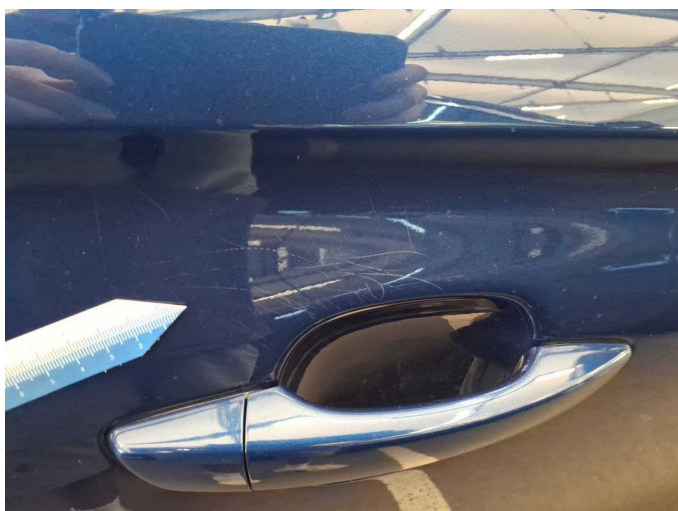


Damage 7: Door - front right side: Door - Scratched - Repair and paint

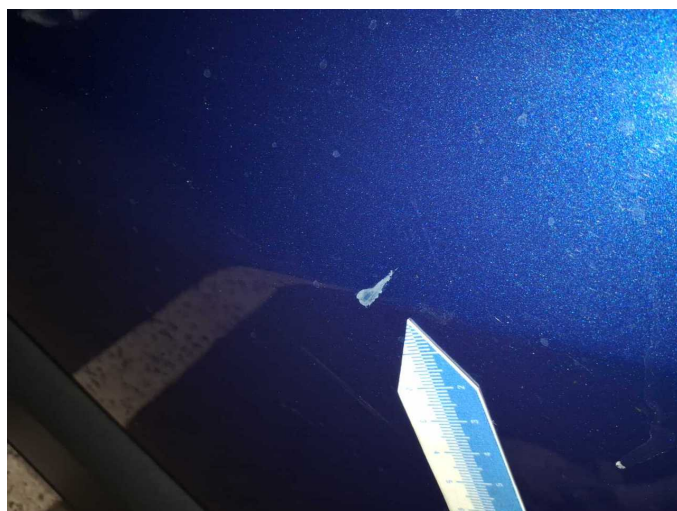


Damage 7: Door - front right side: Door - Scratched - Repair and paint



Damage 7: Door - front right side: Door - Scratched - Repair and paint

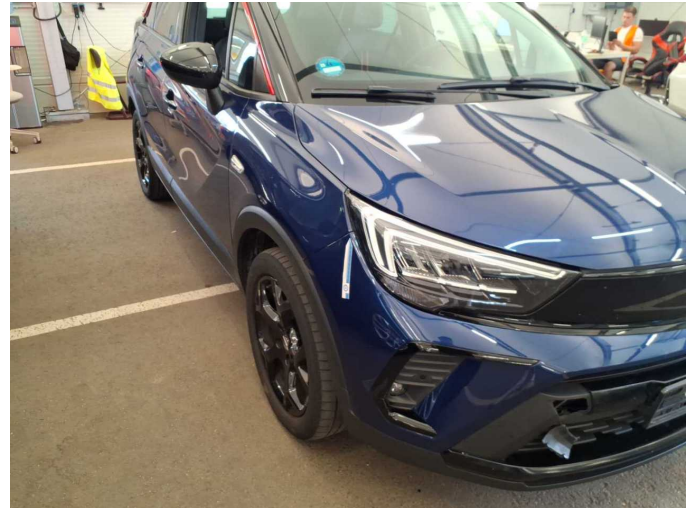

Accident 1: Front

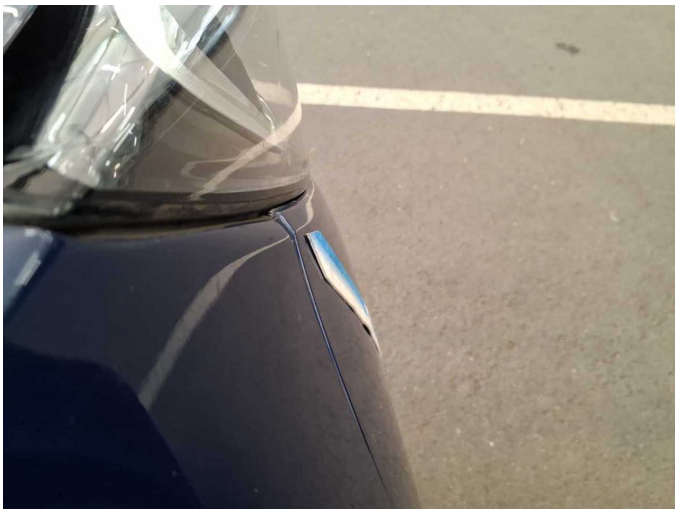


Accident 1: Front



Accident 1: Front



Accident 1: Front

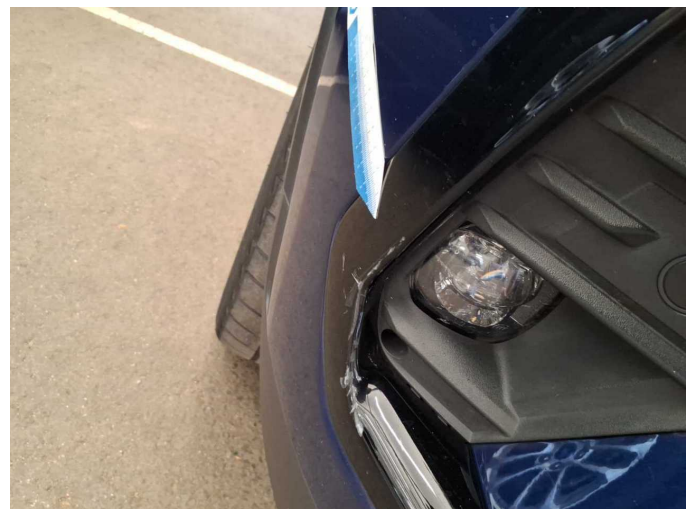

Accident 1: Front



Accident 1: Front




Accident 1: Front



Accident 1: Front




Accident 1: Front

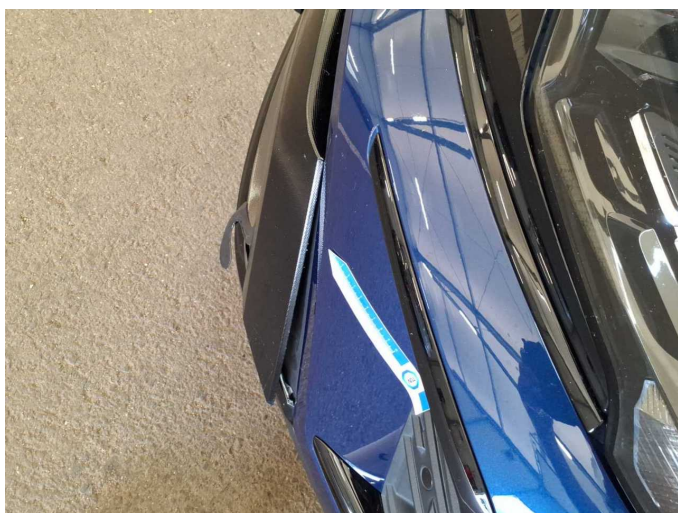


Accident 1: Front




Repainting 1: Mudguard - right side

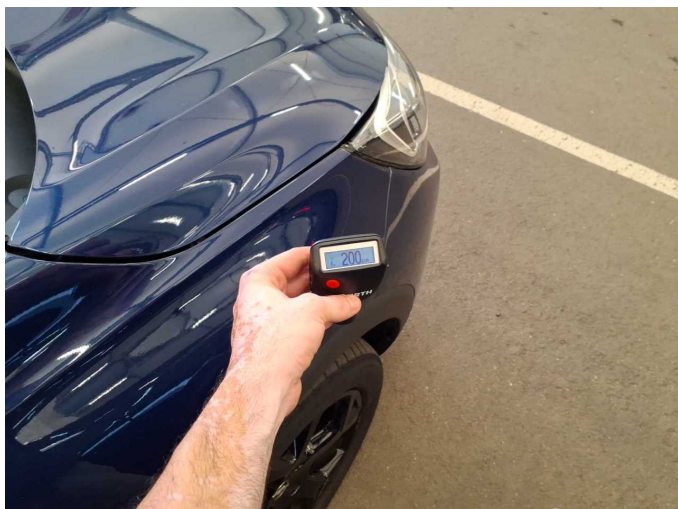


Repainting 1: Mudguard - right side

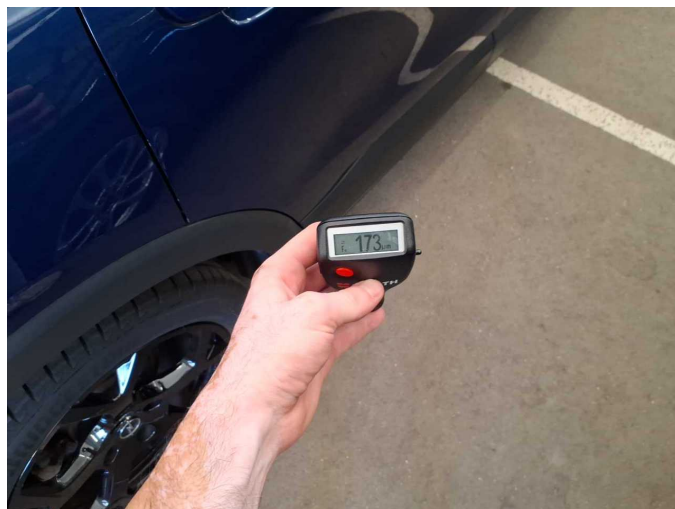

Repainting 2: Side panel - rear right side

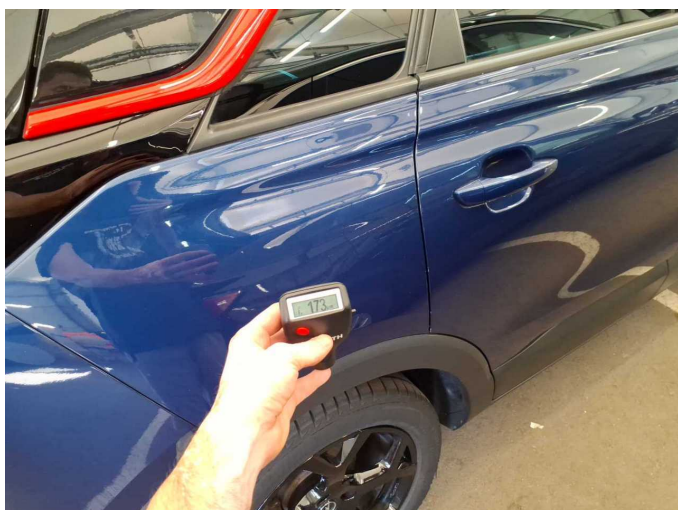


Repainting 2: Side panel - rear right side

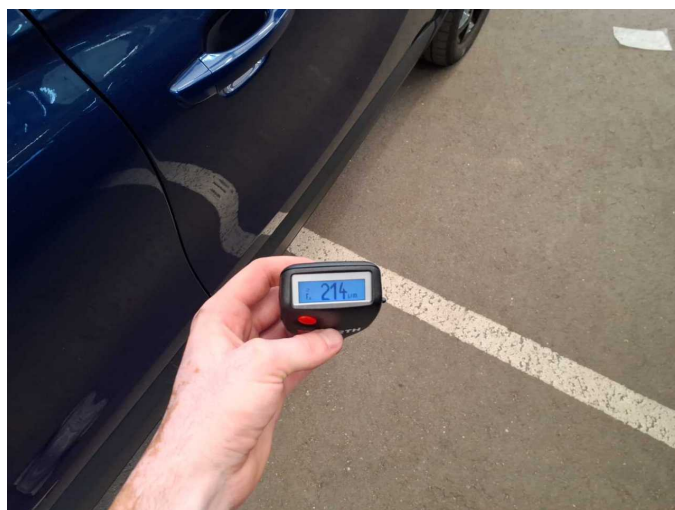


Repainting 3: Door - rear right side



Repainting 3: Door - rear right side

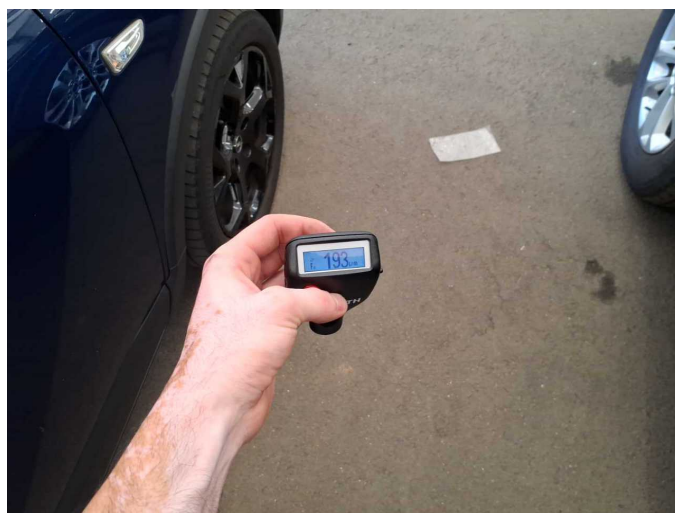

Repainting 4: Door - front right side

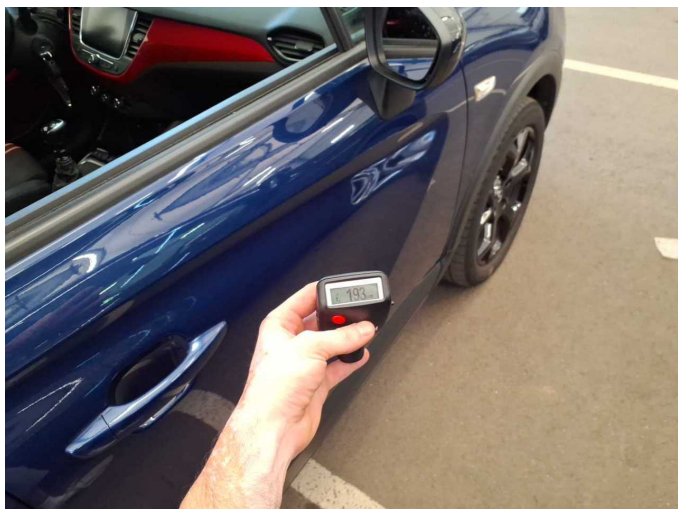

Repainting 4: Door - front right side

Wartungshistorie

(gemäß Auftraggeber Informationen)



Fahrgestellnummer: W0V7D9EN5P4073823
Hersteller / Modell: OPEL OPEL Crossland 1.5 Diesel GS Line

Datum	KM-Stand	Beschreibung
12.03.2026	49.307	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.06.2025	32.164	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.05.2024	14.192	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges