



Expertise

Protocol number: 46655185
Order No. / Reference: 26623027
Inspection date: 22 Jul 2026

Manufacturer: Opel

Model: Mokka 1.2 DI Turbo Edition

VIN: VXXKUSHNSKNW006656



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Mokka 1.2 DI Turbo Edition

Vehicle Identification number VXXKUSHNSKNW006656

Mileage (Read) 136,935 km

First registration 1 Jul 2022

Number of holders 1

Fuel type Petrol

Engine displacement / Cylinder 1,199 ccm / 3

Power 96 kW

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Jade weiß

Doors / Seats 5 / 5

Upholstery type Cloth

Colour of upholstery Black-Dark grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,500 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ628210
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
Manufacturer key number/ type code number	1889 / ADB 00021		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,715 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 98H	All-season tyres on Light alloy	Falken	5mm / 5mm
2)	215/65 R16 98H	All-season tyres on Light alloy	Falken	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • 2 ignition keys, one of which has a radio remote control, foldable • Driver and passenger side airbags • Airbag: Head airbags, front and rear outer • Anti-lock braking system (ABS) with cornering brake control and brake assist • Hill Start Assist • Headliner, Grey • Decorative strips, silver • Third brake light • Electronic Stability Program Plus (ESP Plus) • Front collision warning with automatic city emergency braking and pedestrian detection • Transmission: 6-speed manual • Child safety lock in the rear doors, manual • Headrests (2) • LED headlights • Steering column, height and tilt adjustable • Reading lights, front • Multi-collision brake • Otto particulate filter • Radio: Radio BT • Wheels: Light alloy (4) 5 double spokes 6.5 x 16 • Side impact protection • Seat belts • Seats: Driver's seat 6-way manually adjustable • Seats: Rear seat backrest foldable in a 60:40 ratio • Lane Keeping Assist • Start/Stop System • Traction control with engine and brake intervention TC Plus • Traffic sign recognition • Central locking with remote control | <ul style="list-style-type: none"> • Storage compartments • Adaptive brake light • Airbag: Front and side airbags • Actively controlled air intakes (Active Aero Shutter) • Electrically adjustable and heated exterior mirrors • Exterior mirrors in black • Roof design line in chrome • Roof spoiler, black • Tachometer • Electronic brake force distribution (EBD) • Electric windows front and rear • Pedestrian protection • Cruise control with intelligent speed limiter • Rear shelf • Air conditioning with pollen filter • Rear headrests (3), height adjustable • Steering wheel: Leather steering wheel, flattened at the bottom • Makeup mirror in sun visor, driver and front passenger • Fatigue detection • Upholstery: Cloth • Radio accessories: Digital radio reception DAB+ • Wheels: Tire repair kit • Speed-sensitive power steering • Seats: Passenger seat 4-way manually adjustable • Seats: Comfort seats, front • Seats: Pre-installation for ISOFIX child seat mounting system, rear outer • 12-volt power outlet • Underride protection look, front and rear, in body color • Tinted heat-insulating glazing |
|---|--|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Paint finish: Uni Jade White • Parkpilot, rear parking aid with acoustic warning signal when reversing (180-degree panoramic reversing camera) • Seats: Heated seats, multi-stage, driver and front passenger | <ul style="list-style-type: none"> • Steering wheel: Heated leather steering wheel • Visibility equipment (front rain sensor - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming) |
|---|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected



Value reducing factors

No.	Component group	Description
1	Door - front right side	Door edge - Scratched - Smart repair
2	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
3	Side panel - rear left side	Side panel (Lackpickel) - Unprofessionally repaired - Smart repair
4	Engine	Engine - Rough engine running - Perform diagnosis
5	Door - rear left side	Door (Lackpickel) - Unprofessionally repaired - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 15 Aug 2022	6.939,91 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - rear left side, Door - front left side

Paint coat thickness measurement

Side panel - rear left side	219 µm	Door - rear left side	190 µm
Door - front left side	159 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

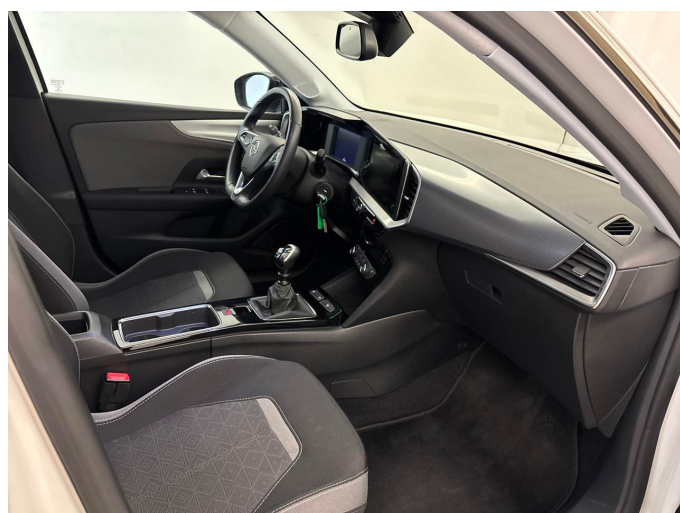


Figure 5: Interior - front

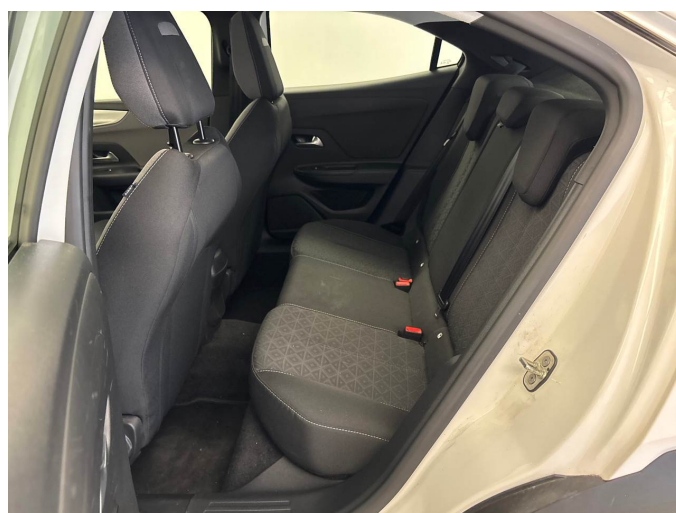


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

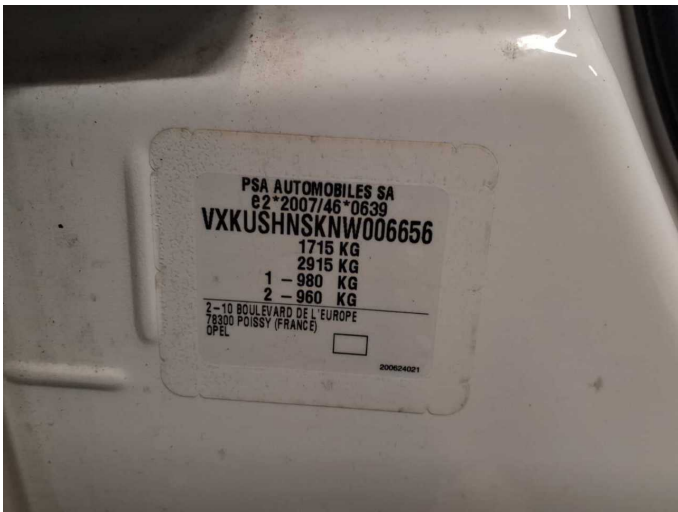


Figure 11: VIN



Figure 12: Mounted tyres

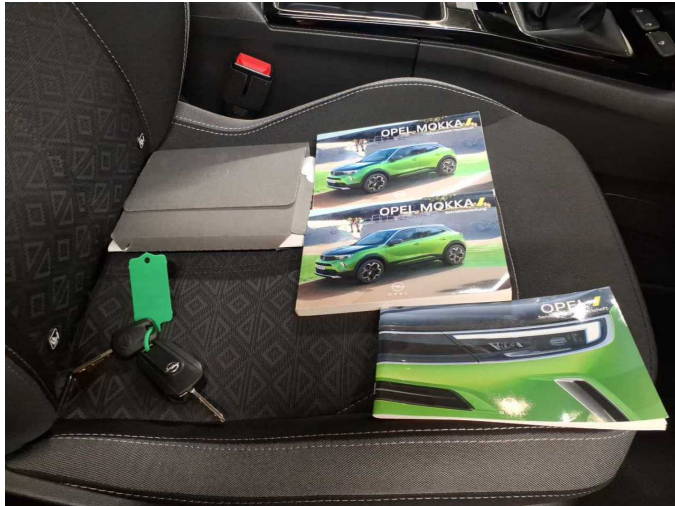


Figure 13: Documents

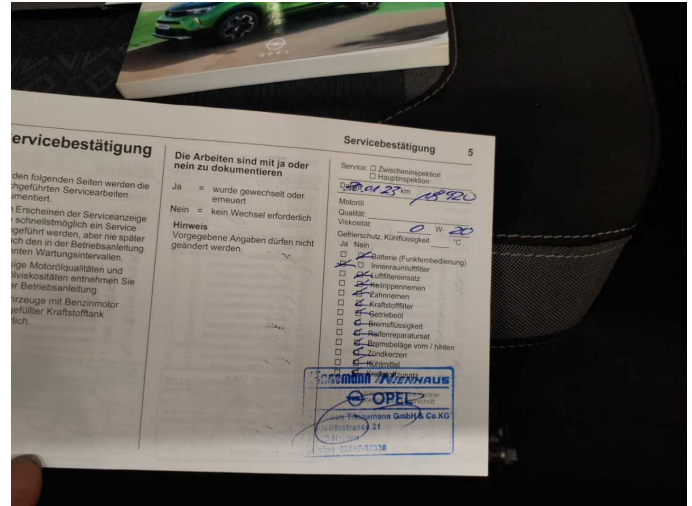


Figure 14: Documents

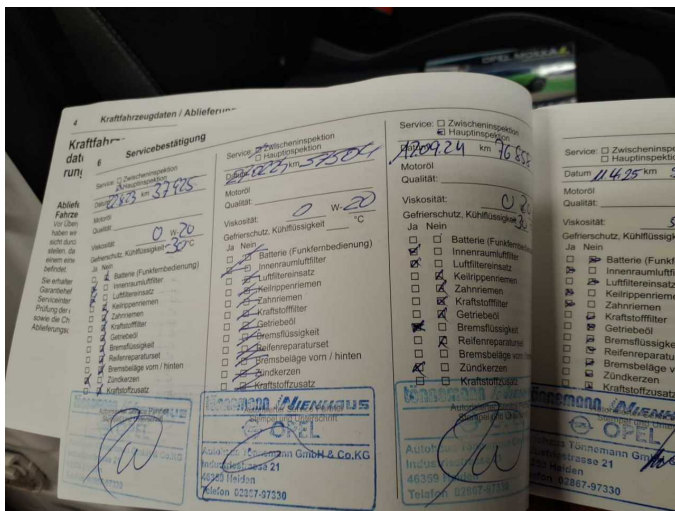


Figure 15: Documents

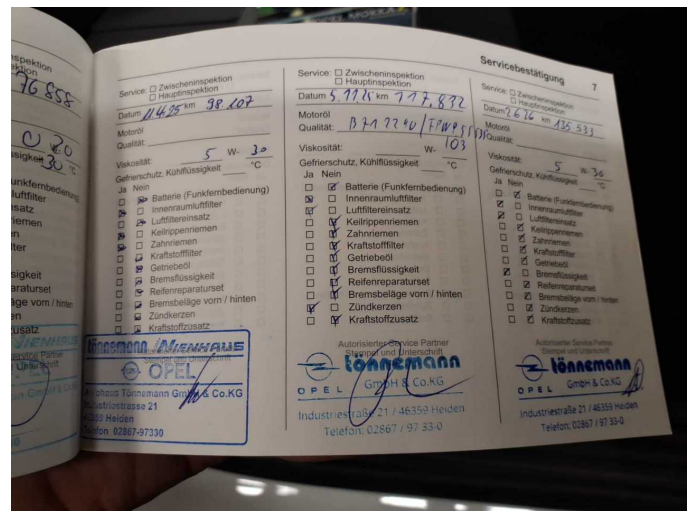


Figure 16: Documents

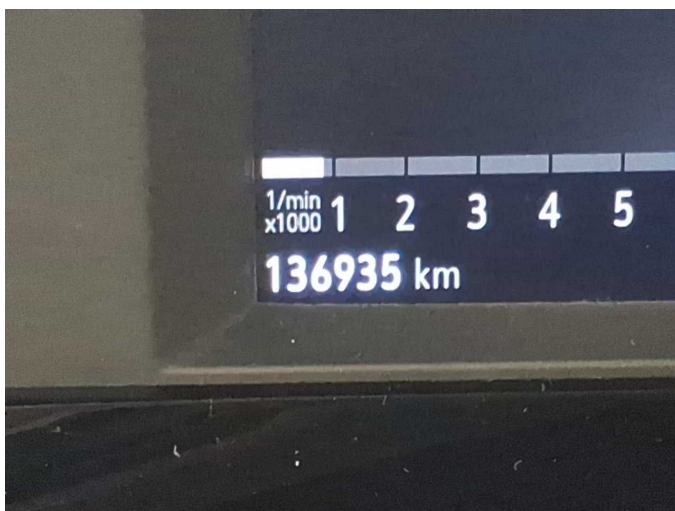


Figure 17: Documents



Figure 18: Documents

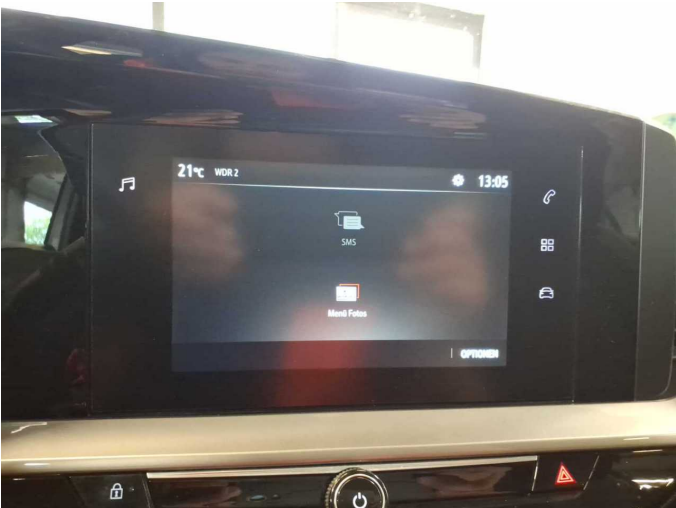


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

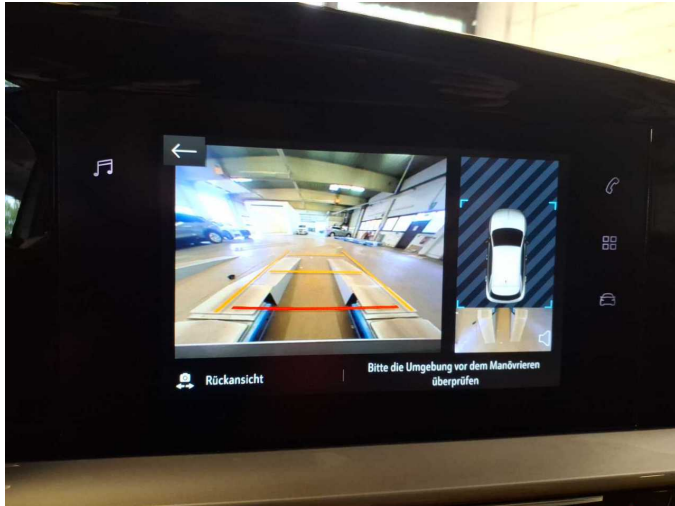


Figure 31: Misc.



Damage 1: Door - front right side: Door edge - Scratched - Smart repair




Damage 1: Door - front right side: Door edge - Scratched - Smart repair



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

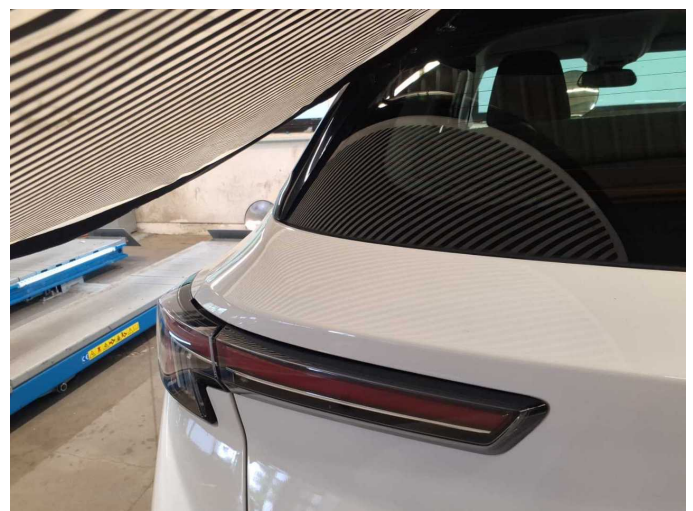

Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Side panel (Lackpickel) - Unprofessionally repaired - Smart repair



Damage 3: Side panel - rear left side: Side panel (Lackpickel) - Unprofessionally repaired - Smart repair



Damage 3: Side panel - rear left side: Side panel (Lackpickel) - Unprofessionally repaired - Smart repair



Damage 5: Door - rear left side: Door (Lackpickel) - Unprofessionally repaired - Paint



Damage 5: Door - rear left side: Door (Lackpickel) - Unprofessionally repaired - Paint



Damage 5: Door - rear left side: Door (Lackpickel) - Unprofessionally repaired - Paint



Damage 5: Door - rear left side: Door (Lackpickel) - Unprofessionally repaired - Paint



Damage 5: Door - rear left side: Door (Lackpickel) - Unprofessionally repaired - Paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side