



Lynk & Co

01

INFORMAZIONI SUL VEICOLO

VIN	L6TCX2E72PE042047	Tipo di carburante	Ibrido plug-in
Registrazione		Colore Carrozzeria	Azzurro
Prima immatricolazione	03/05/2023		

DETTAGLI ISPEZIONE

Cliente	Lynk & Co Italy	Data ispezione	22/06/2026 11:24:25
Ispezione - ID	10758183	Descrizione indirizzo ispezione	

DOCUMENTI E MANUTENZIONE

Numero di chiavi totali	1	Libretto di circolazione	Sì
Libretto di circolazione	Originale		

ACCESSORI

Tetto apribile elettrico	Sì	Telecamera con vista posteriore	Sì
Tetto panoramico	Sì	Tipo di vernice	metallico

PNEUMATICI

Pneumatici montati

Posizione	Posizione	Battistrada	Produttore	Dimensioni	Stagione degli pneumatici	Tipo di cerchi	Runflat
Anteriore	Sinistra	2,0 mm	Pirelli	235/45 R 20 100 W	Estate	In lega	-
Anteriore	Destra	1,0 mm	Continental	235/45 R 20 100 V	Estate	In lega	-
Posteriore	Sinistra	3,0 mm	Pirelli	235/45 R 20 100 V	Estate	In lega	-
Posteriore	Destra	3,0 mm	Pirelli	235/45 R 20 100 V	Estate	In lega	-

DAMAGES

Interior



1 Interior	
Damage type	Dirty
Repair mode	Cleaning




2 Interior	
Damage type	Dirty
Repair mode	Chemical cleaning



3 Remote ignition key (no insert)	
Damage type	Missing
Repair mode	Repair/replace (lump sum)



4 Remote ignition key	
Damage type	Missing
Repair mode	Repair/replace (lump sum)

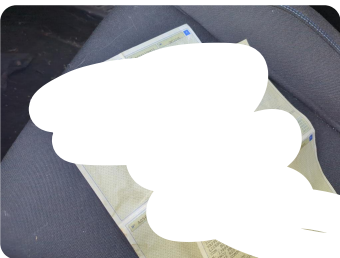

5 Registration document	
Damage type	Damaged
Repair mode	Replace



26 | Luggage compartment cover

Damage type	Missing
Repair mode	Replace

Exterior



6 | Alloy rim FL bitone/polychrome

Damage type	Scratch(es)
Repair mode	Replace



7 | Tyre FL

Damage type	Worn
Repair mode	Replace



8 | Alloy rim RL bitone/polychrome

Damage type	Scratch(es)
Repair mode	Replace




Documento di controllo dell'auto



9 | Alloy rim RR bitone/polychrome

Damage type	Scratch(es)
Repair mode	Repair/replace (lump sum)

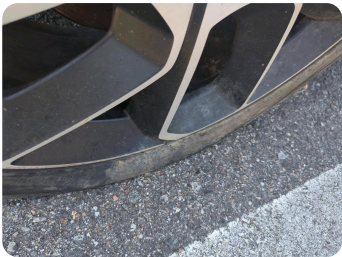

10 | Tyre RR

Damage type	Hole
Repair mode	Replace



11 | Wheel arch cover RR

Damage type	Broken
Repair mode	Replace



12 | Alloy rim FR bitone/polychrome

Damage type	Scratch(es)
Repair mode	Repair/replace (lump sum)



13 | Wheel arch cover FR

Damage type	Scratch(es)
Repair mode	Replace



14 | Tyre FR


Damage type	Worn
Repair mode	Replace

Documento di controllo dell'auto



15 | Roof pillar L

Damage type	Hail damage
Repair mode	Repair and paint (complete)

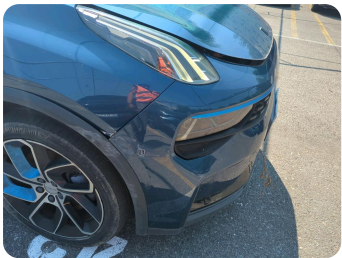

16 | Bumper F

Damage type	Broken
Repair mode	Replace and paint



17 | Bumper spoiler F

Damage type	Missing
Repair mode	Replace and paint



18 | Bumper moulding FL

Damage type	Scratch(es)
Repair mode	Paint




19 | Door RR

Damage type	Dent(s) and scratch(es)
Repair mode	Repair and paint (complete)



20 | Door trim FR

Damage type	Missing
Repair mode	Replace and paint

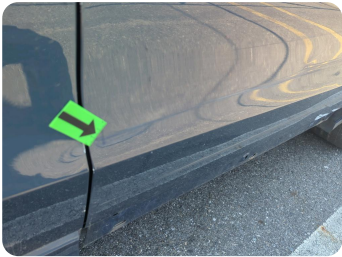


21 | Door FR

Damage type	Dent(s) and scratch(es)
Repair mode	Repair and paint (complete)




22 | Outside rear-view mirror housing R

Damage type	Scratch(es)
Repair mode	Paint

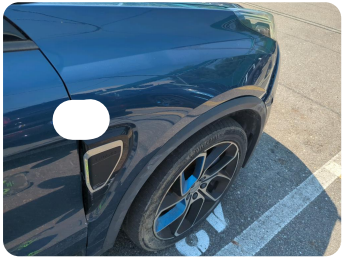

23 | Wing FR

Damage type	Dent(s) and scratch(es)
Repair mode	Repair and paint (complete)

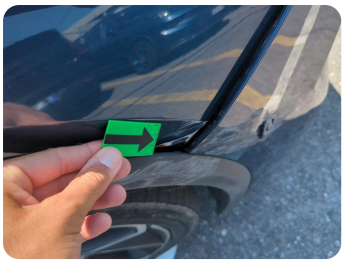

24 Wing trim FR	
Damage type	Broken
Repair mode	Replace



25 Roof pillar R	
Damage type	Dent(s)
Repair mode	Repair and paint (complete)



27 Tailgate / Boot	
Damage type	Crack
Repair mode	Replace and paint



28 Number plate R	
Damage type	Missing
Repair mode	Repair/replace (lump sum)



29 Rear wiper blade	
Damage type	Missing
Repair mode	Replace



30 Wiper arm rear	
Damage type	Missing
Repair mode	Replace



31 Rear light R tailgate	
Damage type	Broken
Repair mode	Repair/replace (lump sum)



32 Rear light R	
Damage type	Missing
Repair mode	Replace



33 Bumper R	
Damage type	Missing
Repair mode	Replace and paint



34 Roof	
Damage type	Hail damage
Repair mode	Repair and paint (complete)



35 | Other exterior parts


Damage type	Broken
Repair mode	Replace

Comments: scarico,piano ,traversa, riserva danni non visibili

FIRME

Ispettore / controllore

| 22/06/2026 11:24

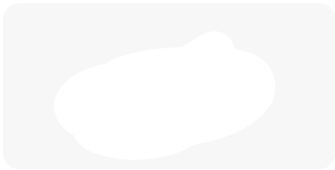

Documento di controllo dell'auto

Lynk & Co Italy

COMMERCIAL PHOTOS

