



Expertise

Protocol number: 46249823
Order No. / Reference: 26566147
Inspection date: 30 Jun 2026

Manufacturer: Opel

Model: Combo Cargo 1.5 D EHZ Edition

VIN: W0VEFYHT2MJ941448



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Combo Cargo 1.5 D EHZ Edition

Vehicle Identification number	W0VEFYHT2MJ941448
Mileage (Read)	135,836 km
First registration	27 Jan 2022
Number of holders	1
Next periodical technical inspection	05/2026
(Report not on hand)	

Power / Engine displacement	75 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Grey-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	21,080 km
Last service on / at	01/2026 at 126,921 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF971719
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AIQ 00869		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,390 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Steel	Fulda	4mm / 4mm
2)	205/60 R16 96V	Summer tyres on Steel	Fulda	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Fulda	3mm / 3mm
2)	205/60 R16 96H	Winter tyres on Steel	Fulda	3mm / 3mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Cover strip for sliding door track • ABS including brake assist and adaptive brake light • Anti-lock braking system (ABS) with cornering brake control and brake assist • Exterior mirror housings in black • Battery discharge protection • Floor covering: Cargo area floor, painted • Diesel particulate filter, maintenance-free • Three-point seat belts in all seats • Electronic Stability Program (ESP Plus) • Electric front windows • Speed controller • Air conditioning, front, with particle and odor filter • Paint finish: Solid color paint • Steering column, adjustable for reach and height • Upholstery: Cloth • Wheels: Steel wheels 6.5 J x 16 • Side protection strips • Seats: Driver's seat adjustable in 6 ways: length, height and backrest angle • Daytime running light • Doors: Sheet metal insert, driver's side • Doors: Sliding door, passenger side, sheet metal • Immobiliser • Central locking with remote control | <ul style="list-style-type: none"> • Storage compartments (edition) • Driver's side airbag • Automatic dipped headlights • Exterior mirrors, electrically adjustable, heated and manually folding • Hill Start Assist • On-board computer • Tachometer • Third brake light • Driver information display - LCD, black surround • Speed limiter • Transmission: 6-speed transmission • Headrests (2), front, height adjustable • Steering wheel remote control • Rear parking pilot • Wheels: Tire repair kit • Side impact protection • Speed-sensitive power steering • Start/Stop System • 12-volt power outlet in the center console • Traction control with engine and brake intervention (TC Plus) • Lashing eyes (6) in the cargo area • Heat-insulating glazing, tinted • Central locking: Ignition keys (2), one of which is foldable |
|--|---|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Driver and passenger side airbags • Tailgate, glazed (with rear window wiper and rear window heater - 2 folding ignition keys) • Radio: Multimedia radio with 8" color touchscreen display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, up to 10 mobile phones can be paired, display of pictures/films/videos via USB interface, smartphone integration via Apple CarPlay and Android Auto, USB interface, dual tuner, graphic equalizer, 4 speakers, cruise control, steering wheel remote control) | <ul style="list-style-type: none"> • Electric windows, front, with one-touch function and anti-pinch protection (as well as comfort closing function via remote control of the central locking system - electrically adjustable, heated and folding exterior mirrors) • Seats: Double passenger seat (Electric parking brake - storage compartment on the backrest of the middle seat of the double passenger seat) • FlexCargo partition wall with window (with pass-through function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable) • Doors: Sliding door, passenger side with fixed window |
|--|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Roof	Roof - Stone chips - Smart repair
2	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
3	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

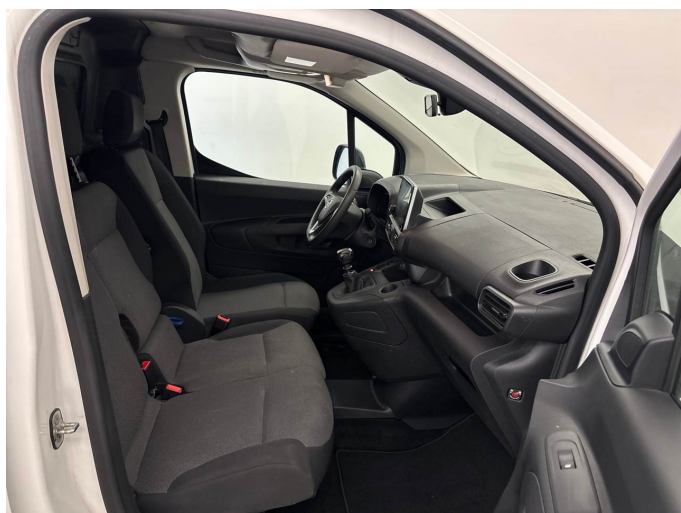


Figure 5: Interior - front

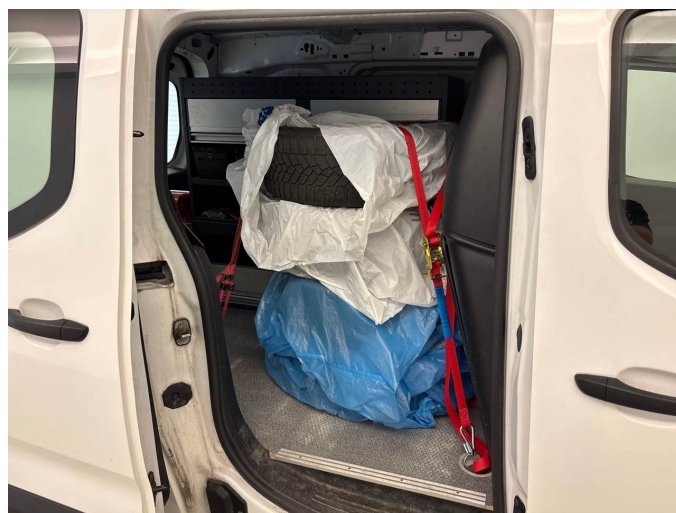


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

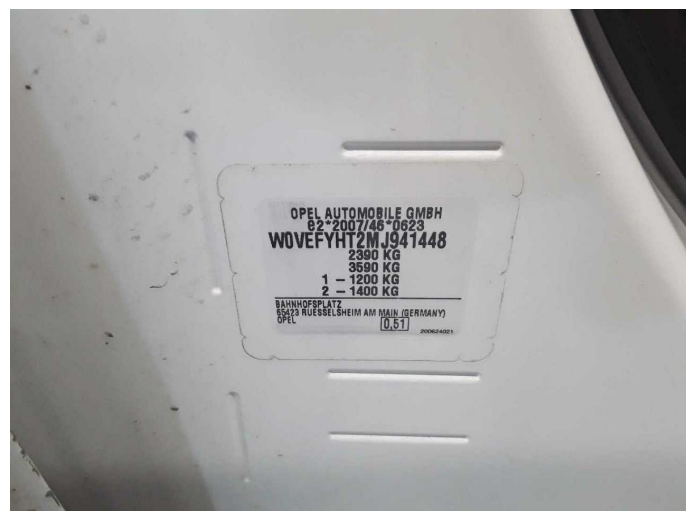


Figure 12: VIN



Figure 13: Mounted tyres

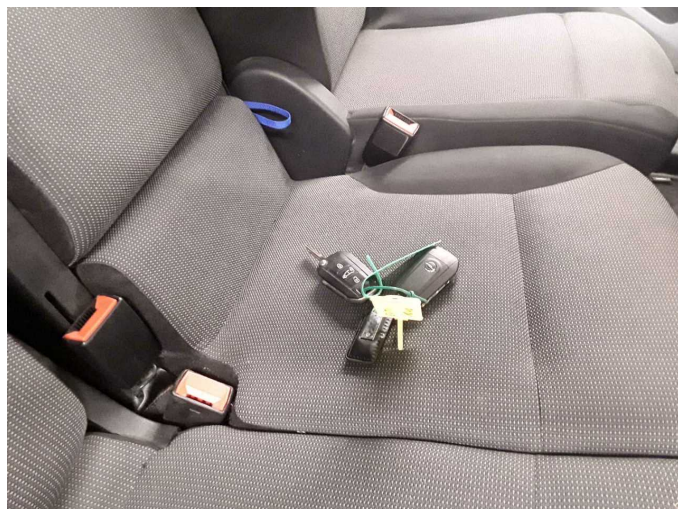


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

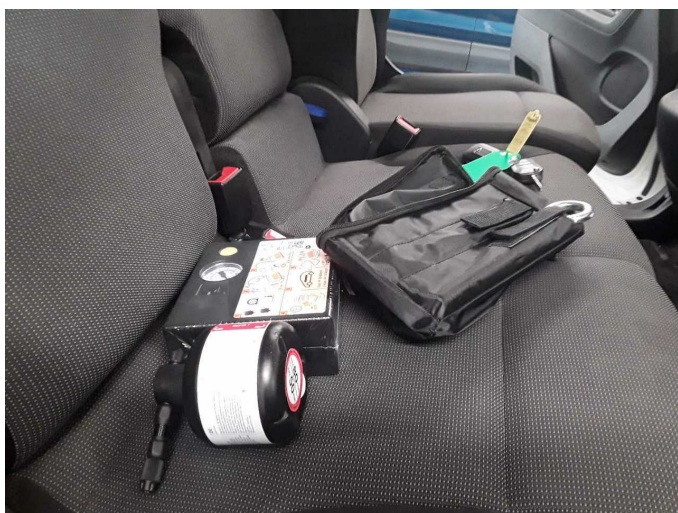


Figure 17: Misc.

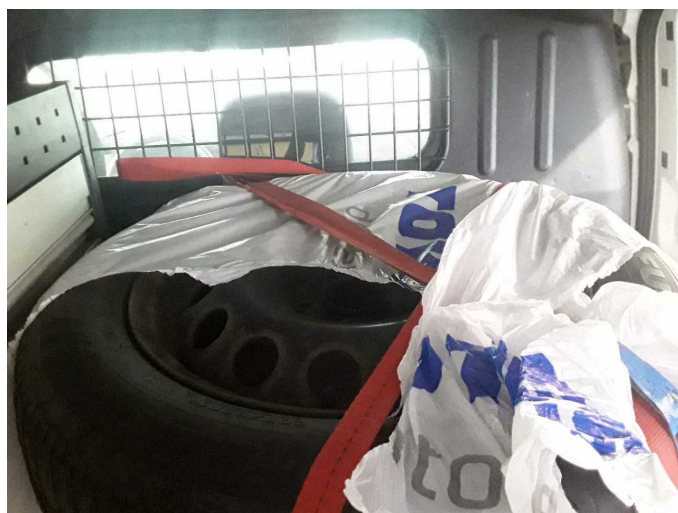


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Roof: Roof - Stone chips - Smart repair



Damage 1: Roof: Roof - Stone chips - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHT2MJ941448
Hersteller / Modell: OPEL OPEL Combo Cargo 1.5 D Edition

Datum	KM-Stand	Beschreibung
12.01.2026	126.921	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.09.2025	116.018	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
05.05.2025	107.530	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
21.05.2024	78.876	Lichtmaschine ern/inst; Systemtest/Eigendiagnose
08.05.2024	77.841	Bremsflüssigkeit ern; Bremsscheiben + Klötze v; HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
06.02.2024	67.220	Reparatur Sonstiges; Systemtest/Eigendiagnose
02.02.2024	67.130	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
17.04.2023	39.695	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges