



Expertise

Protocol number: 46575792
Order No. / Reference: 26739240
Inspection date: 14 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1T9RW004810



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Touran 2.0 TDI SCR DSG Comfortline

Vehicle Identification number WVGZZZ1T9RW004810
Mileage (Read) 118,763 km
First registration 13 Oct 2023
Number of holders 1

Power / Engine displacement 110 kw / 1,968 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 7
Type of drive Front drive
Type of vehicle Station wagon

Colour / colour code Uranograu
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Grey-Black

readiness to drive Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	11,200 km
Last service on / at	06/2026 at 112,100 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV405990
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / BWR 00515		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/60 R16 96V	Summer tyres on Steel	Pirelli	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger (with front passenger airbag deactivation, including driver's side knee airbag)
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Exterior mirror housings and door handles in body color
- third brake light
- black roof rails
- Decorative inlays "Piano Black" (for center console)
- Diesel particulate filter
- Tachometer
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Automatic headlight control with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage management package (with luggage net that can be fixed to rails)
- Additional luggage compartment lighting (removable and usable as a flashlight)
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats (device for attaching child seats to the rear seats)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Front center armrest (height and length adjustable - with removable storage box - 2 rear air vents)
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: Tire pressure monitoring system
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear (and seat belt tensioners in the rear)
- Seats: Folding tables on the backs of the front seats (tilt adjustable)
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear center console (and in the luggage compartment)
- Bumpers in body color
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Electrically folding exterior mirrors (dimming on the driver's side, ambient lighting and passenger-side mirror lowering)
- Headliner in Storm Grey
- Decorative inserts "New Brushed Design" (for instrument panel and front door trim)
- Digital Cockpit, multi-colored (various info profiles selectable)
- Electronic parking brake including auto-hold function
- Electronic Stability Program (ESP) with counter-steering support (Incl. ABS with brake assist, ASR (traction slip control), EDS (electronic differential lock), MSR (engine drag torque control) and trailer stabilization)
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover (with comfort opening, extendable, removable and stowable)
- Luggage compartment floor height adjustable (with fixing element)
- Glove compartment with cooling option
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Air conditioning (with active combination filter)
- Headrests (3) in the 2nd row of seats (height adjustable)
- Black radiator grille with chrome strip on the lower slat
- Paint finish: Solid
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16 (tires 205/60 R 16)
- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely (with table and pass-through function)
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable



- Telephone interface
- Textile floor mats (front and rear)
- USB-C interface (charging power up to 45 W)
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))
- Central locking without safe locking, with remote control and 2 remote folding keys

- Lane change assistant "Side Assist" and parking assistant (warns the driver of vehicles that could pose a danger during lane changes by means of visual signals in the respective exterior mirror - monitors the area behind and beside the vehicle when reversing out of a parking space - issues visual and acoustic warning signals when a vehicle is detected crossing the parking space path - can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Warning tone and light for unfastened front seat belts (warning light for unfastened rear seat belts)
- Electronic immobilizer
- Green heat-insulating glazing (sides and rear)
- Black trim strips on the side windows

Extra equipment

- Anti-slip mat
- luggage compartment net
- Package: Business (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - cargo net partition - automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning light)

- High beam assistant "Light Assist"
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm (8 inch) touchscreen - 8 speakers - digital radio reception DAB+ - USB-C interfaces (up to 45 W charging power) - Bluetooth mobile phone interface)
- Wheels: Spare wheel in driving tire size, steel (on-board tools and jack)
- Smartphone cable

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Wing mirror - left side	Cap - Scratch(es) - Smart repair
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Trim / covers	Trim / covers - Broken / torn - Replace
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Door - rear left side	Door - Scratch(es) - Paint
9	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
10	Side panel - rear right side	Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint
11	Boot lid / rear door	Boot lid - Scratch(es) - Paint
12	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
13	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint
14	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 11 Feb 2026	1.095,54 €
2	Rear, Side right, Provided by user / customer, from 11 Feb 2026	5.018,31 €

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front right side, Professionally carried out, Invoice of repair done Non-existent
5	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	210 µm	Mudguard - right side	181 µm
Side panel - rear right side	2,080 µm	Door - rear right side	191 µm
Door - front right side	251 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres

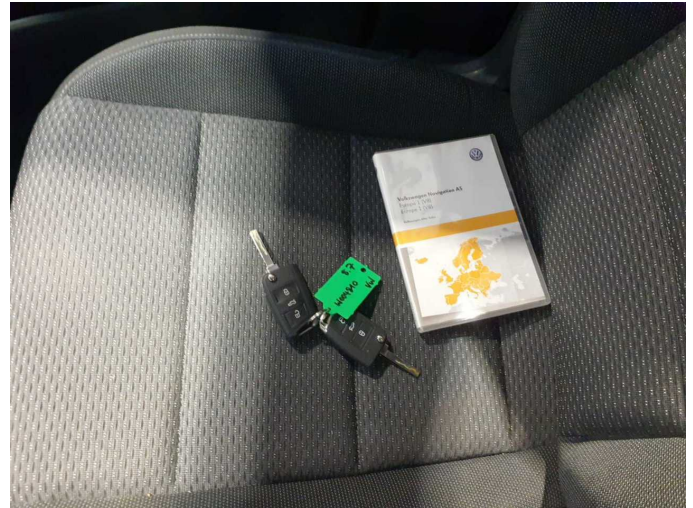


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

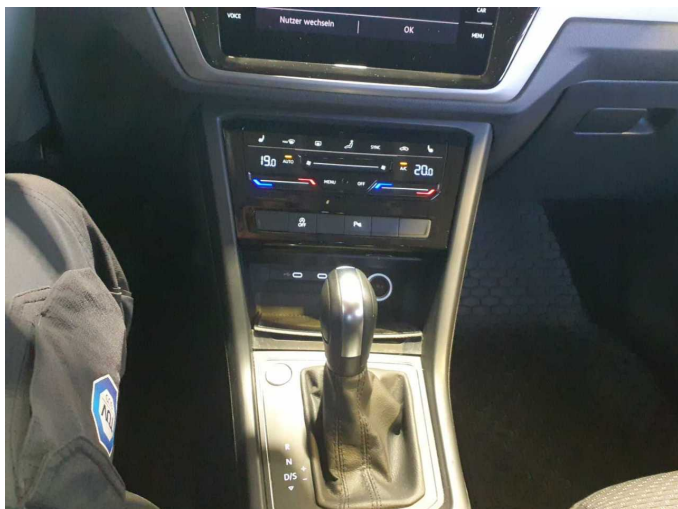


Figure 19: Misc.



Figure 20: Misc.

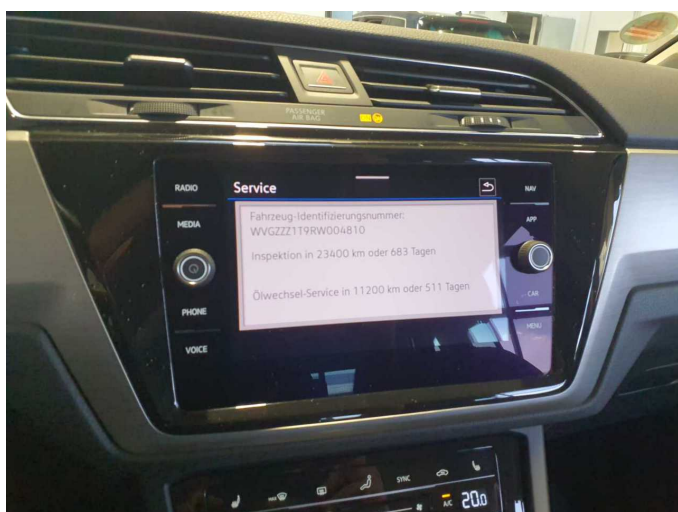


Figure 21: Misc.

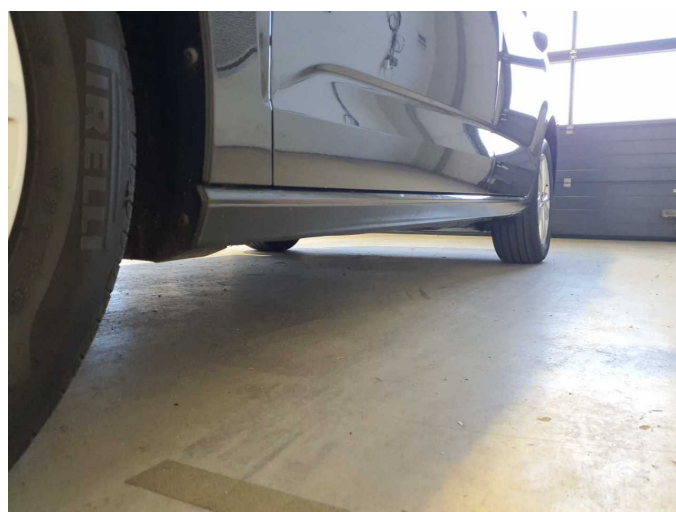


Figure 22: Misc.

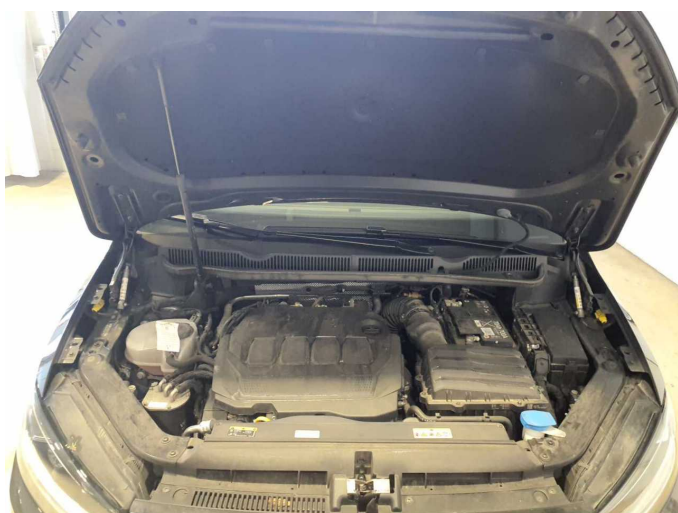


Figure 23: Misc.

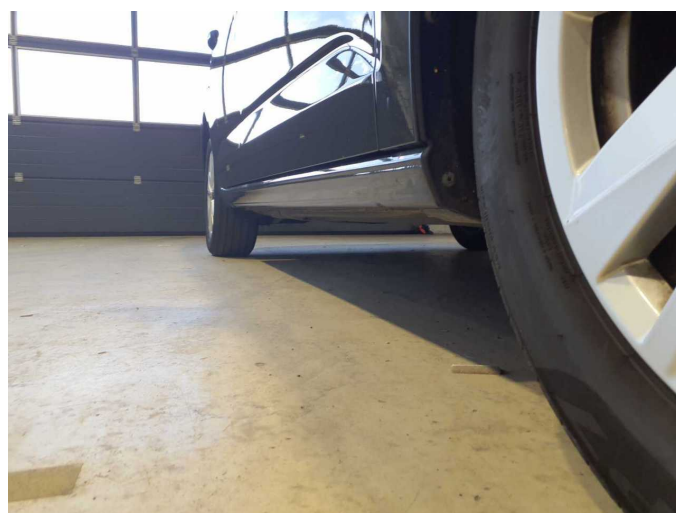


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

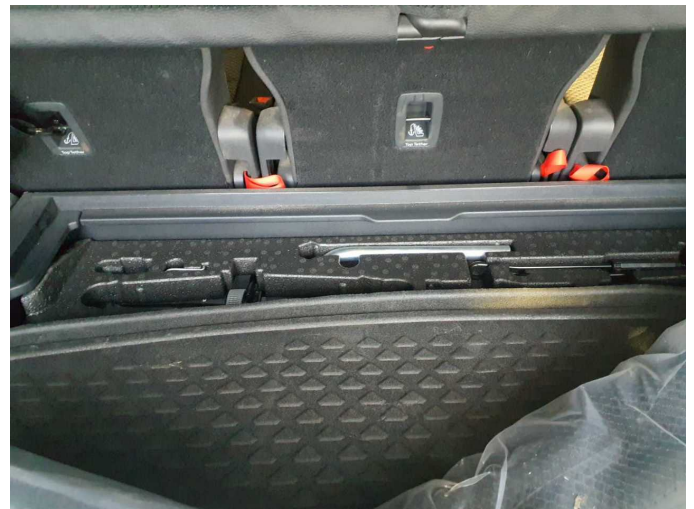


Figure 28: Misc.



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

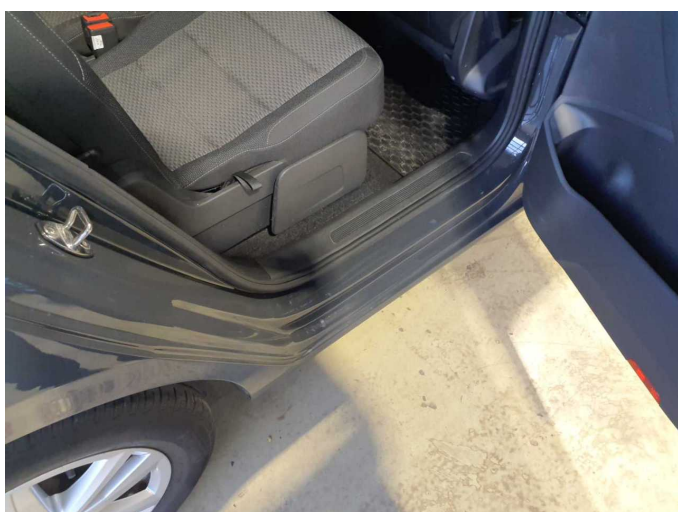


Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair

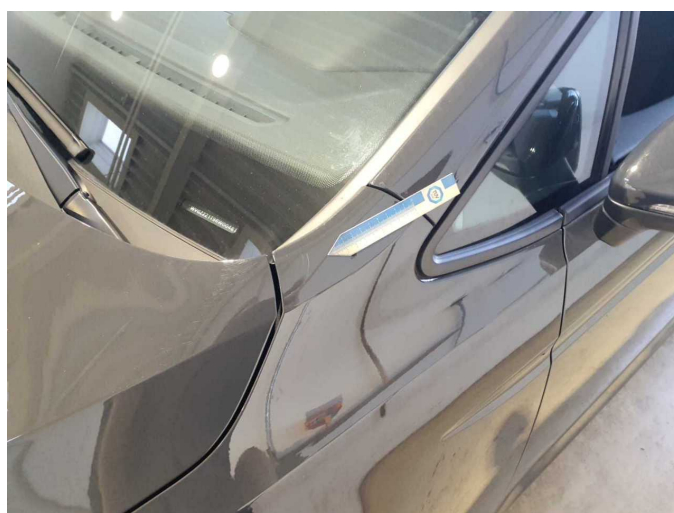

Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

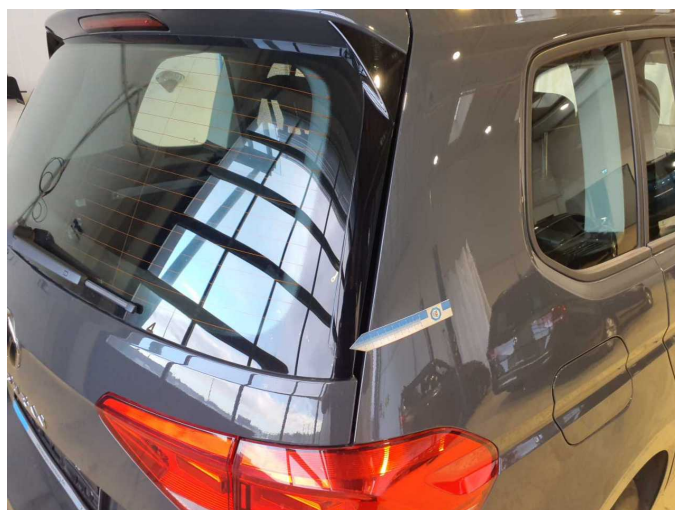

Damage 6: Trim / covers: Trim / covers - Broken / torn - Replace

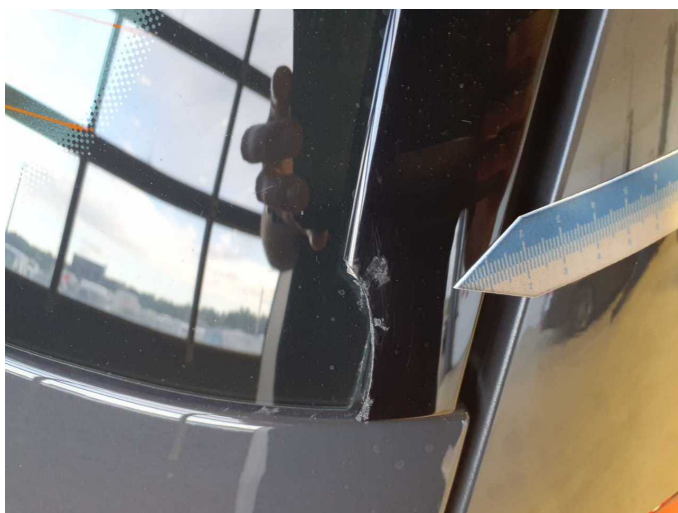


Damage 6: Trim / covers: Trim / covers - Broken / torn - Replace

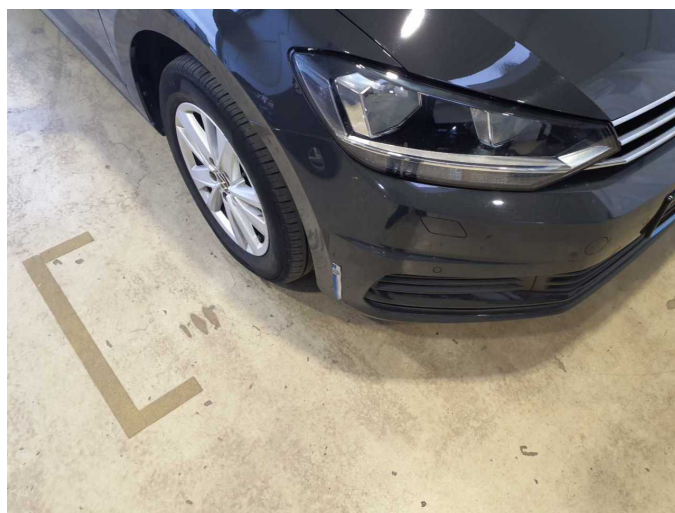

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

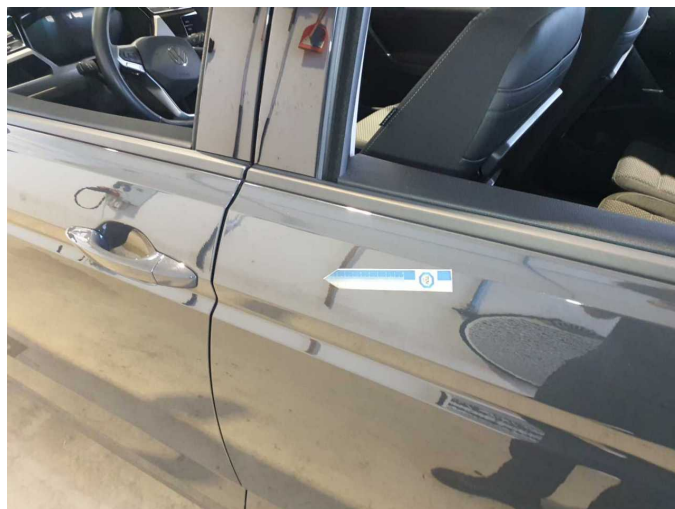


Damage 8: Door - rear left side: Door - Scratch(es) - Paint




Damage 8: Door - rear left side: Door - Scratch(es) - Paint

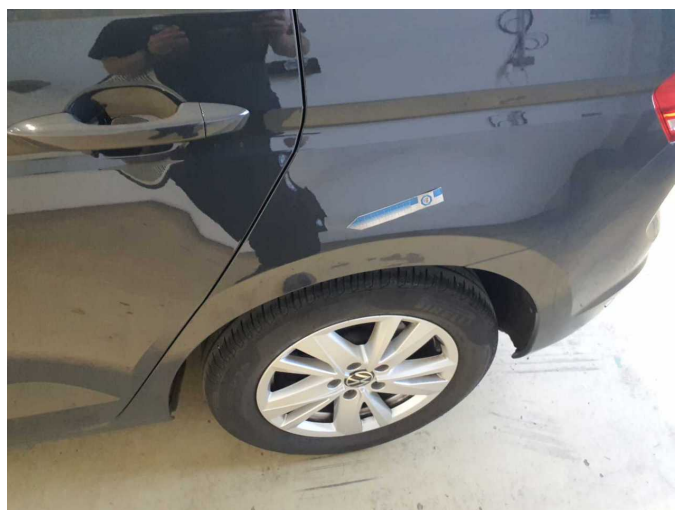

Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

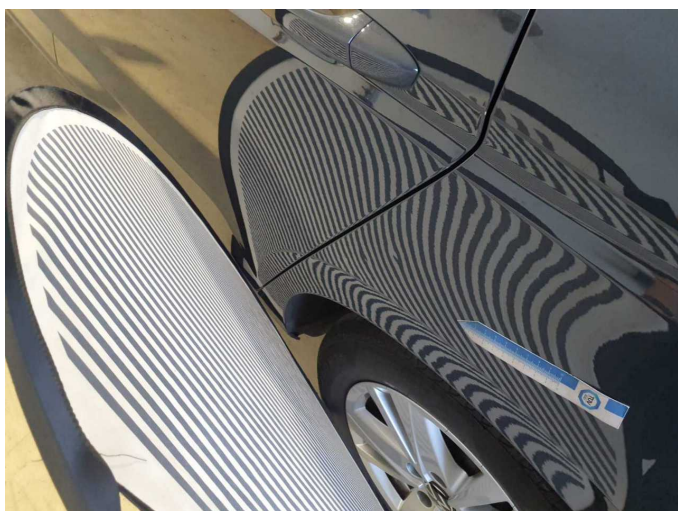

Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

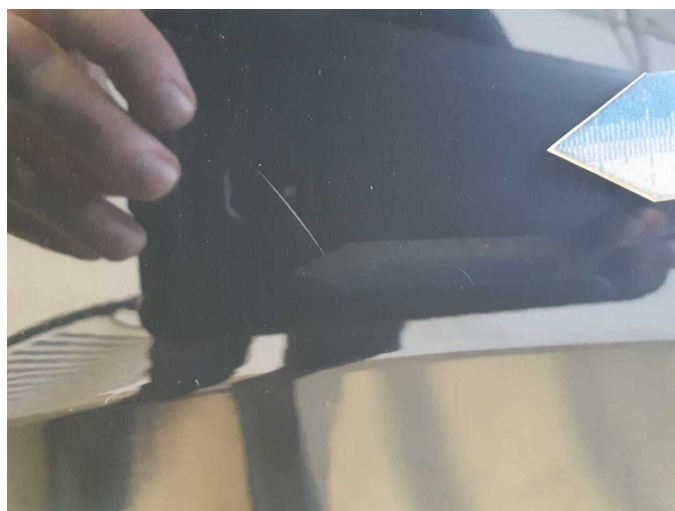


Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

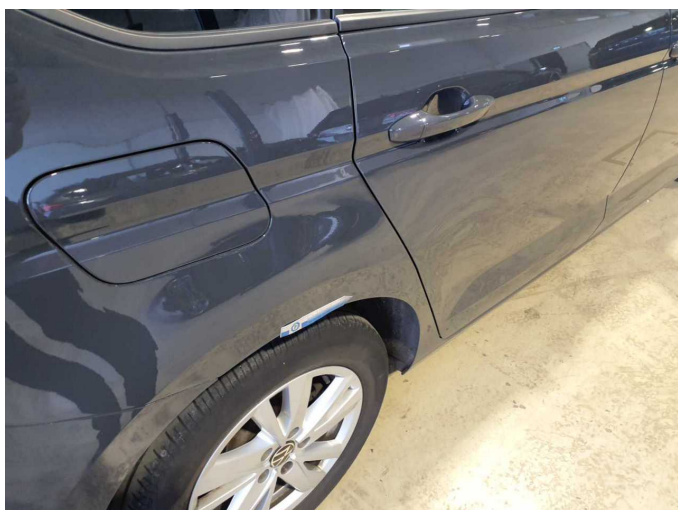

Damage 10: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 10: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 10: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 10: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 10: Side panel - rear right side: Side panel (Einschlüsse) - Unprofessionally repaired - Repair and paint



Damage 11: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 11: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 11: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

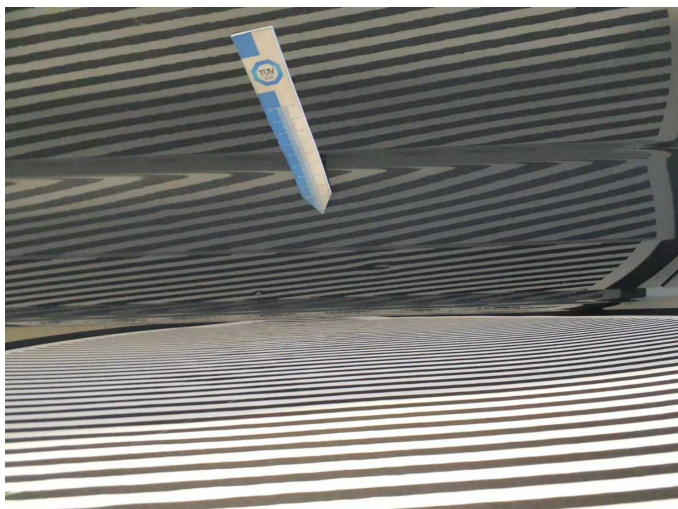


Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

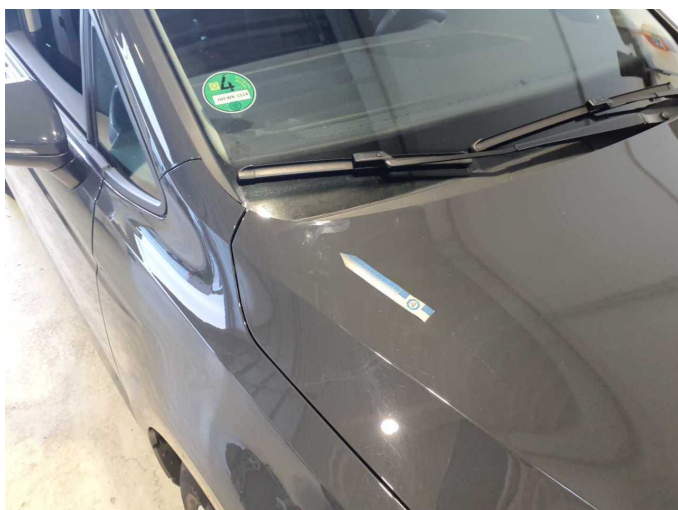


Damage 13: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

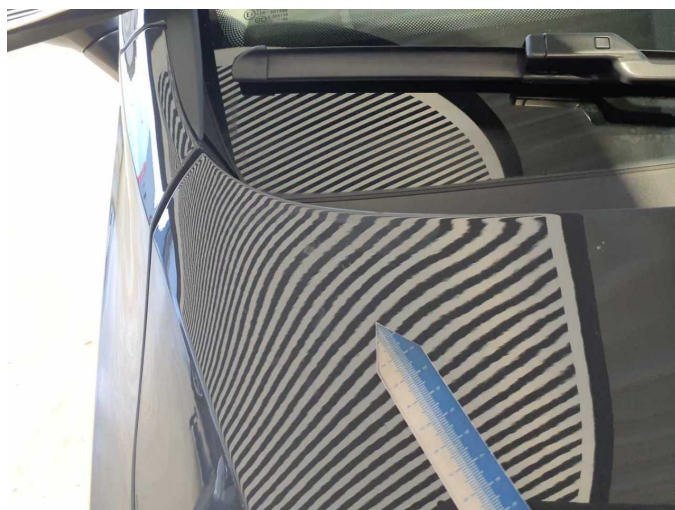

Damage 13: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 13: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

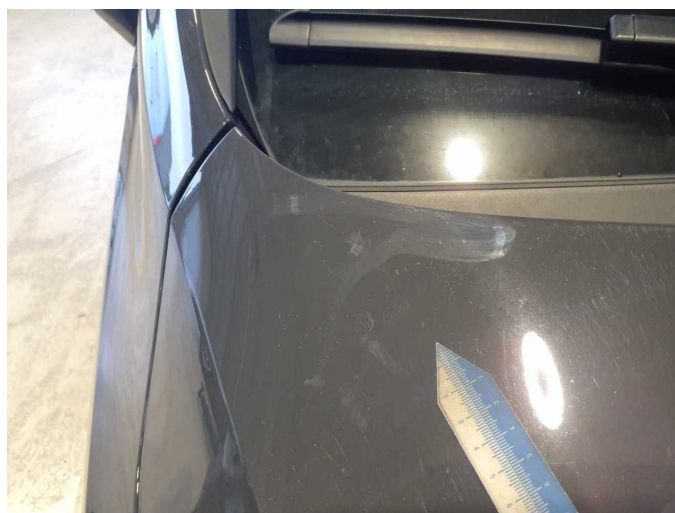

Damage 13: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint



Damage 14: Roof: Roof - Scratch(es) - Paint



Damage 14: Roof: Roof - Scratch(es) - Paint




Damage 14: Roof: Roof - Scratch(es) - Paint



Damage 14: Roof: Roof - Scratch(es) - Paint



Damage 14: Roof: Roof - Scratch(es) - Paint

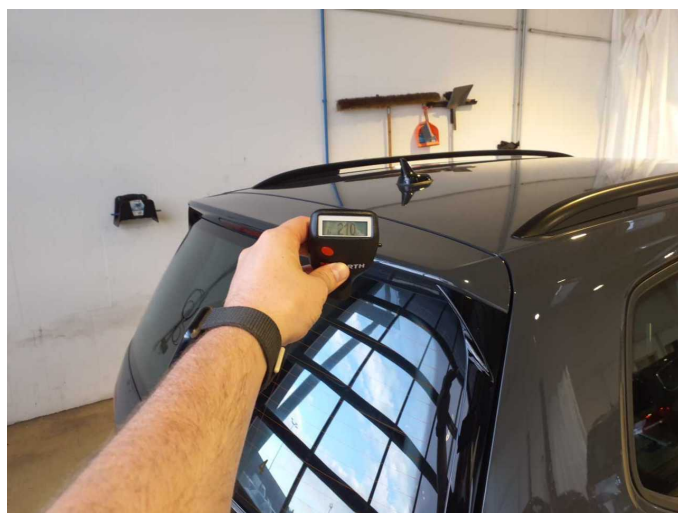

Repainting 1: Boot lid / rear door




Repainting 1: Boot lid / rear door



Repainting 2: Mudguard - right side



Repainting 2: Mudguard - right side

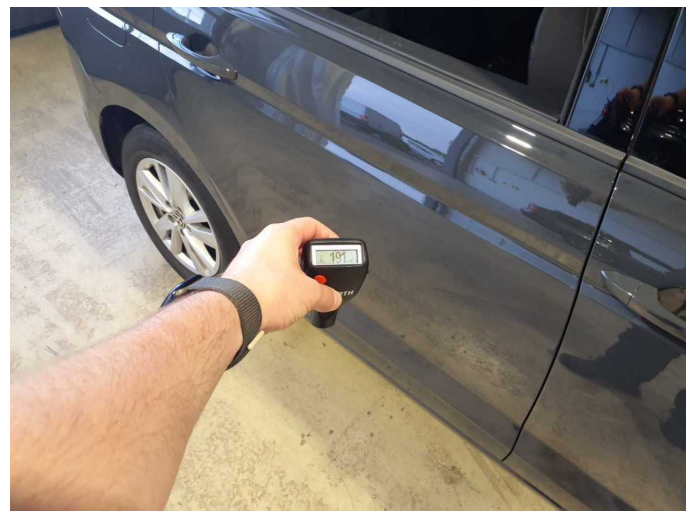

Repainting 3: Door - rear right side



Repainting 3: Door - rear right side



Repainting 4: Door - front right side



Repainting 4: Door - front right side



Repainting 5: Side panel - rear right side



Repainting 5: Side panel - rear right side