



Expertise

Protocol number: 46868102
Order No. / Reference: 26656782
Inspection date: 24 Jul 2026

Manufacturer: Skoda
VIN: TMBJR7NU0P5064888

Model: Karoq 1.5 TSI ACT DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 1.5 TSI ACT DSG Sportline	
Vehicle Identification number	TMBJR7NU0P5064888
Mileage (Read)	159,500 km
First registration	3 Jul 2023
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	stahlgrau (F7A)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,600 km
Last service on / at	03/2026 at 149,071 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT116045
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ASO 03893		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,940 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 96V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/50 R18 96V	Summer tyres on Light alloy	Continental	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Illuminated trunk
- Hydraulic brake assist (HBA)
- Roof rails, black
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Floor mats
- Cruise control
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Interior Design Sportline
- Climatronic air conditioning (2-zone)
- Front headrests are fixed, rear headrests are height-adjustable.
- LED taillights in crystal glass look
- Reading lights at the front of the headliner
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Fog light
- Package: Comfort PLUS
- Package: Sport
- Rear parking sensors
- Radio accessories: USB port in the center console (Type-C)
- Wheels: 18" alloy wheels Procyon black gloss-turned, Aero black matte
- Karoq seat belts
- Seats: Height-adjustable front seats
- Sun visor on driver and passenger side with illuminated vanity mirror
- Lashing eyes in the trunk
- Immobiliser
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Third vehicle key
- eCall
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Aero rear window wiper including windshield washer system
- ISOFIX preparation on the outer rear seats
- Trunk cover, fixed
- Paintwork: Special paintwork
- LED brake light in the rear spoiler
- Steering wheel: Heated sports leather steering wheel (DSG) with multifunction buttons
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Package: Infotainment Basic
- Package: Light & Visibility
- Package: Winter PLUS
- Radio accessories: Digital radio reception DAB+
- Tire Mobility Kit
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- Speed limiter
- 12V socket - in the center console
- Preparation for a trailer hitch
- Central locking with remote control



Extra equipment

- Adaptive Cruise Control (ACC) (control range up to 210 km/h) (replaces cruise control)
- Luggage net partition
- Package: Parking PLUS (Parking Assist - Front and rear parking sensors - 360° AreaView surround view camera including reversing camera)
- Panoramic sliding sunroof, electric (incl. sunshade - no glasses compartment in the headliner)
- Skoda Infotainment Online (online map updates for navigation (only in conjunction with Infotainment Plus) - display of weather data, news, headlines - petrol stations and parking space search and much more)
- Auxiliary heating
- Electric tailgate operation with comfort opening
- Package: Driver assistance (Predictive Adaptive Cruise Control (ACC) (control range up to 210 km/h) - Adaptive Lane Keeping Assist - Traffic sign recognition - Capacitive steering wheel with Hands Off Detection - USB-C charging port on the interior mirror - Emergency and traffic jam assist)
- Swiveling trailer hitch with electric release (including trailer stabilization)
- Trailer Assist

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
3	Door - rear right side	Door - Scratch(es) - Smart repair
4	Roof	Roof - Damage by hail - Smooth repair work
5	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Interior	Interior - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 25 Jun 2024	1.238,43 €
2	Front, Side - left, Provided by user / customer, from 31 Jan 2024	2.396,63 €
3	Rear, Side right, Provided by user / customer, from 20 Feb 2024	4.735,97 €



Repainting

No. Repainting

1 Side panel - rear right side

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

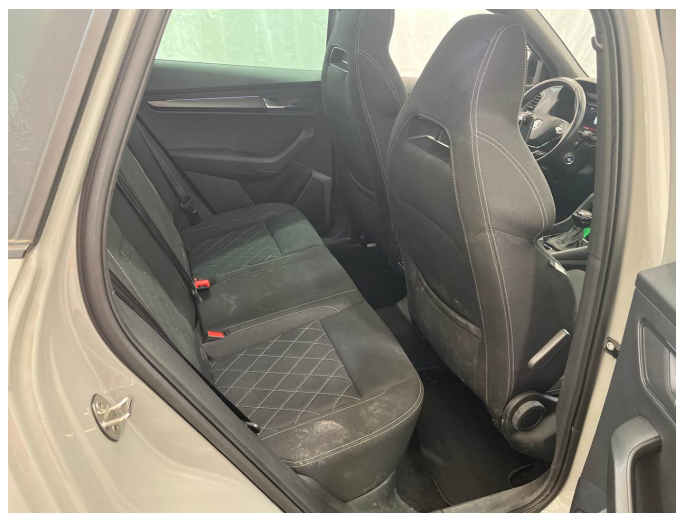


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

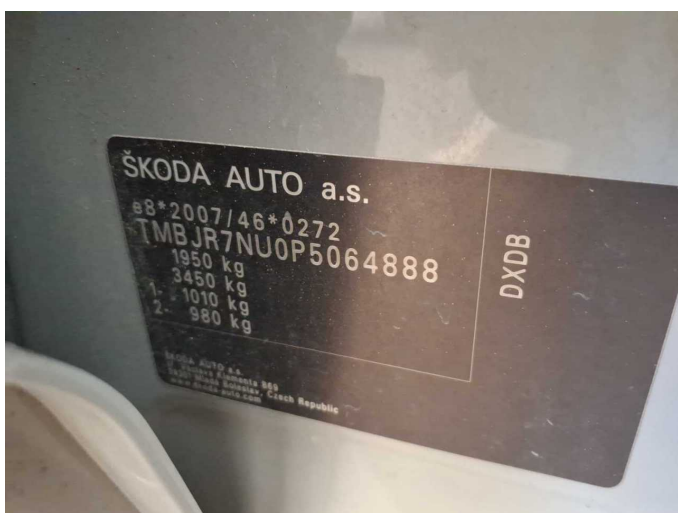


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

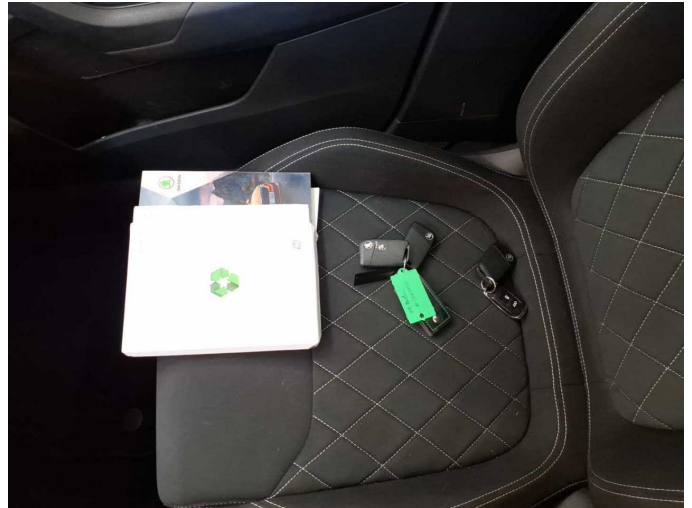


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.

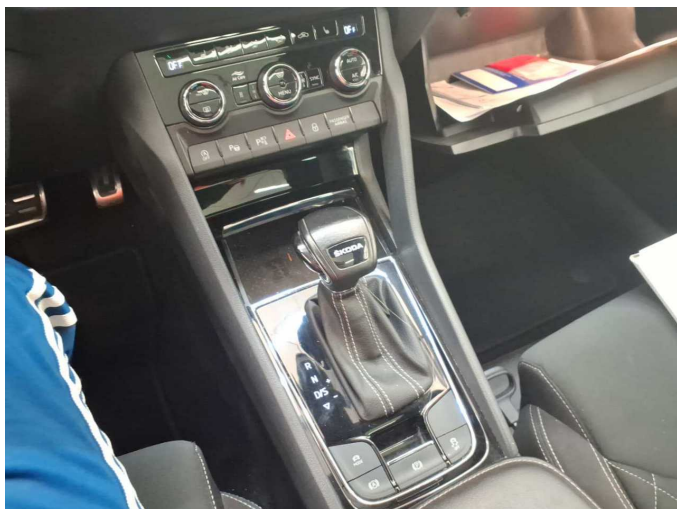


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

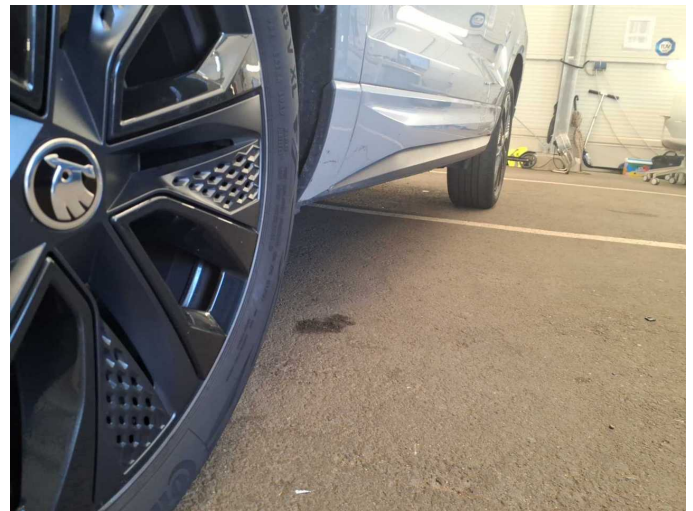


Figure 22: Misc.

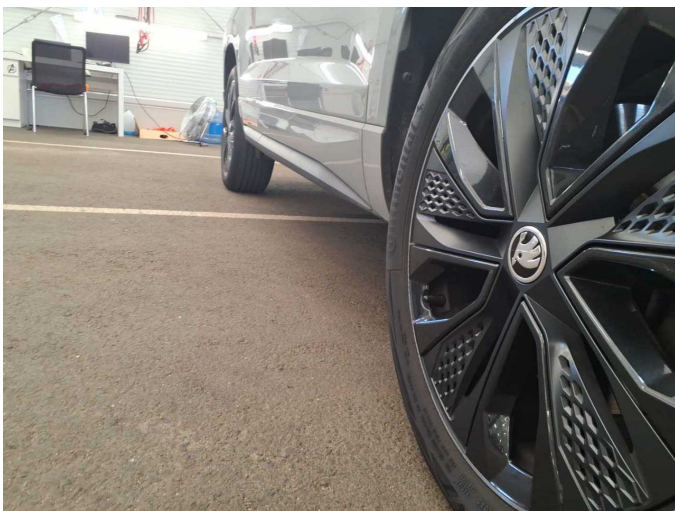


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

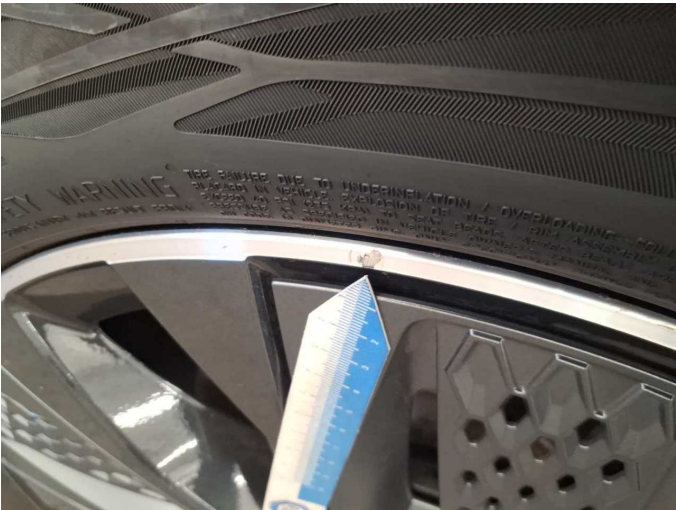

Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 4: Roof: Roof - Damage by hail - Smooth repair work



Damage 4: Roof: Roof - Damage by hail - Smooth repair work



Damage 4: Roof: Roof - Damage by hail - Smooth repair work



Damage 4: Roof: Roof - Damage by hail - Smooth repair work



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side