



Expertise

Protocol number: 46479144
Order No. / Reference: 26535239
Inspection date: 13 Jul 2026

Manufacturer: Ford

Model: Transit Custom 320 L2H1 VA Trend

VIN: WF01XXTTG1NR50367



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Custom 320 L2H1 VA Trend	
Vehicle Identification number	WF01XXTTG1NR50367
Mileage (Read)	113,272 km
First registration	8 Dec 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 9
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,000 km
Last service on / at	06/2025 at 83,502 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP471195
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMX 03782		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,190 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Pirelli	7mm / 7mm
2)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	All-season tyres on Steel	Goodyear	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- On-board computer
- roof, flat
- Double-leaf rear door (with window), with 90° hinges
- Third brake light
- Windows, 2nd row: Side windows fixed, right and left
- Front electric windows
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed transmission
- Interior lighting front and rear with delay function
- Paint finish: Solid color paint
- Emergency brake assist including emergency brake light
- Particulate filter: diesel particulate filter
- Wheel trims
- Tire Pressure Monitoring System (TPMS)
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 tires
- Sliding door entry light automatically illuminates when the door is opened
- Side protection strips
- Seat belts
- Seats: Seat Package 13 (Custom Trend)
- Start-stop system
- Front bumper painted in body color
- Lashing eyes 4
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric
- Driver and passenger side airbags
- Exterior mirrors, electrically adjustable and heated
- Rubberized floor surface throughout the entire vehicle up to the D-pillar
- Headliner in driver's cab and passenger compartment
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- Ford Easy Fuel
- Generator, 240 A
- Cruise control including imitation leather steering wheel
- Lockable glove compartment with lid
- Front air conditioning
- Adjustable steering column
- Front and rear parking pilot system including fog lights
- Radio: Audio system 17: Ford audio system with 4" multifunction display, additionally with DAB/DAB+
- Wheels/Tires: Spare wheel, steel wheel
- Headlights: Halogen projector headlights
- Mud flaps front and rear
- Side windows fixed, second row, right and left
- Power steering
- Seats: 3 seats (single and double seats) in the 2nd and 3rd rows including height-adjustable headrests
- Power outlet: 12-volt connection
- Doors: Sliding door on the right
- Immobiliser
- Central locking with remote control

Extra equipment

- Air conditioning front and rear (including rear water heating)
- Wheels: All-season tires (suitable for winter use) R16
- Radio: Audio System 24: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation system. (Radio (FM/AM) 8" touchscreen multifunction display (20.32 cm), 6 speakers, FordPass Connect, integrated control panel and audio remote control on the steering wheel, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/send function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, Android Auto and Apple CarPlay support, capacitive touchscreen technology,...), dynamic navigation, lane guidance, road map for Western Europe)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - left side	Cap - Scratch(es) - Smart repair
2	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
3	Sliding door, right	Sliding door with glass panel - dent(s) - Smooth repair work
4	Electronic systems	Parking assistance - Functional / admissibility - Perform diagnosis
5	Side panel - rear right side	Sill (Gummi) - Broken / torn - Replace
6	Door - front left side	Door - Dent / paintcoat damage - Smart repair
7	Boot lid / rear door	Rear door - right side (Dellen) - Corrosion - Repair and paint
8	Boot lid / rear door	Rear door - left side (Korrosion) - Scratch(es) - Paint
9	Rear bumper	Rear bumper - Damaged - Replace
10	Door - front right side	Door (Kratzer, Dellen) - Corrosion - Repair and paint
11	Front bumper	Front bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Side panel - rear right side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 31 Jul 2024	972,08 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	157 µm
------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

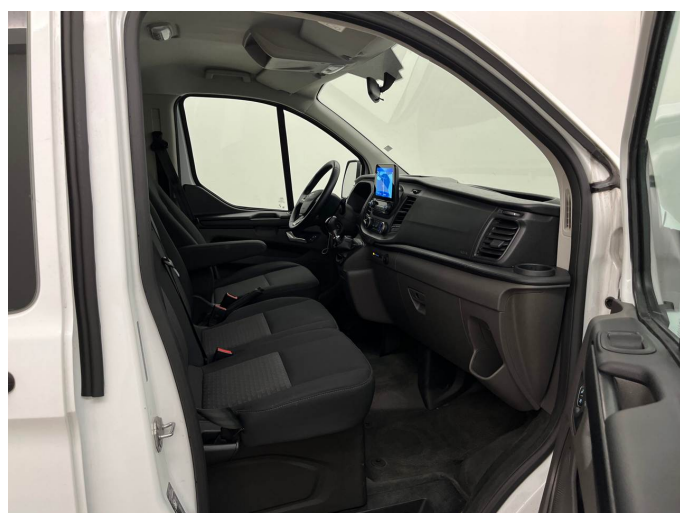


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

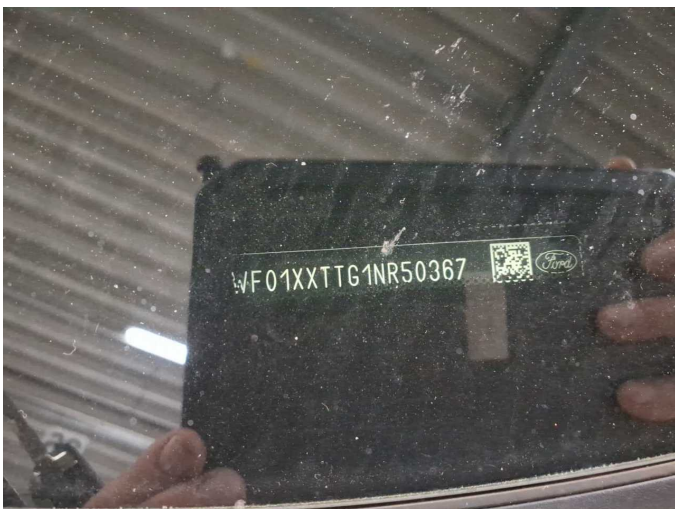


Figure 11: VIN



Figure 12: Mounted tyres

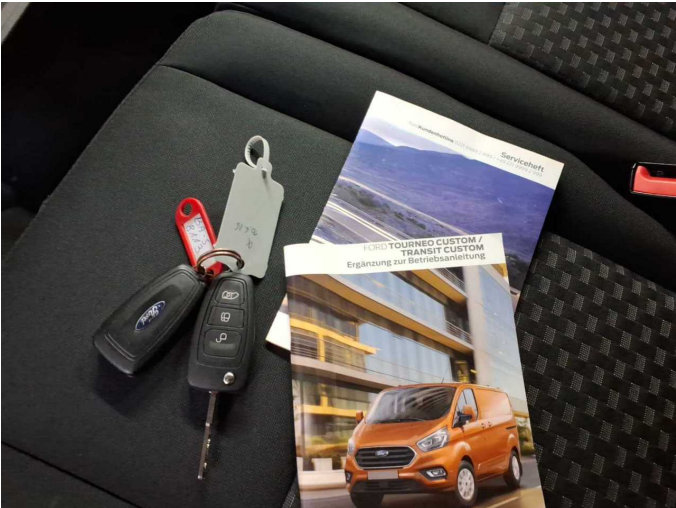


Figure 13: Documents

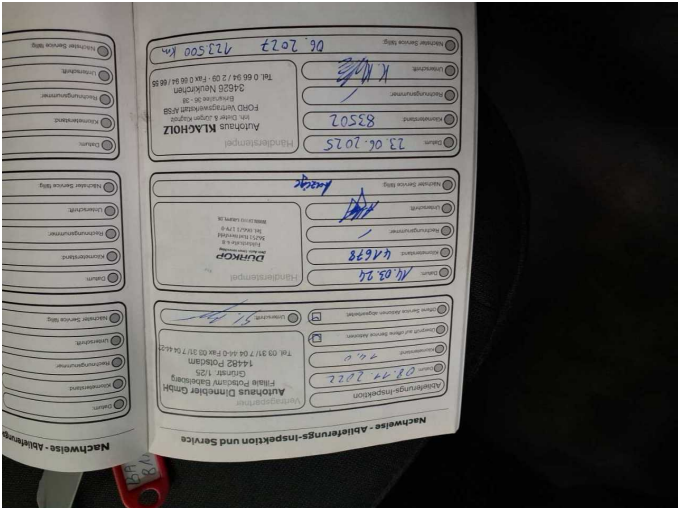


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 3: Sliding door, right: Sliding door with glass panel - dent(s) - Smooth repair work




Damage 3: Sliding door, right: Sliding door with glass panel - dent(s) - Smooth repair work



Damage 4: Electronic systems: Parking assistance - Functional / admissibility - Perform diagnosis



Damage 4: Electronic systems: Parking assistance - Functional / admissibility - Perform diagnosis

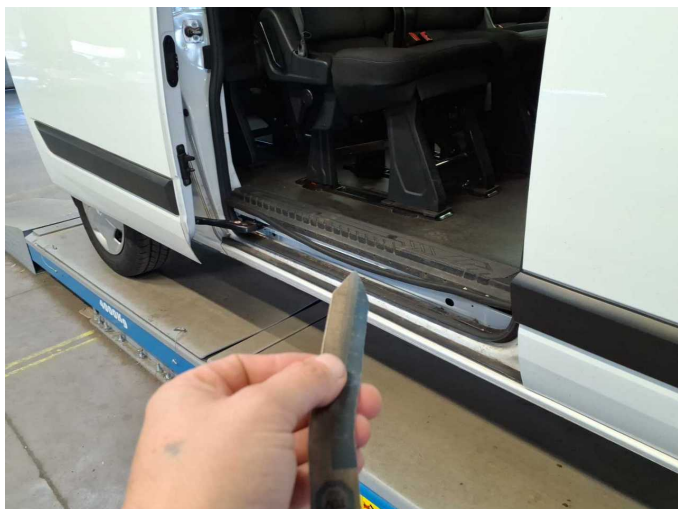

Damage 5: Side panel - rear right side: Sill (Gummi) - Broken / torn - Replace



Damage 5: Side panel - rear right side: Sill (Gummi) - Broken / torn - Replace




Damage 5: Side panel - rear right side: Sill (Gummi) - Broken / torn - Replace



Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair

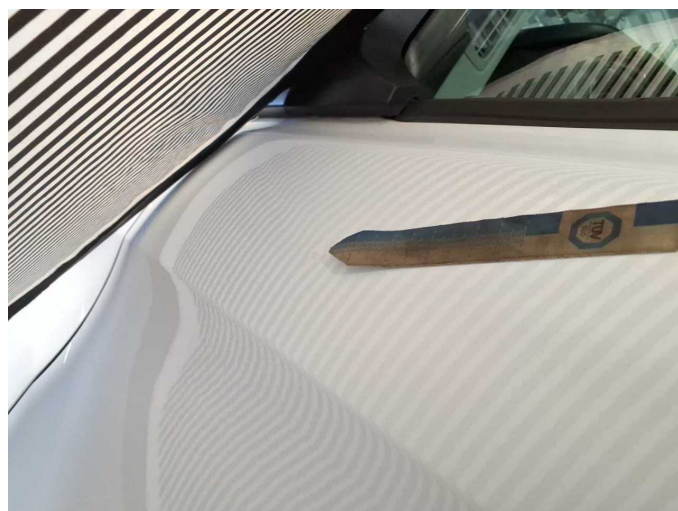


Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair

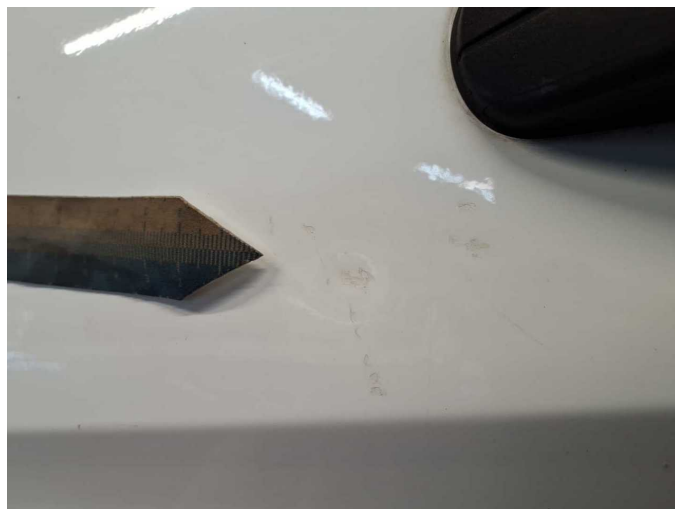


Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair

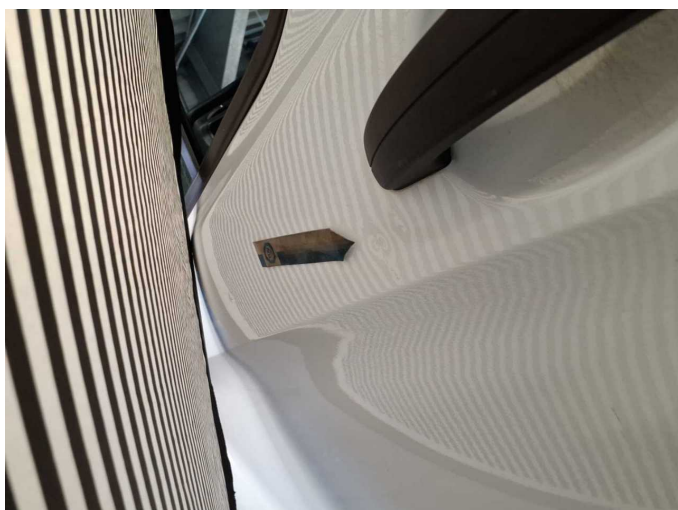

Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair

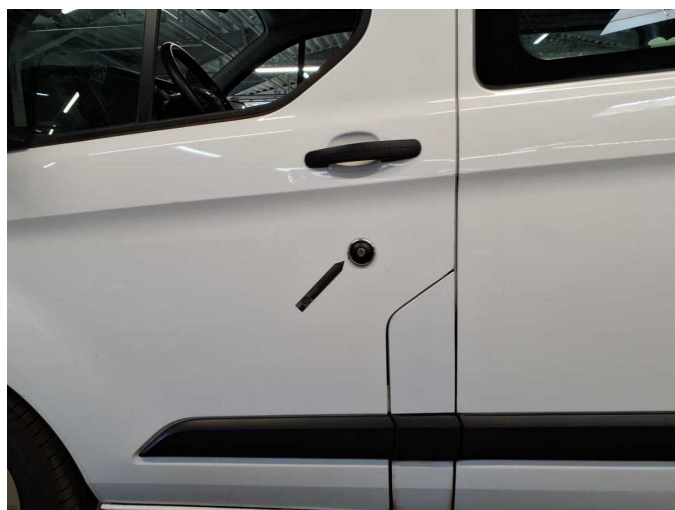

Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair

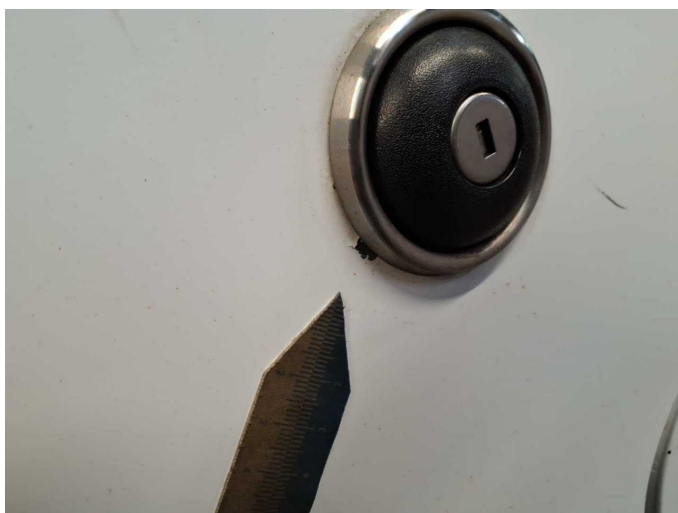


Damage 6: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion - Repair and paint



Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint

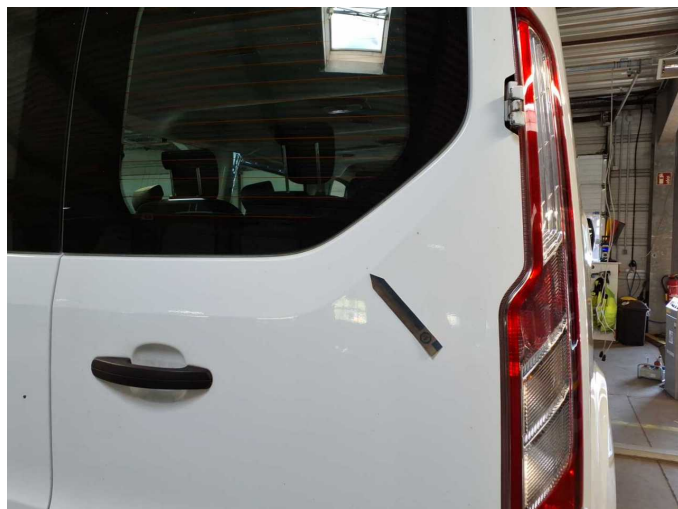

Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint



Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint




Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint




Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint



Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint

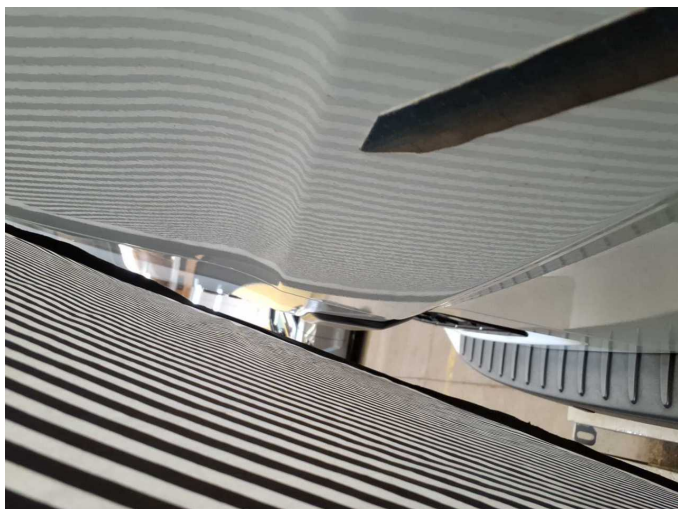

Damage 7: Boot lid / rear door: Rear door - right side (Dellen) - Corrosion
- Repair and paint

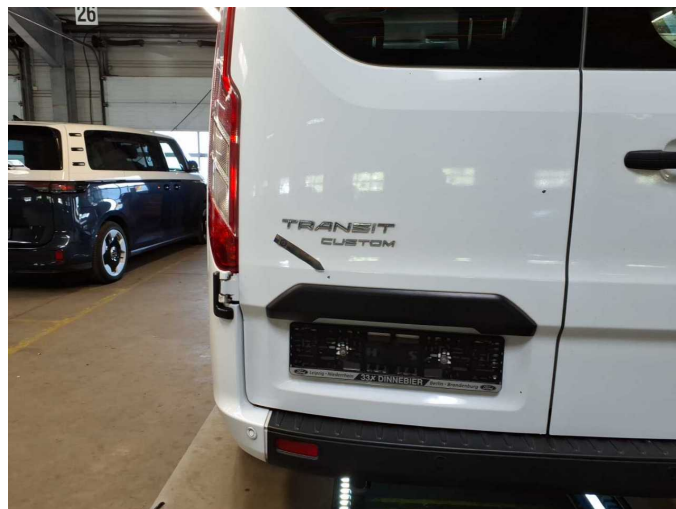

Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) -
Scratch(es) - Paint



Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) -
Scratch(es) - Paint



Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) -
Scratch(es) - Paint




Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) -
Scratch(es) - Paint




Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) -
Scratch(es) - Paint



Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) - Scratch(es) - Paint

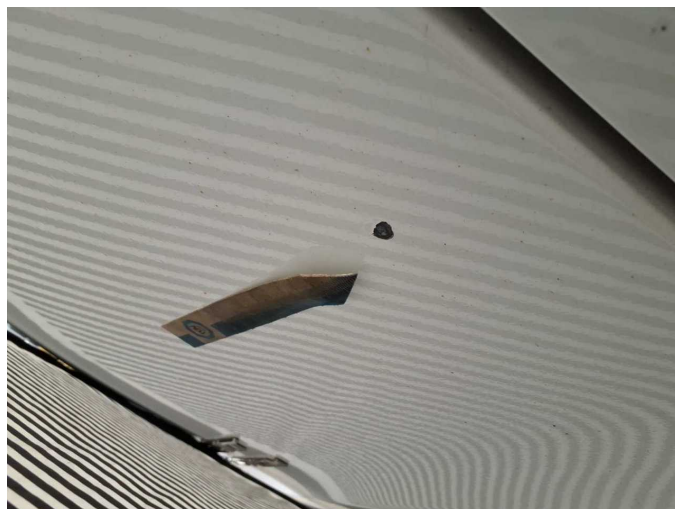

Damage 8: Boot lid / rear door: Rear door - left side (Korrosion) - Scratch(es) - Paint

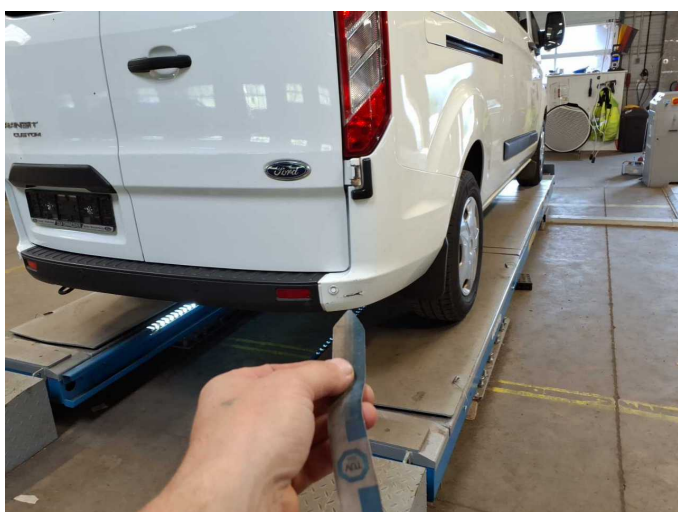


Damage 9: Rear bumper: Rear bumper - Damaged - Replace




Damage 9: Rear bumper: Rear bumper - Damaged - Replace



Damage 9: Rear bumper: Rear bumper - Damaged - Replace

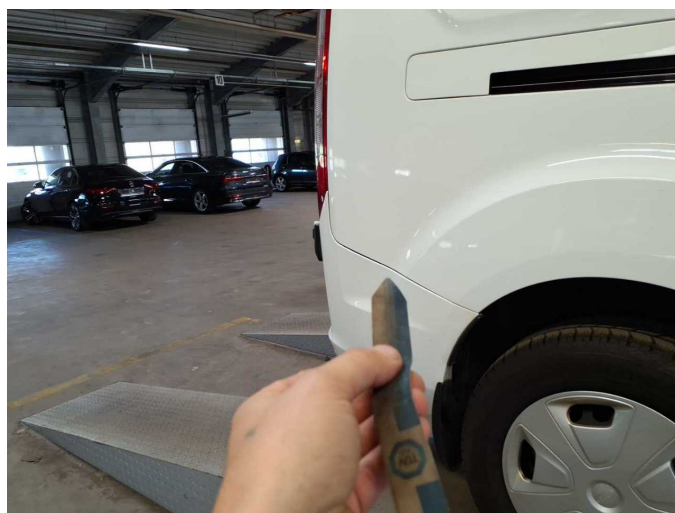

Damage 9: Rear bumper: Rear bumper - Damaged - Replace

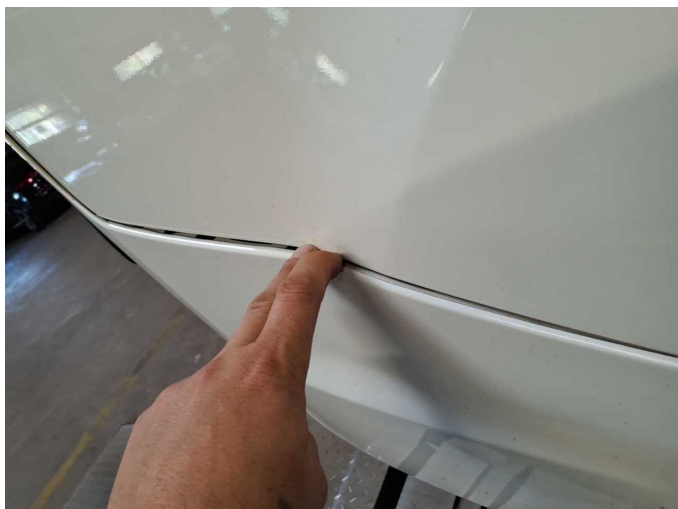

Damage 9: Rear bumper: Rear bumper - Damaged - Replace



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint



Damage 10: Door - front right side: Door (Kratzer, Dellen) - Corrosion - Repair and paint




Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 11: Front bumper: Front bumper - Scratch(es) - Paint

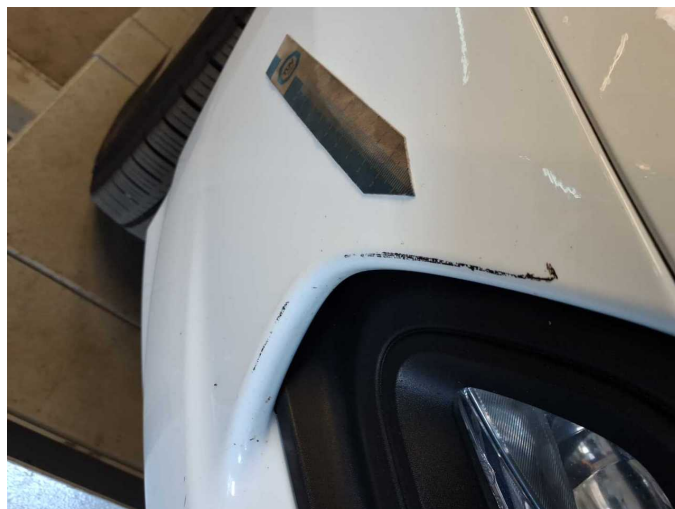

Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Repainting 1: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF01XTTG1NR50367

Hersteller / Modell: FORD FORD Transit Custom 320 L2H1 VA Trend

Datum	KM-Stand	Beschreibung
28.11.2025	98.862	AU
21.11.2025	98.427	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
23.06.2025	83.502	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.01.2025	69.751	Bremsbelagfühler ern; Bremsklötze vorne
11.07.2024	52.635	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
14.03.2024	41.678	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.12.2023	33.717	Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne