



Expertise

Protocol number: 46460485
Order No. / Reference: 26577733
Inspection date: 10 Jul 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D M Aut. Tourer

VIN: VXEEVHZ7NZ010644



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Zafira Life 2.0 D M Aut. Tourer

Vehicle Identification number VXEEVHZ7NZ010644

Mileage (Read) 217,461 km

First registration 11 Mar 2022

Number of holders 1

Next periodical technical inspection 03/2027
(Report on hand)

Power / Engine displacement 130 kw / 1,997 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle Van

Colour / colour code Diamant Schwarz

Doors / Seats 5 / 4

Upholstery type Leather

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	23 Monat(e)
Last service on / at	05/2026 at 210,040 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ638246
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / BBA 00303		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,100 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	3mm / 3mm
2)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and passenger side
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Headliner with 3 reading lights and ambient lighting
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Transmission: 8-speed automatic transmission
- Head-Up Display
- Interior lighting
- Child safety lock, electric
- Automatic climate control: Dual-zone automatic climate control
- Headlight range adjustment, manual
- Fog light
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 1 (High Beam Assist - Driver Alert System - Solar Reflect Windscreen - Lane Keeping Assist - Traffic Sign Recognition with Intelligent Speed Control)
- Panoramic reversing camera 180° (display of the area behind the vehicle up to 180 degrees, including steering guidelines, when reverse gear is engaged in the color display of the infotainment system)
- Radio accessories: Sound system
- Tire repair kit
- Wheels: Alloy wheels in bicolor, 7J x 17
- Keyless locking and starting system Keyless Open & Start
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats
- Seats: 6 leather seats, Claudia Schwarz (Comfort driver's seat: 6-way electrically adjustable, with lumbar support, armrest, massage function and seat heating - Comfort passenger seat: 4-way electrically adjustable, with lumbar support, armrest, massage function and seat heating - Two individual seats on rails in the 2nd row with armrests, swivel, foldable and removable and ISOFIX - Two individual seats on rails in the 3rd row with armrests, foldable and removable and ISOFIX - Headrests, height-adjustable)
- Door: Electric sliding door, driver and passenger side
- Illuminated door sill trim
- Xenon headlights with LED daytime running lights
- Ignition keys (2), both foldable
- Storage compartments
- Airbag: Head airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- third brake light
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Floor mats in all rows of seats
- Electric handbrake
- Glazed tailgate, with rear window wiper and heater
- Interior mirror, automatically dimming
- Air conditioning: Auxiliary air conditioning, rear
- Steering wheel: Multifunction leather steering wheel, flattened at the bottom
- Navigation system: Multimedia Navi Pro with 7" color touchscreen display, voice control for audio, telephone, navigation
- Package: Driver Assistance Package 2 (Semi-adaptive cruise control and speed limiter - Forward collision warning - Instrument cluster, 3, 5" color driver information display - Emergency brake assist - Solar reflective windscreen)
- Parkpilot, front and rear
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Rain sensor
- Tire pressure warning
- Sliding door trim with cover, in vehicle color
- Side impact protection
- Power steering
- Safety steering column, height and length adjustable
- Heated seats for driver and front passenger
- Solar Protect thermal insulation glazing
- Sun visors driver and passenger side
- Sunshades in the 2nd row of seats
- 12-volt power outlet in the second row of seats
- 12V socket
- Power outlet: 220/230V, in the second row of seats under the passenger seat
- Traction Control (TC) Plus
- Exterior door handles, in chrome
- Immobiliser
- Central locking with remote control



Extra equipment

- Detachable trailer hitch
- Folding table on rail system (movable between 2nd and 3rd row of seats, removable)
- Panoramic glass roof with 2 separate windows, manually retractable
- Luggage compartment partition net (vertical behind the last row of seats)
- Paint finish: Metallic
- Webasto auxiliary heater (programmable with remote control)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Engine	Engine cover - Damage caused by marten / rodent - Replace
4	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
5	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
6	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
7	Interior	Interior - Scratched - Loss in value
8	Rear bumper	Rear bumper - Scratched - Repair and paint
9	Front bumper	Front bumper - Scratched - Repair and paint
10	Side panel - rear right side	Side panel (wellig) - Unprofessionally repaired - Repair and paint
11	Door - rear right side	Door - Scratch(es) - Paint
12	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
13	Door - front right side	Door - Scratch(es) - Paint
14	Boot lid / rear door	Boot lid - Deformed - Repair and paint
15	Seat - front	Seat cover - left side - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Rear of vehicle - Key trailer hitch
Equipment - Tirefit complete
Interior - Rear shelf



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 6 Jan 2023	11.988,25 €

Repainting

No.	Repainting
1	Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	1,430 µm
------------------------------	-------------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

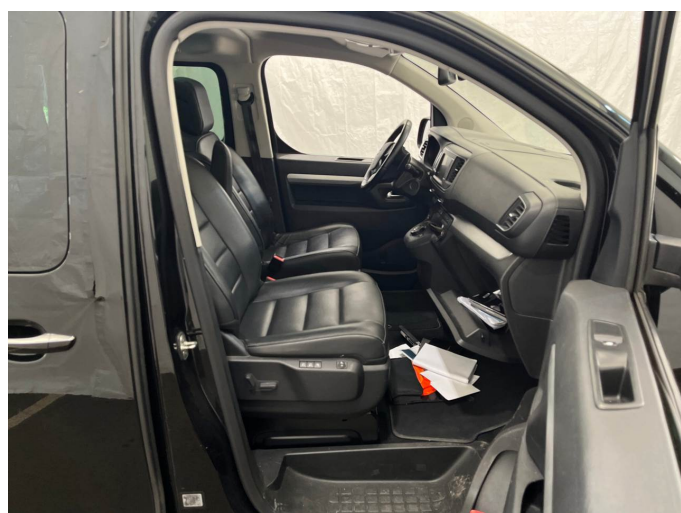


Figure 5: Interior - front

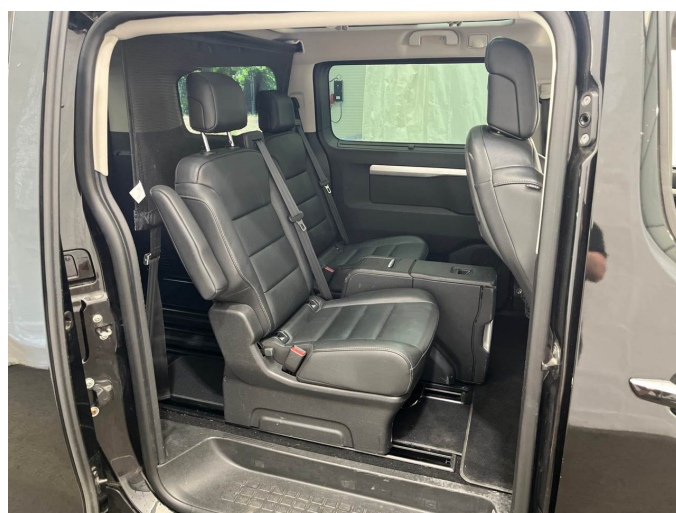


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

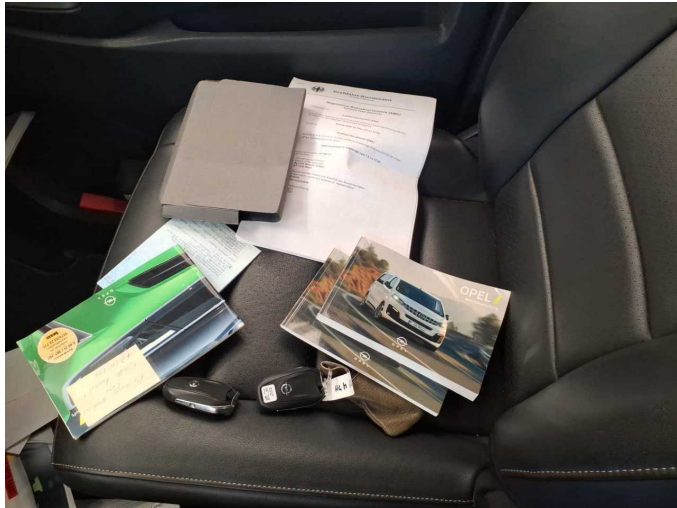


Figure 13: Documents

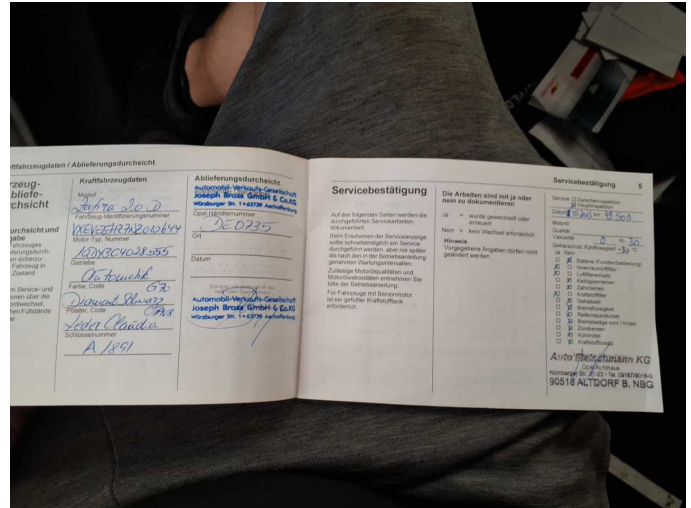


Figure 14: Documents

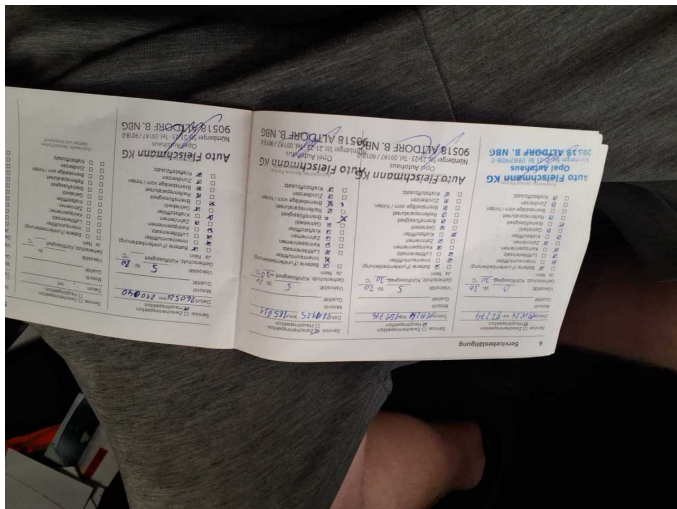


Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.

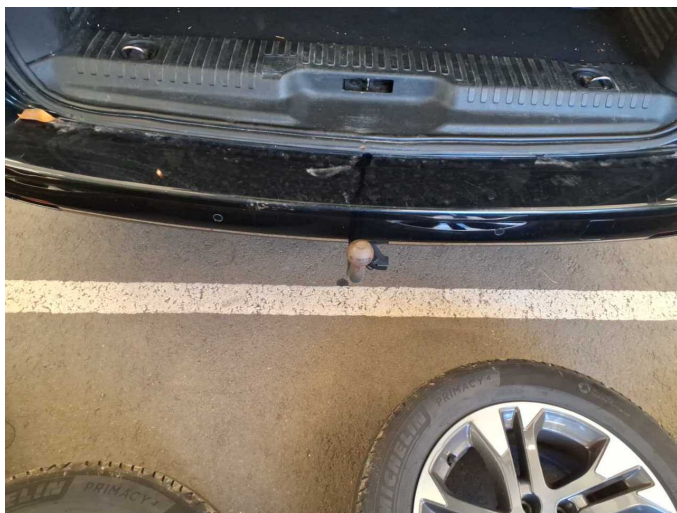


Figure 21: Misc.



Figure 22: Misc.

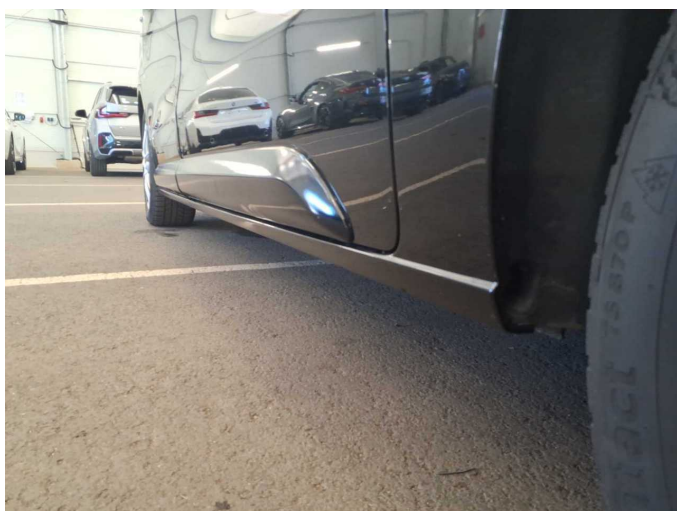


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

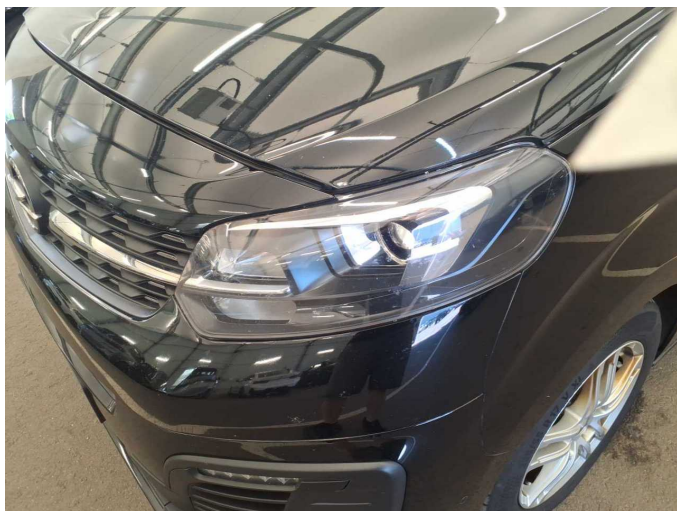


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 5: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

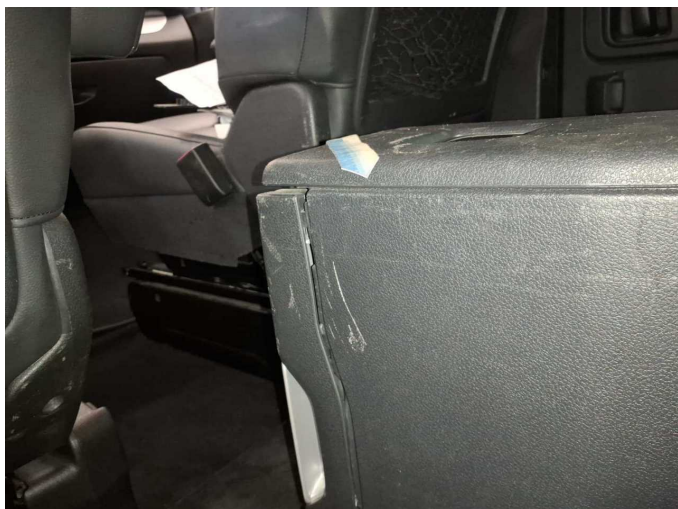


Damage 7: Interior: Interior - Scratched - Loss in value

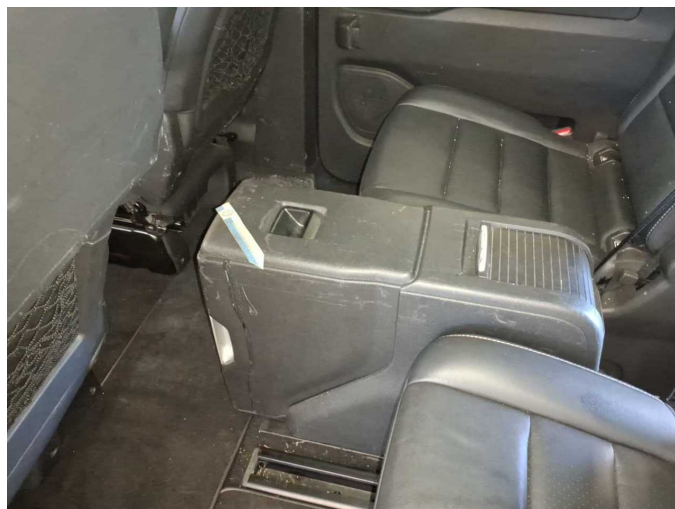

Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value

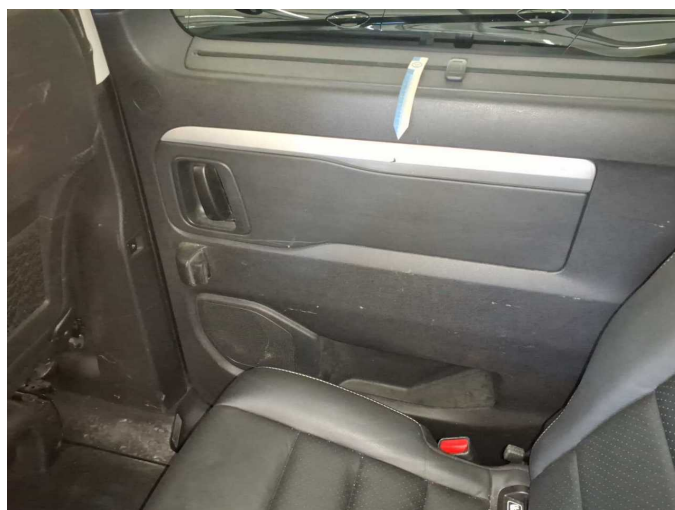

Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value




Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value

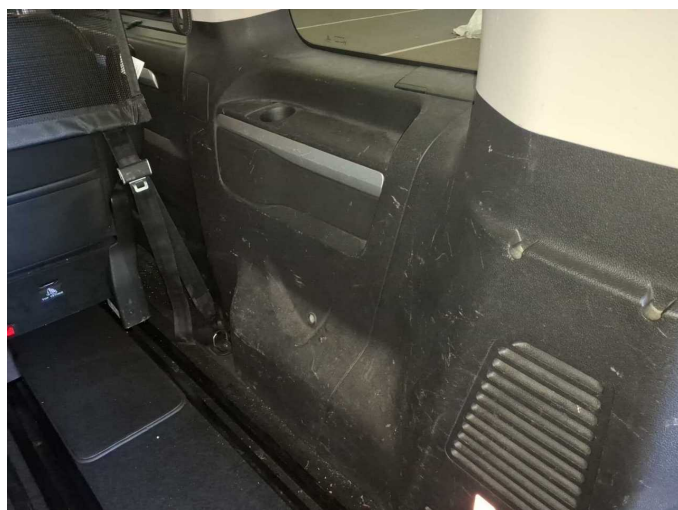

Damage 7: Interior: Interior - Scratched - Loss in value




Damage 7: Interior: Interior - Scratched - Loss in value



Damage 7: Interior: Interior - Scratched - Loss in value




Damage 7: Interior: Interior - Scratched - Loss in value

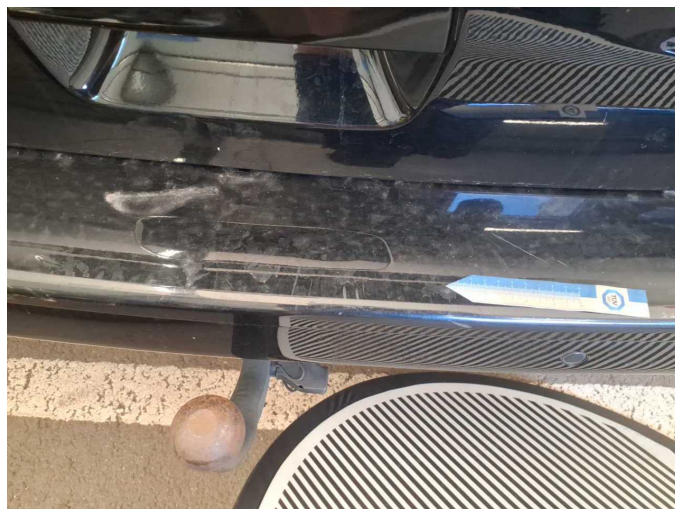


Damage 8: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 8: Rear bumper: Rear bumper - Scratched - Repair and paint

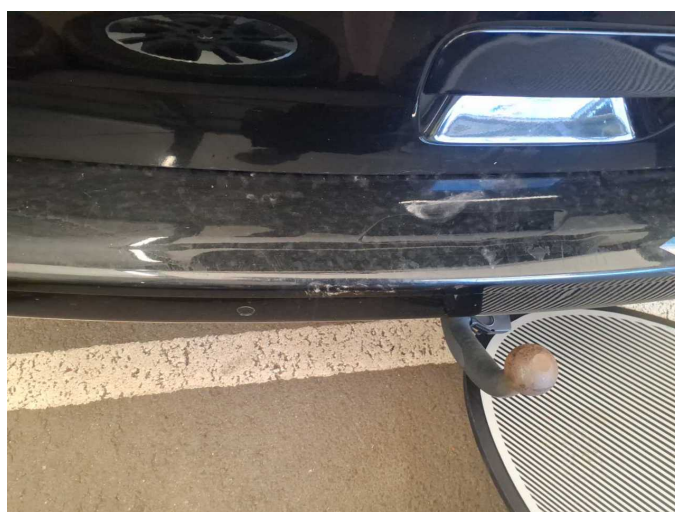

Damage 8: Rear bumper: Rear bumper - Scratched - Repair and paint

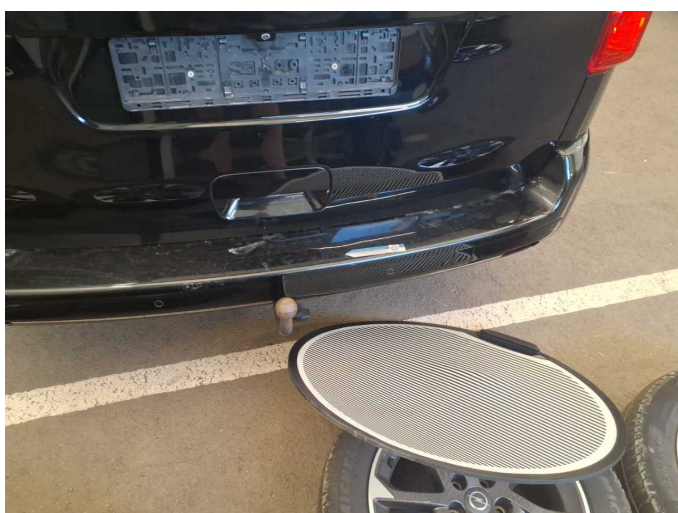

Damage 8: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage 9: Front bumper: Front bumper - Scratched - Repair and paint




Damage 9: Front bumper: Front bumper - Scratched - Repair and paint



Damage 9: Front bumper: Front bumper - Scratched - Repair and paint

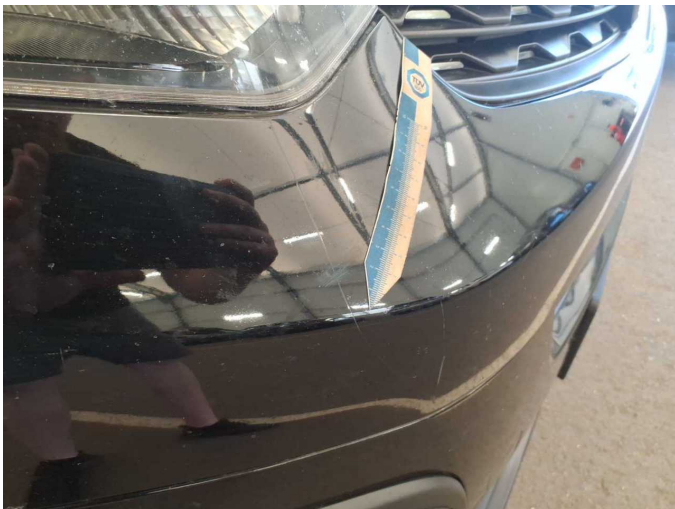

Damage 9: Front bumper: Front bumper - Scratched - Repair and paint

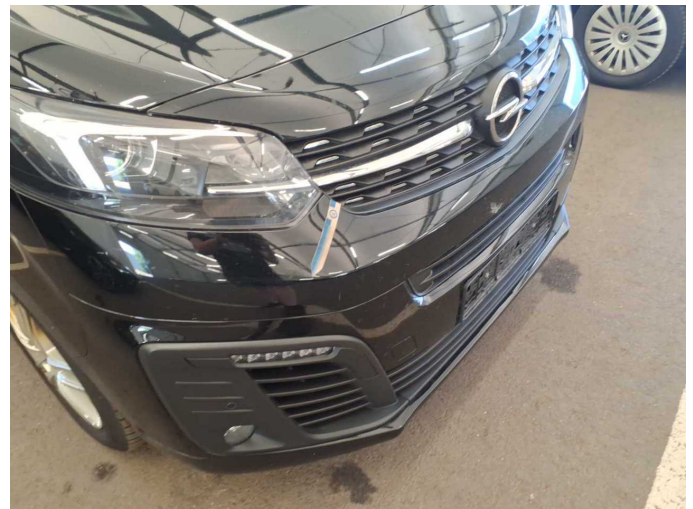


Damage 9: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint




Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

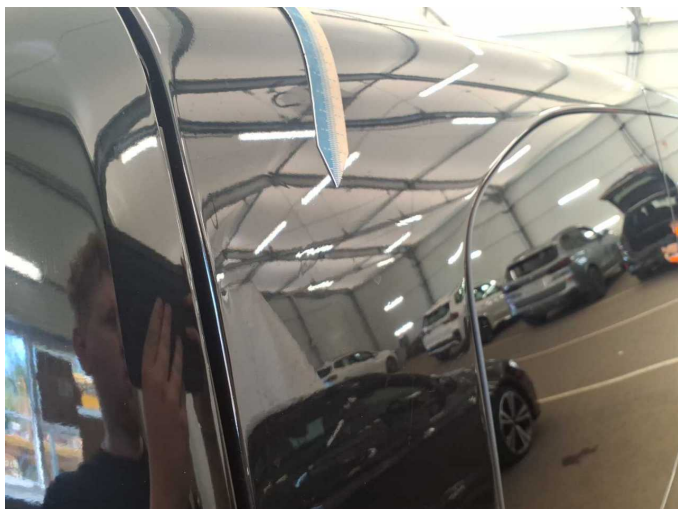

Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint



Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

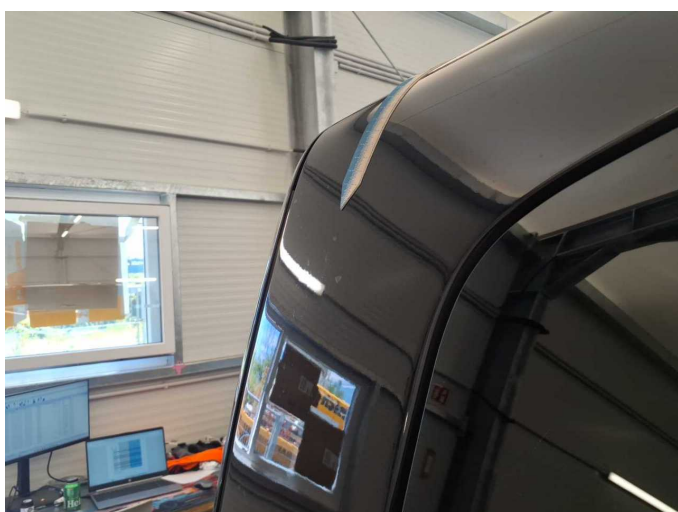

Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint




Damage 10: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint




Damage 11: Door - rear right side: Door - Scratch(es) - Paint




Damage 11: Door - rear right side: Door - Scratch(es) - Paint

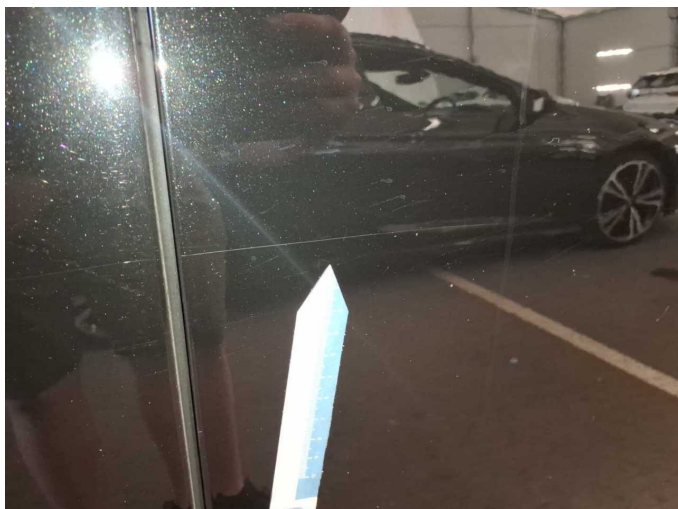

Damage 11: Door - rear right side: Door - Scratch(es) - Paint

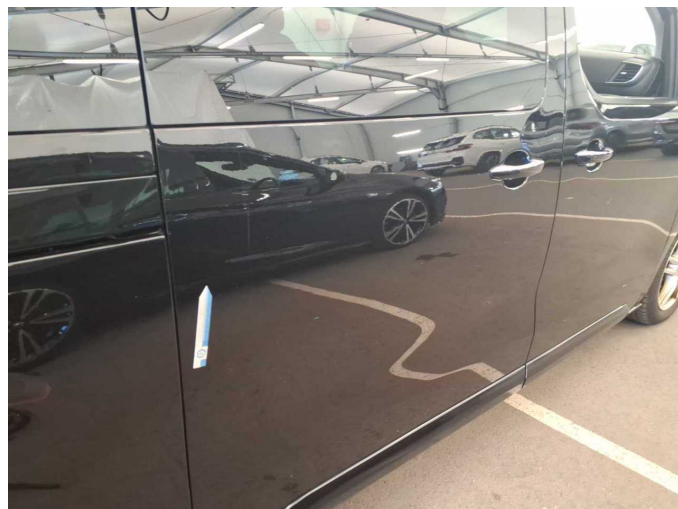


Damage 11: Door - rear right side: Door - Scratch(es) - Paint

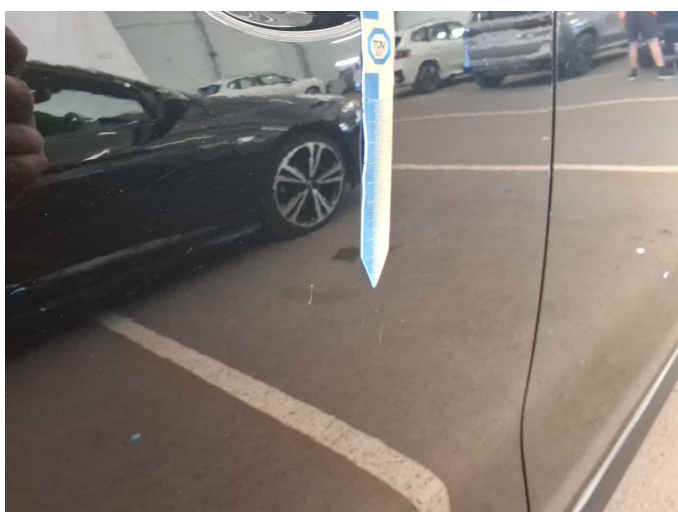

Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

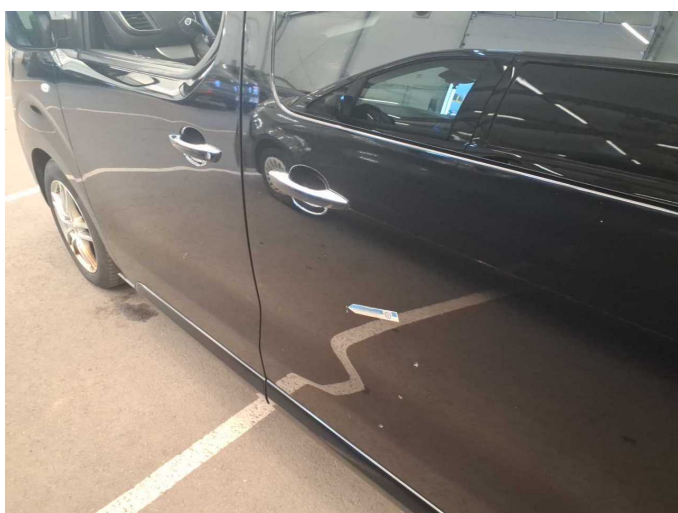


Damage 12: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

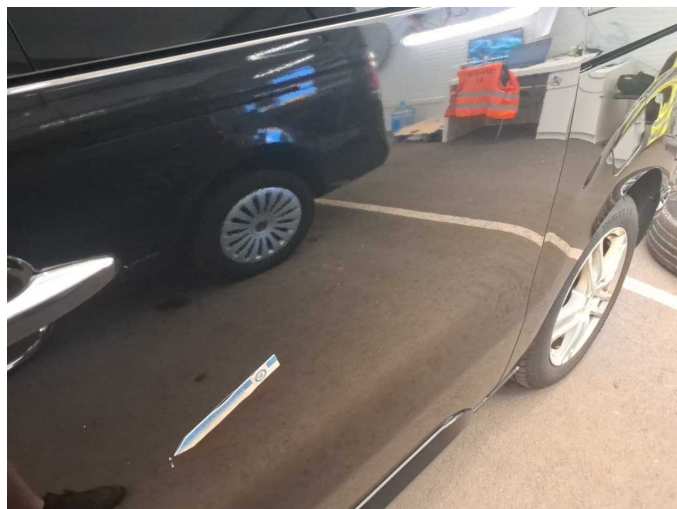

Damage 12: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front right side: Door - Scratch(es) - Paint




Damage 13: Door - front right side: Door - Scratch(es) - Paint



Damage 13: Door - front right side: Door - Scratch(es) - Paint



Damage 13: Door - front right side: Door - Scratch(es) - Paint

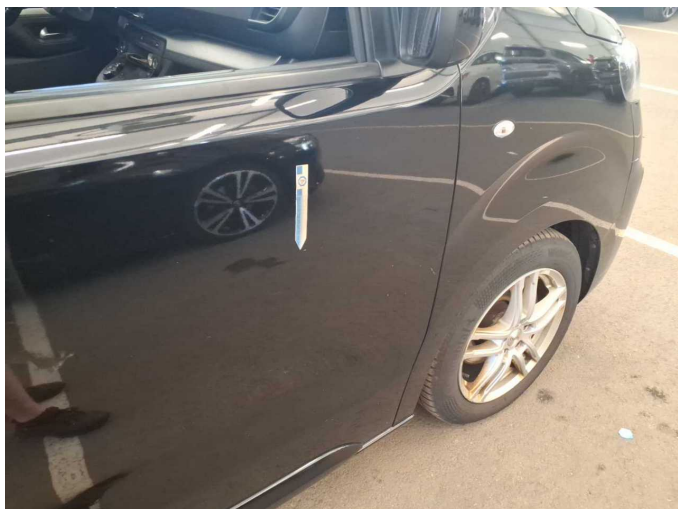


Damage 13: Door - front right side: Door - Scratch(es) - Paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint

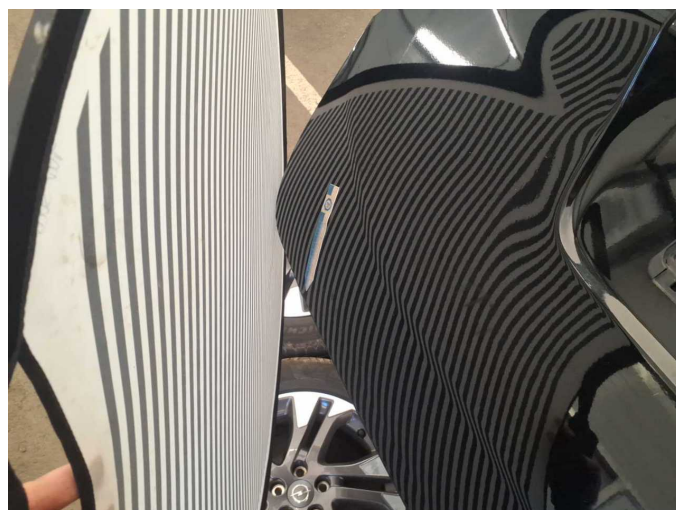

Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 15: Seat - front: Seat cover - left side - Broken / torn - Replace




Damage 15: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 15: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 15: Seat - front: Seat cover - left side - Broken / torn - Replace

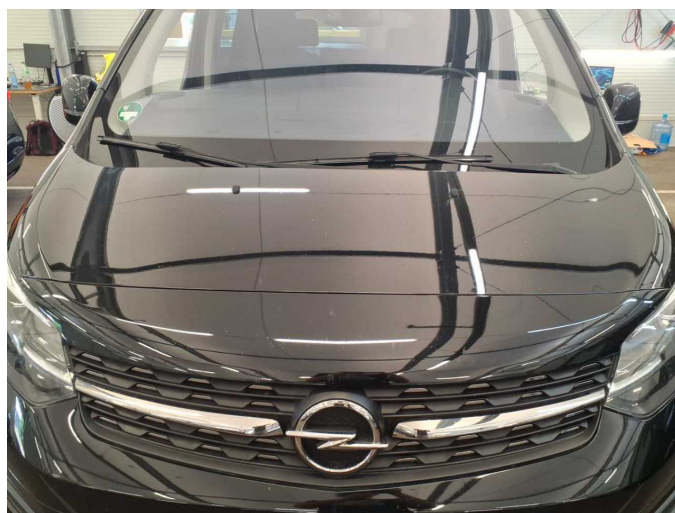

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction




Missing part 1: Rear of vehicle: Key trailer hitch - Missing - Replace



Missing part 1: Rear of vehicle: Key trailer hitch - Missing - Replace



Missing part 2: Equipment: Tirefit complete - Missing - Replace

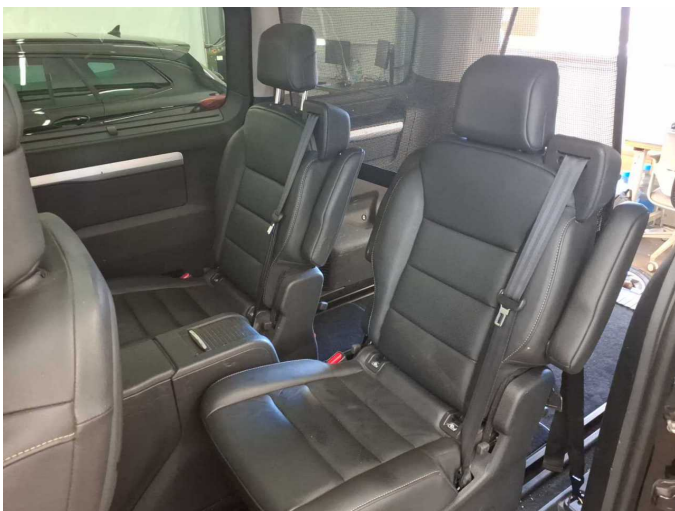

Missing part 3: Interior: Rear shelf - Missing - Replace



Missing part 3: Interior: Rear shelf - Missing - Replace



Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side