



Expertise

Protocol number: 46371487
Order No. / Reference: 26534020-1
Inspection date: 30 Jun 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D M Aut. Elegance

VIN: VXEEVHZ7MZ110924



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Zafira Life 2.0 D M Aut. Elegance

Vehicle Identification number VXEEVHZ7MZ110924

Mileage (Read) 172,503 km

First registration 15 Dec 2021

Number of holders 1

Power / Engine displacement 130 kw / 1,997 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle Van

Colour / colour code Jade Weiß

Doors / Seats 5 / 5

Upholstery type Leather

Colour of upholstery Black



Vehicle details			
Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	45,260 km
Last service on / at	07/2024 at 96,207 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF956501
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / BBA 00317		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,800 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Continental	7mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and passenger side
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Automatic activation of the hazard warning lights
- Exterior mirror housings in black
- On-board computer
- Headliner with 3 reading lights and ambient lighting
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Luggage compartment cover
- Electric handbrake
- Glazed tailgate, with rear window wiper and heater
- Interior mirror, automatically dimming
- Child safety lock, electric
- Automatic climate control: Dual-zone automatic climate control
- Headlight range adjustment, manual
- Navigation system: Multimedia Navi Pro with 7" color touchscreen display, voice control for audio, telephone, navigation
- Package: Driver Assistance Package 2
- 180° panoramic reversing camera
- Parkpilot, front and rear
- Radio: Digital radio reception DAB+
- Rain sensor
- Tire pressure warning
- Sliding door trim with cover, in vehicle color
- Side impact protection
- Power steering
- Safety steering column, height and length adjustable
- Heated seats for driver and front passenger
- Sun visors driver and passenger side
- 12-volt power outlet in the second row of seats
- Power outlet: 220/230V, in the second row of seats under the passenger seat
- Exterior door handles, in chrome
- Immobiliser
- Central locking with remote control
- Storage compartments
- Airbag: Head airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors, electrically adjustable, heated and folding
- Hill Start Assist
- Third brake light
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Floor mats in all rows of seats
- Transmission: 8-speed automatic transmission
- Head-Up Display
- Interior lighting
- Interior mirror, additional, for interior monitoring
- Air conditioning: Auxiliary air conditioning, rear
- Paint finish: Solid
- Steering wheel: Multifunction leather steering wheel, flattened at the bottom
- Fog light
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 1
- Panoramic glass roof with 2 separate windows, manually retractable
- Quickheat rapid heating system
- Radio accessories: Sound system
- Tire repair kit
- Wheels: Alloy wheels in bicolor, 7J x 17
- Keyless locking and starting system Keyless Open & Start
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats
- Seats: 8 leather seats, Claudia Schwarz
- Solar Protect thermal insulation glazing
- Sunshades in the 2nd row of seats
- 12V socket
- Traction Control (TC) Plus
- Door: Electric sliding door, driver and passenger side
- Illuminated door sill trim
- Xenon headlights with LED daytime running lights
- Ignition keys (2), both foldable

Extra equipment

- Detachable trailer hitch
- IntelliGrip (Adaptive traction system with 5 selectable modes: - ESP off - ESP standard - Snow mode - Mud mode - Sand mode)
- Luggage compartment partition net (vertical behind the last row of seats)
- Webasto auxiliary heater (programmable with remote control)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Seat - front	Seat - left side - Glued / labelled - De-glue / neutralise
3	Door - front left side	Door - Stone chips - Smart repair
4	Door - front right side	Door - Stone chips - Smart repair
5	Body	Body - Glued / labelled - De-glue / neutralise
6	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
7	Engine	Engine cover - Broken / torn - Replace
8	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
9	Measurement	Front axle geometry (Spurstangekopf defekt.) - Perform
10	Seat - front	Seat cover - left side (Wange) - Broken / torn - Smart repair
11	Engine	Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis
12	Sill - right side	Sill - Deformed - Smart repair
13	Sill - left side	Sill - Deformed - Smart repair
14	Steering system	Tie rod end (Links--> Achsvermessung) - Broken / torn - Replace
15	Side panel - rear left side	Interior trim - Scratched - Loss in value
16	Wing mirror - right side	Mirror housing (Rahmen) - Broken / torn - Replace
17	Rear bumper	Rear bumper - Scratched - Paint
18	Bonnet	Bonnet - Stone chips - Paint
19	Roof	Roof - Dent / paintcoat damage - Paint
20	Body	A-pillar - right side - Deformed - Paint
21	Side panel - rear right side	Interior trim - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Front, Side right

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Boot lid / rear door 171 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die montierten Winterräder sind kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

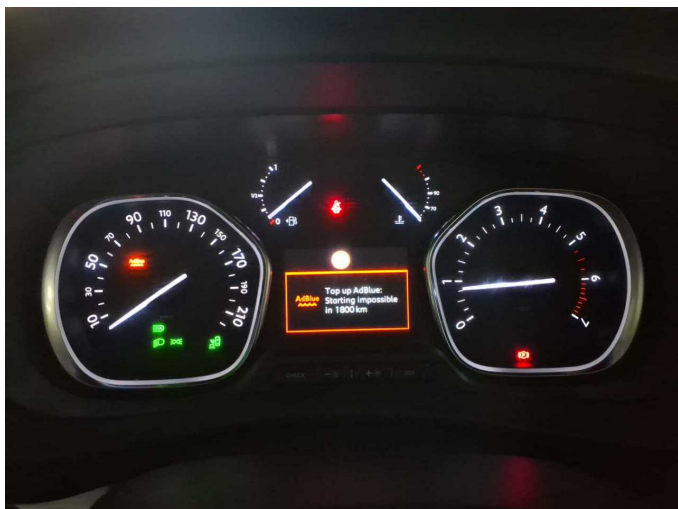


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

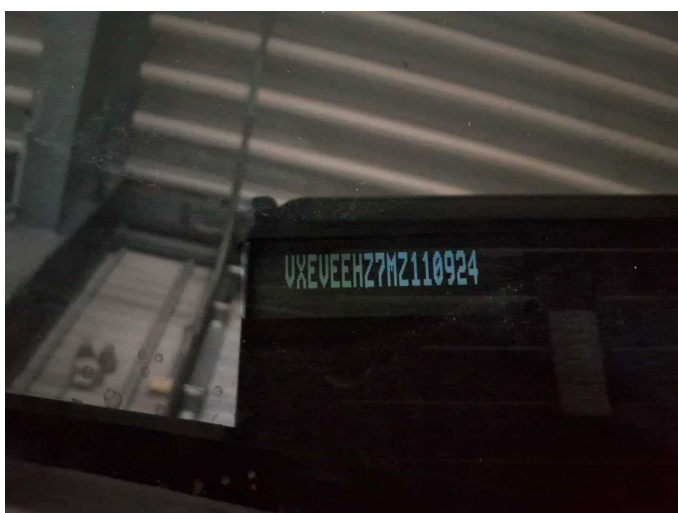


Figure 11: VIN



Figure 12: Mounted tyres

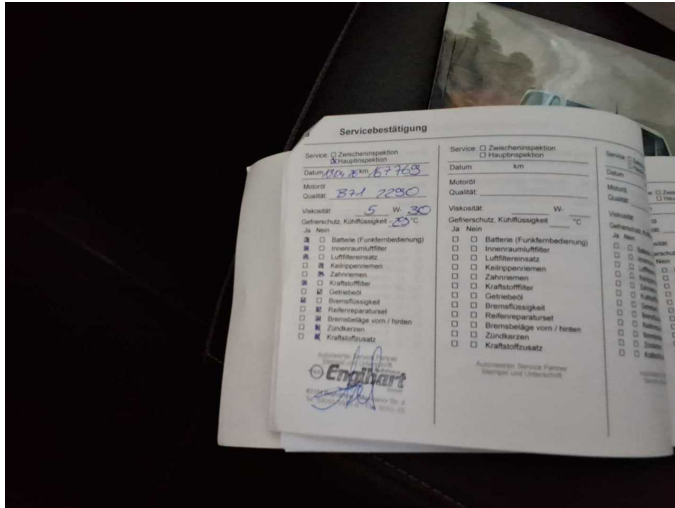


Figure 13: Documents

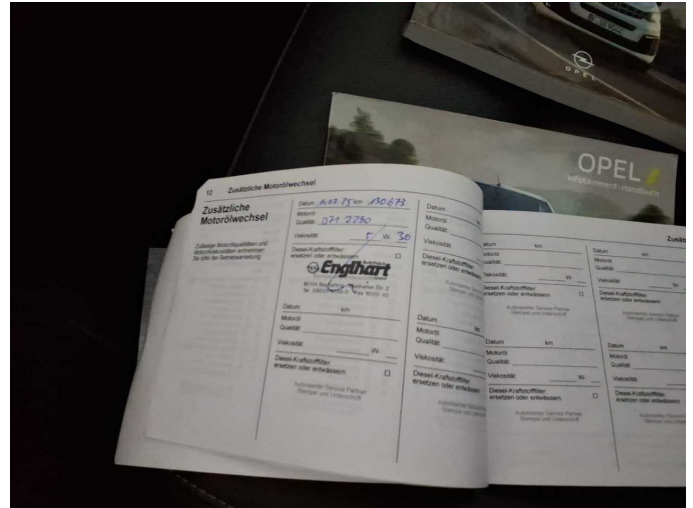


Figure 14: Documents

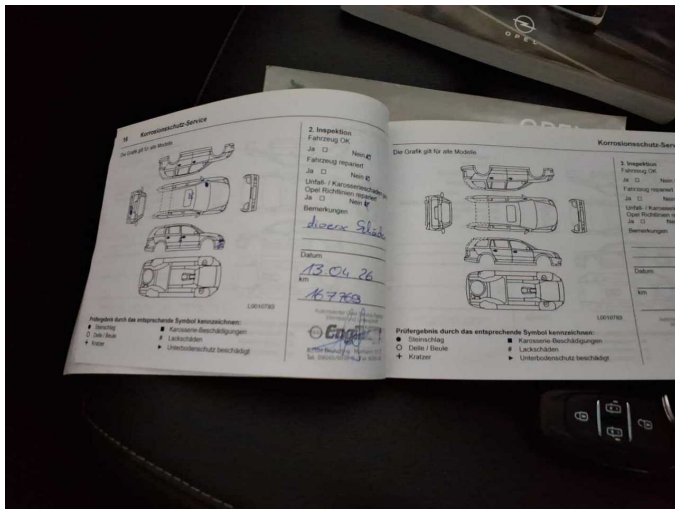


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

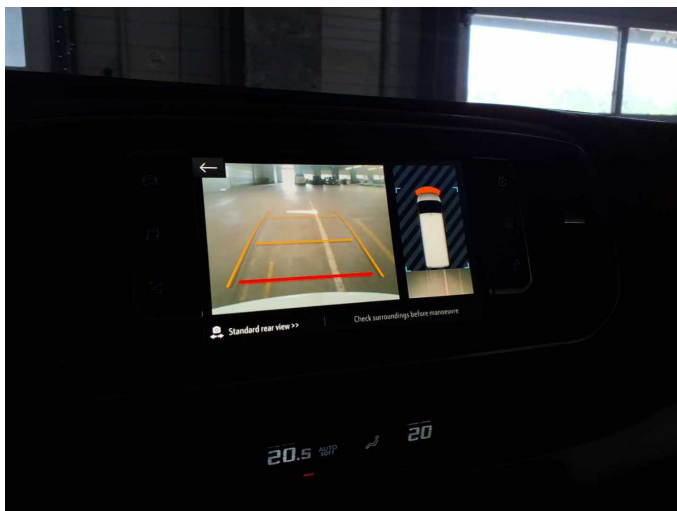


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

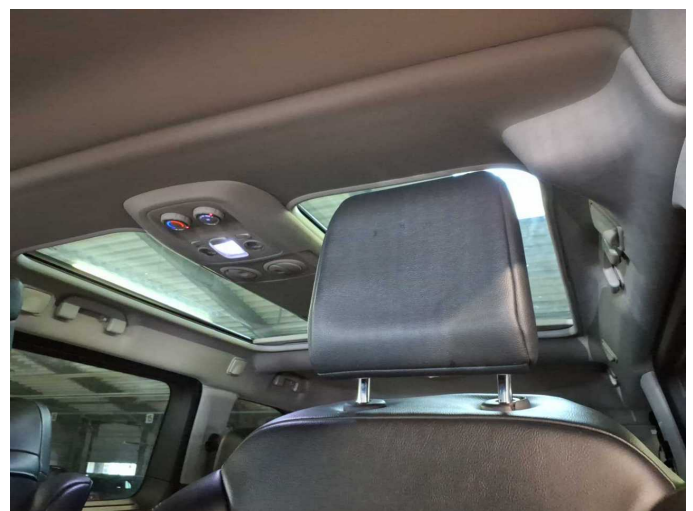


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

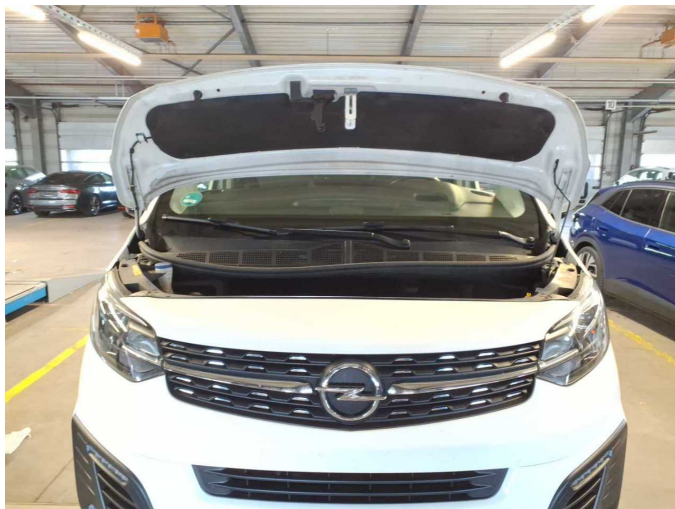


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

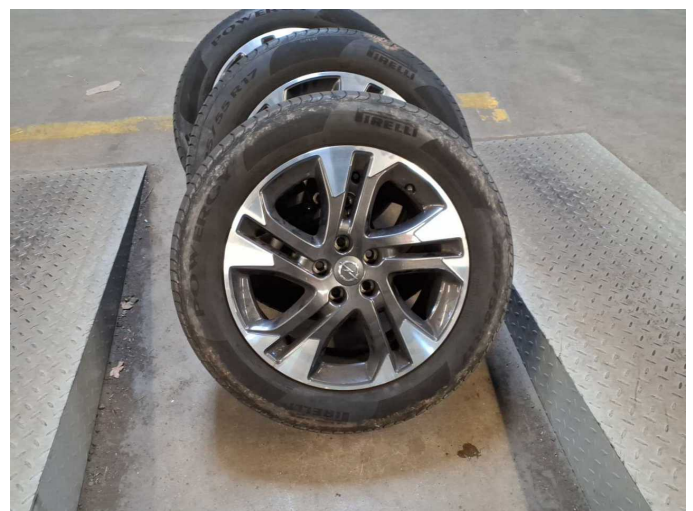


Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

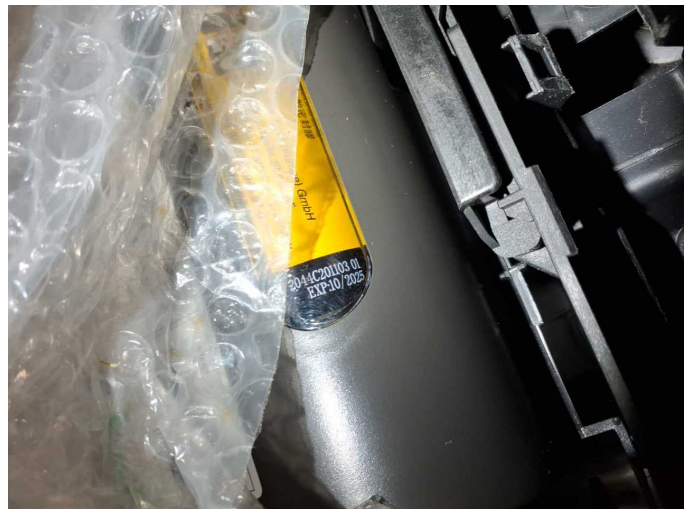

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Seat - front: Seat - left side - Glued / labelled - De-glue / neutralise



Damage 2: Seat - front: Seat - left side - Glued / labelled - De-glue / neutralise



Damage 2: Seat - front: Seat - left side - Glued / labelled - De-glue / neutralise



Damage 3: Door - front left side: Door - Stone chips - Smart repair



Damage 3: Door - front left side: Door - Stone chips - Smart repair




Damage 4: Door - front right side: Door - Stone chips - Smart repair



Damage 4: Door - front right side: Door - Stone chips - Smart repair



Damage 4: Door - front right side: Door - Stone chips - Smart repair

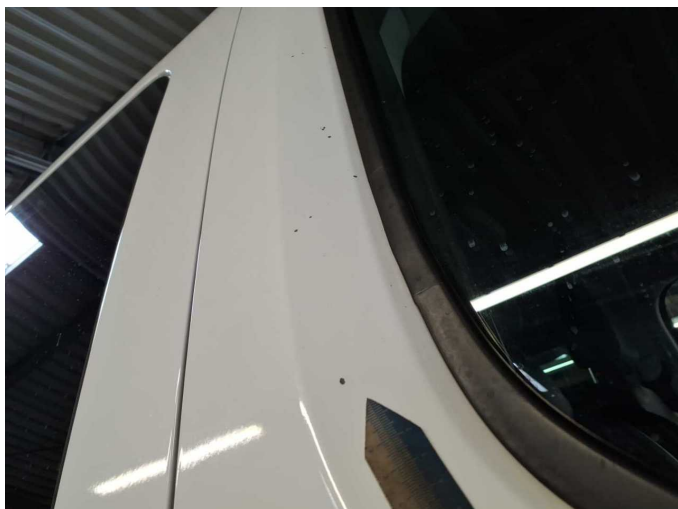

Damage 4: Door - front right side: Door - Stone chips - Smart repair



Damage 4: Door - front right side: Door - Stone chips - Smart repair




Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

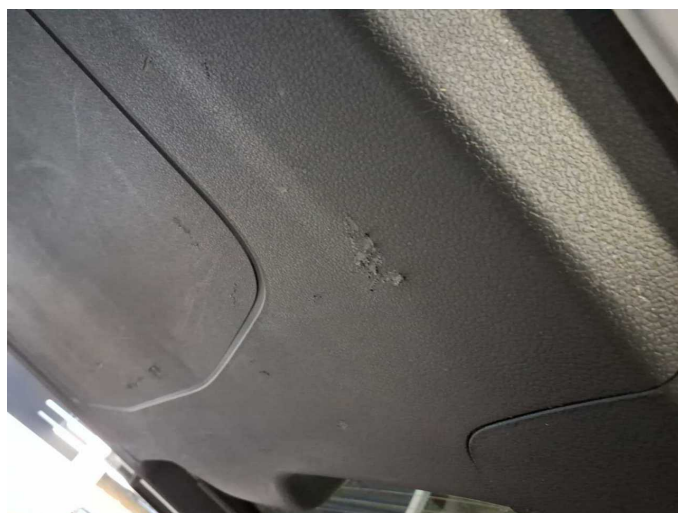

Damage 6: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 6: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 6: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 7: Engine: Engine cover - Broken / torn - Replace



Damage 7: Engine: Engine cover - Broken / torn - Replace

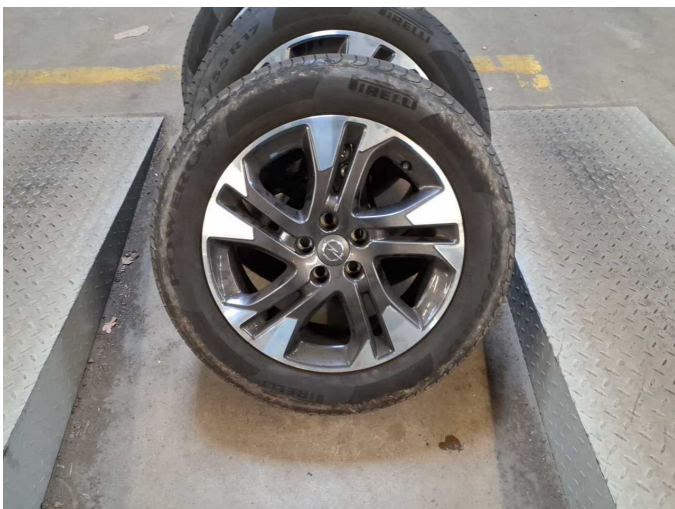

Damage 8: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

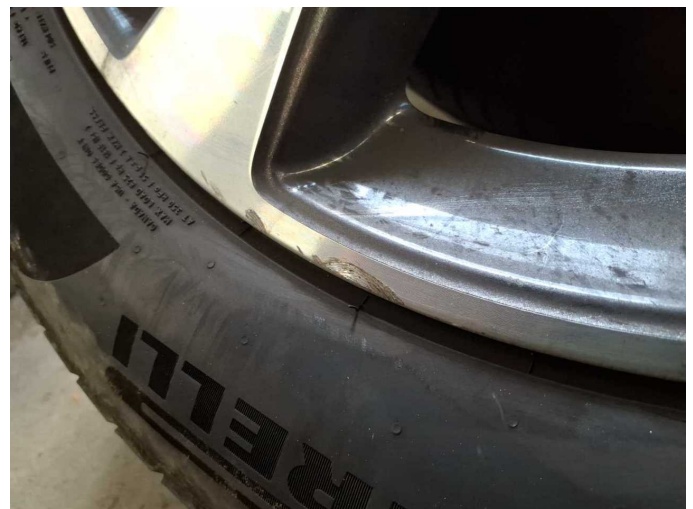

Damage 8: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 10: Seat - front: Seat cover - left side (Wange) - Broken / torn - Smart repair



Damage 10: Seat - front: Seat cover - left side (Wange) - Broken / torn - Smart repair




Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis

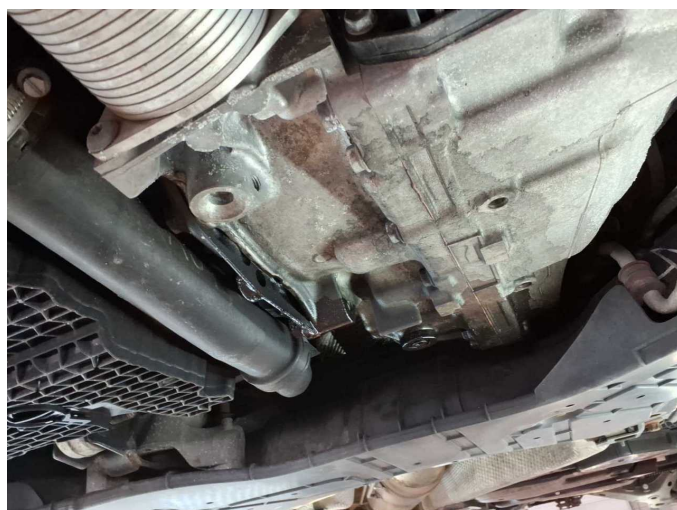


Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis



Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis

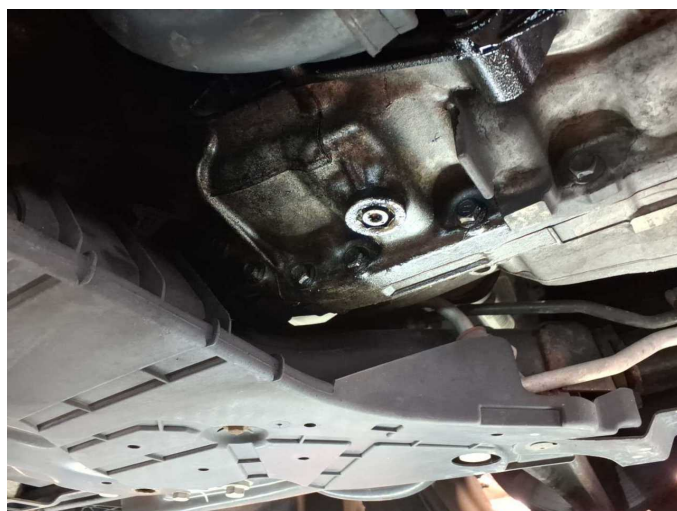


Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis

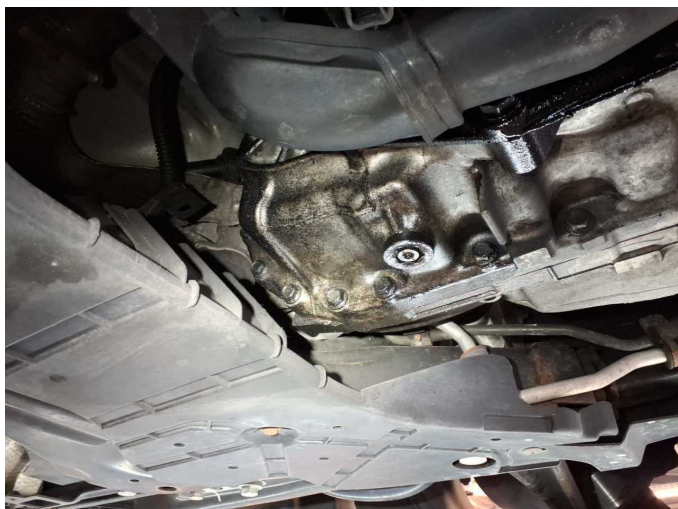


Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis



Damage 11: Engine: Engine (+ Getriebe, Umweltbelastung) - Leaking - Perform diagnosis

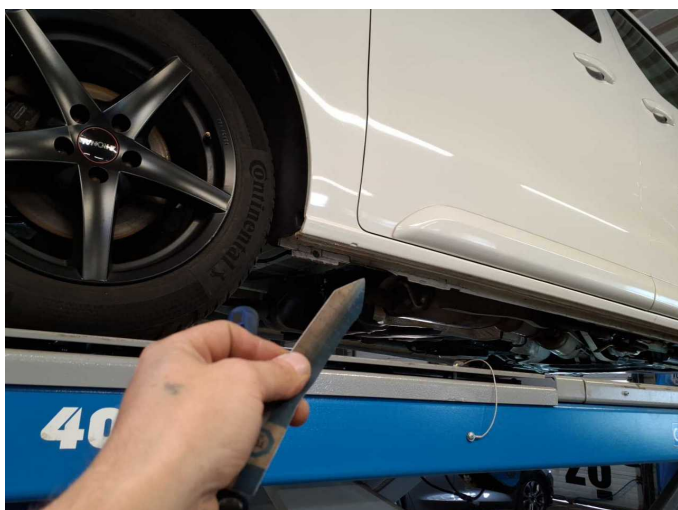


Damage 12: Sill - right side: Sill - Deformed - Smart repair

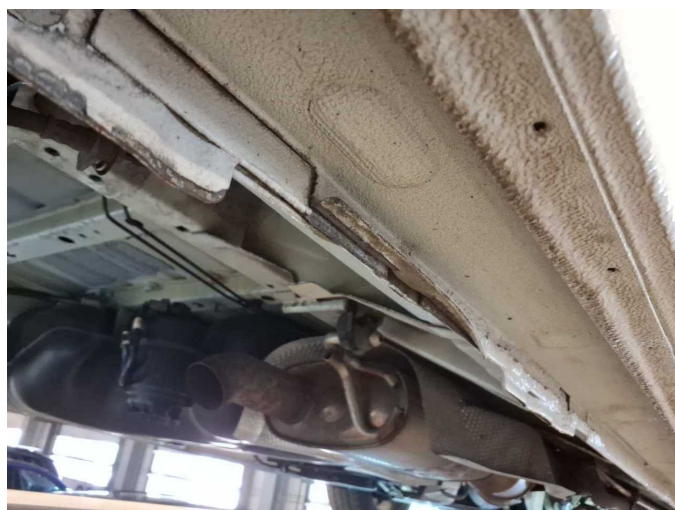

Damage 12: Sill - right side: Sill - Deformed - Smart repair



Damage 12: Sill - right side: Sill - Deformed - Smart repair

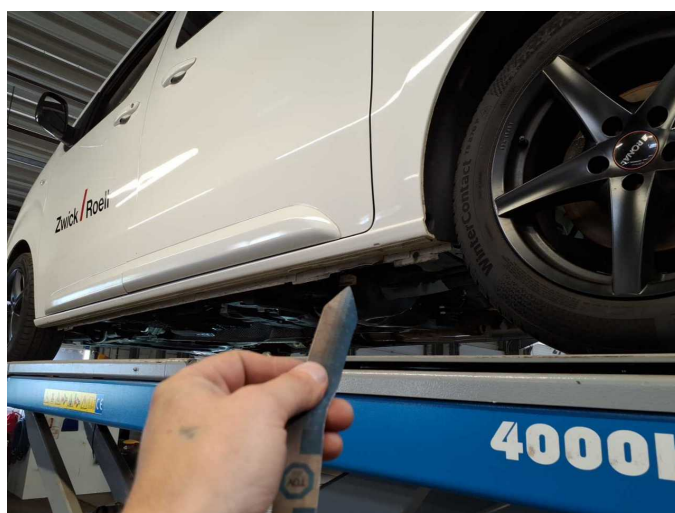


Damage 13: Sill - left side: Sill - Deformed - Smart repair



Damage 13: Sill - left side: Sill - Deformed - Smart repair




Damage 13: Sill - left side: Sill - Deformed - Smart repair

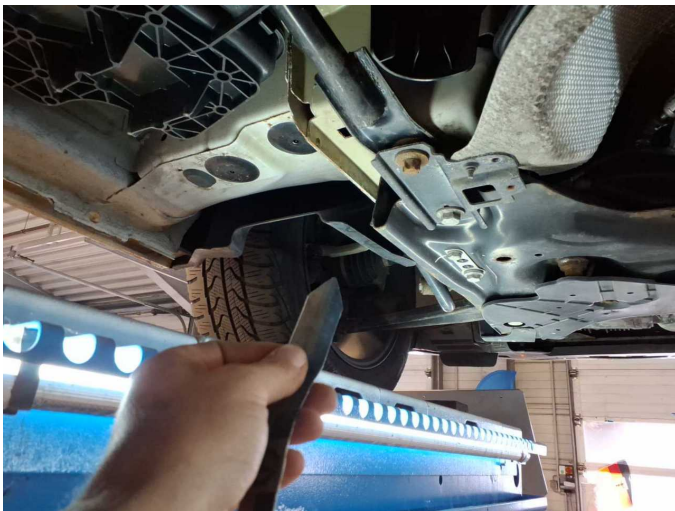

Damage 14: Steering system: Tie rod end (Links--> Achsvermessung) - Broken / torn - Replace



Damage 14: Steering system: Tie rod end (Links--> Achsvermessung) - Broken / torn - Replace

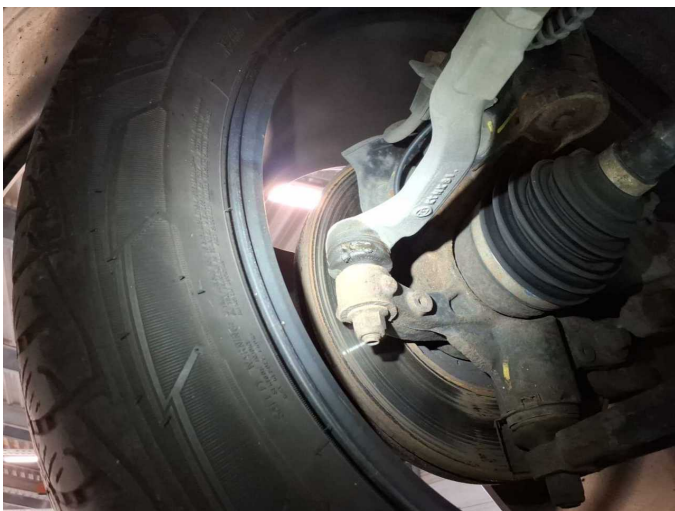

Damage 14: Steering system: Tie rod end (Links--> Achsvermessung) - Broken / torn - Replace




Damage 15: Side panel - rear left side: Interior trim - Scratched - Loss in value




Damage 15: Side panel - rear left side: Interior trim - Scratched - Loss in value



Damage 15: Side panel - rear left side: Interior trim - Scratched - Loss in value

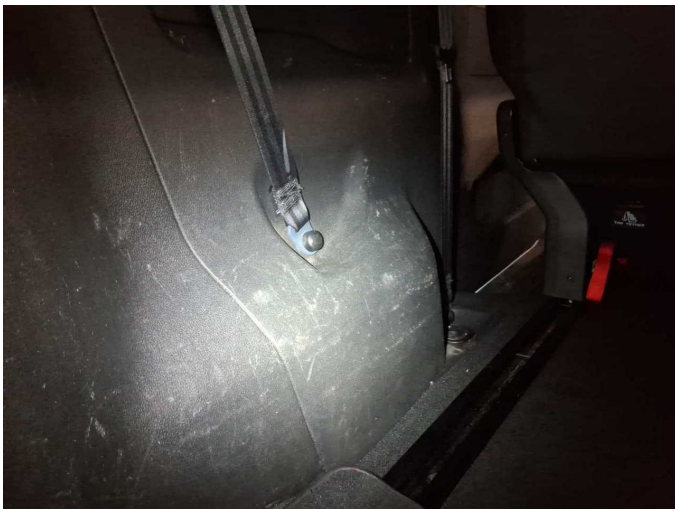

Damage 15: Side panel - rear left side: Interior trim - Scratched - Loss in value

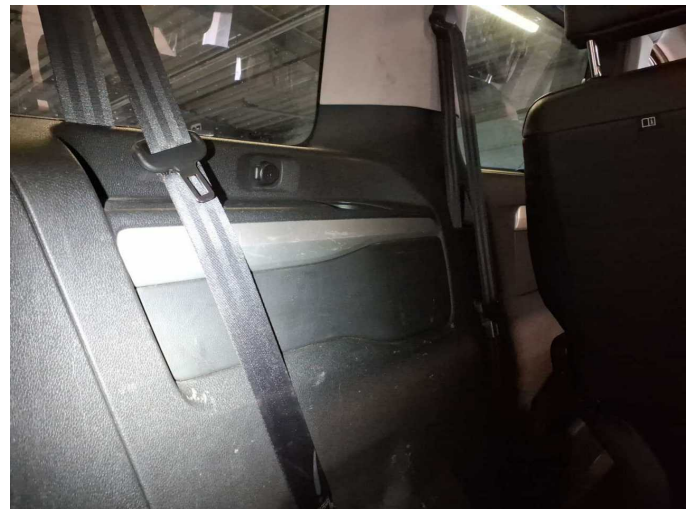

Damage 15: Side panel - rear left side: Interior trim - Scratched - Loss in value



Damage 16: Wing mirror - right side: Mirror housing (Rahmen) - Broken / torn - Replace



Damage 16: Wing mirror - right side: Mirror housing (Rahmen) - Broken / torn - Replace



Damage 16: Wing mirror - right side: Mirror housing (Rahmen) - Broken / torn - Replace



Damage 17: Rear bumper: Rear bumper - Scratched - Paint




Damage 17: Rear bumper: Rear bumper - Scratched - Paint



Damage 17: Rear bumper: Rear bumper - Scratched - Paint



Damage 17: Rear bumper: Rear bumper - Scratched - Paint

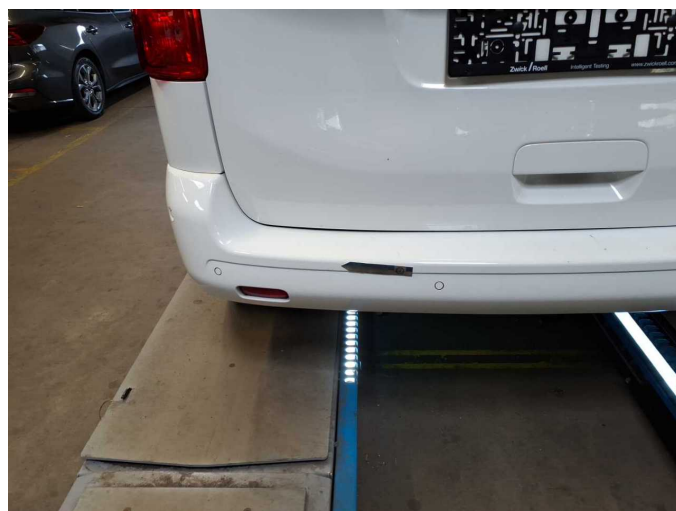

Damage 17: Rear bumper: Rear bumper - Scratched - Paint



Damage 17: Rear bumper: Rear bumper - Scratched - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 18: Bonnet: Bonnet - Stone chips - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 19: Roof: Roof - Dent / paintcoat damage - Paint




Damage 19: Roof: Roof - Dent / paintcoat damage - Paint



Damage 20: Body: A-pillar - right side - Deformed - Paint



Damage 20: Body: A-pillar - right side - Deformed - Paint

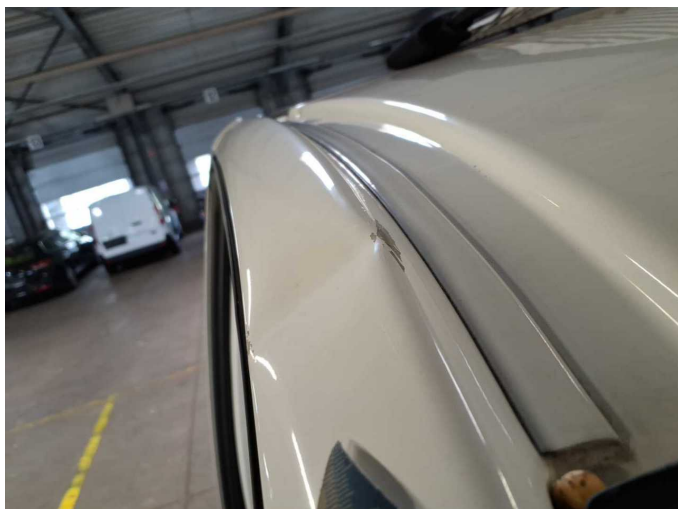

Damage 20: Body: A-pillar - right side - Deformed - Paint



Damage 20: Body: A-pillar - right side - Deformed - Paint



Damage 20: Body: A-pillar - right side - Deformed - Paint



Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace



Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace




Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace



Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace



Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace

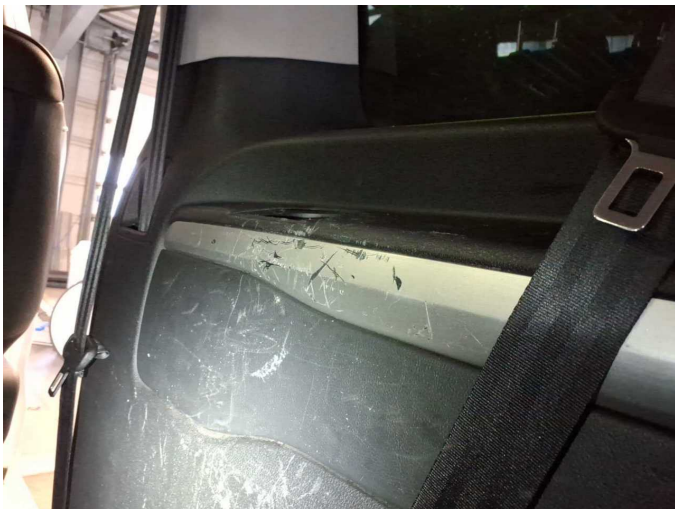


Damage 21: Side panel - rear right side: Interior trim - Scratched - Replace



Accident 1: Front, Side right



Accident 1: Front, Side right

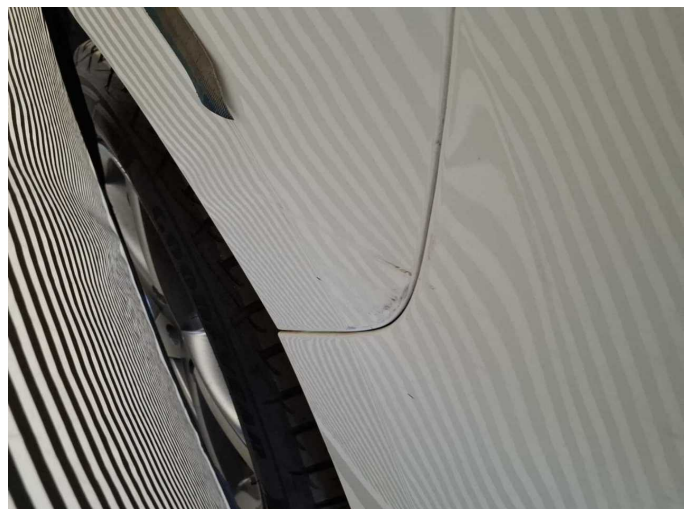

Accident 1: Front, Side right




Accident 1: Front, Side right




Accident 1: Front, Side right



Accident 1: Front, Side right

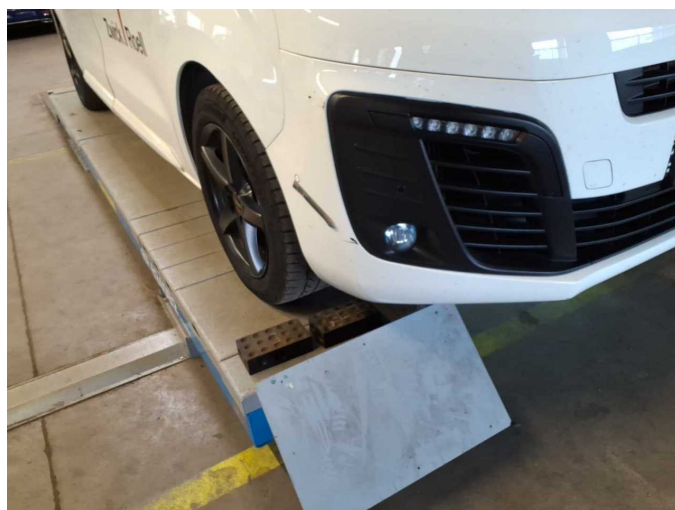

Accident 1: Front, Side right

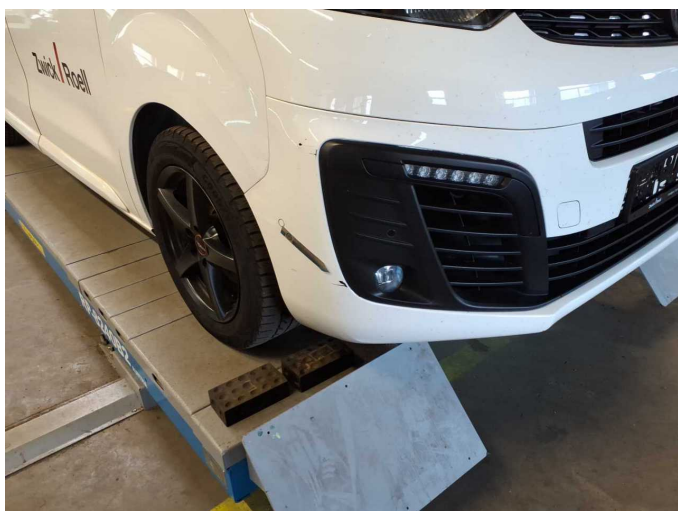

Accident 1: Front, Side right



Accident 1: Front, Side right



Repainting 1: Boot lid / rear door