



Expertise

Protocol number: 46865918
Order No. / Reference: 26805376
Inspection date: 3 Aug 2026

Manufacturer: Skoda
VIN: TMBJR7NX1MY132331

Model: Octavia Combi 1.5 TSI ACT Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 1.5 TSI ACT Clever	
Vehicle Identification number	TMBJR7NX1MY132331
Mileage (Read)	80,313 km
First registration	27 Aug 2021
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Metal Grey Metallic (F7Y)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,900 km
Last service on / at	03/2025 at 56,193 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD063504
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWI 00167		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,869 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Continental	3mm / 4mm
2)	205/60 R16 96H	Winter tyres on Steel	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Cornering lights integrated into fog lights
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Traction control (ASR)
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative strip in silver finish with ambient lighting
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- High beam assist
- Cruise control system
- Transmission: 6-speed manual transmission
- Green tec: Start/stop system including brake energy recuperation
- Interior mirror automatically dimming
- Electronic child safety lock
- Climatronic air conditioning (3-zone) (separately adjustable for driver, front passenger and rear passengers, including air-conditioned and illuminated glove compartment)
- LED license plate lights
- LED headlights with LED daytime running lights
- Steering wheel: Heated steering wheel including heated front seats
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink (Apple CarPlay - Android Auto)
- Tire pressure monitoring
- Wheels: 17" Pulsar AERO alloy wheels, black gloss turned (7J x 17, ET 46 with 205/55 R17 tires)
- Seat belts (Three three-point seat belts in the rear)
- Seats: Heated rear seats
- Seats: Manually adjustable ergonomic front seats (massage function - electrically adjustable lumbar support - extendable leg rest)
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket in the trunk
- Storage compartment in the luggage compartment with cargo element
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Airbag: Center airbag front
- Trailer hitch preparation including trailer stabilization
- Extended warranty for 3 years, max. 50,000 km
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, black
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Removable boot cover
- Headrests (5) front and rear height adjustable
- LED fog lights
- LED taillights in crystal glass look and animated turn signals
- Remote release of the rear seat backrests in the trunk
- Steering wheel: height and reach adjustable
- Steering wheel: Leather steering wheel with multifunction buttons (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Multifunction display in the instrument cluster
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Rear view camera
- Electromechanical power steering
- Safety lights in the front side doors
- Seats: Height-adjustable driver and passenger seats (including lumbar support)
- Seats: Rear seat backrest split 60:40, foldable



- 230V socket and USB charging port (230V socket and 2 x USB charging ports in the rear as well as USB charging port in the rearview mirror)
- Phone: Wireless SmartLink for Apple CarPlay
- Glazing: Acoustic glazing in the front side windows and Sunset (dark tinted rear window and rear side windows)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Opting out of the extended warranty
- Luggage net partition
- Paint finish: Metallic
- Package: Columbus infotainment package (Columbus navigation system - Infotainment Online (3-year subscription) - Digital instrument cluster (Virtual Cockpit) - Phonebox - KESSY (Keyless entry and start-stop system))
- Heated windscreen

- SKODA Care Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in case of breakdown) - Information service (connection option to the hotline for all questions relating to vehicle functions) - Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Immobiliser

- Swiveling trailer hitch including trailer stabilization and adapter
- LED main headlights matrix and dynamic high beam assist (AFS) (headlight cleaning system including washer fluid level control)
- Wheels: 18" Vega AERO alloy wheels, black gloss turned (7.5J x 18, ET 48 with 225/45 R18 tires)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	Mudguard - right side	Mudguard - right side (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning
6	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
7	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
8	Roof	Roof (Mehrkosten möglich) - Paint defect - Conditioning
9	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
10	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
11	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
12	Rear bumper	Rear bumper - Scratch(es) - Paint
13	Bonnet	Bonnet - Corrosion - Repair and paint
14	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation



Wear and tear

No.	Component group	Description
1	Steering system	Steering wheel - Scratch(es) - No deduction
2	2nd wheel set	2 tyres - does not meet manufacturer specifications - No deduction
3	Door - front left side	Door handle - outside - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Umbrella

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 28 Apr 2026	2.999,70 €

Repainting

No. Repainting

1 Mudguard - right side, Unprofessionally carried out

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

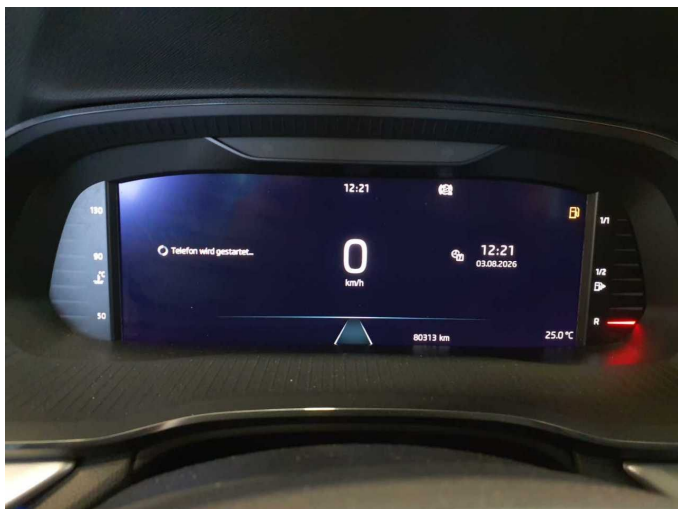


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

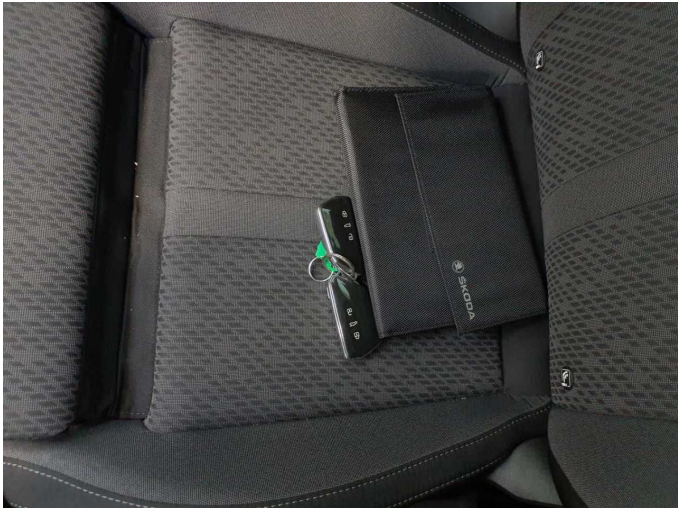


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

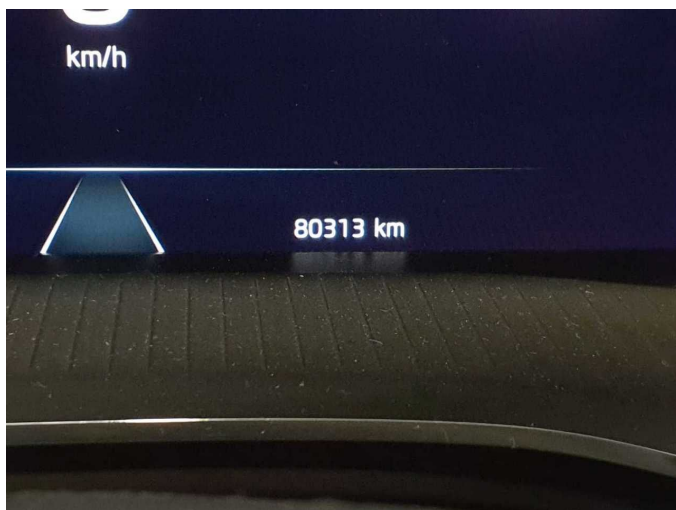


Figure 21: Misc.



Figure 22: Misc.

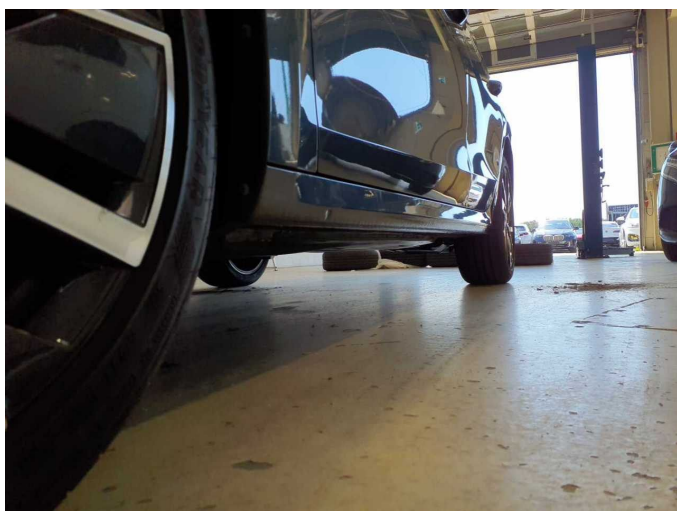


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

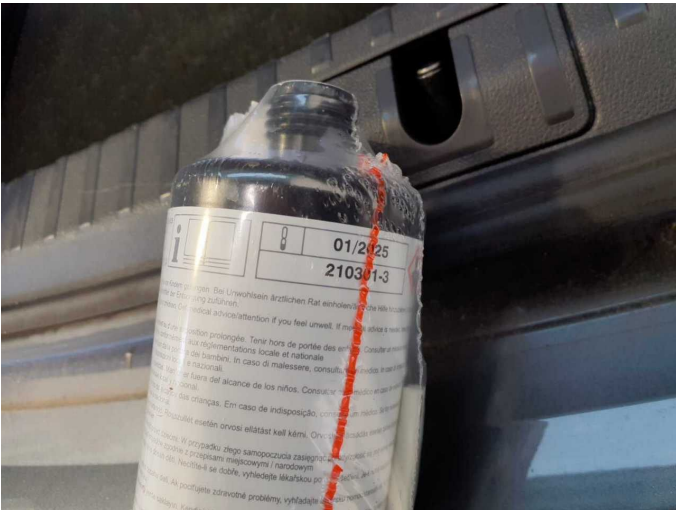

Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 5: Mudguard - right side: Mudguard - right side (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 5: Mudguard - right side: Mudguard - right side (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 5: Mudguard - right side: Mudguard - right side (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 5: Mudguard - right side: Mudguard - right side (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 8: Roof: Roof (Mehrkosten möglich) - Paint defect - Conditioning



Damage 8: Roof: Roof (Mehrkosten möglich) - Paint defect - Conditioning

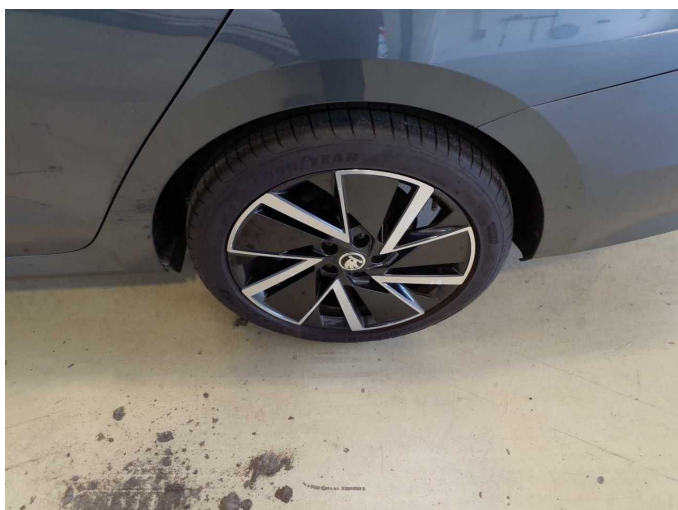

Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value

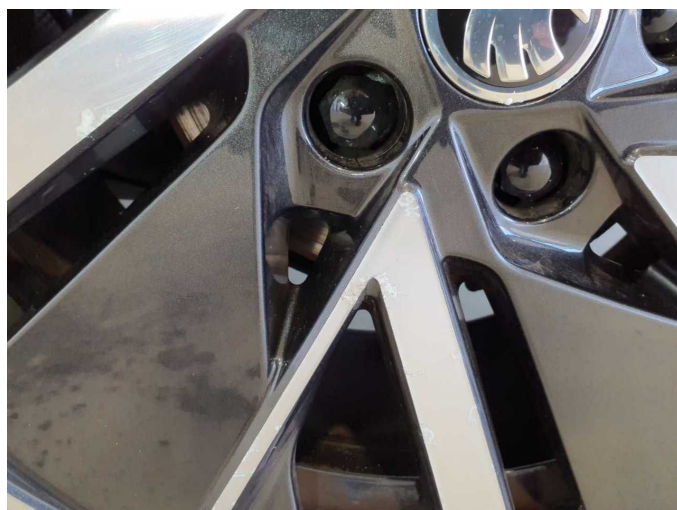

Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 11: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

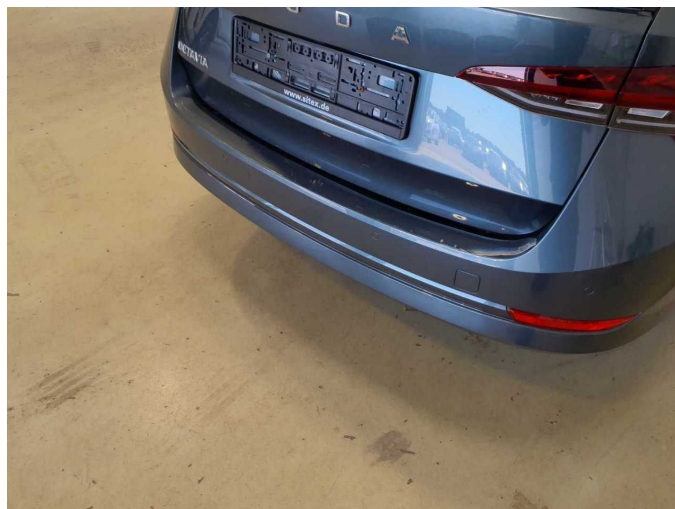

Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint

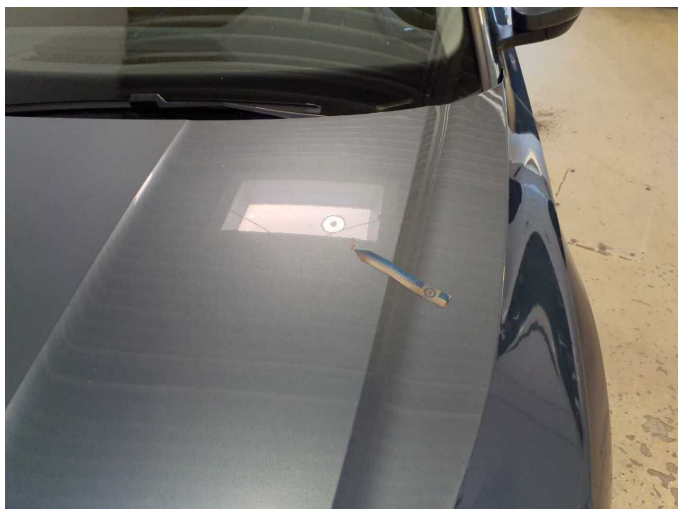


Damage 13: Bonnet: Bonnet - Corrosion - Repair and paint



Damage 13: Bonnet: Bonnet - Corrosion - Repair and paint




Damage 13: Bonnet: Bonnet - Corrosion - Repair and paint

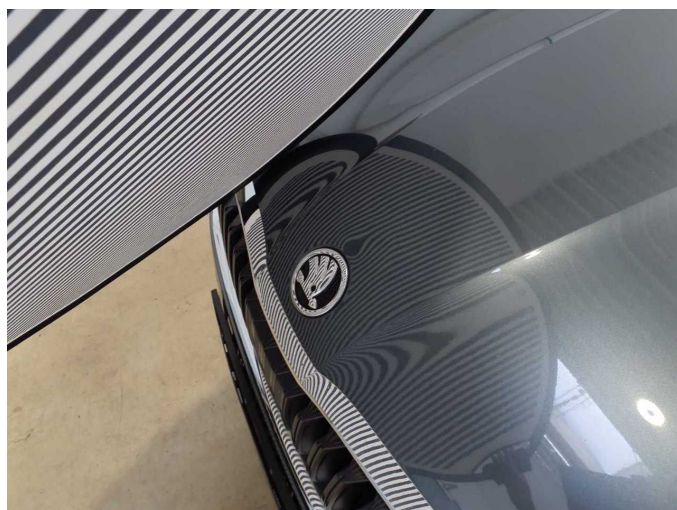

Damage 13: Bonnet: Bonnet - Corrosion - Repair and paint



Damage 14: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation

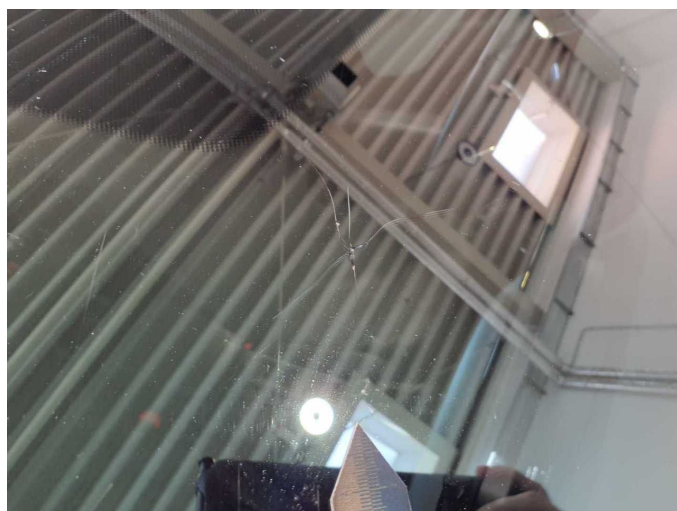

Damage 14: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Missing part 1: Equipment: Umbrella - Missing - Replace