



Expertise

Protocol number: 46377225
Order No. / Reference: 26397414
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR DSG Life

VIN: WVGZZZ5NXPM022253



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZ5NXPM022253
Mileage (Read)	97,505 km
First registration	23 Dec 2022
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Platinum Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,500 km
Last service on / at	05/2026 at 96,035 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP797323
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 23557		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	145/85 R18 103M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Diesel particulate filter
- Parking assistance
- Electronic parking brake including auto-hold function
- Automatic headlight control, with daytime running lights
- High beam control Light Assist
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: Tire Mobility Set omitted
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear
- Airbag for driver and front passenger including knee airbag on the driver's side
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings painted silver
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Horizon Black"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic Stability Program with counter-steering support
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- LED headlights
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Bumpers in body color
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys



Extra equipment

- Airbag: Side airbags for the outer seats of the 2nd row.
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Display: Head-up display
- Foldable towbar (electric release)
- Navigation system "Discover Pro" incl. "Streaming & Internet" (8 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Leather package "Vienna" including front seats with memory function (electrically adjustable, folding, heated exterior mirrors with memory function and ambient lighting - electrically adjustable lumbar support in the front - perforated "Vienna" leather center panels of the front seats and outer rear seats - top comfort seats in the front - electrically adjustable front seats with memory function; with comfort entry on the driver's side - front seats with active climate control)
- Progressive steering (the steering ratio is progressively increased with increasing steering angle - the steering behavior becomes noticeably more direct depending on the driving situation, the steering wheel movements are significantly reduced and thus steering comfort is increased)
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters, heated
- Surround view "Area View" (incl. reversing camera "Rear View")
- Tire pressure monitoring system for road tires and winter tires (scope as for tire pressure monitoring system for road tires, but winter tires with sensors for the tire pressure monitoring system)
- Wheels: Winter wheels (4) (additional), alloy "Montana" 7 J x 17 (AirStop winter tires 215/65 R 17 H - on-board tools and jack)
- "Comfort" telephone interface with inductive charging function (operation and display via multifunction display and touchscreen of the radio or radio navigation system as well as via multifunction steering wheel - hands-free system - Bluetooth audio - external antenna connection with LTE support - 2 USB interfaces, also for iPod/iPhone; 1 USB charging socket and multimedia socket AUX-IN)
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - Dynamic headlight range control with dynamic cornering lights - LED taillights, dark red - Bad weather light and cornering light - IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals)
- Mesh partition
- Package: Ambient lighting package (30-color ambient lighting - applications on mirror adjustment and window regulator switches, door pull handles - "Barrel Craft" decorative inserts for instrument panel and front door trim - illuminated door sill trims)
- Package: Top Package (Adaptive chassis control DCC incl. driving profile selection - Panoramic tilt/slide sunroof with panoramic roof at the rear - Darkened rear side windows and rear window)
- Package: Winter additionally with heated outer rear seats (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - windshield washer nozzles automatically heated at the front - front seats and outer rear seats heated)
- Paint finish: Metallic
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Trailer maneuvering assistant "Trailer Assist" including parking assist "Park Assist" and parking aid
- Wheels: Light alloy (4) "Kingston" 7 J x 18 (AirStop tires 235/55 R 18, optimized for rolling resistance - wheel locks with enhanced theft protection)
- Wheels: Spare wheel in a weight- and space-saving design (on-board tools and jack - spare wheel in a weight- and space-saving design)
- Wirelessly heated windshield (infrared-reflective)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
3	Wheel / tyres	Tyre - rear left side - Does not meet the leasing specifications - Replace
4	Wheel / tyres	Tyre - front right side - Does not meet the leasing specifications - Replace
5	Wheel / tyres	Tyre - front left side - Does not meet the leasing specifications - Replace
6	Bonnet	Air grille - Broken / torn - Replace
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Bonnet	Bonnet (Steinschlag mit Korrosion) - Stone chips - Repair and paint
9	Headlight	Headlight - left side - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Door - front right side	Door - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Side panel - rear left side
2	Side panel - rear right side

Paint coat thickness measurement

Side panel - rear left side	184 µm	Side panel - rear right side	170 µm
-----------------------------	--------	------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Der Scheinwerfer wurde aufgrund des Alters und der Laufleistung gemindert



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

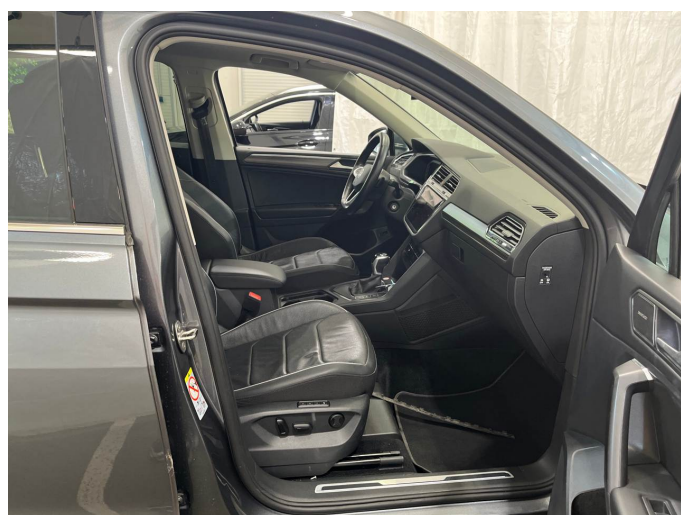


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

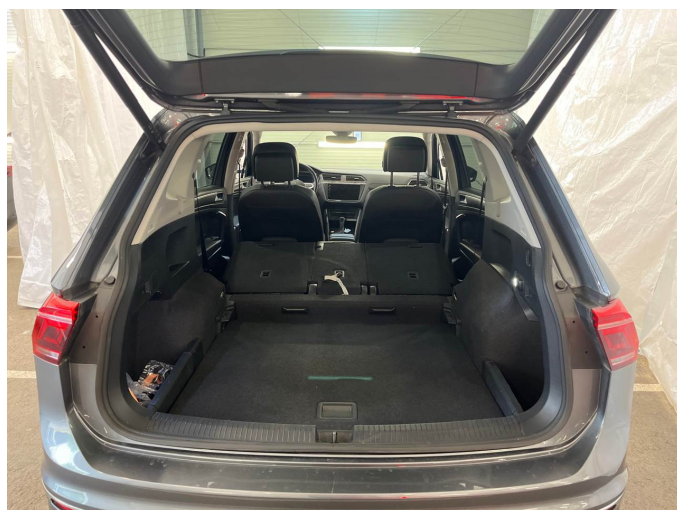


Figure 10: Cargo area



Figure 11: VIN

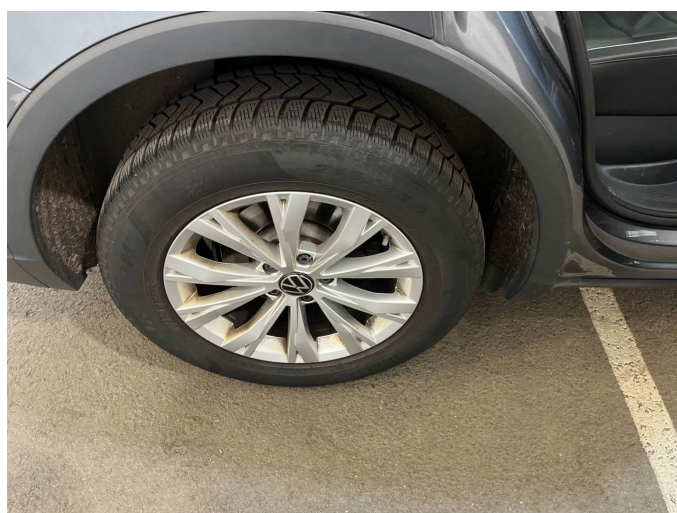


Figure 12: Mounted tyres



Figure 13: Documents

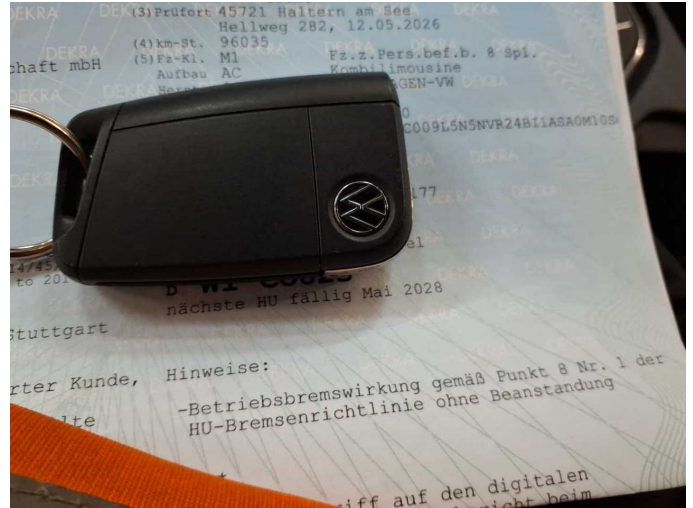


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

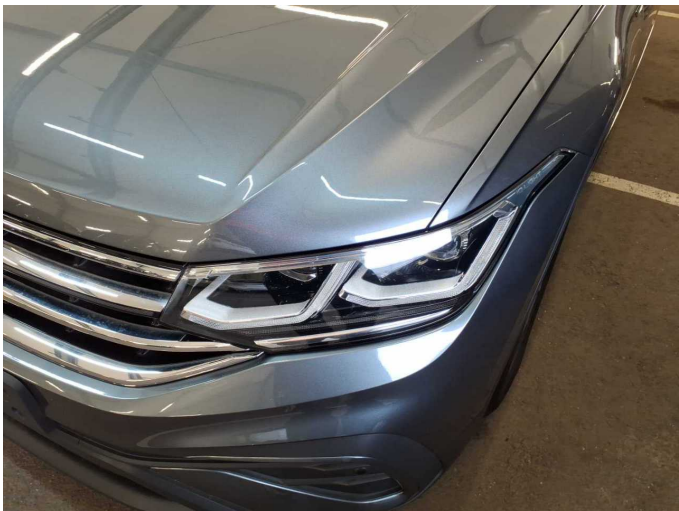


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

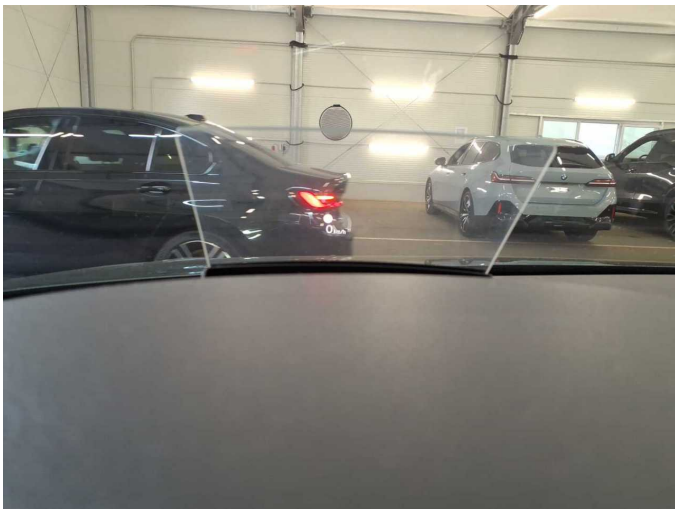


Figure 33: Misc.



Figure 34: Misc.

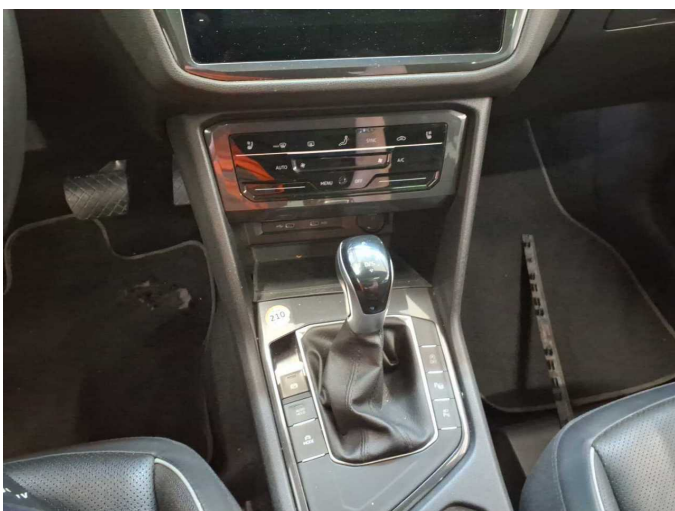


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.


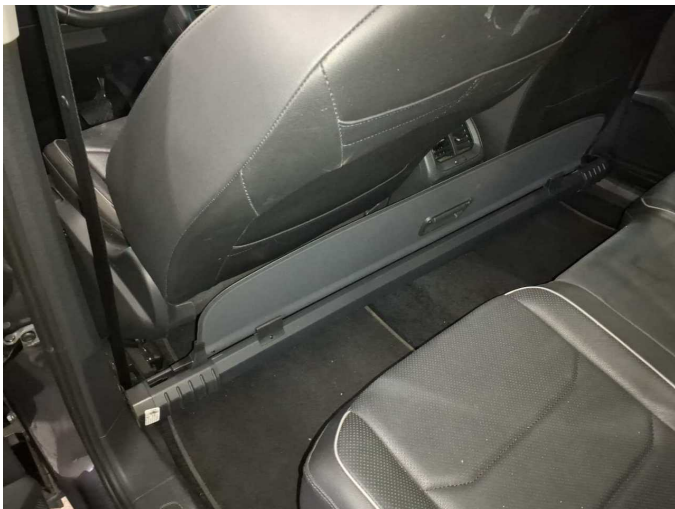



Figure 39: Misc.




Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

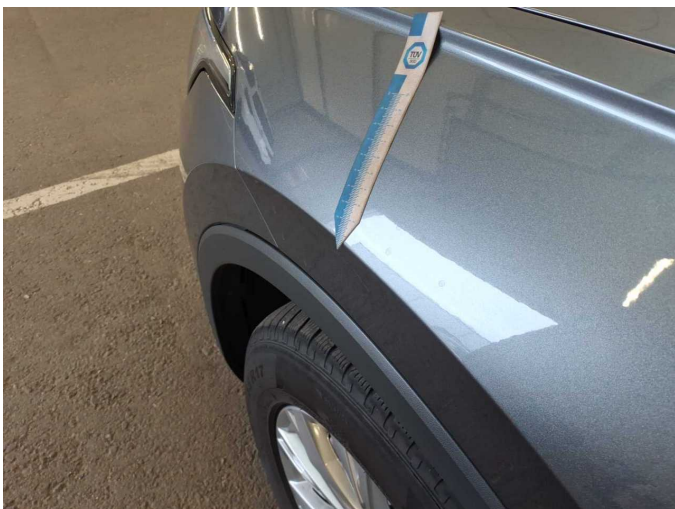

Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair

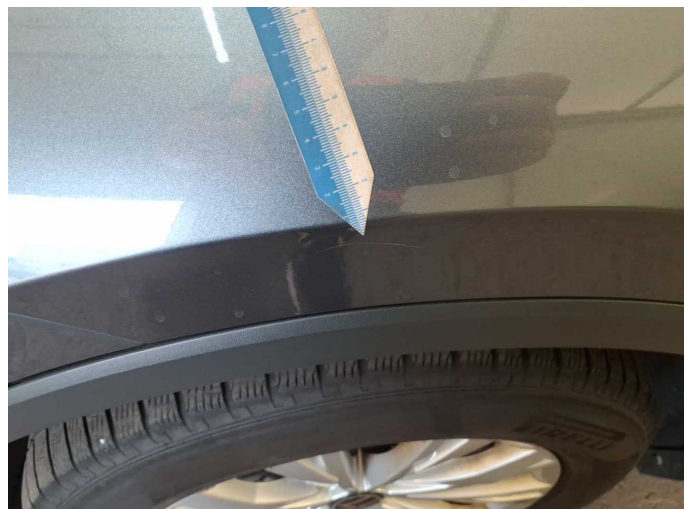


Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair

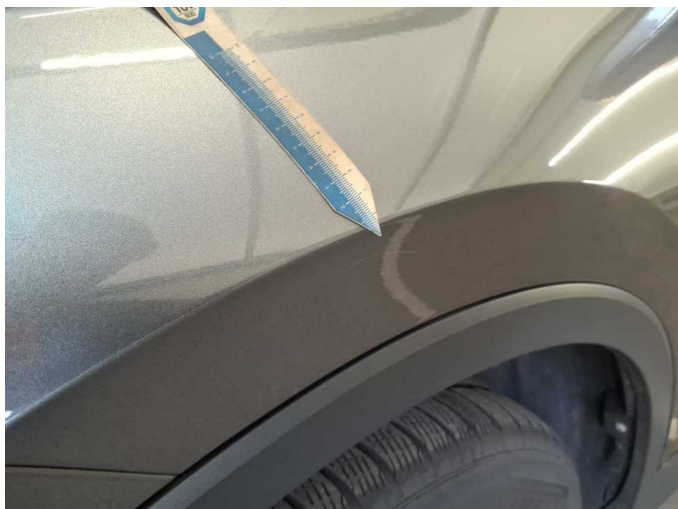

Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair

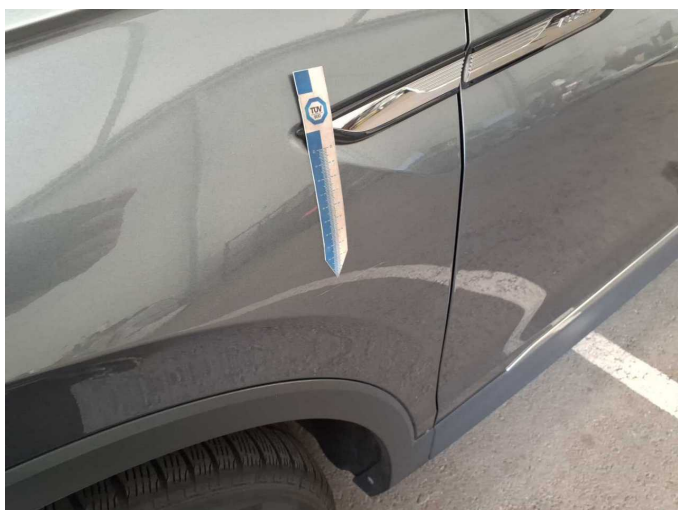

Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Tyre - rear left side - Does not meet the leasing specifications - Replace



Damage 3: Wheel / tyres: Tyre - rear left side - Does not meet the leasing specifications - Replace



Damage 4: Wheel / tyres: Tyre - front right side - Does not meet the leasing specifications - Replace




Damage 4: Wheel / tyres: Tyre - front right side - Does not meet the leasing specifications - Replace




Damage 5: Wheel / tyres: Tyre - front left side - Does not meet the leasing specifications - Replace



Damage 5: Wheel / tyres: Tyre - front left side - Does not meet the leasing specifications - Replace

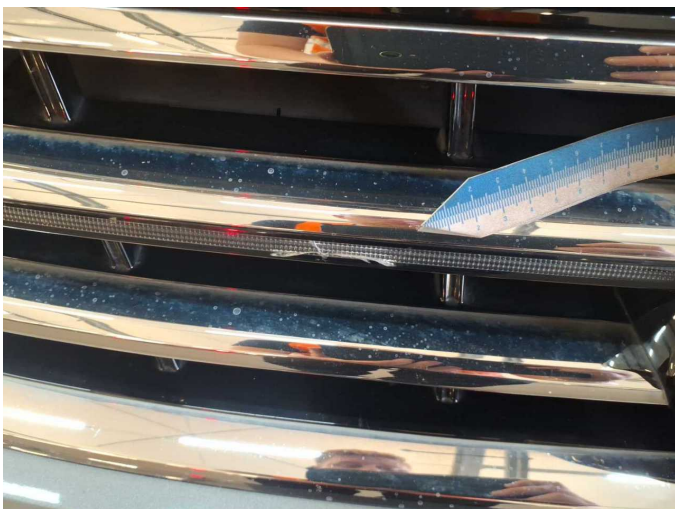

Damage 6: Bonnet: Air grille - Broken / torn - Replace

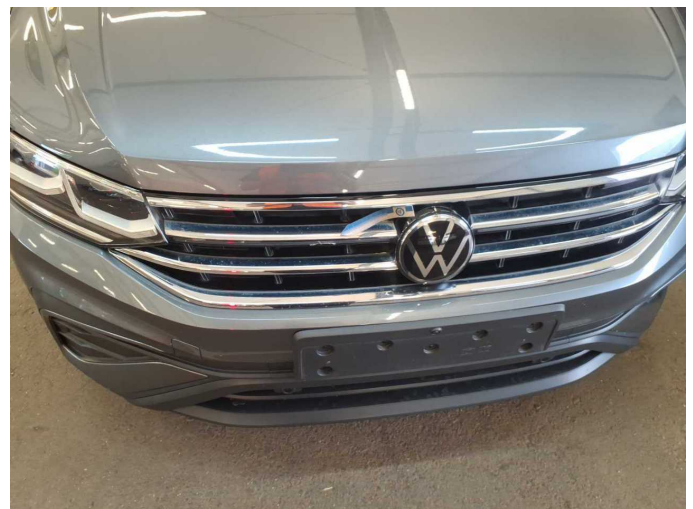

Damage 6: Bonnet: Air grille - Broken / torn - Replace



Damage 6: Bonnet: Air grille - Broken / torn - Replace



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

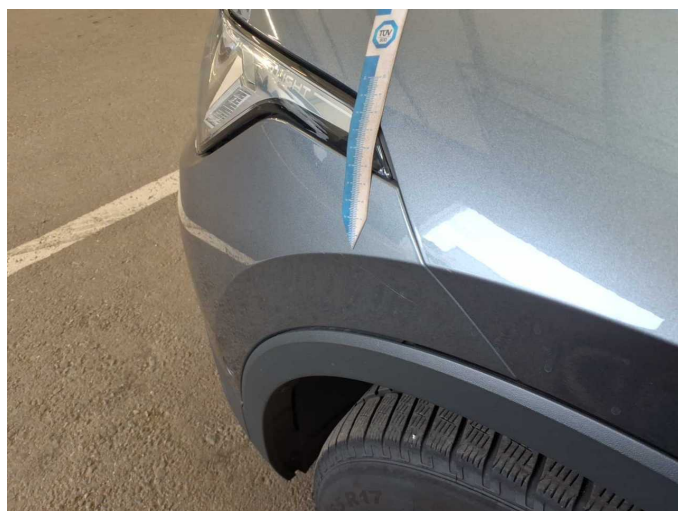


Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

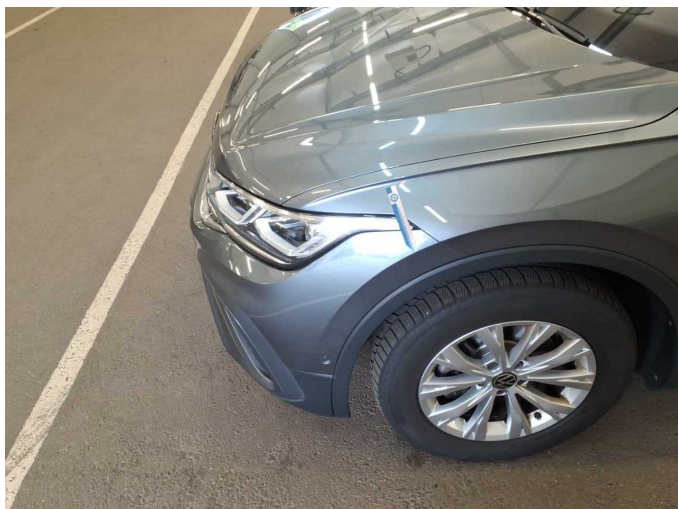


Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

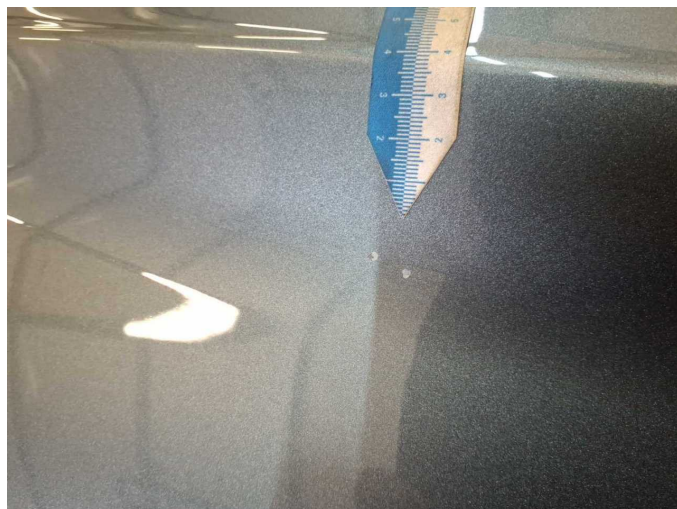


Damage 8: Bonnet: Bonnet (Steinschlag mit Korrosion) - Stone chips - Repair and paint

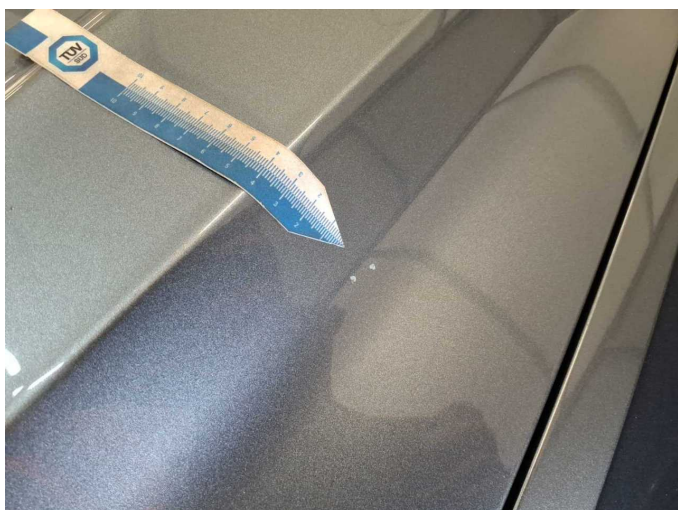

Damage 8: Bonnet: Bonnet (Steinschlag mit Korrosion) - Stone chips - Repair and paint

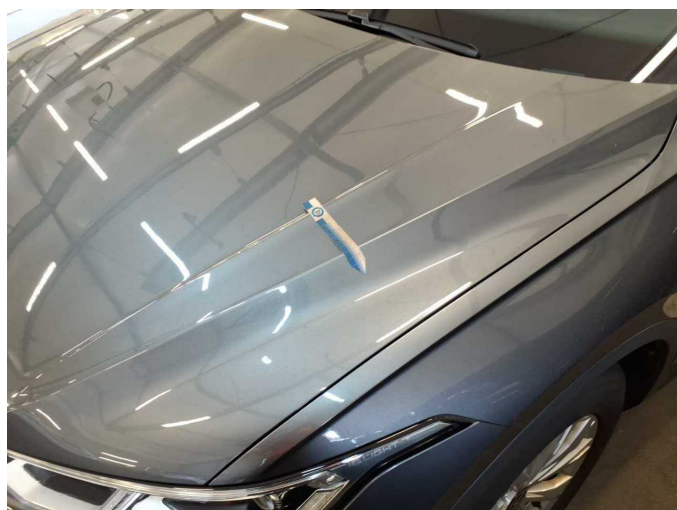

Damage 8: Bonnet: Bonnet (Steinschlag mit Korrosion) - Stone chips - Repair and paint

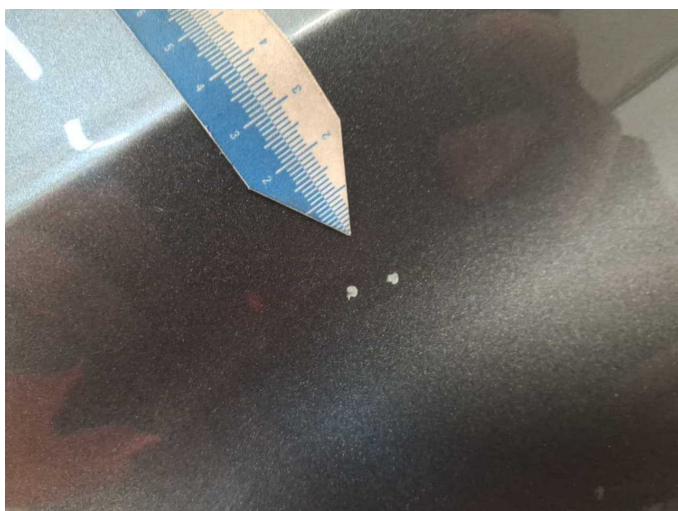


Damage 8: Bonnet: Bonnet (Steinschlag mit Korrosion) - Stone chips - Repair and paint




Damage 9: Headlight: Headlight - left side - Scratch(es) - Replace



Damage 9: Headlight: Headlight - left side - Scratch(es) - Replace

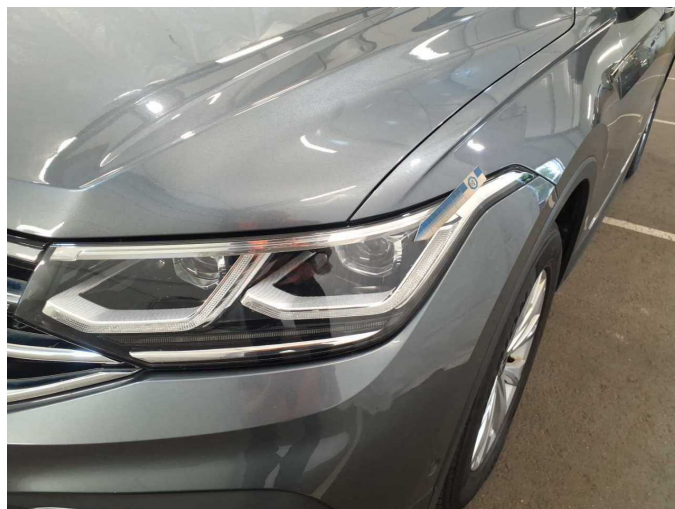


Damage 9: Headlight: Headlight - left side - Scratch(es) - Replace

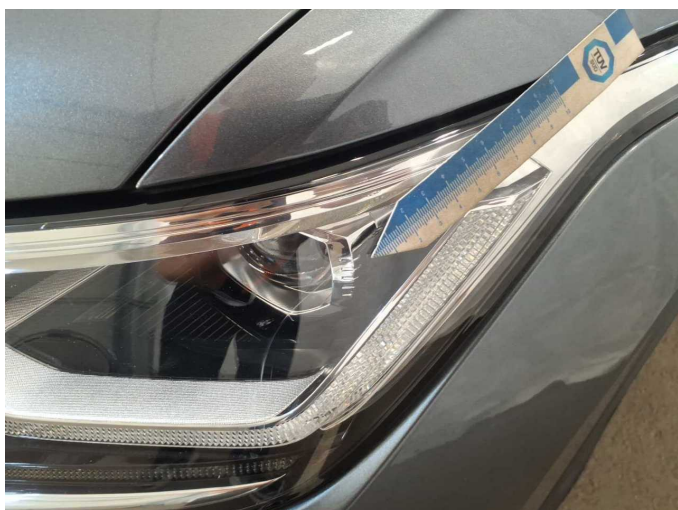


Damage 9: Headlight: Headlight - left side - Scratch(es) - Replace



Damage 9: Headlight: Headlight - left side - Scratch(es) - Replace

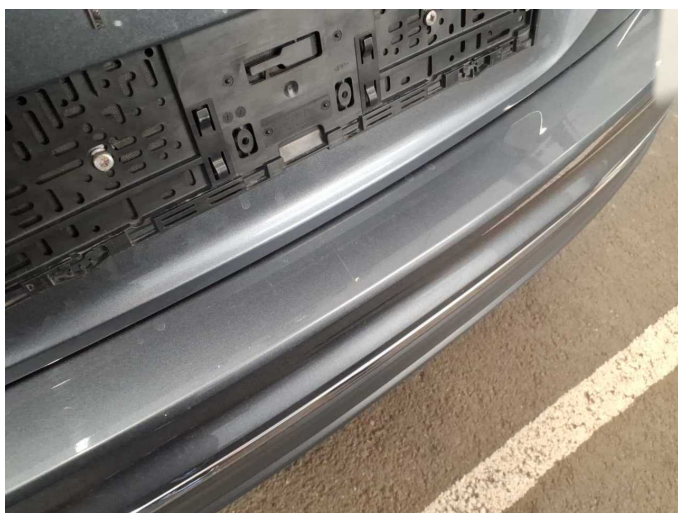

Wear and tear 2: Rear bumper: Rear bumper - Scratch(es) - No deduction

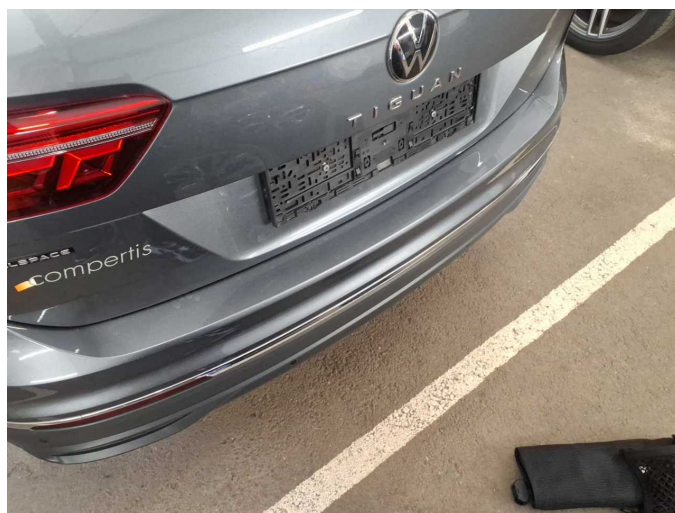


Wear and tear 2: Rear bumper: Rear bumper - Scratch(es) - No deduction




Wear and tear 3: Door - front right side: Door - dent(s) - Smooth repair work




Wear and tear 3: Door - front right side: Door - dent(s) - Smooth repair work

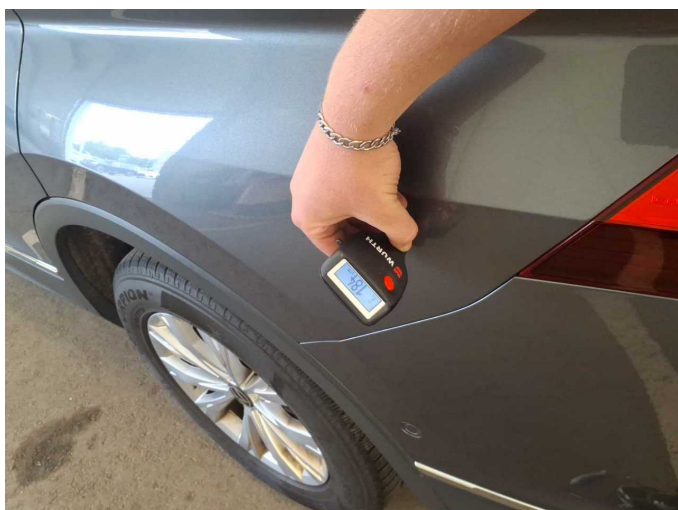


Repainting 1: Side panel - rear left side

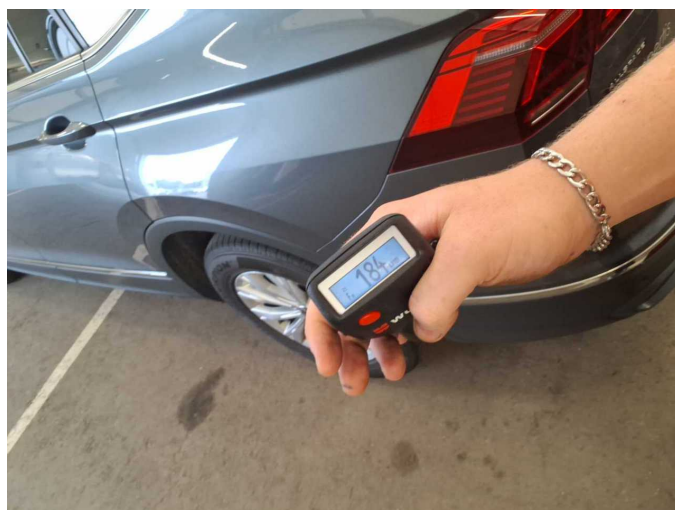

Repainting 1: Side panel - rear left side

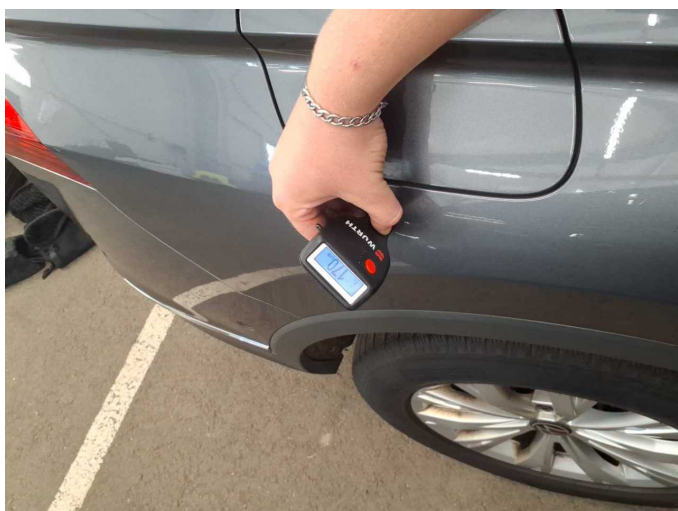

Repainting 2: Side panel - rear right side

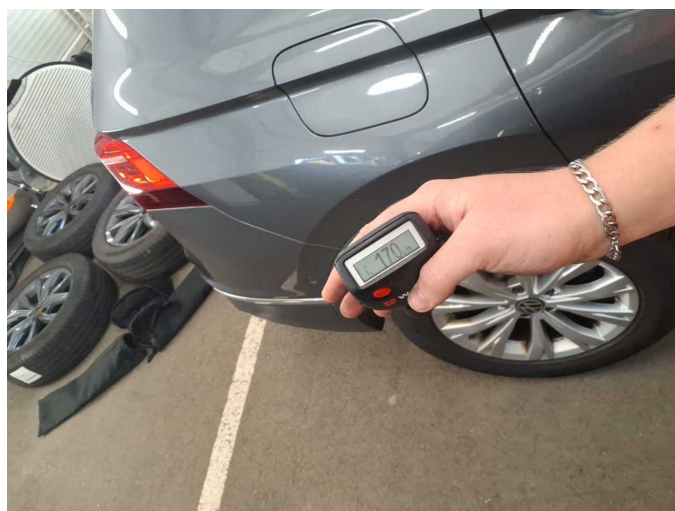

Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NXPM022253

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
DSG Life

Datum	KM-Stand	Beschreibung
13.05.2026	96.035	AU; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
10.11.2025	82.640	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.03.2025	64.496	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Regelwartungsdienst; Wartung Sonstiges
17.12.2024	56.763	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
24.05.2024	32.501	Regelwartungsdienst; Wartung Sonstiges
15.01.2024	27.303	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges