



Expertise

Protocol number: 46893641
Order No. / Reference: 26750341
Inspection date: 5 Aug 2026

Manufacturer: Volkswagen

Model: T-Roc 1.5 TSI OPF DSG R-Line

VIN: WVGZZA1ZPV739120



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen T-Roc 1.5 TSI OPF DSG R-Line

Vehicle Identification number	WVGZZA1ZPV739120
Mileage (Read)	56,547 km
First registration	4 Aug 2023
Number of holders	1
Next periodical technical inspection	08/2026
(Report not on hand)	

Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV

Colour / colour code	Petroleum Blue Metallic/ Dach in Deep Bla
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	3,900 km
Last service on / at	03/2025 at 30,304 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV251688
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CED 00800		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,860 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 92W	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/50 R18 92W	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Pirelli	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

Standard equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable, folding, and heated exterior mirrors with memory function
- Vehicle tool kit
- Black headliner
- Decorative inlays "Lava Stone Black"
- Tachometer
- Front door sill trims with "R-Line" logo
- Electronic Stability Program with counter-steering support
- Driving profile selection
- Chassis: Sport chassis
- High beam control "Light Assist"
- Pedestrian detection
- Luggage compartment floor height-adjustable and removable
- Rear window wiper with intermittent function
- ISOFIX mounting points
- Rear headrests (3)
- LED Plus headlights
- Light in the front footwell
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Otto particulate filter
- Park Assist system including parking aid
- Upholstery: Fabric inner side panels in "ArtVelours"
- Radio "Ready 2 Discover" incl. "Streaming & Internet"
- Tire pressure monitoring system
- Wheels: Tire Mobility Set
- Gearshift knob in leather
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Sport comfort seats in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Textile floor mats front and rear
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Airbag for driver and front passenger, with front passenger airbag deactivation
- white ambient lighting
- Adaptive Cruise Control (ACC) "stop & go" including speed limiter
- Hill start assist
- third brake light
- Silver anodized roof rails
- Digital cockpit, multi-colored, various selectable information profiles
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat-insulating
- Transmission: 7-speed DSG
- Rear window heated
- Interior mirror automatically dimming
- Air conditioning with active combination filter
- Front headrests
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Non-smoking version
- Emergency call service
- Package: Winter Package
- Brushed stainless steel pedals
- Progressive steering
- Rain sensor
- Wheels: Light alloy (4) "Valencia" 7 J x 17, Galvano Grey
- LED taillights, dark red
- Drawer under the right front seat
- Seats: Front passenger seat backrest folds down completely
- Seats: Rear seat backrest asymmetrically split and foldable with center armrest
- Lane keeping assistant "Lane Assist"
- Telephone interface
- Ambient lighting with logo projection
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys



Extra equipment

- Air conditioning system "Air Care Climatronic" (with active combination filter and 2-zone temperature control)
- Package: "Easy Open & Close" with safe locking ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - anti-theft alarm system with interior monitoring, backup horn and tow-away protection - keyless locking and starting system "Keyless Access" with safe locking)
- Package: "IQ.Drive" (DSG) assistance package (Adaptive Cruise Control ACC "stop & go", with speed limiter - "Travel Assist", "Lane Assist" lane keeping assist and "Emergency Assist" - "Light Assist" high beam control - "Front Assist" emergency braking assist - Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - "Side Assist" lane change assist)
- Package: Design package "Black Style" (R-Line) (4 light alloy wheels "Grange Hill" 7Jx18 215/50R 18, black - Exterior mirrors painted in contrasting color - Chrome applications on light switch, mirror adjustment switch, window regulator switch; air vents with black frames - Black roof rails - Carbon-look foil wrapping on the C-pillars - Wheel locks with enhanced theft protection - Darkened rear side windows and rear window - Black trim strips)
- Rear View reversing camera
- Paint finish: Metallic, two-tone with black roof
- Navigation system "Discover Media" incl. "Streaming & Internet" (6 speakers - App-Connect Wireless for Apple CarPlay and Android Auto - 20.3 cm touchscreen - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface (Apple compatibility) - Output power 4 x 20 watts - Map with 2D display - Points of interest - Telephone interface - Traffic sign recognition)
- Package: Business (Air Care Climatronic air conditioning with active combination filter and 2-zone temperature control - lumbar support in the front, electrically adjustable on the driver's side, massage function on the driver's side - "Discover Media" navigation system incl. "Streaming & Internet" - seat center panels of the front seats and the outer rear seats in "ArtVelours" microfleece - voice control - "Comfort" telephone interface with inductive charging function - traffic sign recognition - height-adjustable front seats, ergoAc)
- Panoramic tilt/slide sunroof with panoramic roof at the rear
- Radio accessories: "beatsAudio" sound system (300 watts total power - subwoofer - digital 8-channel amplifier - 6 speakers)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear left side	Door - dent(s) - Smooth repair work
2	Rear bumper	Rear bumper - Scratched - Smart repair
3	Wheel / tyres	Alloy rim - front right side - Scratched - Smart repair
4	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace
5	Interior	Boot cover / roller cover (Halterung defekt) - Defective - Replace
6	Front bumper	Bumper - front right side (Blende) - Scratched - Replace
7	Trim / covers	Door trim - rear left side - Damaged - Replace



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Boot lid / rear door	Boot lid - Stone chips - No deduction
3	Boot lid / rear door	Trim - standard - lower - Scratched - No deduction
4	2nd wheel set	2 wheel covers (HL VR) - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Engine - Engine cover

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 11 May 2025	7.095,89 €

Repainting

No. Repainting

1 Mudguard - left side, Bonnet, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	165 µm	Bonnet	305 µm
Door - front left side	174 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

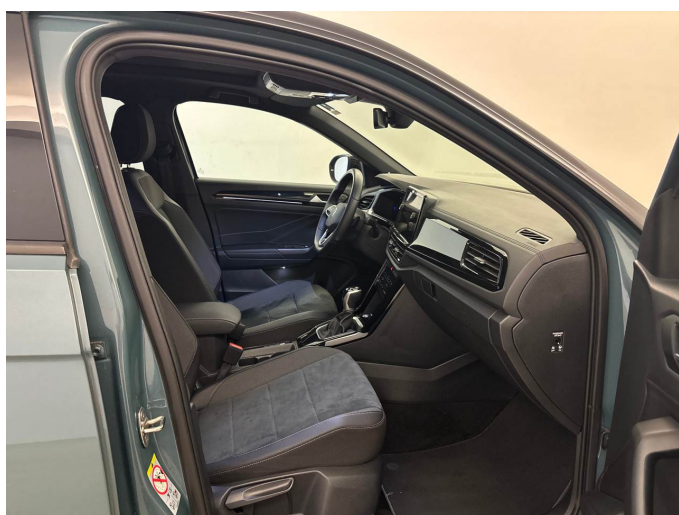


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

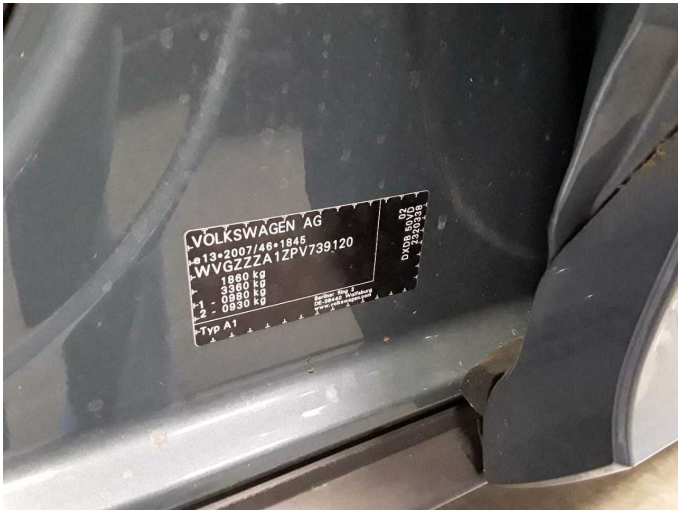


Figure 11: VIN



Figure 12: Mounted tyres

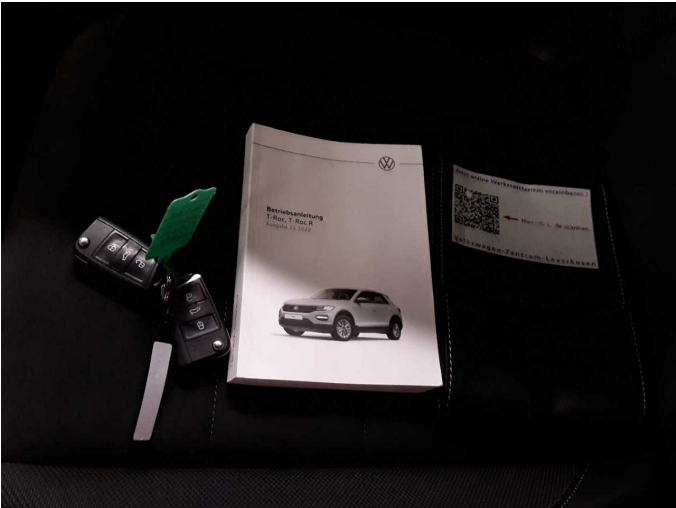


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

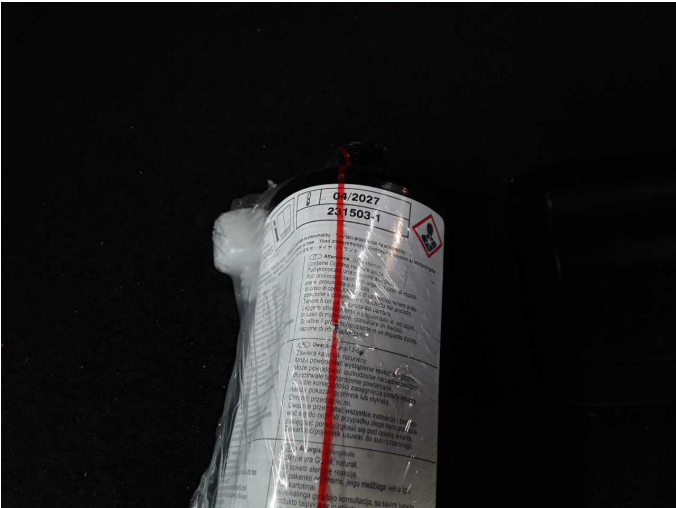


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Damage 1: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 1: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 4: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace




Damage 4: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace



Damage 5: Interior: Boot cover / roller cover (Halterung defekt) - Defective - Replace



Damage 5: Interior: Boot cover / roller cover (Halterung defekt) - Defective - Replace

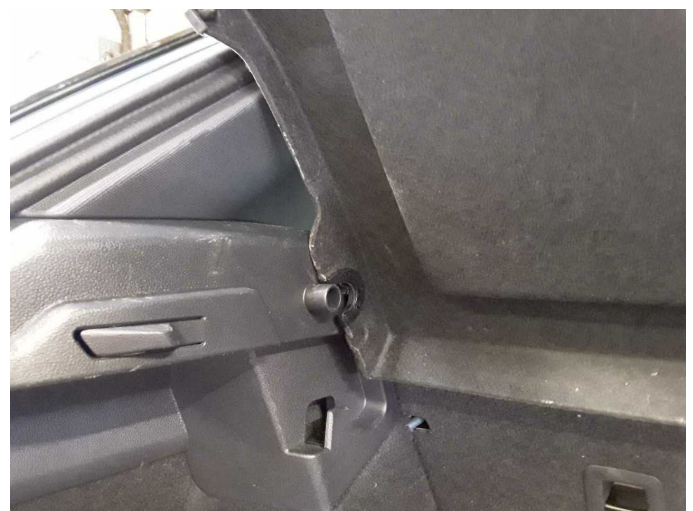

Damage 5: Interior: Boot cover / roller cover (Halterung defekt) - Defective - Replace



Damage 5: Interior: Boot cover / roller cover (Halterung defekt) - Defective - Replace




Damage 6: Front bumper: Bumper - front right side (Blende) - Scratched - Replace



Damage 6: Front bumper: Bumper - front right side (Blende) - Scratched - Replace



Damage 6: Front bumper: Bumper - front right side (Blende) - Scratched - Replace

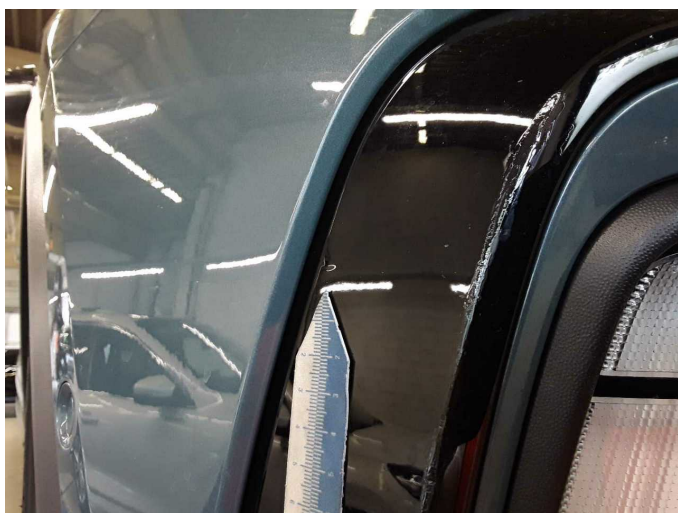

Damage 6: Front bumper: Bumper - front right side (Blende) - Scratched - Replace



Damage 7: Trim / covers: Door trim - rear left side - Damaged - Replace



Damage 7: Trim / covers: Door trim - rear left side - Damaged - Replace



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction




Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Boot lid / rear door: Boot lid - Stone chips - No deduction



Wear and tear 2: Boot lid / rear door: Boot lid - Stone chips - No deduction

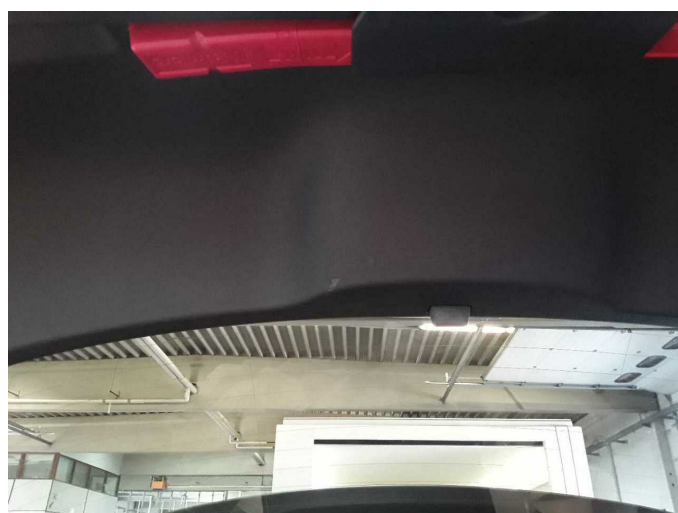

Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched - No deduction



Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched - No deduction



Wear and tear 4: 2nd wheel set: 2 wheel covers (HL VR) - Scratched - No deduction




Wear and tear 4: 2nd wheel set: 2 wheel covers (HL VR) - Scratched - No deduction



Wear and tear 4: 2nd wheel set: 2 wheel covers (HL VR) - Scratched - No deduction



Wear and tear 4: 2nd wheel set: 2 wheel covers (HL VR) - Scratched - No deduction

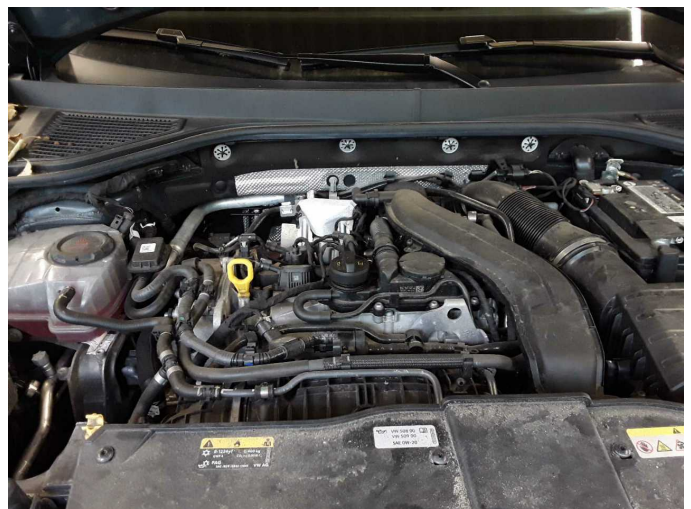

Missing part 1: Engine: Engine cover - Missing - Replace



Missing part 1: Engine: Engine cover - Missing - Replace



Mudguard - left side: 165 µm



Bonnet: 305 µm



Door - front left side: 174 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZA1ZPV739120

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN T-Roc 1.5 TSI OPF DSG R-Line

Datum	KM-Stand	Beschreibung
13.03.2025	30.304	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges