



Expertise

Protocol number: 46502663
Order No. / Reference: 26621369
Inspection date: 14 Jul 2026

Manufacturer: Mercedes-Benz

Model: Vito 110 CDI Kompakt HA BASE Kasten

VIN: W1V44760114123316



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz Vito 110 CDI Kompakt HA BASE Kasten

Vehicle Identification number W1V44760114123316
Mileage (Read) 47,129 km
First registration 9 Jun 2022
Number of holders 1
Next periodical technical inspection 07/2026
(Report on hand)

Power / Engine displacement 75 kw / 1,950 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 6
Type of drive Rear drive
Type of vehicle Van

Colour / colour code Verkehrsblau
Doors / Seats 4 / 3
Upholstery type Cloth
Colour of upholstery Black

Re-import no
readiness to drive Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	580 Tag(e)
Last service on / at	02/2026 at 44,322 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM180784
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BDX 00388		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	2,800 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/65 R16 103H	All-season tyres on Steel rim with wheel cover	Continental	6mm / 6mm
2)	205/65 R16 103H	All-season tyres on Steel rim with wheel cover	Continental	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Screw-in towing eye front/rear
- Passenger side airbag
- ATTENTION ASSIST
- Outdoor temperature display
- Battery: fleece battery 12 V / 92 Ah
- Hill start assist
- Brake lights, adaptive
- Front cupholder
- Electronic tachometer
- Chassis: Standard chassis
- HVO-capable vehicle
- Parking brake
- Generator 14 V / 250 A
- Speed limit 210 km/h
- Weight variant 2,800 kg
- Seatbelt warning device for driver's seat
- Main tank 57 liters
- Interior trim of cargo area, side
- Headrests (2), front
- Mercedes-Benz emergency call system
- Breakdown management
- Tires: Tires without specified make
- Wheels: Steel rims 6.5 J x 16
- Sliding door on the right, cargo/passenger compartment
- Crosswind Assist
- Seats: Adjustable passenger seat
- Start-stop function
- Cruise control
- First aid kit
- Warning triangle
- Immobiliser
- Central locking with radio remote control
- Registration certificate, Part II
- Axle ratio $i = 3.267$
- Driver's side airbag
- Exterior mirrors, manually adjustable (2)
- Battery: Backup battery for starting process
- Fixing points in the roof frame
- third brake light
- COC documents
- Diesel particulate filter
- Electronic Stability Program (ADAPTIVE ESP) with integrated Anti-lock Braking System (ABS)
- Electric windows, driver/passenger
- Generator 14 V / 200 A
- Generator management
- Transmission: 6-speed manual transmission TSG 380
- Seatbelt warning device for front passenger seat
- Lockable glove box
- Boot lid
- Communication module (LTE) for digital services
- Headlight range control
- Package: BlueEFFICIENCY
- Upholstery: Caluma fabric, black
- Tires: Premium protection tires (3 years)
- Headlights: halogen technology
- Key: 3-button remote control
- electromechanical power steering
- Seats: Driver's seat
- 12V socket
- continuous partition wall
- Pre-installation for Remote Services Plus
- Maintenance interval indicator >>ASSYST<
- Heat-insulating glass all around
- Registration as a truck



Extra equipment

- Comfort roof control unit in conjunction with rain sensor
- Window in tailgate (with wiper/washer system)
- Fleet Comfort Package
- Wooden floor (cargo area)
- Tempmatic controlled air conditioning
- Large fuel tank, approx. 70 liters
- Steering wheel adjustable for tilt and height
- Navigation accessories: Live Traffic Information
- Radio/Navigation: Multimedia radio and navigation system "Audio 40" (7-inch LCD touchscreen - DAB digital radio - Apple CarPlay and Android Auto - Bluetooth 3.0 - Hands-free system - Live Traffic Information - 2-way front speakers)
- Tire pressure monitoring (on front and rear axles (wireless))
- Seats: Comfort driver's seat
- Auxiliary heater, electric
- Driving light assistant (automatically switching on driving lights)
- Rear camera not foldable
- Interior lining of the cargo area up to roof height (wood)
- Instrument cluster with pixel matrix display (operated via the buttons on the multifunction steering wheel - round instruments for speedometer and tachometer or fuel level and coolant temperature - high-quality pixel matrix display in white and red between the large round instruments)
- Radio: Digital Radio DAB
- Rain sensor
- Tires: 205/65 R 16
- Tires: All-season tires
- High-resolution reversing camera with guide lines
- Seats: Passenger seat, two-seater
- Partition wall with 1 continuous window

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Air-conditioning system	Air-conditioning system (Knopf) - Missing - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Loss in value
3	Vehicle glazing	Rear window (Folie) - Scratch(es) - Loss in value
4	Roof	Roof - dent(s) - Smart repair
5	Bonnet	Bonnet (Farbunterschied) - Paint defect - Paint
6	Boot lid / rear door	Boot lid (Orangenhaut) - Paint defect - Paint
7	Sliding door, right	Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection (07.2026) - Due - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 4 Oct 2022	6.376,25 €



Repainting

No. Repainting

- 1 Boot lid / rear door, Unprofessionally carried out, Invoice of repair done Non-existent
- 2 Bonnet, Unprofessionally carried out, Invoice of repair done Non-existent
- 3 Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	304 µm	Bonnet	230 µm
Door - rear right side	567 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

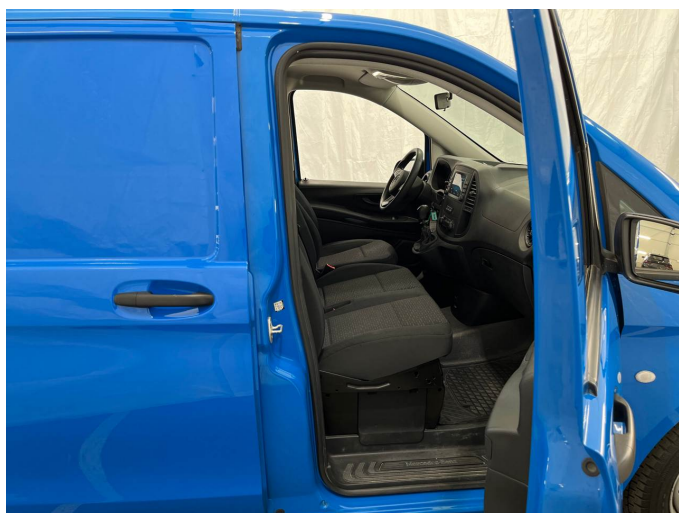


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

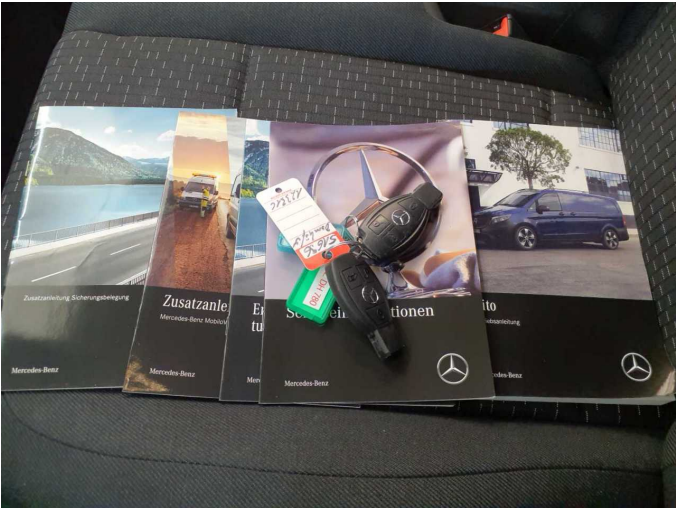


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.

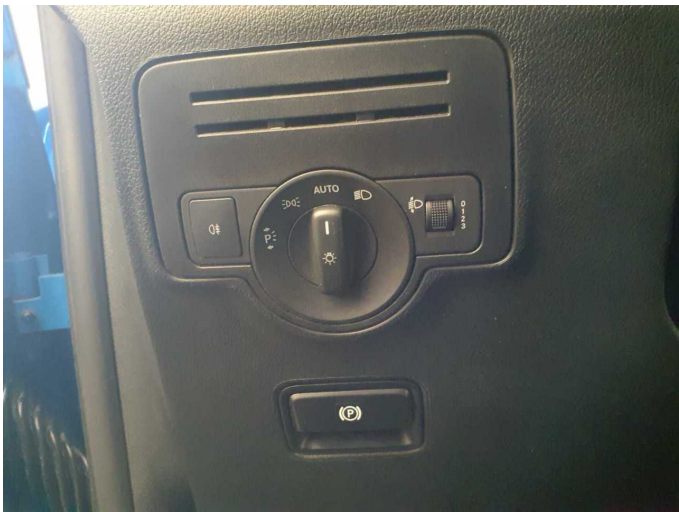


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.


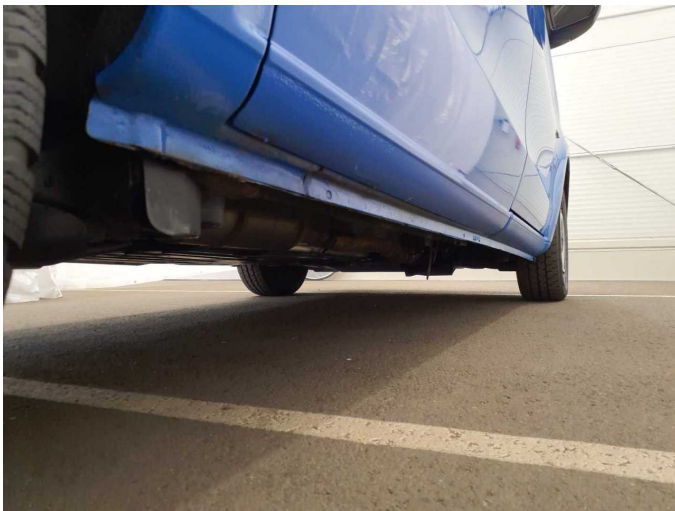


Figure 27: Misc.



Damage 1: Air-conditioning system: Air-conditioning system (Knopf) - Missing - Replace

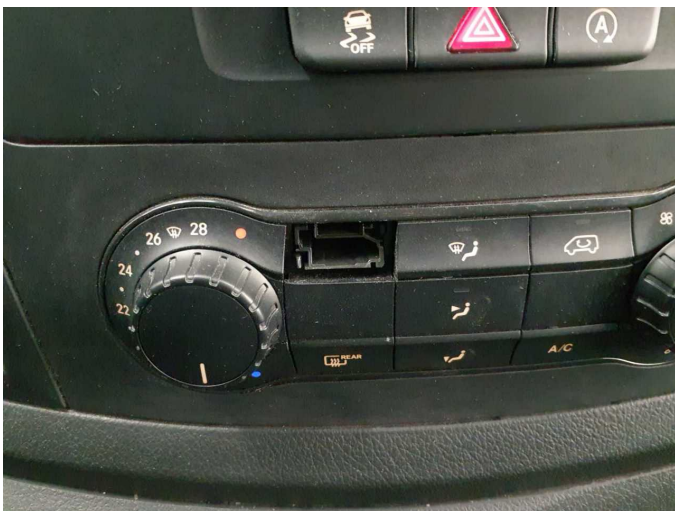

Damage 1: Air-conditioning system: Air-conditioning system (Knopf) - Missing - Replace



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value

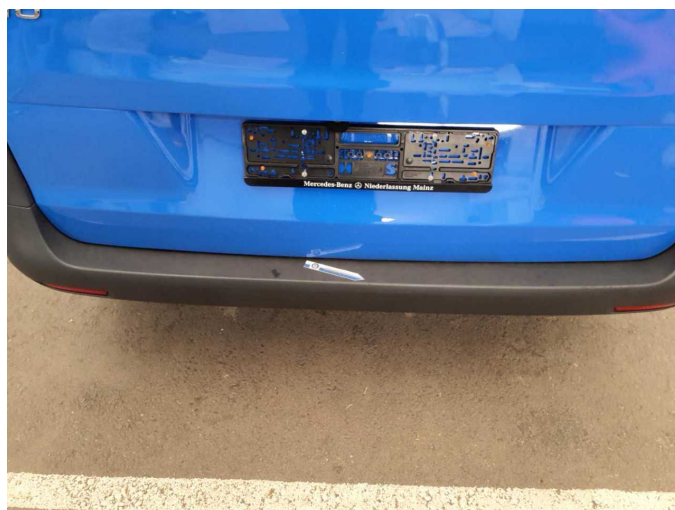

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value

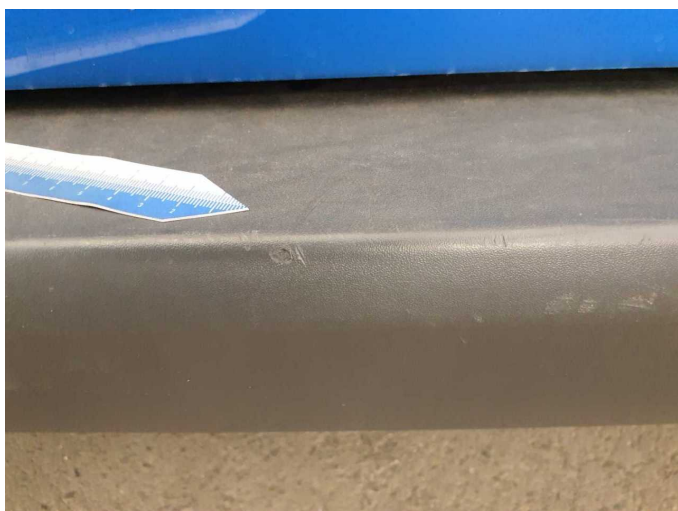

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 3: Vehicle glazing: Rear window (Folie) - Scratch(es) - Loss in value




Damage 3: Vehicle glazing: Rear window (Folie) - Scratch(es) - Loss in value




Damage 3: Vehicle glazing: Rear window (Folie) - Scratch(es) - Loss in value




Damage 4: Roof: Roof - dent(s) - Smart repair

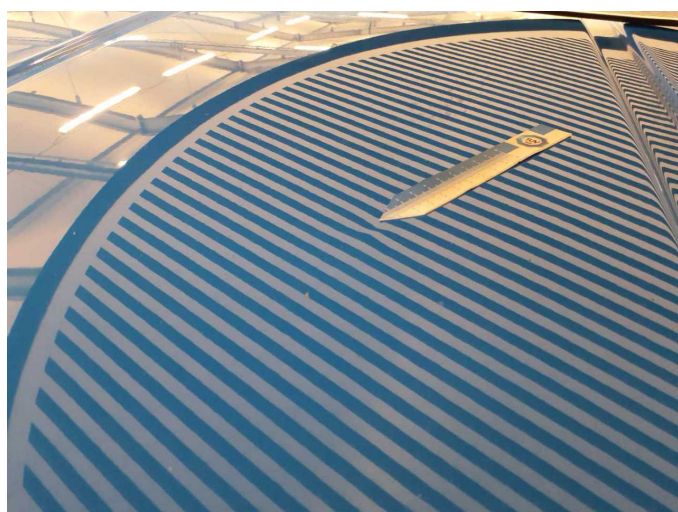

Damage 4: Roof: Roof - dent(s) - Smart repair

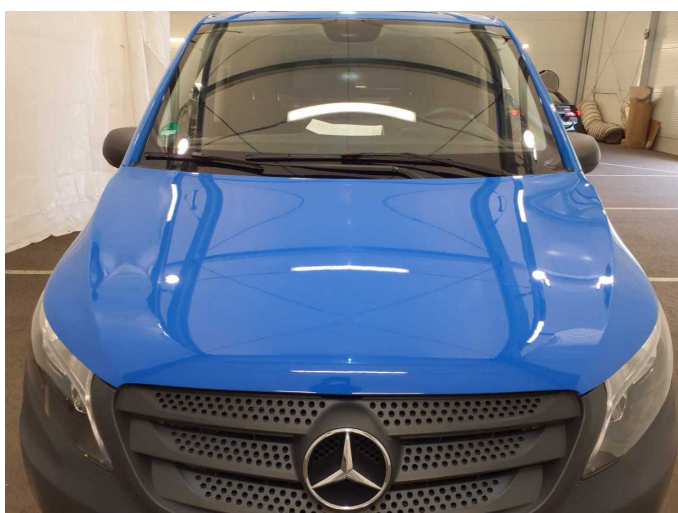


Damage 5: Bonnet: Bonnet (Farbunterschied) - Paint defect - Paint

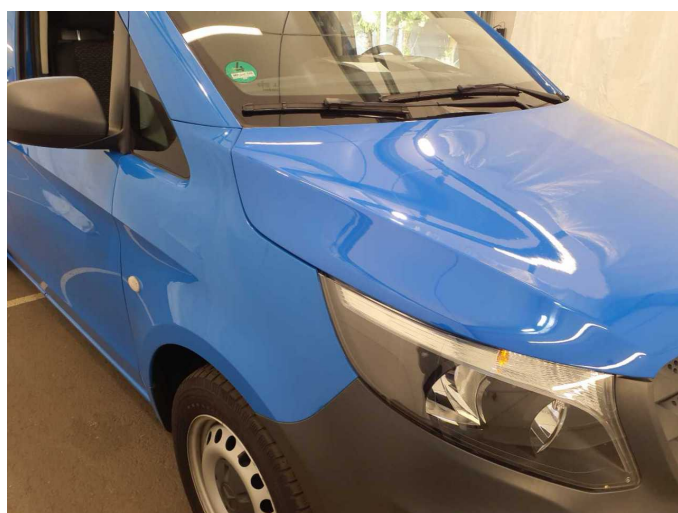


Damage 5: Bonnet: Bonnet (Farbunterschied) - Paint defect - Paint




Damage 6: Boot lid / rear door: Boot lid (Orangenhaut) - Paint defect - Paint

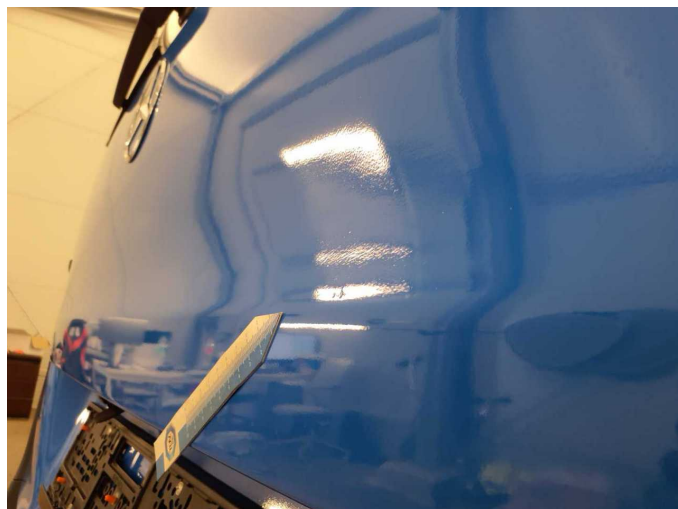


Damage 6: Boot lid / rear door: Boot lid (Orangenhaut) - Paint defect - Paint

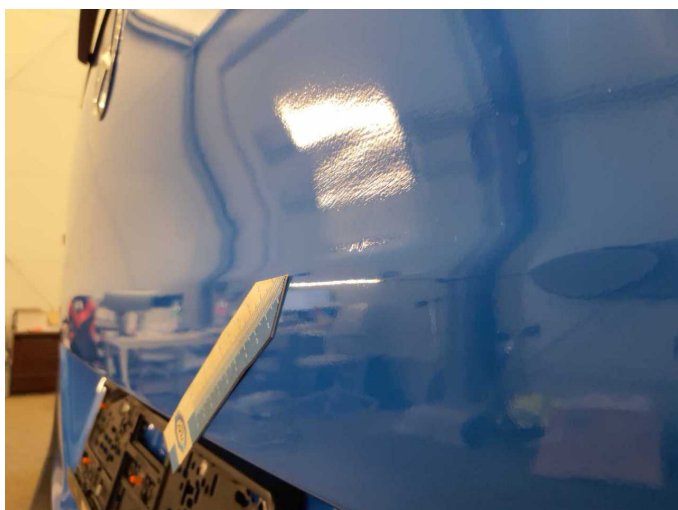


Damage 6: Boot lid / rear door: Boot lid (Orangenhaut) - Paint defect - Paint

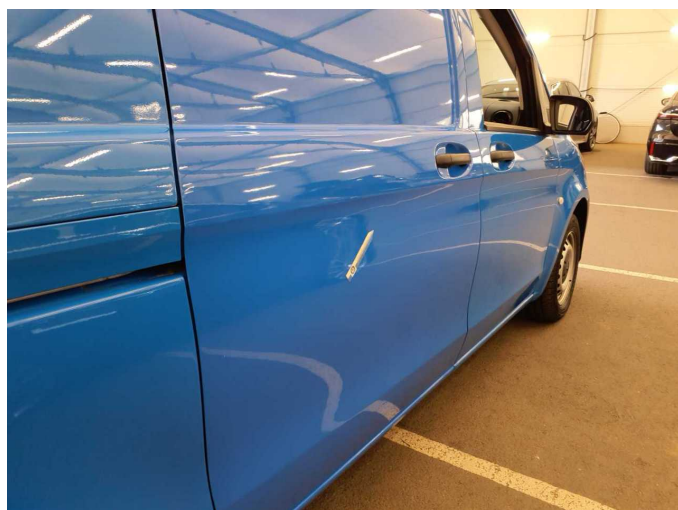

Damage 7: Sliding door, right: Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint

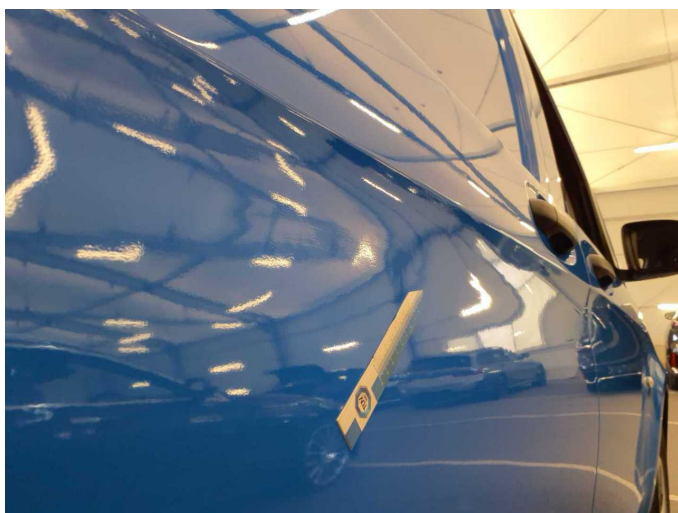


Damage 7: Sliding door, right: Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint

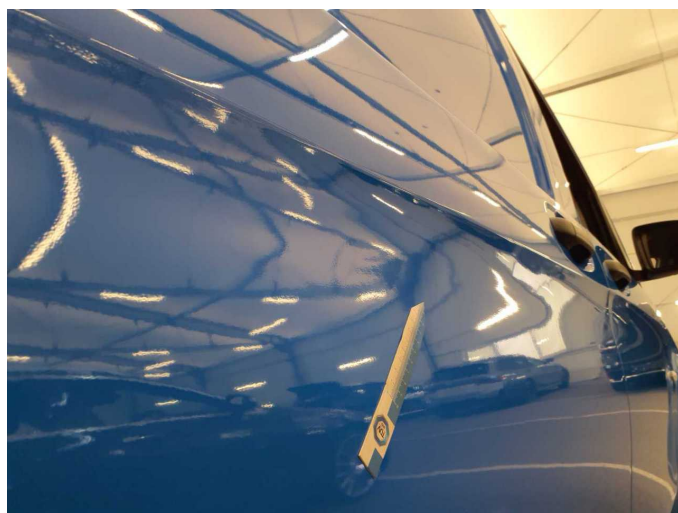

Damage 7: Sliding door, right: Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint



Damage 7: Sliding door, right: Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint

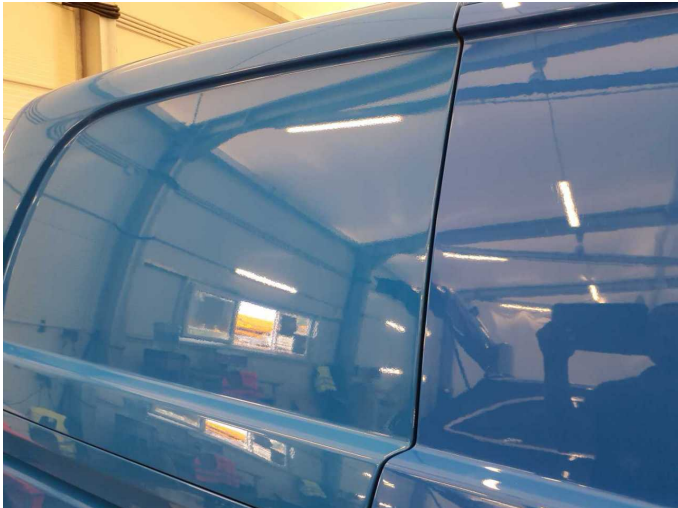


Damage 7: Sliding door, right: Sliding door (Orangenhaut + Farbunterschied) - Paint defect - Paint




Wear and tear 1: Misc.: Main inspection (07.2026) - Due - No deduction



Repainting 1: Boot lid / rear door

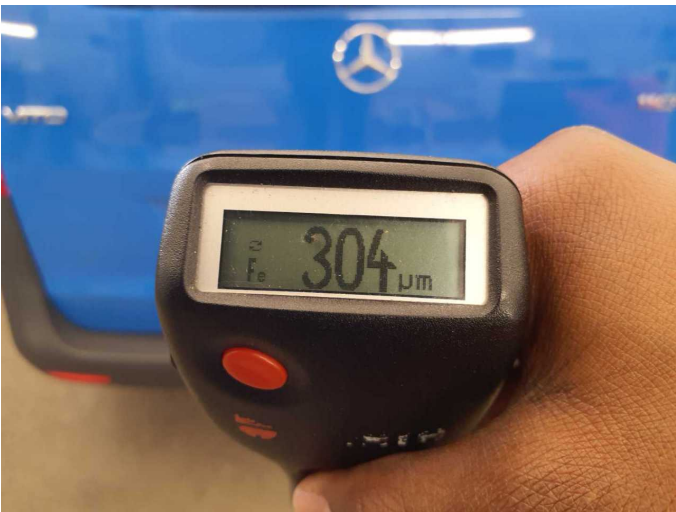


Repainting 1: Boot lid / rear door

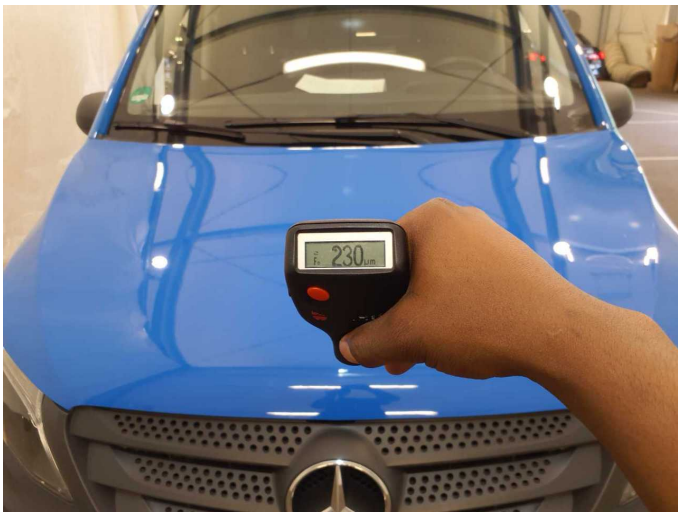

Repainting 2: Bonnet



Repainting 2: Bonnet

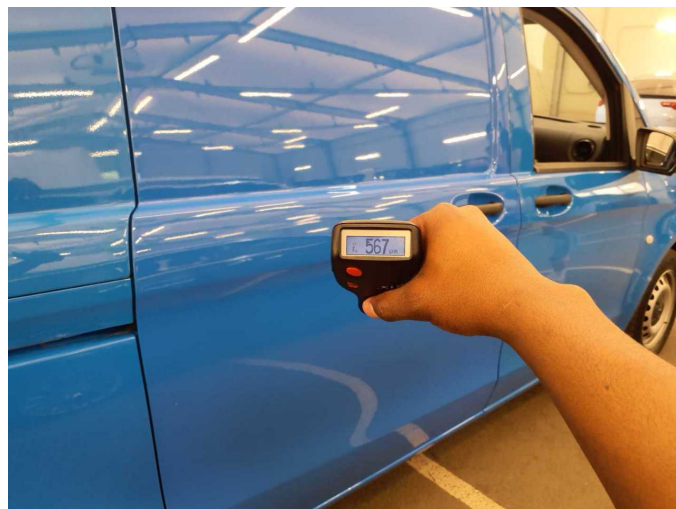

Repainting 3: Door - rear right side



Repainting 3: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1V44760114123316

Hersteller / Modell: MERCEDES-BENZ MB Vito 110 CDI Kompakt HA BASE

Datum	KM-Stand	Beschreibung
26.02.2026	44.322	Regelwartungsdienst
23.07.2024	25.984	AU
08.02.2024	16.951	Regelwartungsdienst