



Expertise

Protocol number: 46589179
Order No. / Reference: 26678705
Inspection date: 20 Jul 2026

Manufacturer: Volkswagen

Model: Transporter T6.1 DSG Kurz

VIN: WV1ZZZ7HZMH013082



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Transporter T6.1 DSG Kurz

Vehicle Identification number	WV1ZZZ7HZMH013082
Mileage (Read)	190,343 km
First registration	28 Oct 2021
Number of holders	1
Next periodical technical inspection	11/2027
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Candy White (B9A)
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Anthracite-Grey
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	4,700 km
Last service on / at	02/2026 at 181,395 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX338585
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / BXU 55196		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,800 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Steel rim with wheel cover	Continental	7mm / 7mm
2)	215/65 R16 109R	Winter tyres on Steel rim with wheel cover	Continental	9mm / 9mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 106T	Summer tyres on Steel	Hankook	5mm / 3mm
2)	215/65 R16 106T	Summer tyres on Steel	Hankook	0mm / 0mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2032		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage and stowage boxes
- Electrically adjustable and heated exterior mirrors
- Hill Start Assist
- third brake light
- Electronic Stability Program
- Electric windows, front
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Headrests (2)
- Headlight range control
- Non-smoking version
- Radio: Digital radio reception (DAB+)
- Wheels/Tires: Steel wheels 6.5 J x 16 in 20-hole design
- Wheels/Tire Accessories: Wheel covers for 16" wheels
- Sliding door in the passenger/cargo compartment: sliding door on the right
- electromechanical power steering
- Start-stop system
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control and interior operation
- Airbag for driver and front passenger
- Exterior mirrors, left and right convex
- Floor coverings: Rubber floor covering in the driver's cab
- Tachometer
- Chassis: 16" chassis with 16" brake system
- Fresh air system with multi-stage fresh air blower
- Heating and ventilation system in the driver's cab
- Child safety lock, electrically operated
- Paint finish: Solid
- Multi-collision brake
- Particulate filter: Soot particle filter for diesel engines
- Wheels/Tires: 205/65 R 16 C 107/105 T, optimized for low rolling resistance
- Wheels: Tire Mobility Set
- Keys for locking system: 2 remote control flip keys
- Crosswind assist
- Seat belts: Three-point automatic seat belts
- Daytime running light
- Lashing eyes for securing cargo
- Green thermal insulation glazing
- Registration as a truck



Extra equipment

- "Transporter" lettering on the fender, no lettering on the rear
- Fleet management system interface (electrical terminal block)
- Glove compartment with light
- Light and visibility (interior safety mirror, automatically dimming - daytime running lights with automatic headlight control, "Leaving home" function and manual "Coming home" function - intermittent wiper control with rain sensor for the windshield wipers)
- Partition wall and air outlet relocation including installation
- Partition walls: High partition wall with fixed window and 8 lashing rings for securing cargo (partition wall, high, with window - without child safety lock in passenger compartment - lashing rings for securing cargo, reinforced (ISO 27956))
- Power outlets: 2 12-volt sockets in the dashboard
- Radio navigation system "Discover Media" including "Streaming & Internet" (voice control - 2 USB interfaces (Type C) in the dashboard - "Discover Media" radio navigation system with 20.3 cm (8 inch) touchscreen including "Streaming and Internet" - navigation function/ preparation - 4 speakers: 2 tweeters, 2 woofers - Wired & Wireless App-Connect)
- Rear window with heat-insulating glazing, heated, and rear window wiper/washer system
- Seat configuration - 4. Lumbar support: Lumbar support (electrically adjustable) for single seat in the driver's cab, left.
- Tailgate with window, heated (tailgate with window cutout - rear window, heated - safety interior mirror, dimmable)
- Wheels/Tires: Tire pressure monitoring system (direct measuring)
- "Premium" multifunction display with multicolor screen and fatigue detection
- Auxiliary heater: Air auxiliary heater and PW3
- Bott facility
- Cruise control system including speed limiter
- Fuel tank with 80 l tank capacity
- LED headlights and LED taillights (LED headlights with LED daytime running lights - automatic headlight range control - red LED taillights)
- Package: Comfort Package Plus (2 12-volt sockets, air conditioning in the driver's cab with manual control, fabric seat covers, "Bricks" design, 1 waste bin for the door pockets in the driver's cab, additional soundproofing measures in the driver's cab, height adjustment for the left single seat in the driver's cab, glove compartment lid with light, foldable grab handle on the roof frame on the passenger side, storage compartments on the driver's cab seats, reading light, sun visors with mirrors (front/rear), grab handle (front/rear), manual lumbar support for the left single seat in the 1st row of seats)
- Seat configuration - 5. Armrests: Armrests for the left seat in the driver's cab
- Seat heating for driver's seat, left, adjustable
- Telephone: Mobile phone interface "Comfort" (with inductive charging function)
- Total weight: Permissible total weight 3.2 t with reinforced 16" steel wheels (4 steel wheels 6.5 J x 16 - Permissible total weight 3,200 kg - Suspension and damping, for vehicles with 3.2 t permissible total weight - On-board tools and jack, reinforced, for vehicles with 3.2 t GVW)
- Windows: Front window and closed rear side wall, in the cargo/ passenger compartment, right

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (unvollständig) - No evidence - No deduction
2	Bonnet	Bonnet - dent(s) - Smart repair
3	Sliding door, right	Trim - Broken / torn - Replace
4	Door - front right side	Door - Dent / paintcoat damage - Smart repair
5	Measurement	Undercarriage (Sommerreifen laufen auf einseitig ab) - Measure
6	2nd wheel set	2 tyres - Worn - Replace
7	Engine	Engine (Zusatzkosten können entstehen) - Noise - Perform diagnosis
8	Body	Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction
2	Sliding door, right	Sliding door with glass panel - dent(s) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- 1 Mudguard - left side, Professionally carried out

Paint coat thickness measurement

Mudguard - left side

201 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

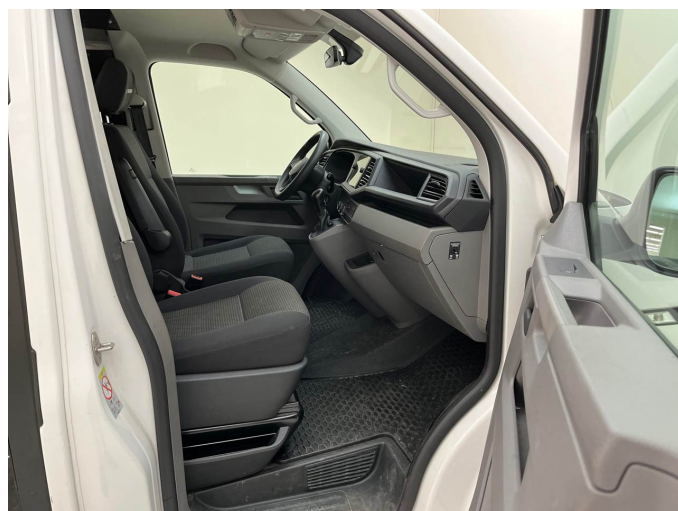


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

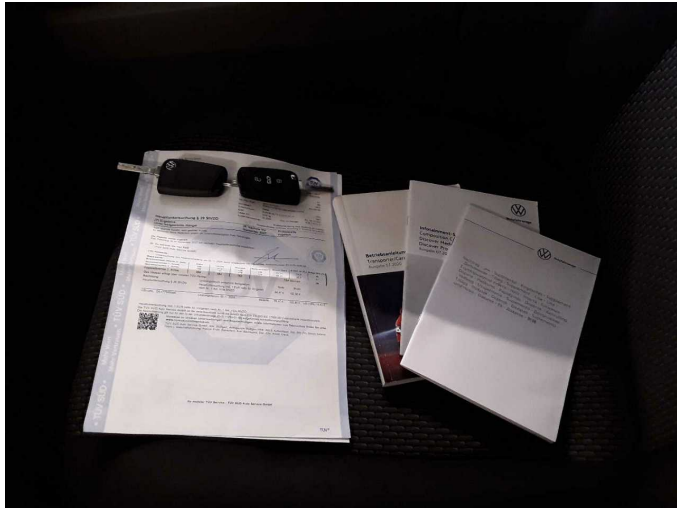


Figure 13: Documents



Figure 14: Documents

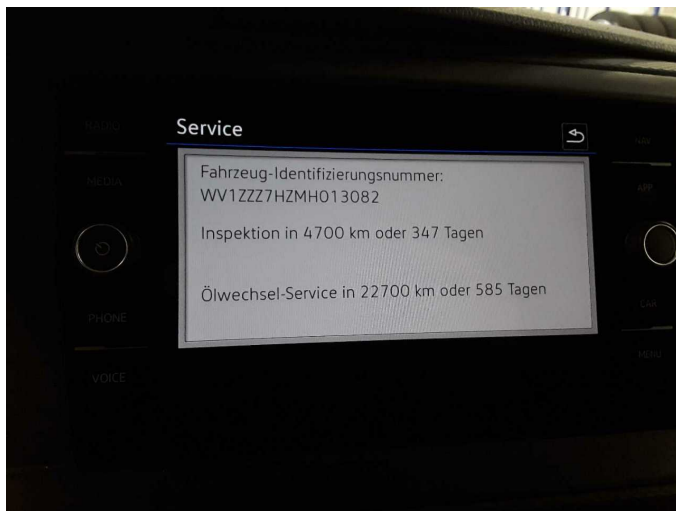


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 2: Bonnet: Bonnet - dent(s) - Smart repair



Damage 2: Bonnet: Bonnet - dent(s) - Smart repair



Damage 3: Sliding door, right: Trim - Broken / torn - Replace



Damage 3: Sliding door, right: Trim - Broken / torn - Replace



Damage 4: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 6: 2nd wheel set: 2 tyres - Worn - Replace



Damage 6: 2nd wheel set: 2 tyres - Worn - Replace



Damage 6: 2nd wheel set: 2 tyres - Worn - Replace



Damage 7: Engine: Engine (Zusatzkosten können entstehen) - Noise - Perform diagnosis




Damage 8: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise



Damage 8: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise



Damage 8: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise

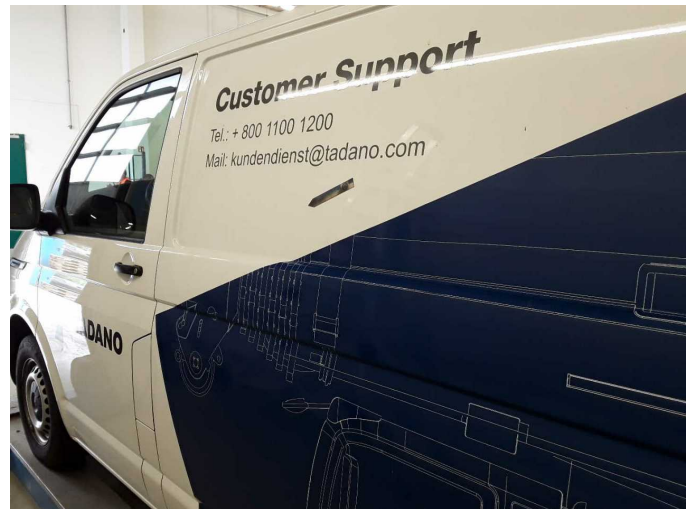

Wear and tear 4: Side panel - rear left side: Side panel - dent(s) - No deduction



Wear and tear 4: Side panel - rear left side: Side panel - dent(s) - No deduction



Mudguard - left side: 201 μ m



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZ7HZMH013082

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Transporter T6.1 DSG Kurz

Datum	KM-Stand	Beschreibung
25.02.2026	181.395	Bremsflüssigkeit; Bremsflüssigkeit ern; Lichtmaschine ern/inst; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges
01.07.2025	154.973	Batterie ern; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
31.10.2024	127.009	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.03.2024	94.946	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.11.2023	78.633	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
21.04.2023	60.469	Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst