



Expertise

Protocol number: 47108463
Order No. / Reference: 26787117
Inspection date: 18 Aug 2026

Manufacturer: Skoda
VIN: TMBLE9NY6PF058154

Model: Enyaq iV 80x



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80x	
Vehicle Identification number	TMBLE9NY6PF058154
Mileage (Reported)	54,395 km
First registration	26 Jun 2023
Number of holders	1
Fuel type	Electric
Power	77 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	All-wheel drive
Type of vehicle	Car station wagon
Colour / colour code	Graphite Grau Metallic (F7C)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	310 Tag(e)
Last service on / at	06/2026 at 36,500 km		
Key is / should be	2 / 2	FZG documents	
		Letter No.	GT110966
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWT 00040		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,750 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R21 101T	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/45 R21 101T	Summer tyres on Light alloy	Pirelli	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Evasive steering assist including turn assist
- Outdoor temperature display
- Hill start assist
- Design Selection Loft
- Third brake light
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Front radar assistant with pedestrian and cyclist detection and city emergency braking function
- Tinted windows
- Rear window wiper including windshield washer system
- Isofix anchorage on the front passenger seat
- Child safety locks on the rear doors
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED taillights
- Steering wheel: Leather steering wheel with multifunction buttons
- Navigation system
- Front and rear parking sensors
- Rain sensor and driving light assistant with coming and leaving home function
- Tire pressure monitoring
- Rear view camera
- Rear seat backrest split 60:40, foldable
- Seat belts
- Seats: Front seats height-adjustable including manually adjustable lumbar support
- Lane keeping assistant (Lane Assist)
- Traffic sign recognition
- heat pump
- Airbag, center airbag front
- Airbag, front and rear head airbags
- acoustic windscreen
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- AERO anodized roof rails
- Digital instrument cluster (Virtual Cockpit)
- E-Sound
- Increased battery charging power max. 125 kW
- Electric windows front and rear
- Cruise control
- Transmission: 1-speed (EV)
- Heated rear window
- Automatic interior mirror dimming
- Isofix anchorage on the outer rear seats including top tether
- Removable boot cover
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Steering wheel adjustable for height and reach
- Manual headlight range adjustment
- Multi-collision brake
- Package: Chrome
- Radio: Infotainment system with capacitive 13" color display
- Tire Mobility Kit
- Wheels: 19" Regulus AERO alloy wheels, anthracite, polished
- Power steering
- Safety lights in the front side doors
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Immobiliser
- Central locking including remote control integrated into the key

Extra equipment

- Swiveling trailer hitch (including trailer stabilization)
- Paint finish: Metallic
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Luggage net partition
- Mobile charging station "iV Universal Charger" with interchangeable connection adapters
- Wheels: 21" Supernova alloy wheels, black gloss turned (Seal tires front: 8.5Jx21 tires 235/45 R21 101T rear: 9Jx21 tires 255/40 R21 102T)



Brief expert findings

VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key with remote control - Empty - Replace
2	Door - front left side	Door - dent(s) - Smooth repair work
3	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
4	Door - front right side	Door edge - Scratch(es) - Smart repair
5	Rear bumper	Spoiler - Scratch(es) - Smart repair
6	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
7	Rear bumper	Rear bumper - Scratch(es) - Smart repair
8	Door - rear left side	Door - dent(s) - Smooth repair work

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

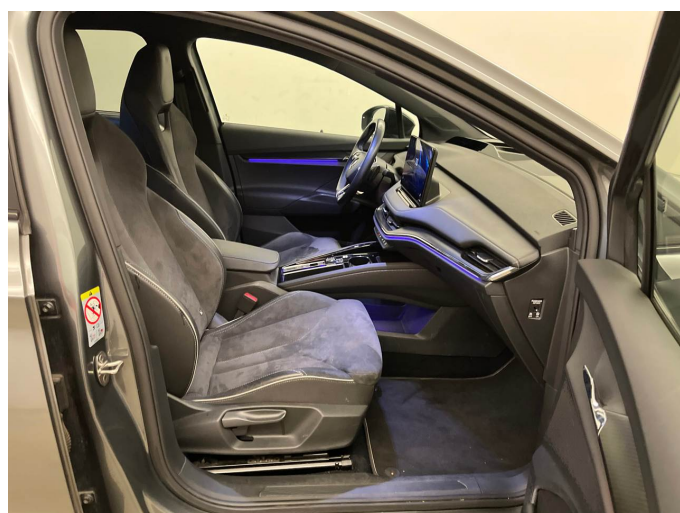


Figure 5: Interior - front

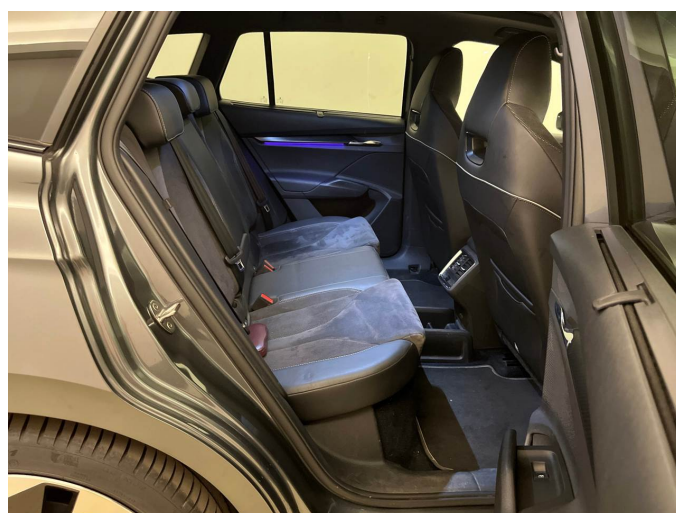


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

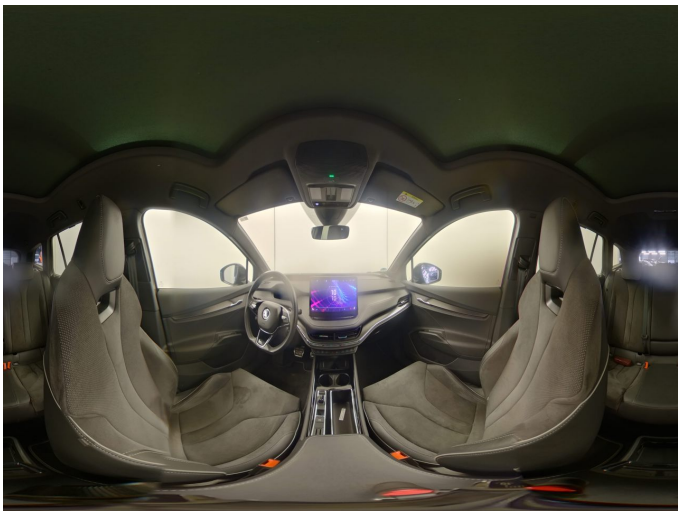


Figure 9: Interior 360° view



Figure 10: Cargo area

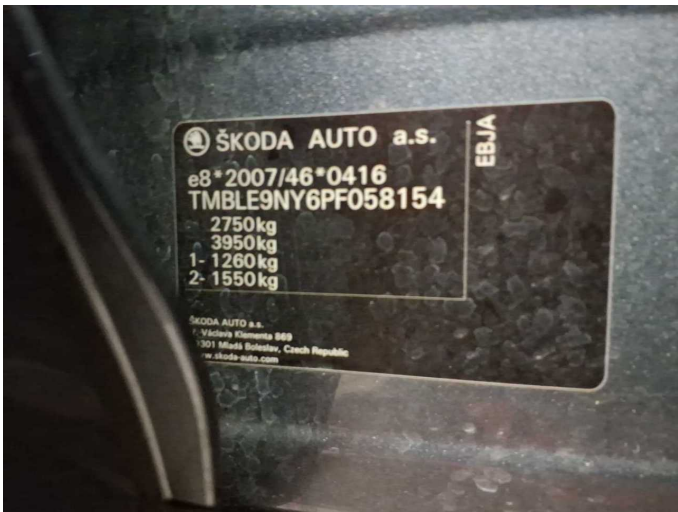


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

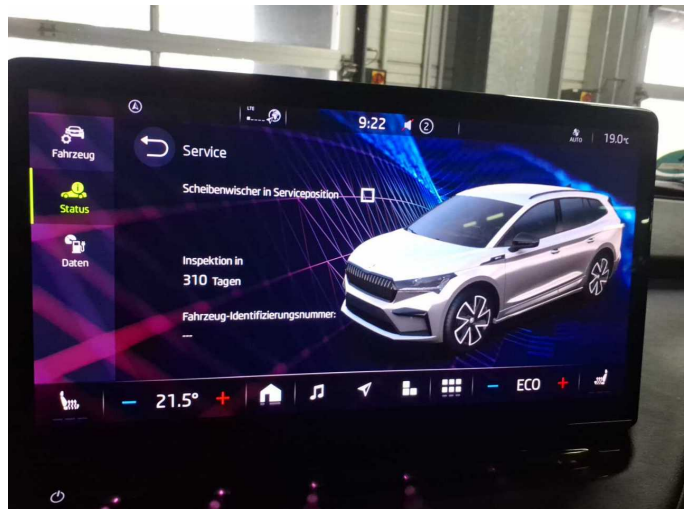


Figure 16: Misc.



Figure 17: Misc.

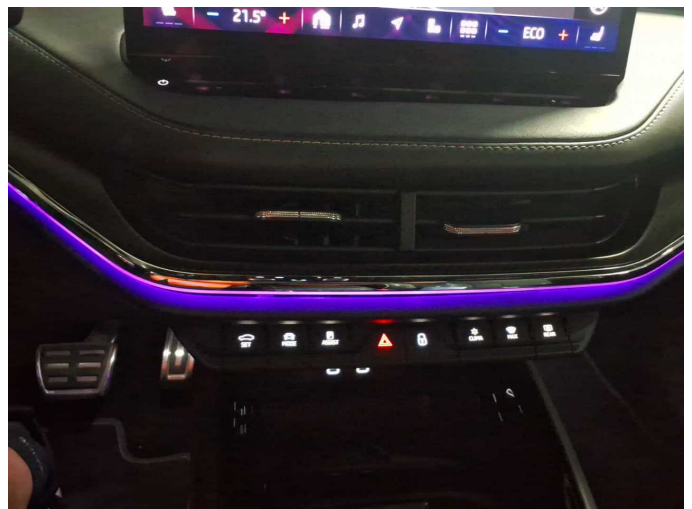


Figure 18: Misc.

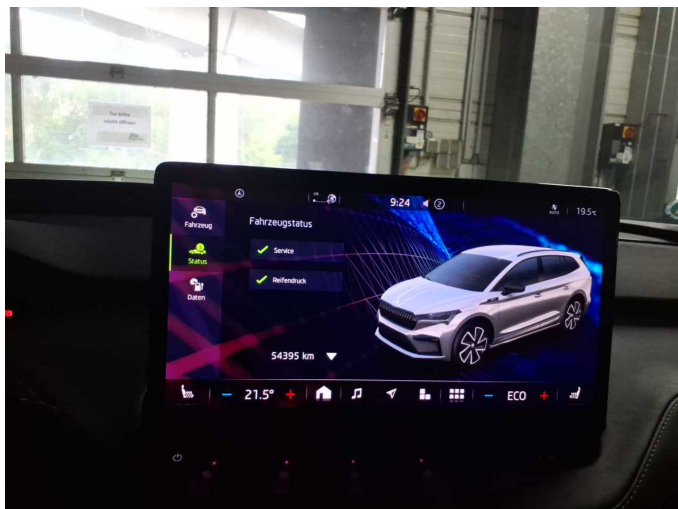


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

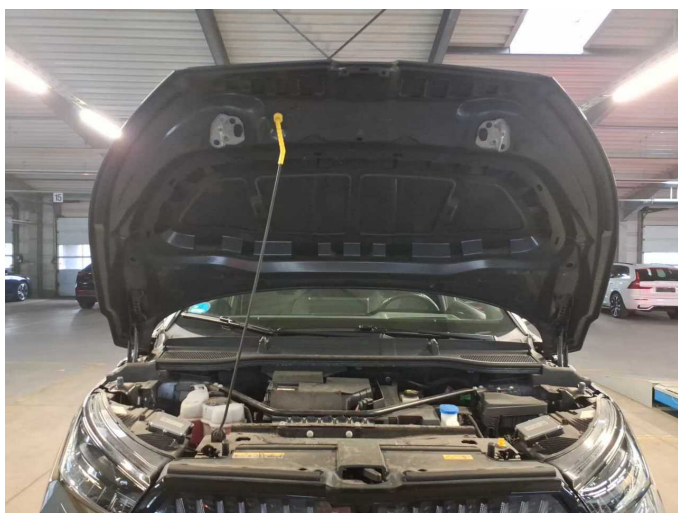


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

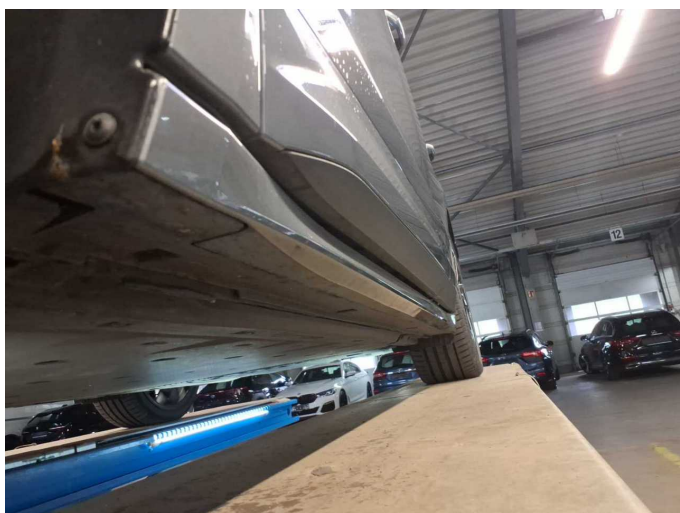


Figure 27: Misc.

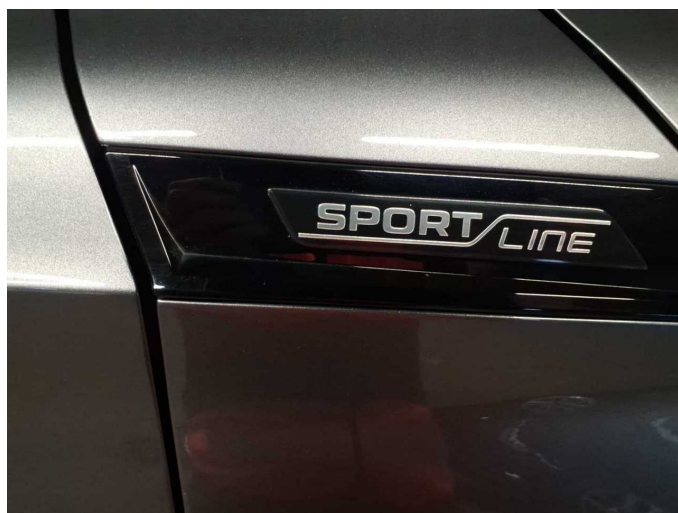


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

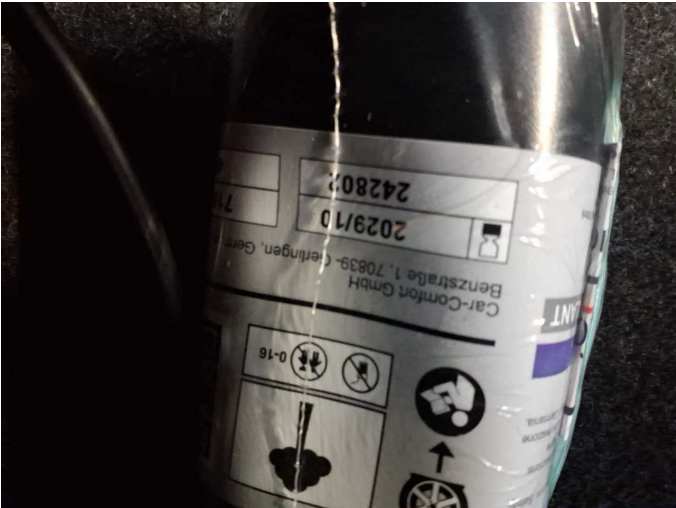


Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Damage 2: Door - front left side: Door - dent(s) - Smooth repair work




Damage 2: Door - front left side: Door - dent(s) - Smooth repair work



Damage 2: Door - front left side: Door - dent(s) - Smooth repair work



Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

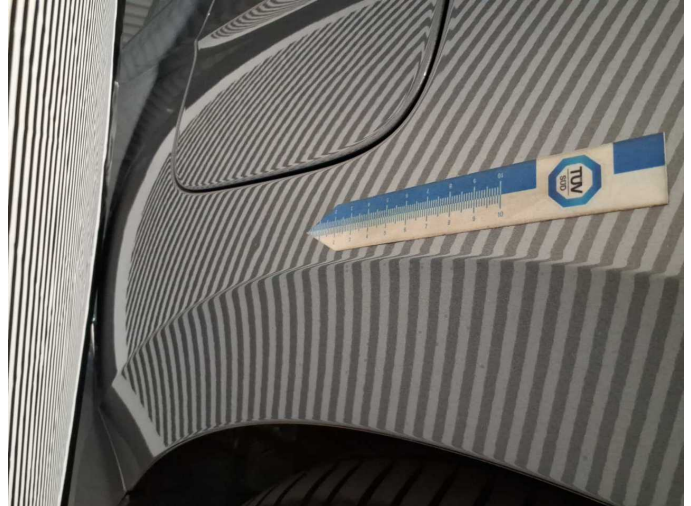


Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 4: Door - front right side: Door edge - Scratch(es) - Smart repair

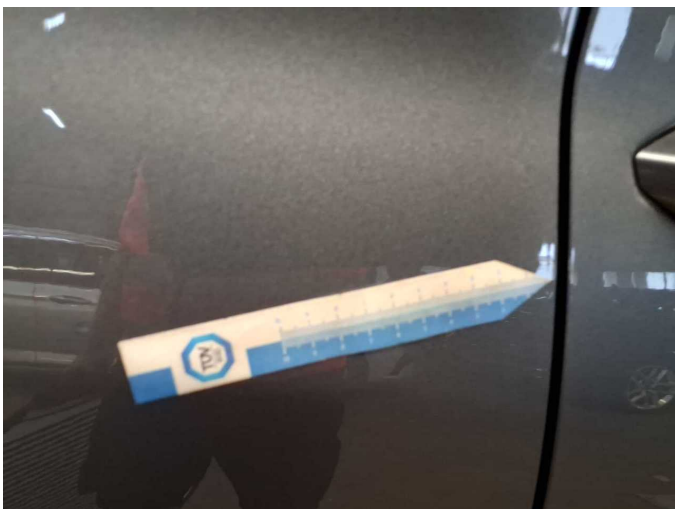


Damage 4: Door - front right side: Door edge - Scratch(es) - Smart repair

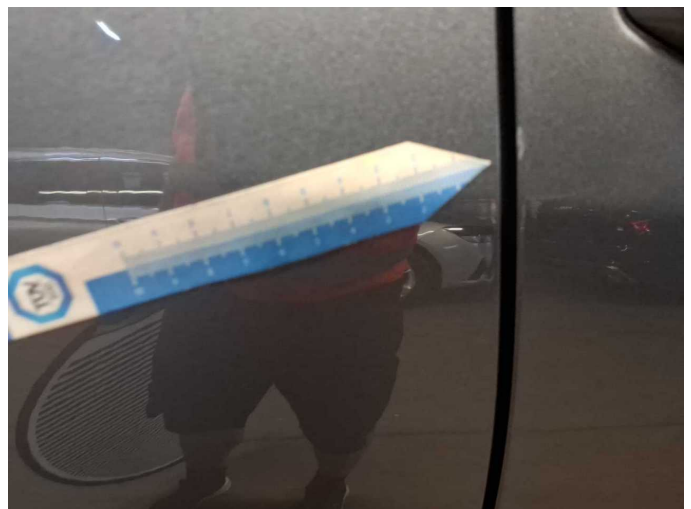

Damage 4: Door - front right side: Door edge - Scratch(es) - Smart repair

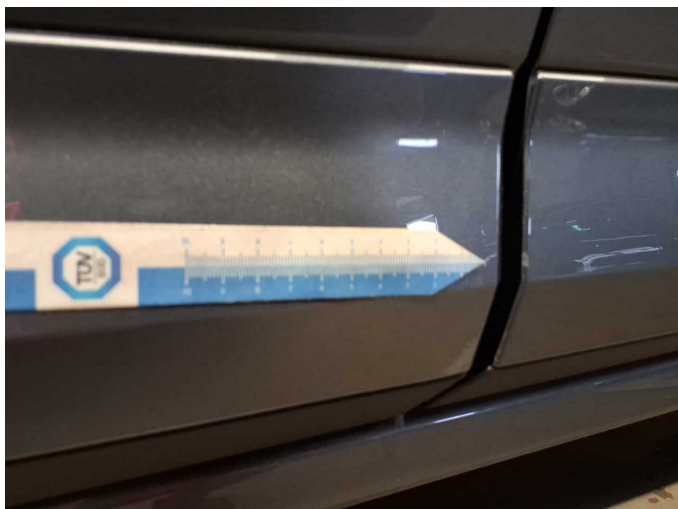

Damage 4: Door - front right side: Door edge - Scratch(es) - Smart repair

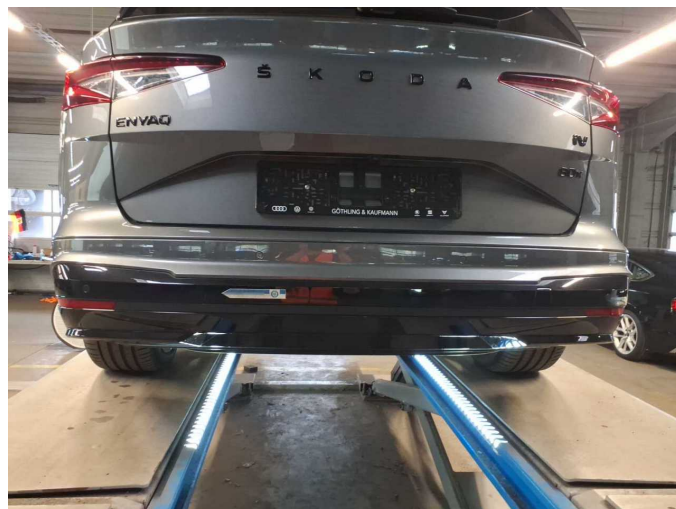

Damage 5: Rear bumper: Spoiler - Scratch(es) - Smart repair



Damage 5: Rear bumper: Spoiler - Scratch(es) - Smart repair



Damage 5: Rear bumper: Spoiler - Scratch(es) - Smart repair




Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Smart repair




Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

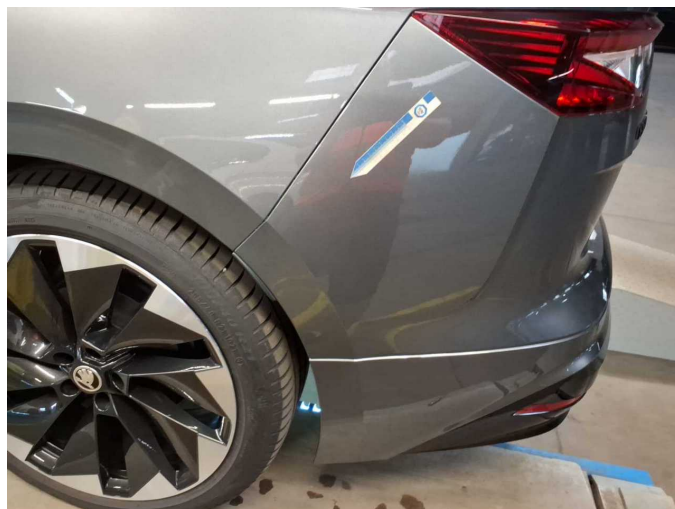

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair

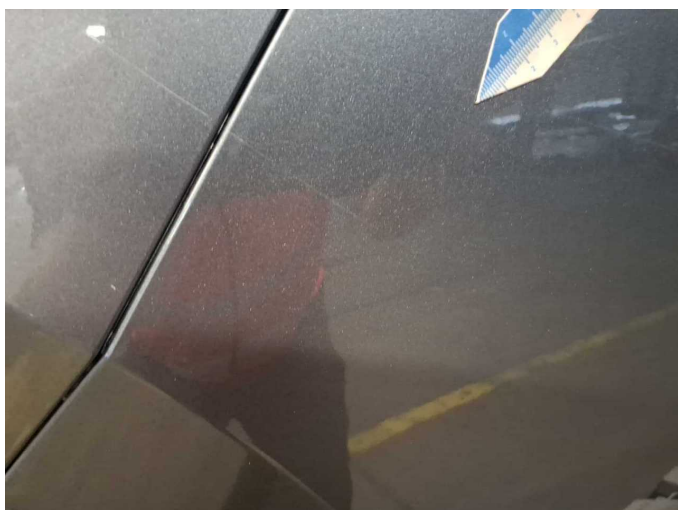


Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 8: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 8: Door - rear left side: Door - dent(s) - Smooth repair work

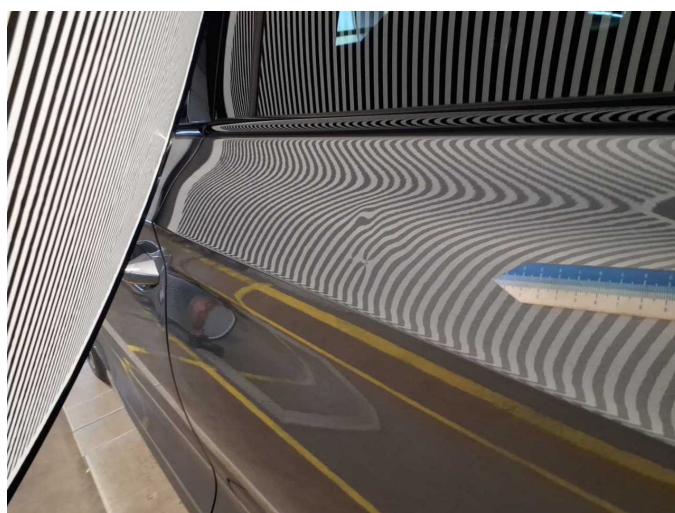

Damage 8: Door - rear left side: Door - dent(s) - Smooth repair work



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLE9NY6PF058154
Hersteller / Modell: SKODA SKODA Enyaq iV 80x

Datum	KM-Stand	Beschreibung
25.06.2025	36.560	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst