



Expertise

Protocol number: 46745500
Order No. / Reference: 26734311
Inspection date: 28 Jul 2026

Manufacturer: Peugeot

Model: Rifter BlueHDI 130 L1 Allure

VIN: VR3ECYHZ2MJ683433



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot Rifter BlueHDI 130 L1 Allure	
Vehicle Identification number	VR3ECYHZ2MJ683433
Mileage (Read)	103,745 km
First registration	22 Jun 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Onyx Schwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	4 Monat(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX943502
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / AAG 00710		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,130 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 102H	Summer tyres on Steel rim with wheel cover	Bridgestone	4mm / 4mm
2)	215/65 R16 102H	Summer tyres on Steel rim with wheel cover	Bridgestone	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS (Anti-lock Braking System) with electronic brake force distribution
- Dashboard in (dark blue)
- Electrically adjustable and heated exterior mirrors
- Exterior mirror caps painted in car color
- third brake light
- Roof rails, grey
- Tachometer
- Rear parking aid (acoustic and visual)
- Electric front windows
- electric parking brake
- Luggage compartment cover in row 2
- Transmission: 6-speed manual transmission
- Halogen headlights
- Rear spoiler lip painted in car color
- Manual air conditioning
- Headrests (5)
- Steering wheel: Steering wheel adjustable in height and reach.
- Center console with storage compartment between driver and passenger seats
- Package: Safety Package Plus (Active Safety Brake - Cruise control with speed limiter - Lane keeping assist - Traffic sign recognition with speed recommendation display in the instrument cluster - High beam assist - Driver drowsiness warning - Stop and one-way street sign recognition)
- Particulate filter: FAP diesel particulate filter
- Radio: RCC audio system (with DAB+ digital radio reception - with 8" color touchscreen - 6 speakers - Bluetooth hands-free system - Mirror screen - USB input for connecting external audio devices)
- Shift point indicator
- Electric power steering
- Seats: Front passenger seat foldable, with armrest (folding table behind the seats of row 1)
- Seats: Rear bench seat 2/3 - 1/3 in row 2 with Isofix, foldable
- 12-volt socket in the dashboard
- Doors unlock automatically in case of an accident.
- Traffic sign recognition for stop and one-way street signs
- Active Safety Brake
- Airbags (6) (Driver and front passenger airbag - front passenger airbag deactivatable - front side airbags - curtain airbags)
- On-board computer
- Front overhead storage compartment including (lighting in row 2 and in the trunk - grab handles in rows 1 and 2)
- Three-point seat belts on all seats
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Follow-me-home function (automatic)
- Cruise control system with speed limiter
- Front cup holder
- Glazed and heated tailgate with rear window wiper
- Manual child lock
- Analog instrument cluster
- Paint finish: Snow white
- Manual headlight range adjustment
- Illuminated makeup mirror for drivers
- Package: Safety (Active Safety Brake - Cruise control with speed limiter - Lane keeping assist - Traffic sign recognition with speed recommendation display in the instrument cluster)
- Visibility package including multifunction steering wheel (light sensor - rain sensor including Magic Wash Premium system - fog lights - door handles painted in body color - multifunction leather steering wheel)
- Upholstery: "Puma" fabric, black
- Active tire pressure monitoring system
- Tire repair kit (compressor and tire sealant spray)
- Wheels: 16" steel rims with "Tongariro" wheel trims (with 215/65 R 16 tires)
- Manual sliding doors on the right and left (Manual sliding doors on the right and left: - Hinged windows in row 2 - Fixed windows in row 3)
- Seats: Driver's seat adjustable in height and depth, with armrest (manual lumbar support)
- Lane departure warning system
- Daytime running lights: LED daytime running lights
- Door handles painted in car color
- Central locking can be activated from inside, with remote control

Extra equipment

- Towbar with gooseneck and trailer stabilization (Towbar with gooseneck and trailer stabilization, removable without tools)
- Seats: Heated front seats
- Package: Comfort (electrically adjustable, heated and folding exterior mirrors - electric rear windows - manual sliding doors on the right and left including lowering windows in the 2nd row and fixed windows in the 3rd row)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Misc.	Main inspection - No evidence - No deduction
3	Wheel / tyres	Wheel cover - front right side - Scratch(es) - Replace
4	Side panel - rear right side	Side panel - Scratch(es) - Paint
5	Door - front right side	Door - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Front bumper	Front bumper (unpainted) - Stone chips - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Mudguard - right side	Mudguard - right side - Scratch(es) - No deduction
7	Tail light	Tail lamp - right side - Scratch(es) - No deduction
8	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
9	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Rear shelf

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die Wartungshistorie ist nicht vorhanden und kann somit nicht auf Vollständigkeit geprüft werden.

- Die Unterbodenbesichtigung war nur ebenerdig und eingeschränkt möglich.
- Mehrkosten möglich .



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

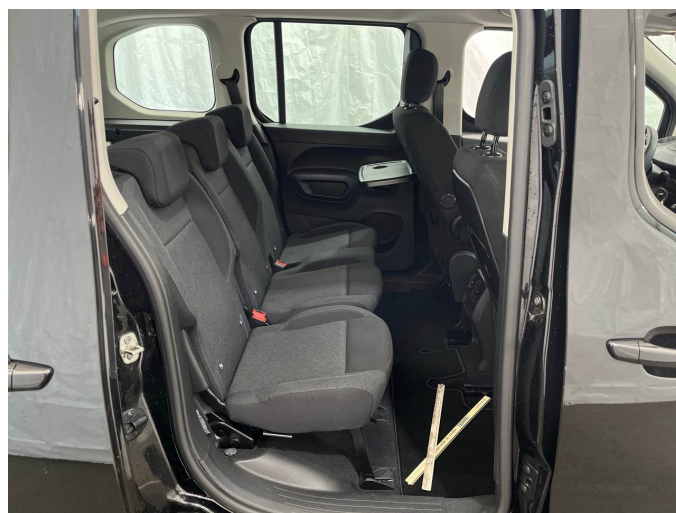


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

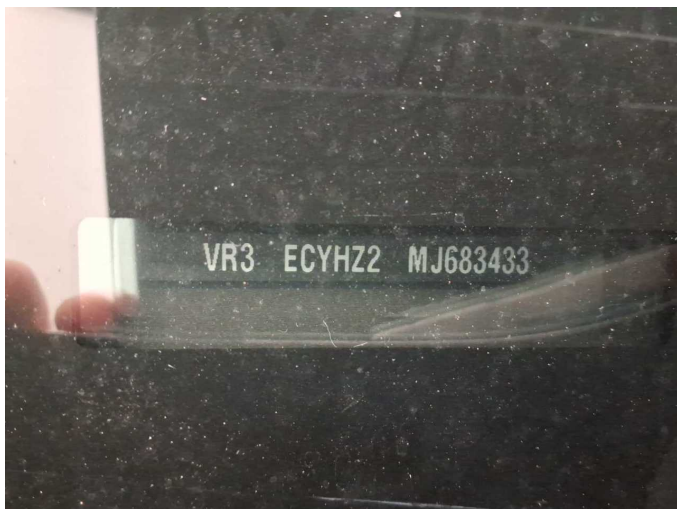


Figure 11: VIN



Figure 12: Mounted tyres

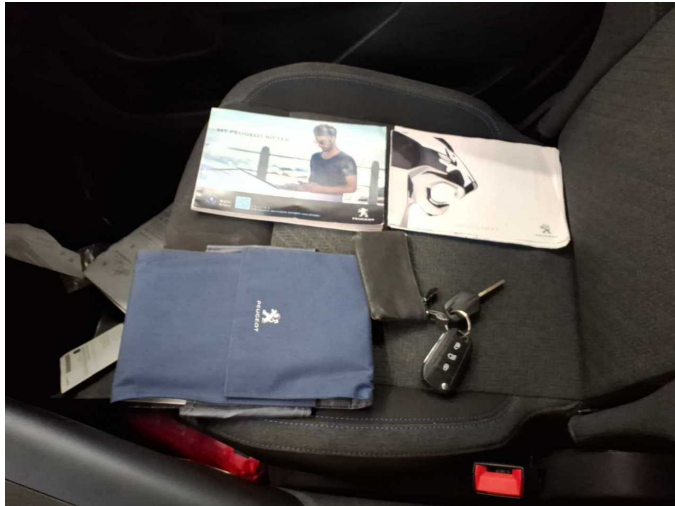


Figure 13: Documents

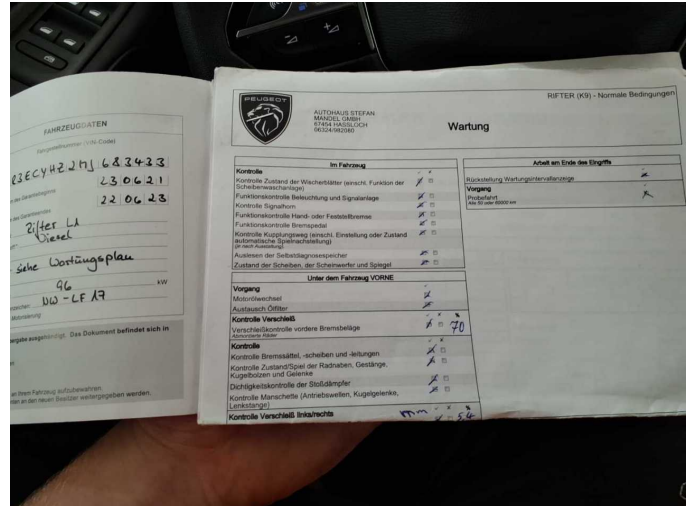


Figure 14: Documents



Figure 15: Documents

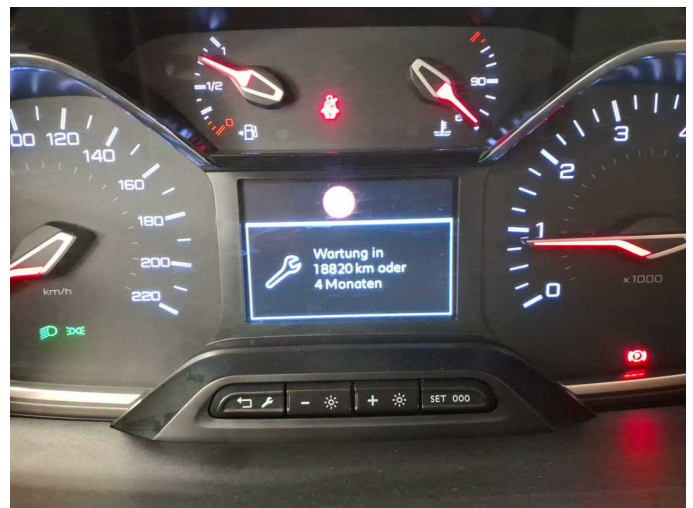


Figure 16: Documents



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.


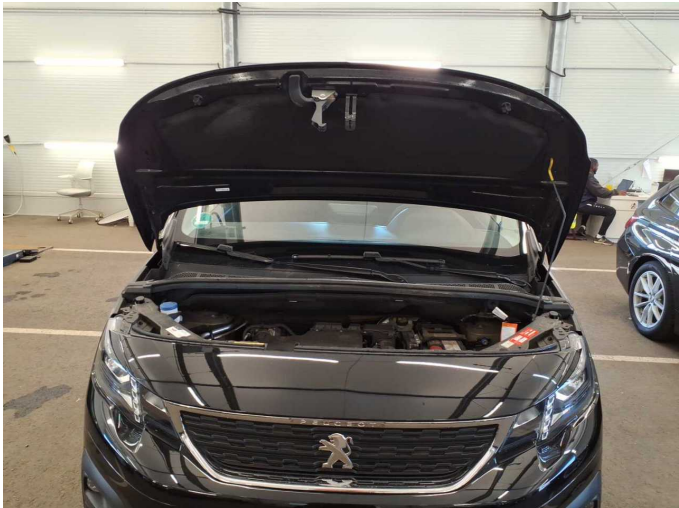


Figure 34: Misc.



Damage 3: Wheel / tyres: Wheel cover - front right side - Scratch(es) - Replace

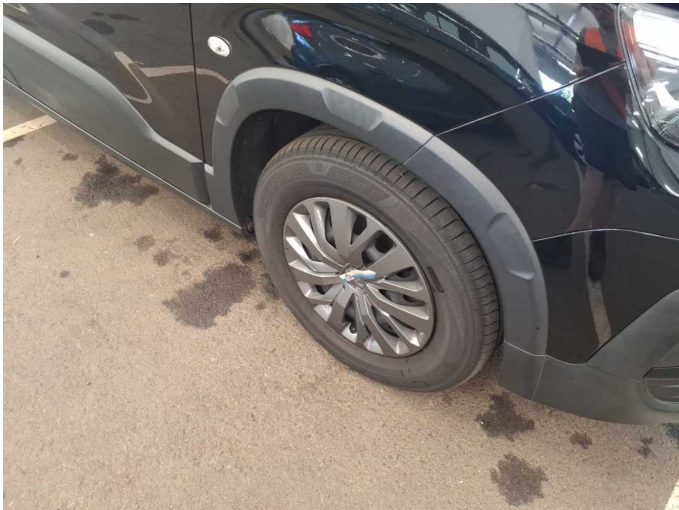

Damage 3: Wheel / tyres: Wheel cover - front right side - Scratch(es) - Replace



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 5: Door - front right side: Door - Scratch(es) - Paint



Damage 5: Door - front right side: Door - Scratch(es) - Paint




Damage 5: Door - front right side: Door - Scratch(es) - Paint



Damage 5: Door - front right side: Door - Scratch(es) - Paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

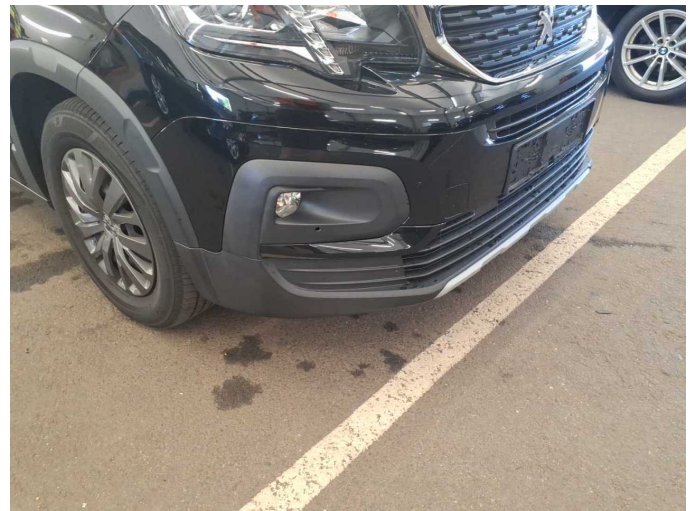


Wear and tear 3: Front bumper: Front bumper (unpainted) - Stone chips - No deduction




Wear and tear 4: Front bumper: Front bumper - Stone chips - No deduction




Wear and tear 5: Vehicle glazing: Windscreen - Stone chips - No deduction

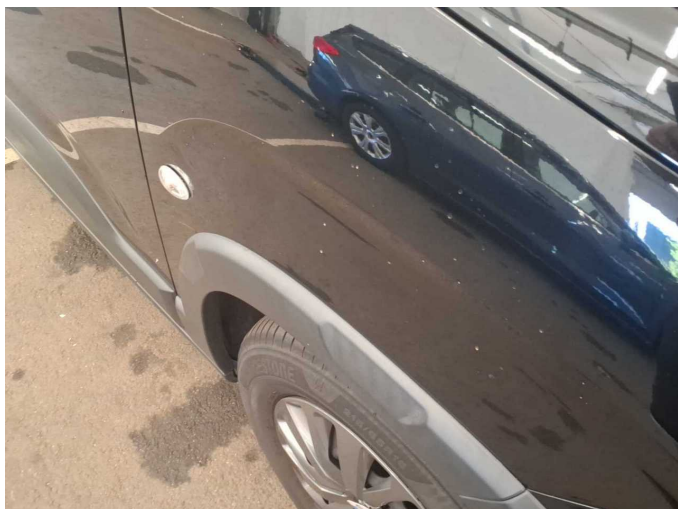

Wear and tear 6: Mudguard - right side: Mudguard - right side - Scratch(es) - No deduction

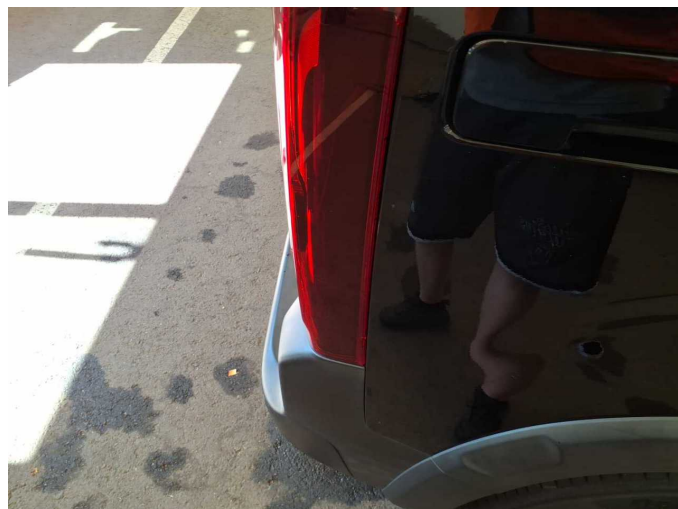

Wear and tear 7: Tail light: Tail lamp - right side - Scratch(es) - No deduction

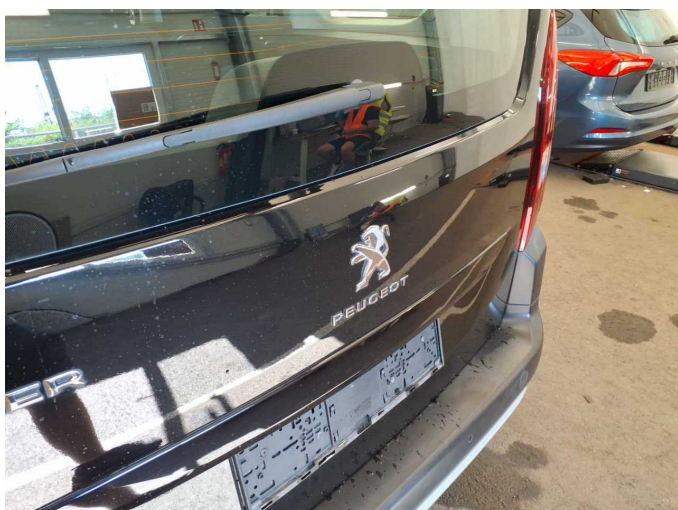

Wear and tear 8: Boot lid / rear door: Boot lid - Scratch(es) - No deduction



Wear and tear 9: Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



Missing part 1: Interior: Rear shelf - Missing - Replace