

Expertise

Protocol number: 46229071
Order No. / Reference: 26588983
Inspection date: 30 Jun 2026

Manufacturer: MAN

Model: MAN TGE 3.140 4X2F SB

VIN: WMA03VUY6P9021366



Vehicle details

Manufacturer / Type / Model / Equipment

MAN MAN TGE 3.140 4X2F SB

Vehicle Identification number WMA03VUY6P9021366

Mileage (Read) 104,940 km

First registration 9 Jun 2023

Number of holders 1

Next periodical technical inspection 07/2027
(Report on hand)

Power / Engine displacement 103 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Van

Colour / colour code Candy Weiß

Doors / Seats 4 / 2

Upholstery type Cloth

Colour of upholstery Black

Vehicle with smoke odor no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	233 Tag(e)
Last service on / at	08/2025 at 104,157 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GU302972
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1516 / AYN 61613		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/75 R16 113R	All-season tyres on Steel rim with wheel cover	Sonstige	8mm / 8mm
2)	205/75 R16 113R	All-season tyres on Steel rim with wheel cover	Bridgestone	8mm / 8mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/75 R16 113R C	All-season tyres on Steel	Bridgestone	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Airbag for driver and front passenger with passenger • C-rails on the side walls in the loading area • All-season tyres • MAN Media Van package with 4 speakers • Center wheel cover with chrome emblem • Spare wheel in driving tire size, steel as well as • Side interior paneling in the cargo area (plastic) • 'Comfort' seat on the left, in the 1st row. | <ul style="list-style-type: none"> • Battery with increased capacity • Cab doors, additionally reinforced • Wooden floor in the cargo area with wheel arch trim • National registration documentation (German) • Smoker's version: 12V socket with cigarette lighter • Rear View camera • Single airline points sliding door • Rear step, across the entire width |
|--|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Interior	Interior (Laderaumverkleidungen) - Broken / torn - Replace

Repainting

No.	Repainting
1	Bonnet, Professionally carried out

Paint coat thickness measurement

Bonnet	315 µm
--------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

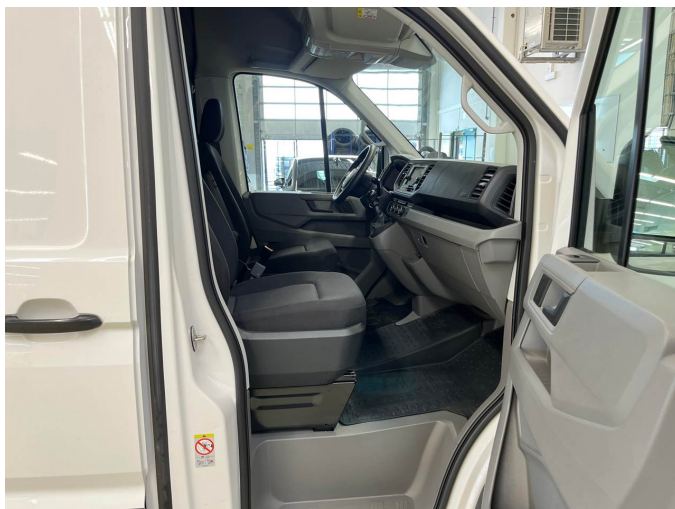


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

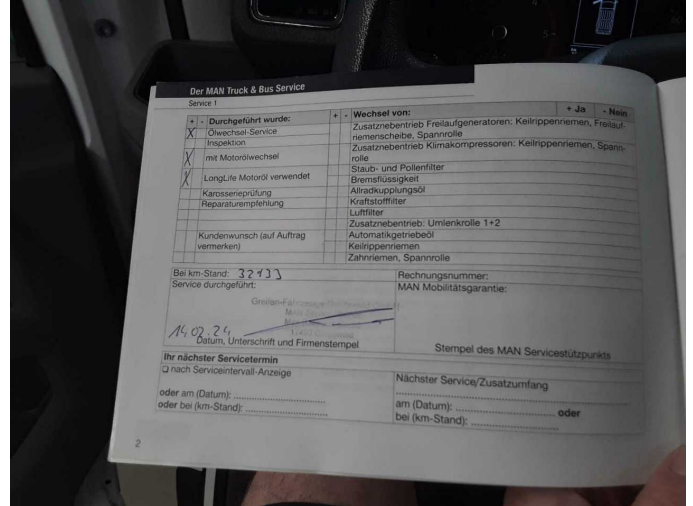


Figure 14: Documents

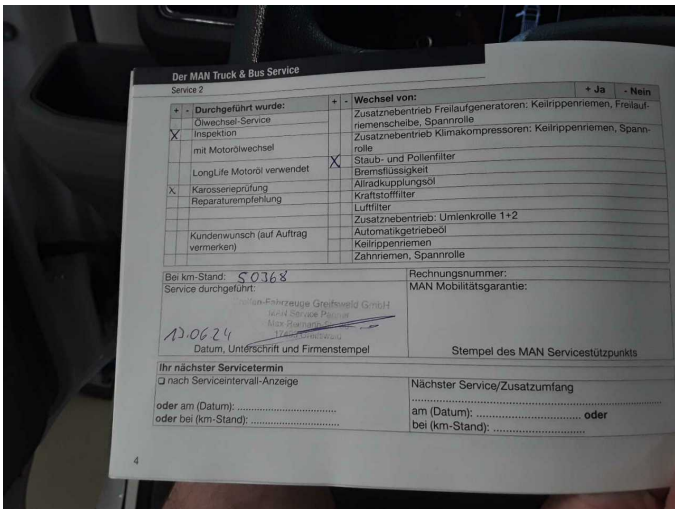


Figure 15: Documents

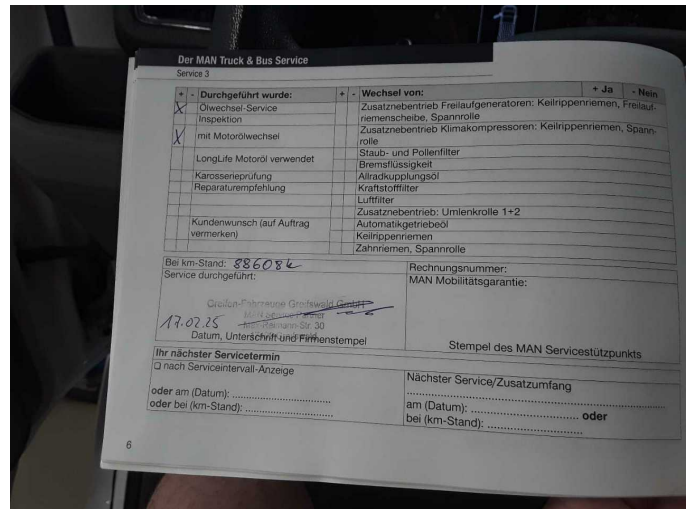


Figure 16: Documents

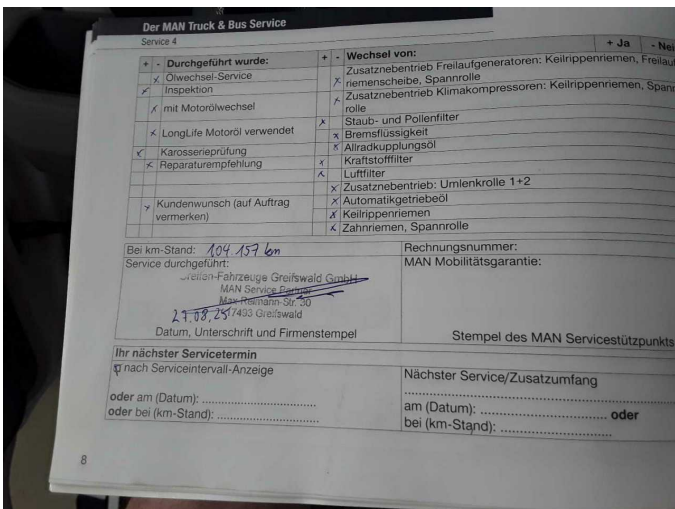


Figure 17: Documents



Figure 18: Documents



Figure 19: Documents

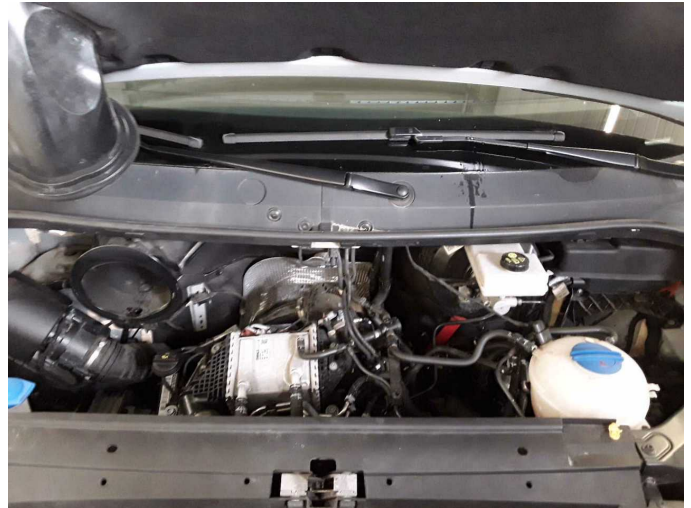


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Damage 1: Interior: Interior (Laderaumverkleidungen) - Broken / torn - Replace



Damage 1: Interior: Interior (Laderaumverkleidungen) - Broken / torn - Replace



Damage 1: Interior: Interior (Laderaumverkleidungen) - Broken / torn - Replace



Bonnet: 315 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WMA03VUY6P9021366

Hersteller / Modell: MAN MAN TGE 3.140 4X2F SB

Datum	KM-Stand	Beschreibung
02.07.2025	103.745	AU; Bremsentest; Wartung Sonstiges
18.02.2025	88.608	Bremsbelagfühler ern; Bremsentest; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
15.06.2024	50.368	Regelwartungsdienst; Reparatur Sonstiges
14.02.2024	32.933	Motoröl b. Wartung; Ölwechsel; Systemtest/Eigendiagnose