



Expertise

Protocol number: 46495109
Order No. / Reference: 26694886
Inspection date: 13 Jul 2026

Manufacturer: Volkswagen	Model: ID. Buzz Pro
VIN: WV2ZZZEB9PH017632	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID. Buzz Pro	
Vehicle Identification number	WV2ZZZEB9PH017632
Mileage (Read)	89,775 km
First registration	3 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	70 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Van
Colour / colour code	Candyweiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	254 Tag(e)
Last service on / at	04/2026 at 85,964 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS474241
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CQY 00016		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	3,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 104T	Summer tyres (with run-flat tyres) on Light alloy	Continental	0mm / 0mm
2)	265/45 R20 108T	Summer tyres (with run-flat tyres) on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107V	Winter tyres on Light alloy	Bridgestone	2mm / 2mm
2)	255/55 R18 109V	Winter tyres on Light alloy	Bridgestone	1mm / 1mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS
- Airbag: Side and head airbags for driver and front passenger
- Electrically adjustable, folding and heated exterior mirrors, with passenger-side mirror lowering function.
- Exterior mirror housings in high-gloss black and door handles in body color
- Vehicle tool kit
- CCS charging socket
- Design badges D-pillar
- Three-point automatic seat belts at the front with belt and end fitting tensioners and height adjustment
- Black surround for the infotainment display and central controls
- Electronic Stability Program
- Windows: Rear windows made of tinted heat-insulating glass
- Window: Fixed side window in the passenger compartment, front right
- Luggage compartment cover
- Cruise control system with speed limiter
- Tailgate with window cutout
- Heated rear window
- Interior lighting in the front and rear footwells
- Air conditioning system "Air Care Climatronic" with active combination filter
- LED luggage compartment lighting
- LED headlights
- Headlight range control
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Upholstery: Cloth
- Radio: App-Connect incl. App-Connect Wireless
- Radio: Digital radio reception (DAB+)
- Radio: "Ready 2 Discover" radio with 25.4 cm (10-inch) color touchscreen
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tires: Wheel bolts with enhanced theft protection
- Windscreen wiper intermittent control
- Sliding door, left side in the passenger/cargo area
- Keys for locking system: 2 vehicle keys
- Seatbelt check
- Seats: Height adjustment for both front seats, manual
- Lane keeping assistant "Lane Assist"
- LED daytime running lights
- Telephone: Mobile phone interface with inductive charging function
- Traffic sign recognition
- Electronic immobilizer
- Central locking with keyless start system "Keyless Start" without safe locking
- Airbag for driver and front passenger
- Armrests for front seats (inside)
- Evasive steering assist and turn assist
- Exterior mirrors, driver's side convex, passenger's side convex
- Battery (58 Ah/340 A)
- Operating voltage 12 V
- Third brake light
- DC/DC converter 3.0 KW
- Three-point automatic seat belts, rear outer seats, with ECE label
- e-Sound
- Parking assistance in the front and rear areas
- Single-tone signal horn
- Window: Rear window
- Window: Fixed side window in the passenger compartment, front left
- Electric windows, front
- Windscreen in heat-insulating glass
- Total weight: Permissible total weight 3,000 kg
- Transmission: Direct drive, 1-speed
- Tailgate closing without interior unlocking function
- Rear window wiper/washer system with intermittent function
- Headrests (5)
- Mode 3 Type 2 charging cable, 16 A
- LED taillights
- Steering wheel: Multifunction steering wheel
- Multifunctional camera
- Non-smoking version
- eCall emergency call system
- Proactive occupant protection system (PreCrash Basic and Front)
- Radio: Diversity antenna for FM reception
- Radio accessories: 2 USB-C ports in the instrument panel and 1 USB-C charging port in the front.
- Wheels/Tires: "Tilburg" alloy wheels 8 J x 19 front, 9 J x 19 rear, in black, diamond-turned finish
- Rear seat bench and backrest can be folded down in a split configuration
- Sliding door, on the right in the passenger/cargo area
- Speed-sensitive power steering (Servotronic)
- Dimmable interior safety mirror
- Sun visors with mirrors, illuminated
- Bumpers in body color
- Phone: Car2X
- Ambient lighting with logo projection
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: "Discover Pro" navigation function



Extra equipment

- Towbar, foldable (with electric release)
- Paint finish: Solid
- Mains charging cable for household socket (Mode 2 Type 2, 10A)
- Package: Comfort package "Plus" ZC2
- Package: Design package (illuminated strip between the headlights - stainless steel pedals in "Play/Pause" design - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - dynamic headlight range control with dynamic cornering lights - LED taillights with dynamic turn signals)
- Wheels/Tires: 20" "Stockton" alloy wheels (4 "Stockton" alloy wheels 8 J x 20 front, 10 J x 20 rear, in silver, with black plastic trim - Airstop tires 235/50 R 20 104 T XL front, Airstop tires 265/45 R 20 108 T XL rear)
- Operating voltage 12 V with 230 V socket (Schuko socket)
- Mode 3 Type 2 charging cable, 32 A
- Package: Assistance package (Park Assist Plus including parking aid - illuminated door handle recesses - central locking with keyless locking and starting system "Keyless Advanced" with safe locking - anti-theft alarm system with interior monitoring, backup horn and tow-away protection - ACC "stop & go" automatic distance control with speed limiter)
- Package: Infotainment Package Plus (Voice control - Navigation system "Discover Pro" - Radio "Ready 2 Discover" with 30, 48 cm (12-inch) touch color display - 9 speakers (5 front speakers and 4 rear speakers) - Mobile phone interface "Comfort" with inductive charging function)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Indicator light (RDKS) - on - Diagnosed and repair if necessary
2	Wheel / tyres	Tyre - front (Einseitig abgefahren) - Worn - Replace
3	Wing mirror - right side	Mirror housing - Scratched - Replace
4	Front bumper	Grille - Broken / torn - Replace
5	Door - front left side	Door - Unprofessionally repaired - Paint
6	Door - front right side	Door (Orangenhaut) - Unprofessionally repaired - Paint
7	Sliding door - left side	Sliding door with glass panel - Unprofessionally repaired - Paint
8	Sliding door, right	Sliding door with glass panel - Unprofessionally repaired - Paint
9	Vehicle glazing	Windscreen - Stone chips - Replace
10	Trim / covers	Roof lining - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Door - front right side	Window guide - Scratch(es) - No deduction
3	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

Documents - Log book

Repainting

No. Repainting

- 1 Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
- 2 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 3 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 4 Door - front left side, Professionally carried out, Invoice of repair done Non-existent
- 5 Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	202 µm	Door - rear left side	214 µm
Door - rear right side	190 µm	Door - front left side	191 µm
Door - front right side	191 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

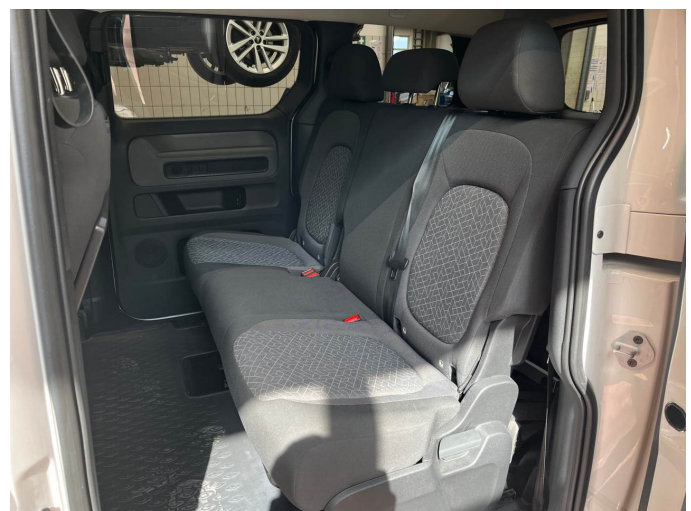


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

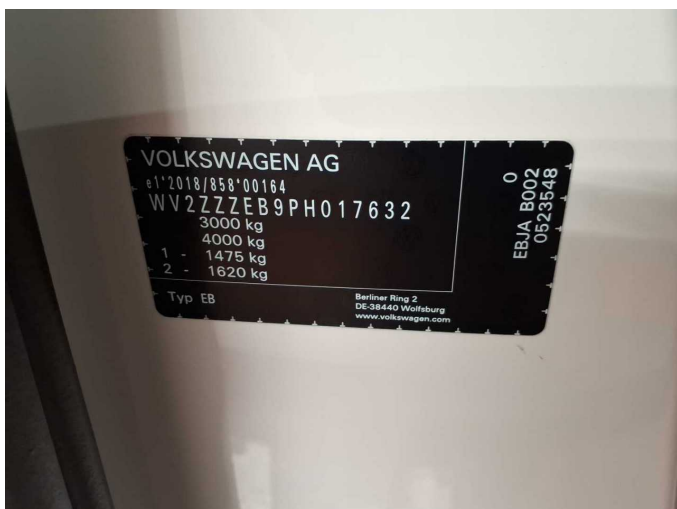


Figure 11: VIN



Figure 12: Mounted tyres

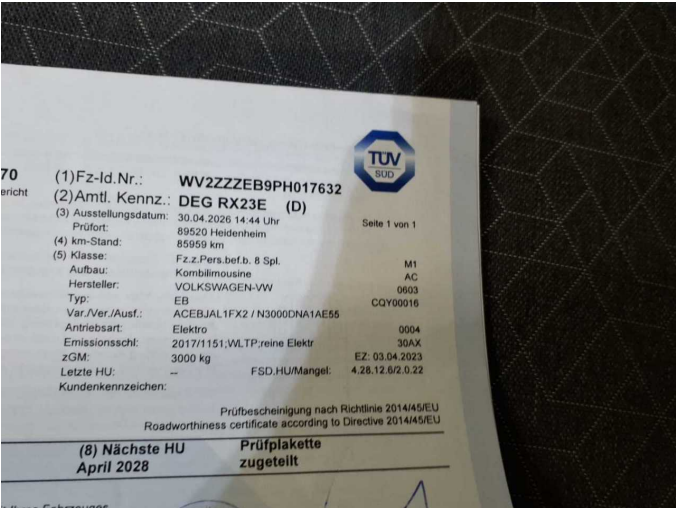


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

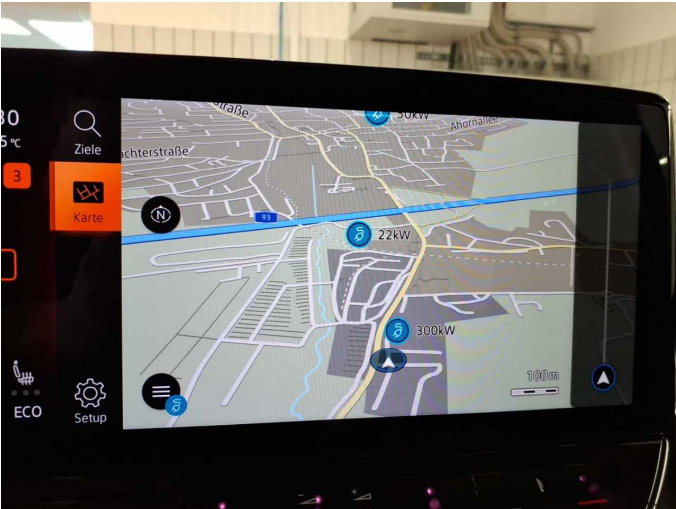


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

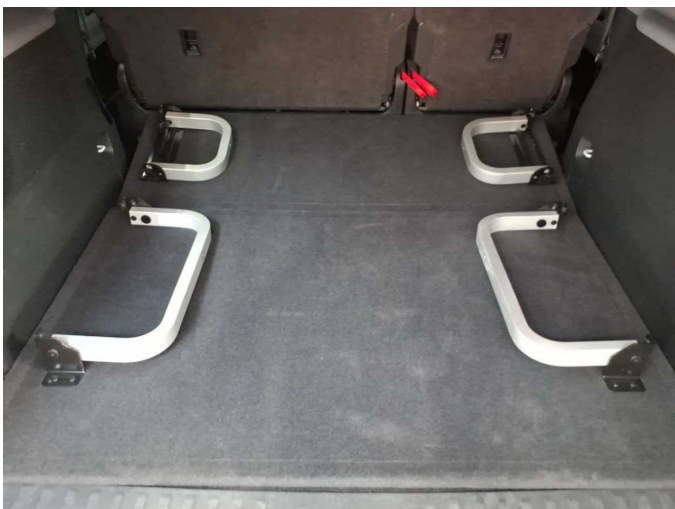


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

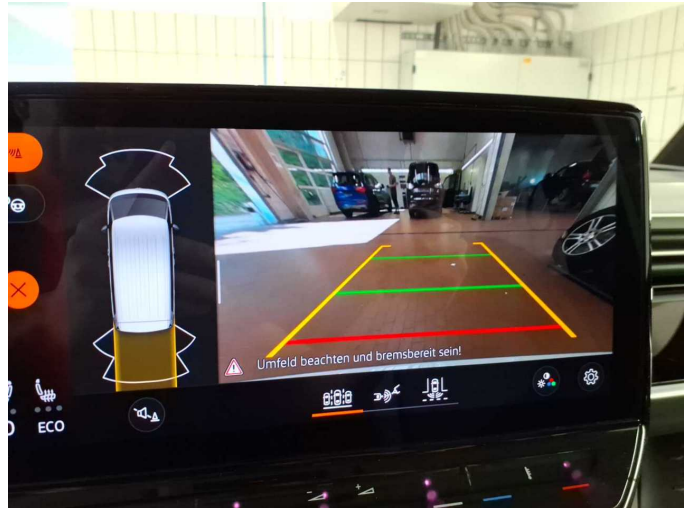


Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Instrument panel: Indicator light (RDKS) - on - Diagnosed and repair if necessary



Damage 2: Wheel / tyres: Tyre - front (Einseitig abgefahren) - Worn - Replace



Damage 2: Wheel / tyres: Tyre - front (Einseitig abgefahren) - Worn - Replace




Damage 2: Wheel / tyres: Tyre - front (Einseitig abgefahren) - Worn - Replace



Damage 2: Wheel / tyres: Tyre - front (Einseitig abgefahren) - Worn - Replace



Damage 3: Wing mirror - right side: Mirror housing - Scratched - Replace

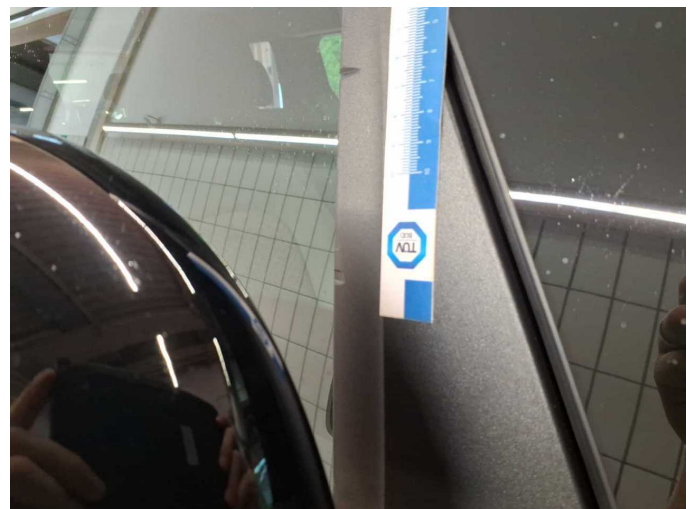

Damage 3: Wing mirror - right side: Mirror housing - Scratched - Replace



Damage 3: Wing mirror - right side: Mirror housing - Scratched - Replace



Damage 4: Front bumper: Grille - Broken / torn - Replace



Damage 4: Front bumper: Grille - Broken / torn - Replace



Damage 5: Door - front left side: Door - Unprofessionally repaired - Paint




Damage 5: Door - front left side: Door - Unprofessionally repaired - Paint



Damage 5: Door - front left side: Door - Unprofessionally repaired - Paint




Damage 5: Door - front left side: Door - Unprofessionally repaired - Paint

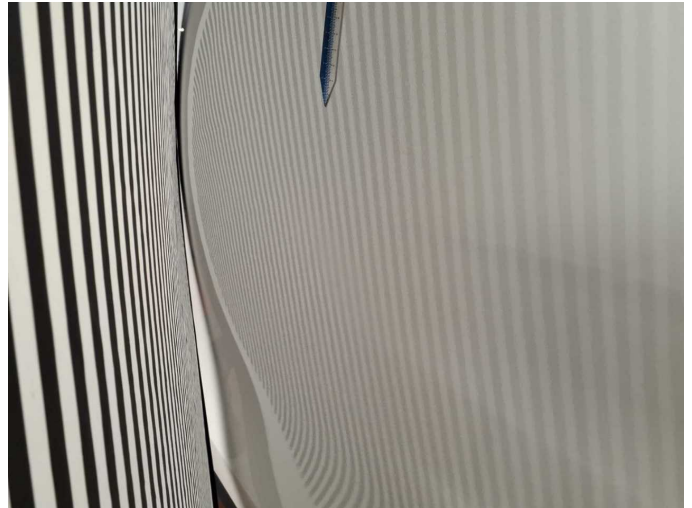

Damage 6: Door - front right side: Door (Orangenhaut) - Unprofessionally repaired - Paint



Damage 6: Door - front right side: Door (Orangenhaut) - Unprofessionally repaired - Paint

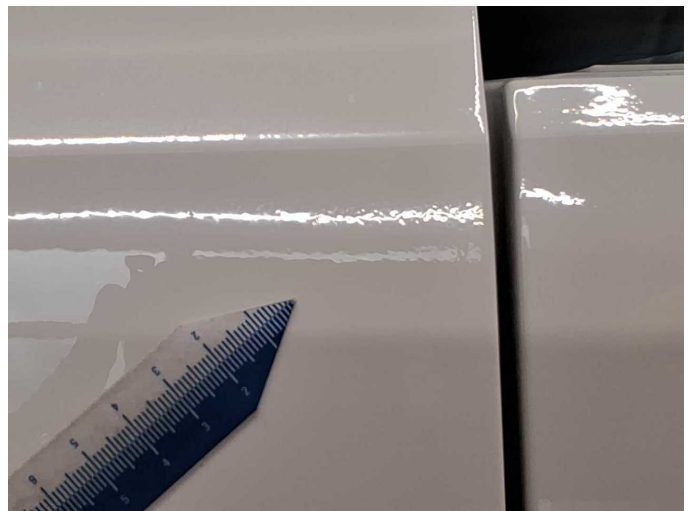

Damage 7: Sliding door - left side: Sliding door with glass panel - Unprofessionally repaired - Paint




Damage 7: Sliding door - left side: Sliding door with glass panel - Unprofessionally repaired - Paint




Damage 7: Sliding door - left side: Sliding door with glass panel - Unprofessionally repaired - Paint



Damage 8: Sliding door, right: Sliding door with glass panel - Unprofessionally repaired - Paint

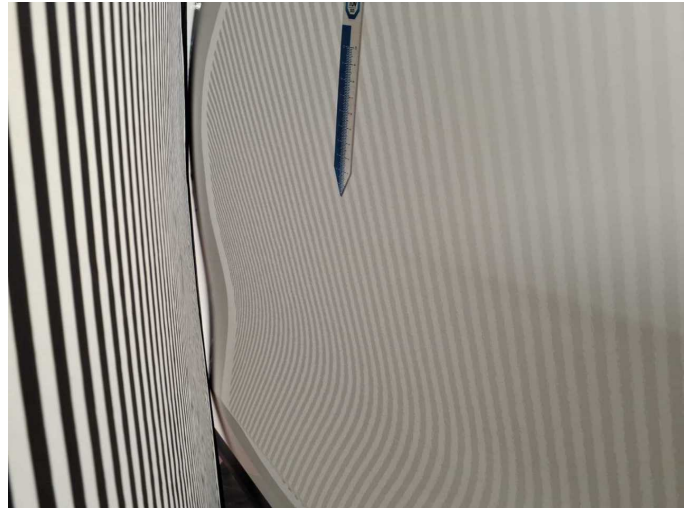

Damage 8: Sliding door, right: Sliding door with glass panel - Unprofessionally repaired - Paint

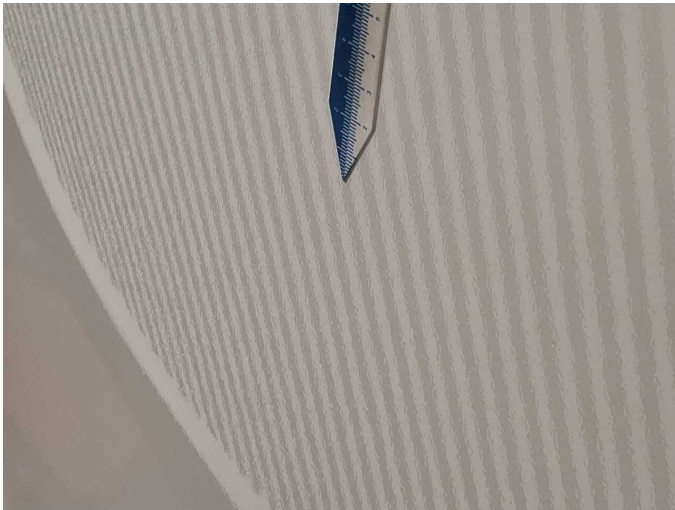

Damage 8: Sliding door, right: Sliding door with glass panel - Unprofessionally repaired - Paint




Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 10: Trim / covers: Roof lining - Broken / torn - Replace

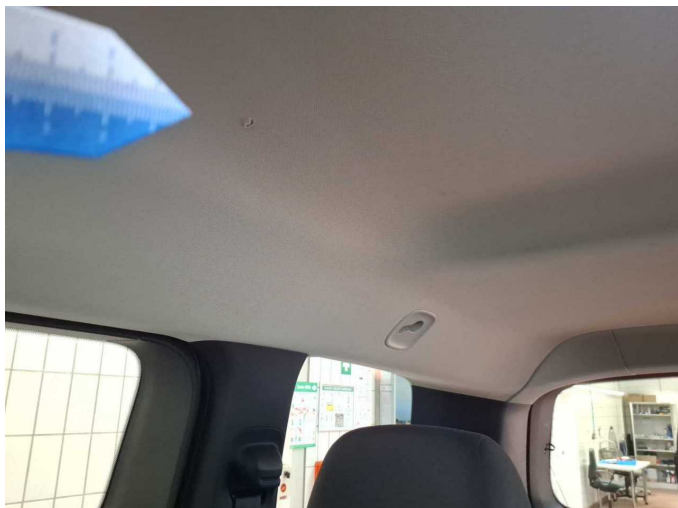

Damage 10: Trim / covers: Roof lining - Broken / torn - Replace

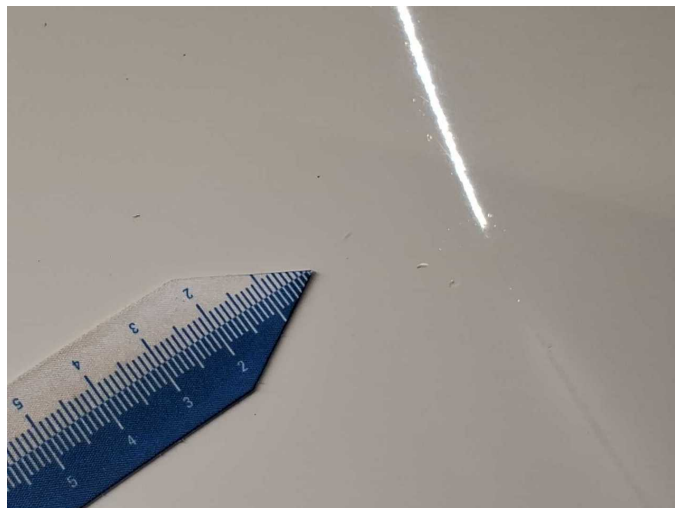

Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction




Wear and tear 2: Door - front right side: Window guide - Scratch(es) - No deduction



Wear and tear 2: Door - front right side: Window guide - Scratch(es) - No deduction



Repainting 1: Mudguard - right side

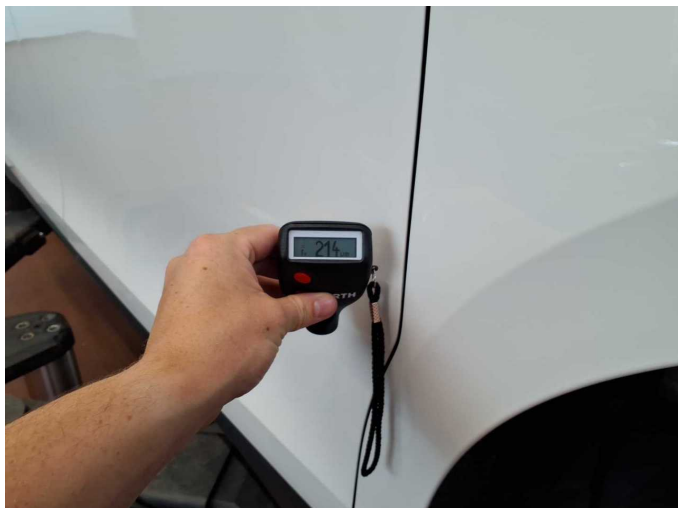

Repainting 2: Door - rear left side



Repainting 3: Door - rear right side



Repainting 4: Door - front left side



Repainting 5: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZEB9PH017632
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID. Buzz

Datum	KM-Stand	Beschreibung
30.04.2026	85.964	Wartung Sonstiges
24.03.2025	52.457	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges