

Expertise

Protocol number: 46145875
Order No. / Reference: 26518192
Inspection date: 17 Jun 2026

Manufacturer: Ford

Model: Transit Connect 230 L2 S&S Trend

VIN: WF07XXWPG7NY73116



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 230 L2 S&S Trend

Vehicle Identification number WF07XXWPG7NY73116

Mileage (Read) 211,664 km

First registration 21 Jul 2022

Number of holders 1

Next periodical technical inspection 08/2027
(Report not on hand)

Power / Engine displacement 88 kw / 1,499 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Manual / 6

Type of drive Front drive

Type of vehicle Station wagon

Colour / colour code Silver Metallic

Doors / Seats 5 / 5

Upholstery type Cloth

Colour of upholstery Black-Anthracite

Re-import no

readiness to drive Not roadworthy /
moveable



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	93 %
Last service on / at	05/2026 at 210,916 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH427759
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BLK 00440		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,300 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Pirelli	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Pirelli	3mm / 3mm

Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel	Continental	3mm / 3mm
2)	205/60 R16 96H	Summer tyres on Steel	Continental	4mm / 4mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS with EBD
- Airbag package (front airbag for passenger, including deactivation function and glove compartment with lid - head and shoulder airbags in front and for outer rear seats - side airbags for driver and passenger)
- Floor covering: Carpet (1st and 2nd row)
- Diesel particulate filter (DPF) (with SCR catalyst and AdBlue tank)
- Electronic Stability Program (ESP) (with Traction Control (TCS) including Torque Vectoring Control and Adaptive Load Control)
- Front electric windows (with one-touch down function for driver's side)
- Ford ECO-Coach (signals environmentally friendly driving style)
- Heated windscreen (including electrically adjustable and heated exterior mirrors)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Rubberized luggage compartment floor mat
- Glove compartment with lid
- Rear window wiper/washer system
- Isofix mounting (on the outer seats of the 2nd row)
- Alternator/Generator
- Fog light
- Emergency brake light (hazard warning flashing activated during heavy braking)
- Pre-Collision Assist, camera-based (with pedestrian and cyclist detection, including Automatic Emergency Braking (AEB), Dynamic Brake Support (DBS), Forward Collision Warning (FCW))
- Tire pressure monitoring system
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Sliding door, right and left
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Automatic security door lock (45 sec.) (Automatic relocking if no door is opened within 45 seconds of unlocking via remote control)
- Front spoiler lip
- Dust and pollen filter
- Power outlet: 12-volt connection on the center console, front and rear
- Daytime running light
- Carpet floor mats, front (2-piece set)
- Door handles, black
- Seatbelt warning system (Seatbelt warning system in all other seats)
- Central locking with remote control (door lock only on driver's door - 2 keys, one of which is a remote control key)
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Exterior mirror housing black
- Battery (12 V / 71h) ((EFB, 12V 70 Ah, 700 CCA))
- Hill start assist
- On-board computer including outside temperature display
- Tachometer
- Third brake light
- Fixed rear windows, right and left (at the height of the 3rd row of seats)
- Rear electric windows, right and left (at the height of the 2nd row of seats)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- FordPass Connect (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - incl. live traffic information in real time (in conjunction with Ford navigation system incl. Ford SYNC 3) - incl. Wi-Fi hotspot)
- Transmission: 6-speed transmission
- Heated rear windows
- Front interior lighting with delay function
- Steering column, adjustable in height and reach
- Center console, front (open with storage area, 2 cup holders)
- Package: Passenger car version package with rear swing door (folding front passenger seat, lane keeping assist, lane departure warning, driver drowsiness detection, cruise control, integrated speed limiter (camera-based), traffic sign recognition system, IPS: front and side airbags, front/rear head/shoulder airbags, seat belt tensioners and force limiters, safety pedals and steering column, 3-point seat belts at all seats, height-adjustable front seats, pre-collision assist, pedestrian/cyclist detection, tire pressure monitoring system (TPMS). Without partition and safety net).
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Passenger compartment seats: 2nd row (bench seat, 60:40 split, foldable, can be lowered into the footwell - ISOFIX mounting on the outer seats)
- Start-stop system
- Concealed storage compartment (in the floor of the 2nd row of seats)
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Lashing eyes
- Electronic immobilizer (EPATS)
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front



Extra equipment

- Detachable towbar (including ESP trailer stabilization and continuous power supply)
- Anti-theft alarm system with interior monitoring (including double locking and 2 remote control keys)
- Air conditioning with automatic temperature control (2 zones) (for driver and passenger side, separately adjustable)
- Paint finish: Metallic
- Front and rear parking pilot system
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Heat-insulating glazing, tinted (from the B-pillar) (side windows from the 2nd row of seats)
- Xenon: Bi-xenon headlights with LED daytime running lights (with automatic headlight range control)
- Electrically adjustable and heated exterior mirrors with blind spot assist (blind spot assist including cross traffic alert)
- Adaptive cruise control (with intelligent speed limiter - including radar- and camera-based pre-collision assist with pedestrian and cyclist detection, lane keeping assist including lane keeping assist and driver drowsiness detection - including traffic sign recognition system - leather multifunction steering wheel with 4 spokes in aluminum trim)
- Headlight assistant with day/night sensor including automatically dimming interior mirror (including headlight dimming with switch-off delay, windscreen wipers with rain sensor)
- Safety partition net for separating passenger and luggage compartments (including attachment points (retrofitting not possible later))
- Seats: Seat Package 6 (Fabric "Capitol/City" in Ebony (black) - Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Front passenger single seat, 2-way adjustable (forward/backward/backrest) and foldable - Headrests, height adjustable - Seat heating driver, front passenger - Lumbar support, manual (driver) - Map pocket for driver's seat - Airbag package for driver and front passenger)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Vibrationen
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Roof	Stub aerial (Nicht original) - Differs from the original configuration - Replace
2	Equipment	Tirefit filler - Expired - Replace
3	Equipment	Vehicle key with remote control - Damaged - Loss in value
4	Body	Body - Glued / labelled - De-glue / neutralise
5	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
6	Engine	Engine (Ölfeucht) - Leaking - Perform diagnosis
7	Engine	Engine (Vibrationen im Leerlauf) - Odour - Perform diagnosis
8	Rear bumper	Rear bumper - Deformed - Replace
9	Interior	Cargo area floor - Broken / torn - Replace
10	Front bumper	Front bumper - Scratched - Paint
11	Sliding door, right	Sliding door with glass panel - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Rear of vehicle - Key trailer hitch

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 23 Mar 2023	1.350,14 €
2	Rear, Provided by user / customer, from 26 Apr 2025	1.541,75 €
3	Rear, Provided by user / customer, from 19 Jan 2024	2.098,64 €
4	Roof, Front, Provided by user / customer, from 22 Jun 2023	5.152,40 €

Repainting

No. Repainting

1	Roof, Professionally carried out, Invoice of repair done Non-existent
2	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent
4	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
5	Bonnet, Professionally carried out, Invoice of repair done Non-existent
6	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
7	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
8	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
9	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
10	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
11	Door - front right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Roof	182 µm	Boot lid / rear door	300 µm
Mudguard - left side	179 µm	Mudguard - right side	162 µm
Bonnet	189 µm	Side panel - rear left side	170 µm
Side panel - rear right side	203 µm	Door - rear left side	178 µm
Door - rear right side	231 µm	Door - front left side	181 µm
Door - front right side	191 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

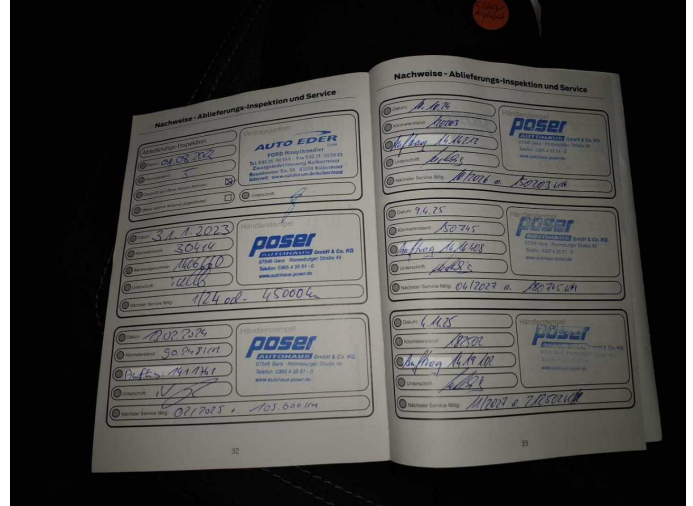


Figure 14: Documents

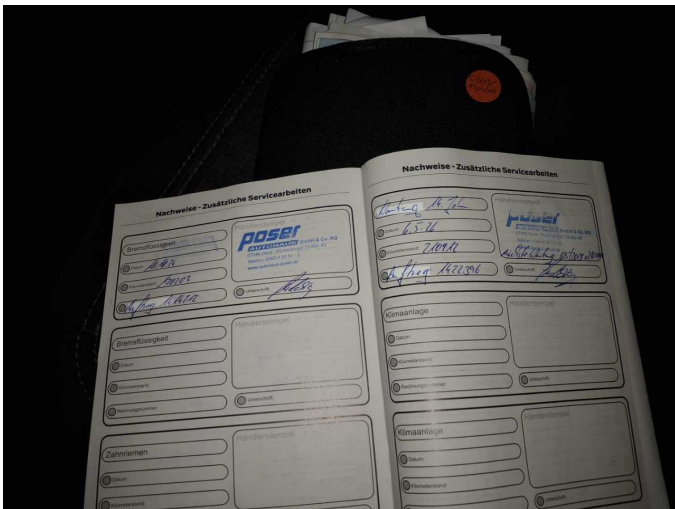


Figure 15: Documents

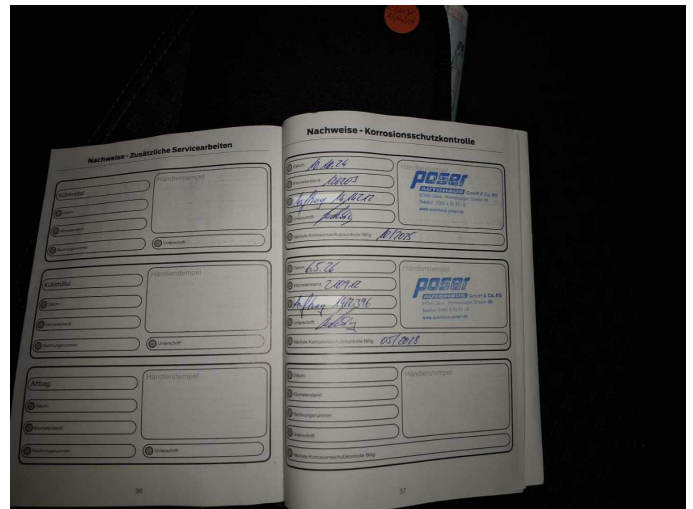


Figure 16: Documents



Figure 17: Additional tyres

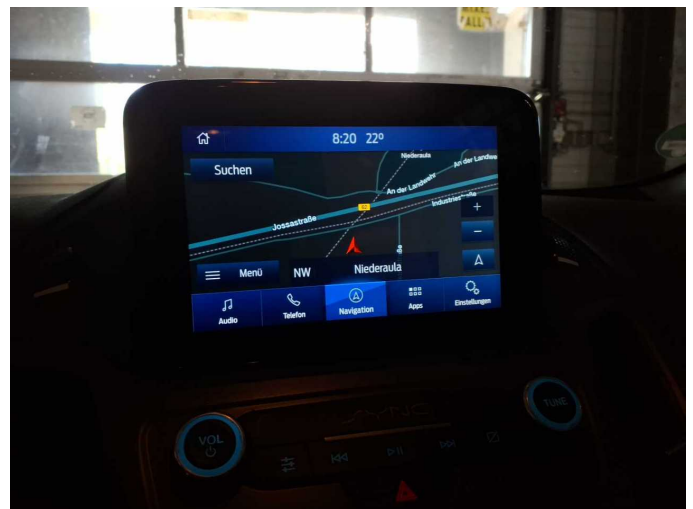


Figure 18: Navigation

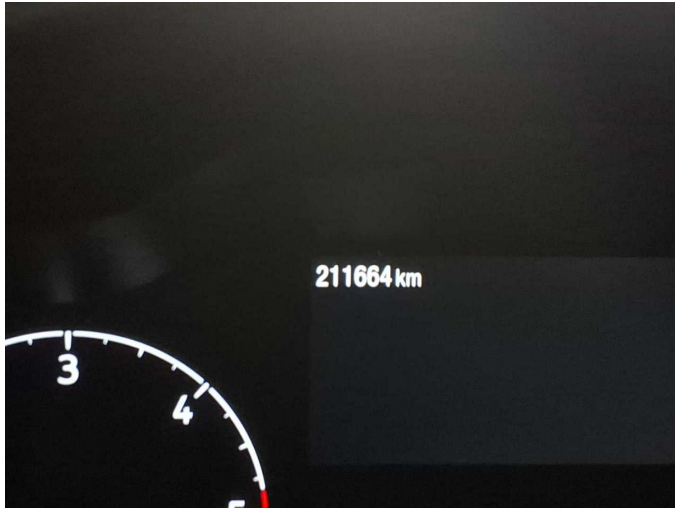


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

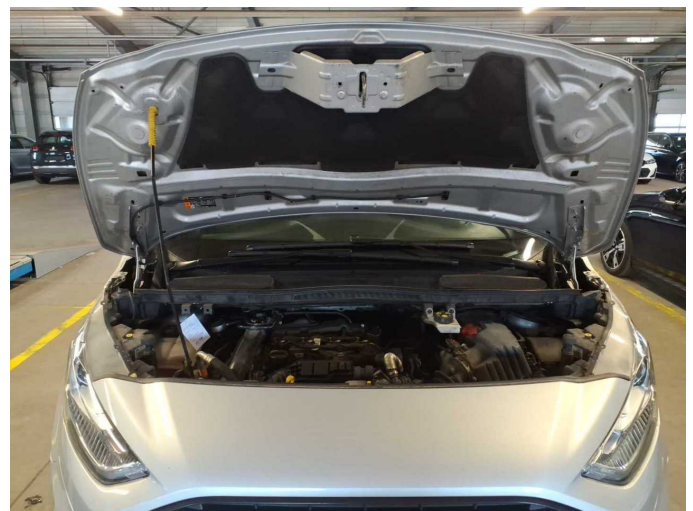


Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

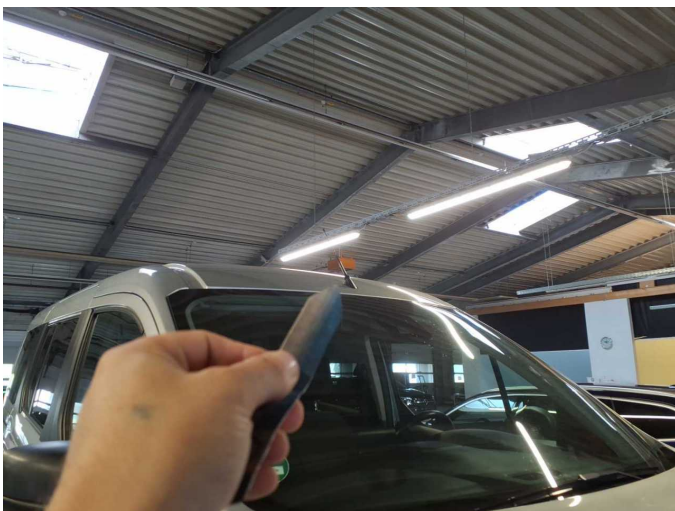

Damage 1: Roof: Stub aerial (Nicht original) - Differs from the original configuration - Replace




Damage 1: Roof: Stub aerial (Nicht original) - Differs from the original configuration - Replace




Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Equipment: Vehicle key with remote control - Damaged - Loss in value

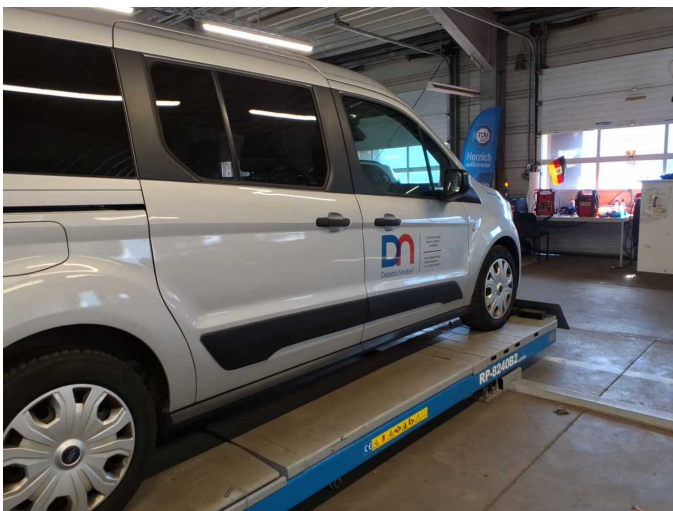

Damage 4: Body: Body - Glued / labelled - De-glove / neutralise

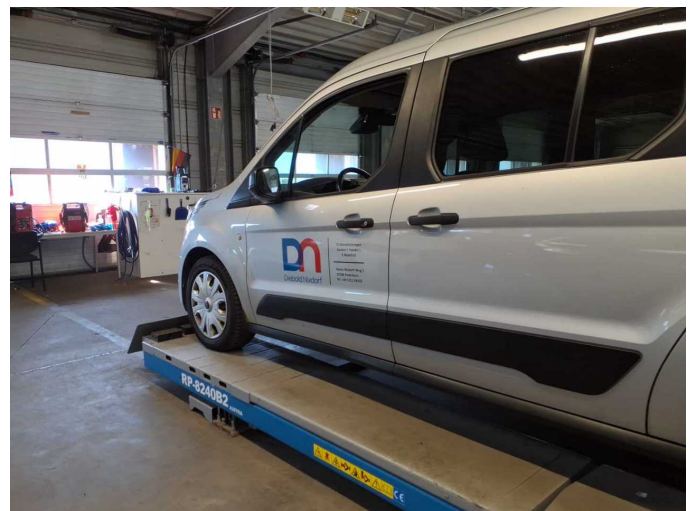

Damage 4: Body: Body - Glued / labelled - De-glove / neutralise



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 5: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 6: Engine: Engine (Ölfeucht) - Leaking - Perform diagnosis



Damage 6: Engine: Engine (Ölfeucht) - Leaking - Perform diagnosis

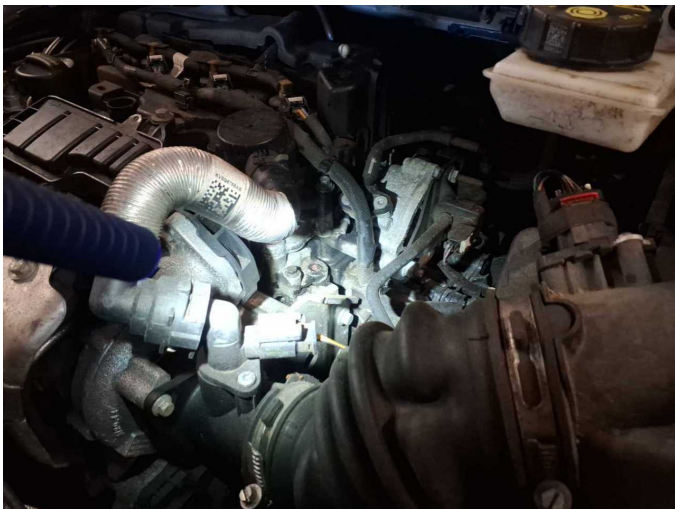


Damage 6: Engine: Engine (Ölfeucht) - Leaking - Perform diagnosis

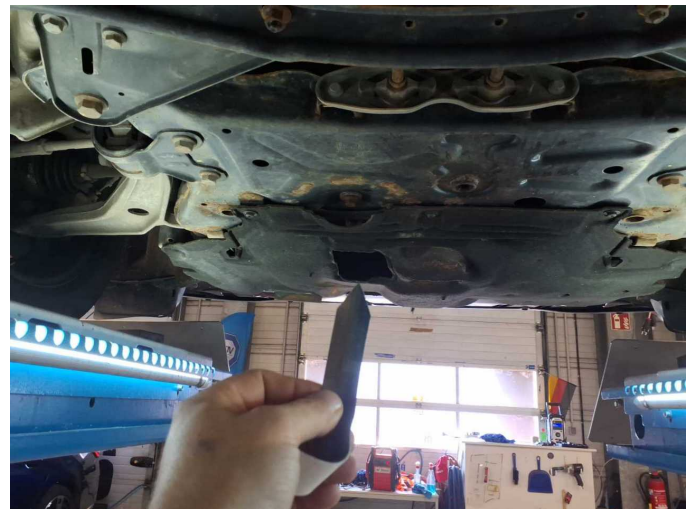

Damage 6: Engine: Engine (Ölfeucht) - Leaking - Perform diagnosis



Damage 6: Engine: Engine (Ölfeucht) - Leaking - Perform diagnosis

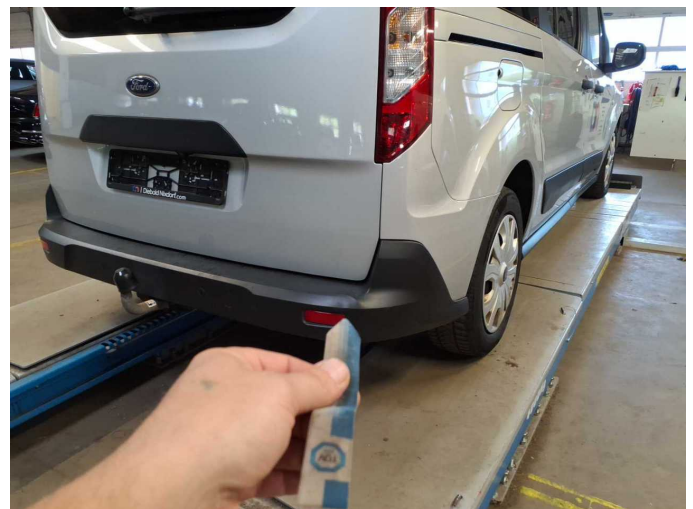

Damage 8: Rear bumper: Rear bumper - Deformed - Replace



Damage 8: Rear bumper: Rear bumper - Deformed - Replace



Damage 8: Rear bumper: Rear bumper - Deformed - Replace



Damage 9: Interior: Cargo area floor - Broken / torn - Replace



Damage 9: Interior: Cargo area floor - Broken / torn - Replace



Damage 10: Front bumper: Front bumper - Scratched - Paint



Damage 10: Front bumper: Front bumper - Scratched - Paint




Damage 10: Front bumper: Front bumper - Scratched - Paint



Damage 10: Front bumper: Front bumper - Scratched - Paint



Damage 11: Sliding door, right: Sliding door with glass panel - Deformed - Repair and paint

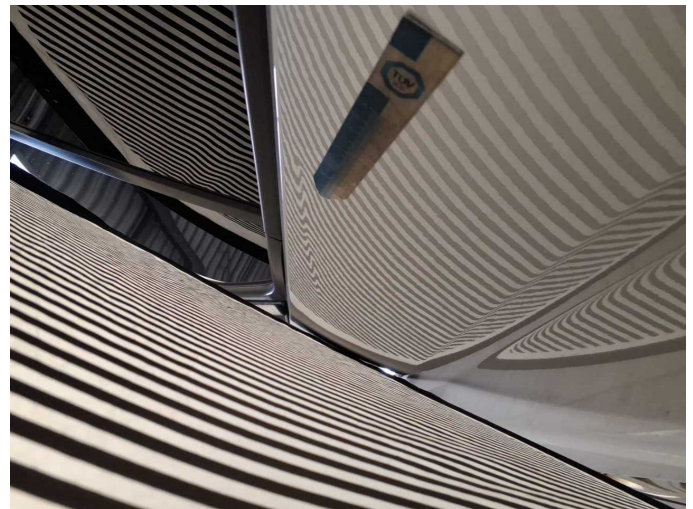

Damage 11: Sliding door, right: Sliding door with glass panel - Deformed - Repair and paint



Repainting 1: Roof



Repainting 2: Boot lid / rear door



Repainting 3: Mudguard - left side



Repainting 4: Mudguard - right side



Repainting 5: Bonnet



Repainting 6: Side panel - rear left side



Repainting 7: Side panel - rear right side



Repainting 8: Door - rear left side



Repainting 9: Door - rear right side



Repainting 10: Door - front left side



Repainting 11: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF07XXWPG7NY73116
Hersteller / Modell: FORD FORD Transit Connect 230 L2 S&S Trend

Datum	KM-Stand	Beschreibung
05.05.2026	210.916	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.11.2025	184.822	Keilrippenriemen; Reparatur Sonstiges; Wasserpumpe ern; Zahnriemen/ Steuerkett ern
30.10.2025	182.515	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.08.2025	168.170	HU + AU
08.04.2025	150.745	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
02.10.2024	120.207	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.02.2024	90.257	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.08.2023	61.345	Bremsklötze hinten; Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.01.2023	30.414	Motoröl b. Wartung; Regelwartungsdienst