

## Expertise

Protocol number: 45470390  
Order No. / Reference: 26227747  
Inspection date: 15 May 2026

Manufacturer: Peugeot

Model: 5008 BlueHDi 130 EAT8 GT

VIN: VF3MCYHZUNS162160



### Vehicle details

#### Manufacturer / Type / Model / Equipment

Peugeot 5008 BlueHDi 130 EAT8 GT

**Vehicle Identification number** VF3MCYHZUNS162160

**Mileage (Read)** 101,434 km

**First registration** 16 Feb 2023

**Number of holders** 1

**Next periodical technical inspection** 03/2028  
(Report not on hand)

**Power / Engine displacement** 96 kw / 1,499 ccm

**Fuel type / Cylinder** Diesel / 4

**Gearbox / Number of gears** Automatic / 8

**Type of drive** Front drive

**Type of vehicle** SUV

**Colour / colour code** Perla Nera Schwarz  
Metallic

**Doors / Seats** 5 / 7

**Upholstery type** Leather

**Colour of upholstery** Black



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	19,800 km
<b>Last service on / at</b>	11/2025 at 91,241 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		<b>Letter No.</b>	GC919639
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	Detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	3003 / AZJ 00263		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>fine dust sticker</b>	
<b>Permitted total weight</b>	2,230 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103H	Winter tyres on Light alloy	Semperit	5mm / 5mm
2)	215/65 R17 103H	Winter tyres on Light alloy	Semperit	6mm / 6mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	All-season tyres on Light alloy	Goodyear	4mm / 4mm
2)	225/55 R18 102V	All-season tyres on Light alloy	Goodyear	5mm / 5mm

**Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.**

TÜV SÜD Auto Partner GmbH  
Wiesenring 2  
04159 Leipzig

Inspection location  
Hartmann Fleet Professionals GmbH  
Industriestraße 11  
36272 Niederaula



## Equipment



## Standard equipment

- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger
- Airbag: Curtain airbags front and rear
- Adaptive Cruise Control (ACC) with Stop & Go function including lane positioning assistant
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- On-board computer
- Chrome trim strips on the lower part of the doors
- Chrome trim strips below the side windows
- Black headliner
- Ceiling light - LED at the front, in row 2 and in row 3, 2 LED reading lights at the front, in row 2 and in row 3
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Driving mode selector (Sport - Normal - Eco)
- Misfueling protection
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Floor mats
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point safety belts
- Heated rear window
- Interior mirror automatically dimming
- Keyless system
- Automatic climate control (2-zone), with activated carbon filter
- Chrome-plated loading sill protector
- Blue LED lighting on the door panel
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: small multifunction steering wheel, flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Emergency brake assist
- Particulate filter: FAP diesel particulate filter
- Peugeot Connect Box
- Radio: RCC audio system
- Radio: Mirror Screen
- Rain sensor
- Wheels: 18" "Detroit" alloy wheels, two-tone with black
- Reversing camera with 180° surround view
- Keyless start system
- Electric power steering
- Seats: 2 additional seats for the 3rd row
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Power outlet: Dual USB port (Type A) in row 2
- Active Safety Brake Plus
- Airbag: Front and rear side airbags
- Active Blind Spot Assist
- Electrically folding exterior mirrors with LED approach lighting
- Exterior mirrors in Perla Nera Black
- Hill start assist
- third brake light
- Chrome trim strips above the side windows
- Black Diamond roof (roof in Perla Nera black)
- Aluminum roof rails
- Alcantara "Grevat" decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Electric windows front and rear
- electric parking brake
- Front collision warning
- Full LED headlights with automatic headlight range control
- Cruise control system with speed limiter
- Cup holder in the center console
- Illuminated glove compartment
- rear window wiper
- Frameless interior mirror
- Child safety locks on the rear doors
- Front headrests (2)
- Rear headrests (3)
- White LED ambient lighting in the front footwell
- LED daytime running lights and LED turn signals at the front
- light sensor
- makeup mirror
- Fatigue warning
- Navigation system: 3D navigation system NAC
- Package: Children's Package
- Aluminum pedals and stainless steel door sills
- Upholstery: Fabric/faux leather "Belomka" in black with decorative stitching in copper
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire repair kit (compressor + tire sealant spray)
- paddle shifters on the steering wheel
- Side windows in the second row and rear window are more heavily tinted.
- Seats: 3 separate individual seats in row 2
- Seats: Passenger seat foldable
- Seats: Manual lumbar support, for driver's seat
- Socket (3) 12 Volt
- Stop&Start system
- Tie-down points in the trunk (4 pieces)
- Central locking system, activatable from inside via remote control



- Traffic sign recognition
- Immobiliser

### Extra equipment

- Package: Full Leather Package (Black) with AGR seal of approval (Black Nappa leather with grey and copper decorative stitching - Ergonomic comfort seats - Electrically adjustable driver's seat with memory function - Heated front seats - Extendable thigh support for driver and front passenger - Electrically adjustable lumbar support for driver and front passenger - Electrically adjustable seat cushion tilt for front passenger - Massage function for driver and front passenger - Genuine wood trim for door panels and dashboard - Exterior mirrors with PEUGEOT lion projection onto the ground)
- Paint finish: Special metallic paint
- Luggage compartment partition net D382
- Package: Grip Control (Adaptive traction system with 4 modes (Standard, Sand, Mud, Snow) - Hill Descent Control - 18" "Los Angeles" alloy wheels, two-tone with 225/55 R18 M+S tires - Emergency wheel well)
- Panoramic tilt/slide sunroof with electric blind (blue LED lighting - exterior mirrors with projection of the PEUGEOT lion onto the ground)
- tailgate sensor-controlled
- Warning triangle TJ01

### Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

### Value reducing factors

No.	Component group	Description
1	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
2	Roof	Roof rail - right side - dent(s) - Smooth repair work
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Door - rear left side	Door - Scratch(es) - Smart repair
5	Indicator - front	Mirror - right side - Scratched - Replace
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Door - rear right side	Door - Scratch(es) - Paint
8	Door - front right side	Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint

### Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

### Missing parts

#### Description

Equipment - Tirefit complete



## Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 25 Feb 2024	1.443,85 €
2	Front, Provided by user / customer, from 30 Sept 2025	2.331,95 €

## Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front right side, Unprofessionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

Mudguard - right side	156 µm	Side panel - rear right side	227 µm
Door - rear right side	263 µm	Door - front right side	163 µm

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

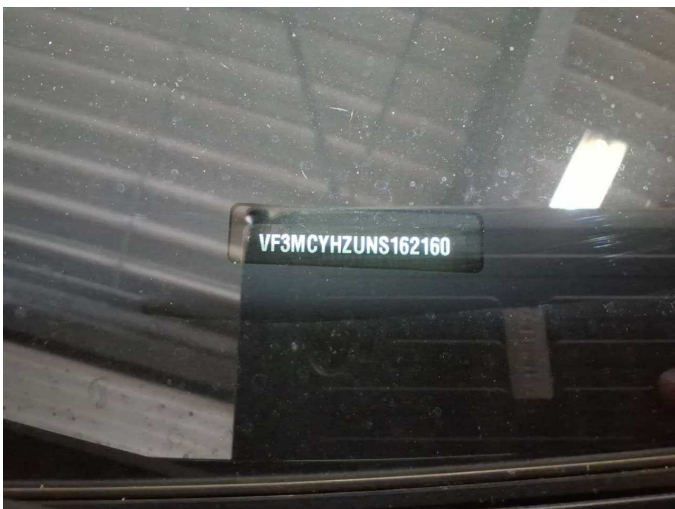


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

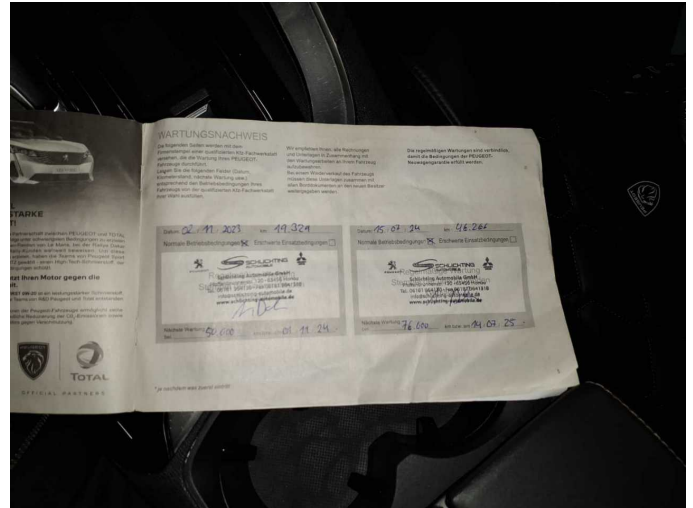


Figure 14: Documents



Figure 15: Additional tyres

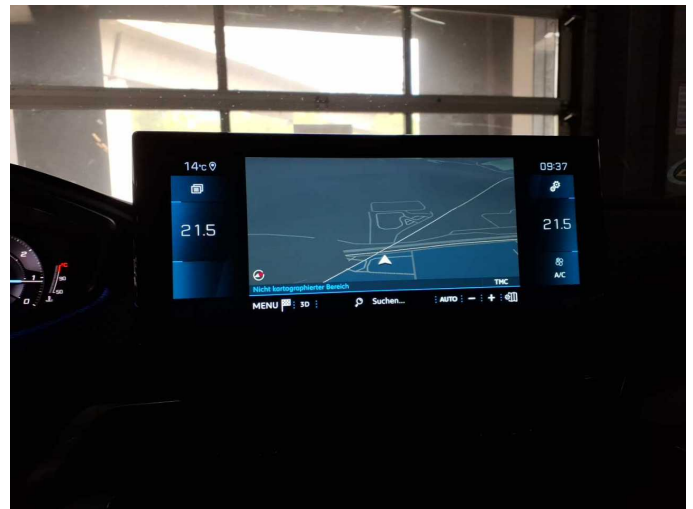


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

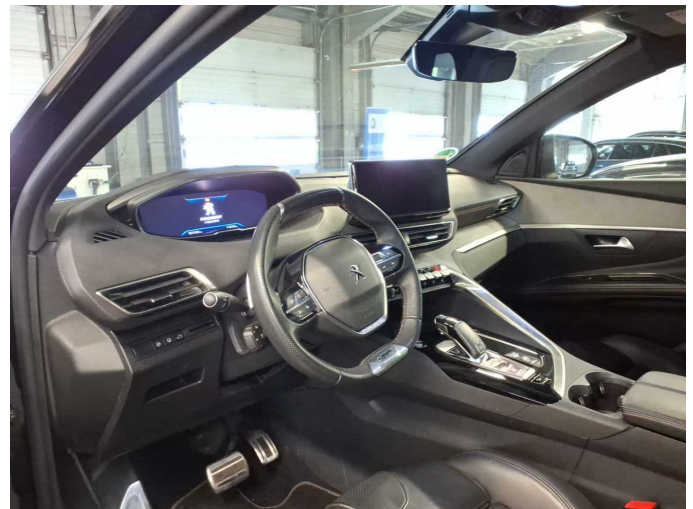


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

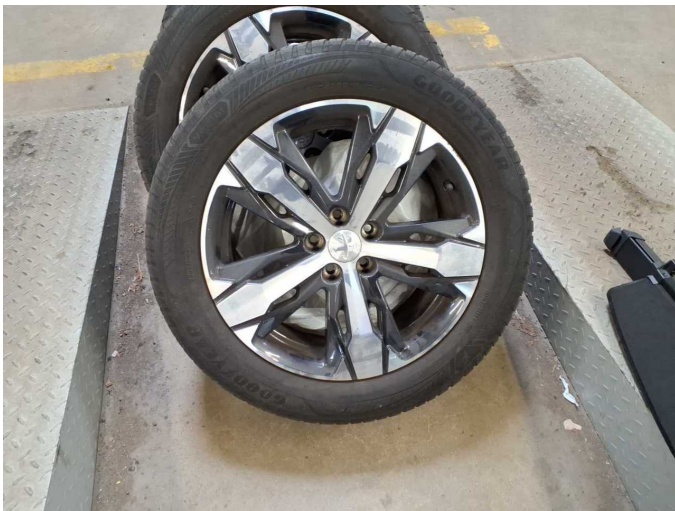


Figure 27: Misc.



Figure 28: Misc.



**Damage 1:** Door - front right side: Door handle - outside - Scratch(es) - Smart repair



**Damage 1:** Door - front right side: Door handle - outside - Scratch(es) - Smart repair




**Damage 2:** Roof: Roof rail - right side - dent(s) - Smooth repair work



**Damage 2:** Roof: Roof rail - right side - dent(s) - Smooth repair work



**Damage 3:** Side panel - rear left side: Side panel - dent(s) - Smooth repair work

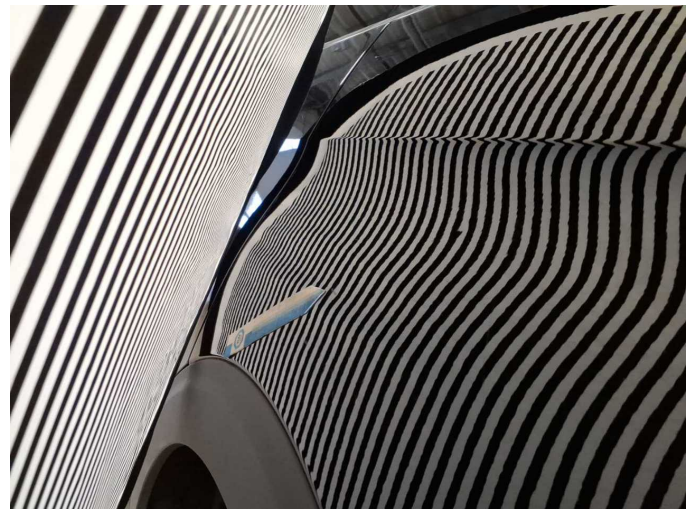

**Damage 3:** Side panel - rear left side: Side panel - dent(s) - Smooth repair work



**Damage 4:** Door - rear left side: Door - Scratch(es) - Smart repair



**Damage 4:** Door - rear left side: Door - Scratch(es) - Smart repair



**Damage 5:** Indicator - front: Mirror - right side - Scratched - Replace




**Damage 5:** Indicator - front: Mirror - right side - Scratched - Replace




**Damage 5:** Indicator - front: Mirror - right side - Scratched - Replace



**Damage 6:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

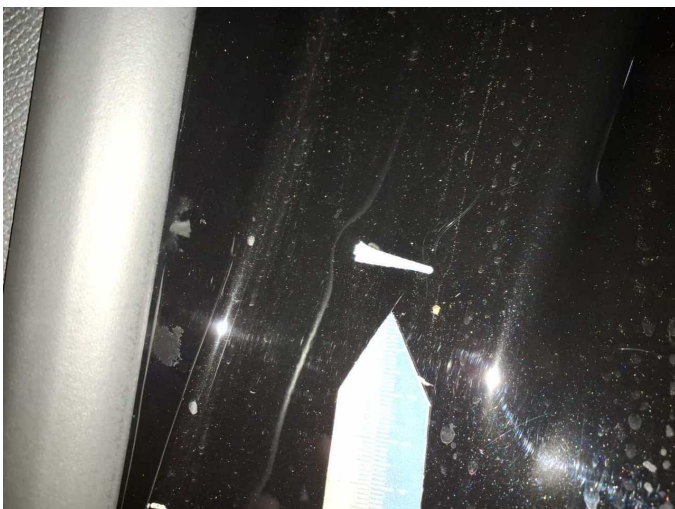

**Damage 6:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

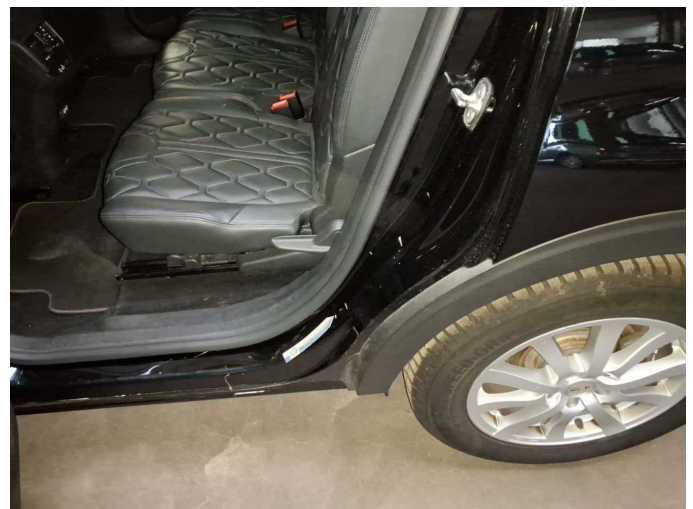


**Damage 6:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



**Damage 6:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




**Damage 7:** Door - rear right side: Door - Scratch(es) - Paint

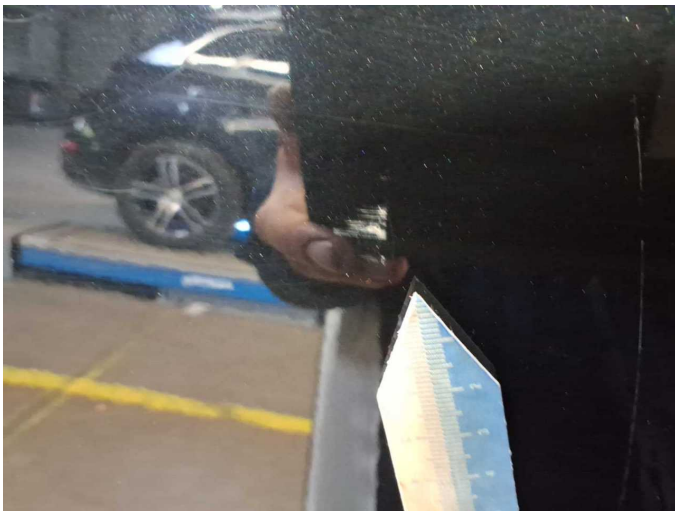

**Damage 7:** Door - rear right side: Door - Scratch(es) - Paint



**Damage 7:** Door - rear right side: Door - Scratch(es) - Paint

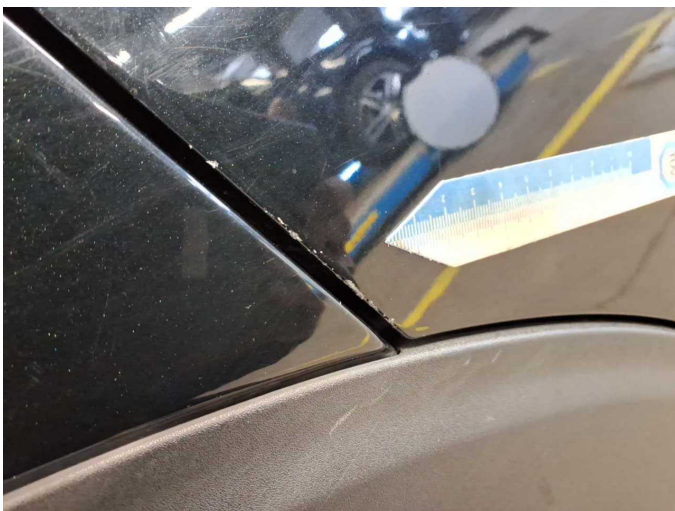


**Damage 7:** Door - rear right side: Door - Scratch(es) - Paint



**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint



**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint

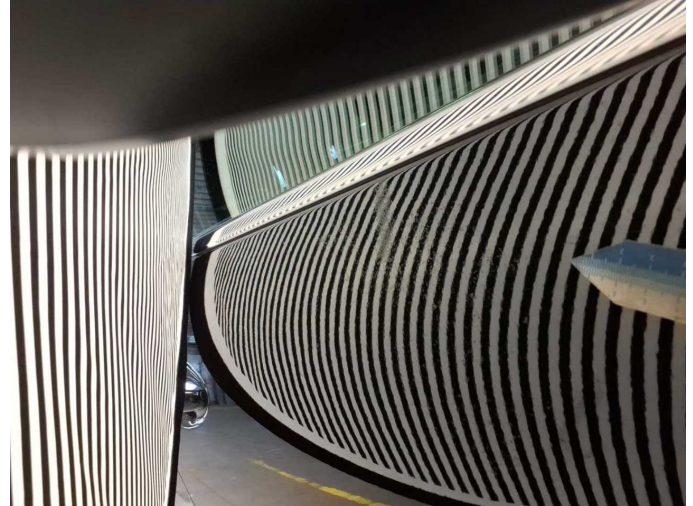


**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint



**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint



**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint

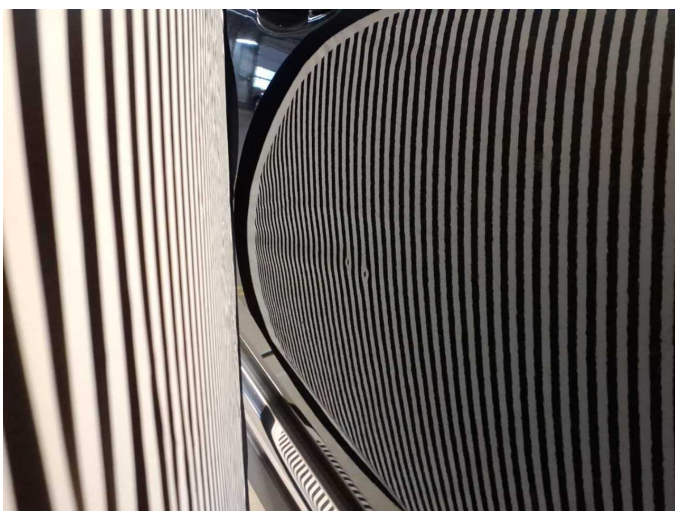

**Damage 8:** Door - front right side: Door (Einschlüsse, dellen) - Unprofessionally repaired - Repair and paint



**Repainting 1:** Mudguard - right side



**Repainting 2:** Side panel - rear right side



**Repainting 3:** Door - rear right side



**Repainting 4:** Door - front right side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZUNS162160

Hersteller / Modell: PEUGEOT PEUGEOT 5008 BlueHDi 130 EAT8 GT

Datum	KM-Stand	Beschreibung
10.03.2026	101.076	HU + AU
25.11.2025	91.241	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
08.08.2025	75.266	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
09.01.2025	62.504	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
21.10.2024	58.510	Kraftstofffilter ern; Luftfiltereinsatz ern
23.07.2024	46.266	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.11.2023	19.329	Motoröl b. Wartung; Regelwartungsdienst