



Expertise

Protocol number: 46334850
Order No. / Reference: 26615109
Inspection date: 1 Jul 2026

Manufacturer: Seat

Model: Ateca 1.6 TDI Style

VIN: VSSZZZ5FZL6556295



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Ateca 1.6 TDI Style	
Vehicle Identification number	VSSZZZ5FZL6556295
Mileage (Read)	185,072 km
First registration	25 May 2020
Number of holders	1
Power / Engine displacement	85 kw / 1,598 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Energy blau (V5F)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Blue-Black



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	42 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GB952234
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7593 / AMP 00078		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,970 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Steel	Goodyear	6mm / 6mm
2)	215/60 R16 99H	Winter tyres on Steel	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18	Summer tyres on Steel	Maxxis	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 12V socket at the front
- Storage compartment in the middle area of the lower dashboard
- Storage pocket on the back of the front seats
- Electrically folding and heated exterior mirrors
- Outdoor temperature display
- On-board computer
- Diesel particulate filter
- Tachometer
- Third brake light, integrated into the tailgate
- Electronic parking brake including auto-hold function
- Electric windows front and rear
- Gear recommendation display
- Cruise control system (CCS)
- Illuminated glove compartment
- Rear window wiper and rear window heater
- Climatronic air conditioning system with electronic temperature control
- Paint finish: Solid
- Reading lights, 2 in the front and 2 in the rear
- Armrest - centre, rear
- Fatigue detection
- Fog lights with cornering light function
- Radio: Media System Plus (Style, Xcellence, FR)
- Wheels: 4 "Dynamic" alloy wheels
- Rear seat backrest asymmetrically split and foldable
- Electromechanical power steering
- Seats: Remote release for folding down the rear seat backrest into the boot
- Sun visor on driver's and passenger's side
- LED daytime running lights
- Front Assist area monitoring system with City Emergency Braking function
- thermal insulation glazing
- Storage compartment for sunglasses on the driver's side
- Storage compartment in the front doors
- Storage compartment under the driver's seat
- Airbags
- Electrically adjustable exterior mirrors
- Hill Start Assist (HHC)
- Chrome applications in the interior
- Electronic differential lock (XDS)
- Three-point automatic seat belts, front and rear, with belt tensioners
- Electronic Stability Control (ESC)
- Footwell lighting
- Luggage compartment cover
- Transmission: 6-speed transmission
- LED taillights
- ISOFIX child seat restraint system
- Headrests, 2 front, 3 rear
- Black radiator grille with chrome strip
- Steering wheel: Three-spoke leather steering wheel with multifunction controls
- Center console with integrated storage compartment, center armrest, cup holders and rear air vents
- Upholstery: Cloth
- Tire Pressure Monitoring System (TPMS)
- Wheels: Tyre fit
- Leather gear knob
- Seats: Driver's seat with height adjustment
- Seats: Lumbar support for driver and front passenger with height adjustment for front passenger seat
- Start-stop technology
- Ultrasonic rear parking aid
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking, including tailgate, with remote control

Extra equipment

- Swiveling towbar with electric release
- Navigation: Navigation data for Europe (on SD card) for navigation systems
- Package: Driving Assistance Package II (High Beam Assist - Lane Keeping Assist - Traffic Sign Recognition)
- Package: Light and Sight (Automatic Coming Home and Leaving Home function - Automatically dimming interior mirror - Light sensor with automatic headlight control - Rain sensor)
- Luggage partition net
- Package: Business Package INFOTAIN (Navigation system - BeatsAudio sound system - Full Link: MirrorLink, Android Auto, Apple CarPlay - Digital radio reception DAB+ - Connectivity Box in the storage compartment of the center console incl. wireless charger - Spare wheel as emergency wheel)
- Rear view camera
- WKR 16 inch



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Seat cover - left side (Sitze) - Soiled - Clean
2	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
3	Roof	Roof rail - right side - dent(s) - Smooth repair work
4	Body	Body (Baumharz: Lackaufbereitung) - Soiled - Clean
5	Misc.	Main inspection - No evidence - Replace
6	2nd wheel set	1 tyre (Luftleer, keine Beschädigung erkennbar.) - Leaking - Replace
7	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
8	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
9	Side panel - rear right side	Side panel (Oberflächliche) - Scratch(es) - Smart repair
10	Door - rear left side	Brightware - lower - Scratched - Replace
11	Door - front left side	Brightware - lower - Scratched - Replace
12	Rear bumper	Rear bumper - Scratch(es) - Paint
13	Door - rear right side	Door - Scratch(es) - Paint
14	Front bumper	Front bumper - Dent / paintcoat damage - Paint
15	Door - front right side	Door - Dent / paintcoat damage - Paint
16	Vehicle glazing	Windscreen - Stone chips - Replace
17	Roof	Roof - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - No deduction
3	Roof	Roof rail - left side - dent(s) - No deduction
4	Headlight	Headlight - right side - Scratch(es) - No deduction
5	Body	Body - Scratch(es) - No deduction
6	Rear bumper	Spoiler - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Separation net



Accident damages

No. Accident

1 Front, Underbody

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

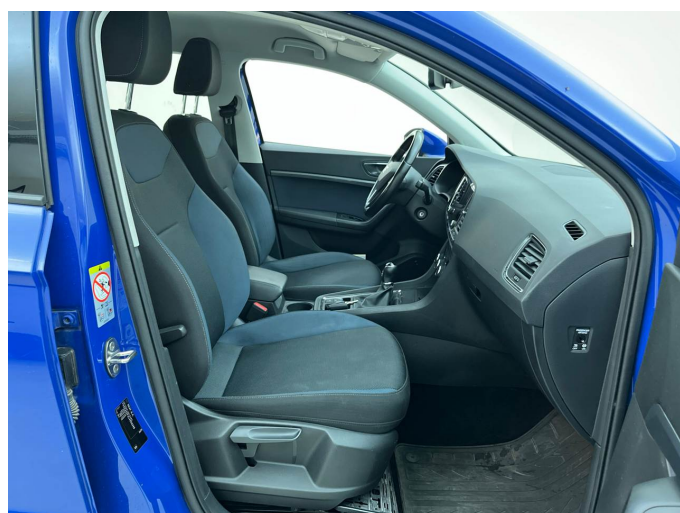


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

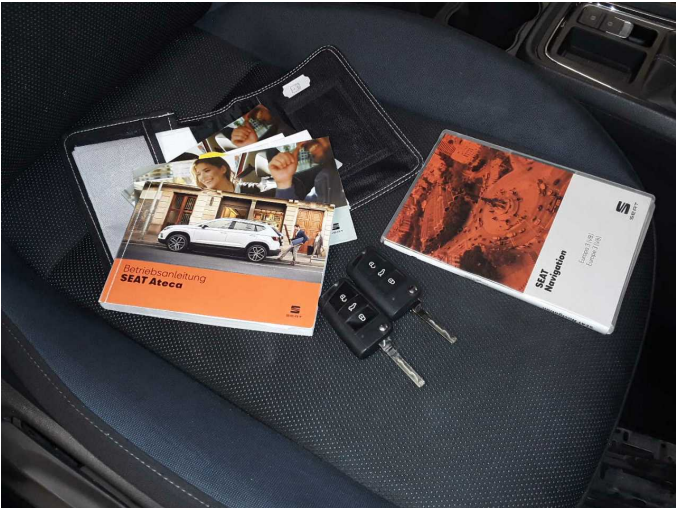


Figure 13: Documents



Figure 14: Documents

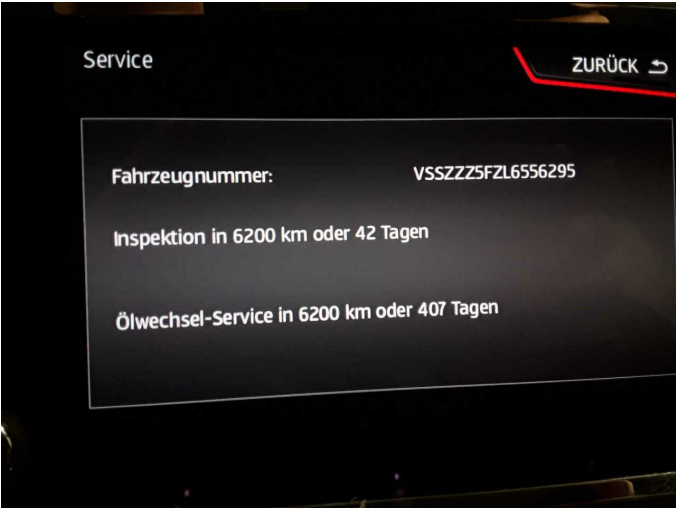


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

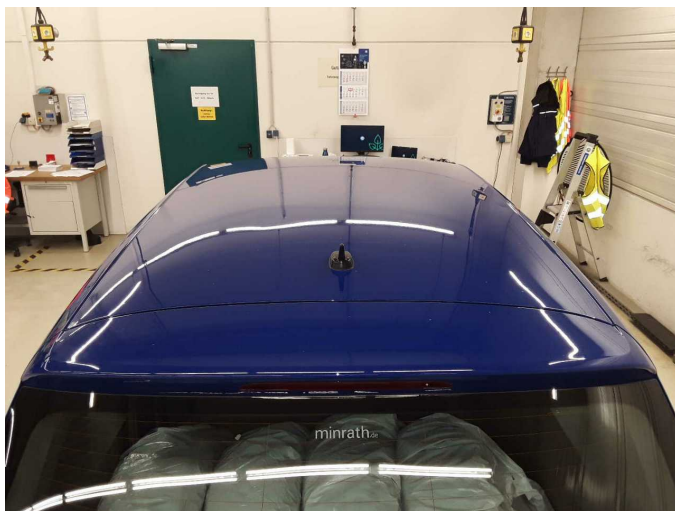


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

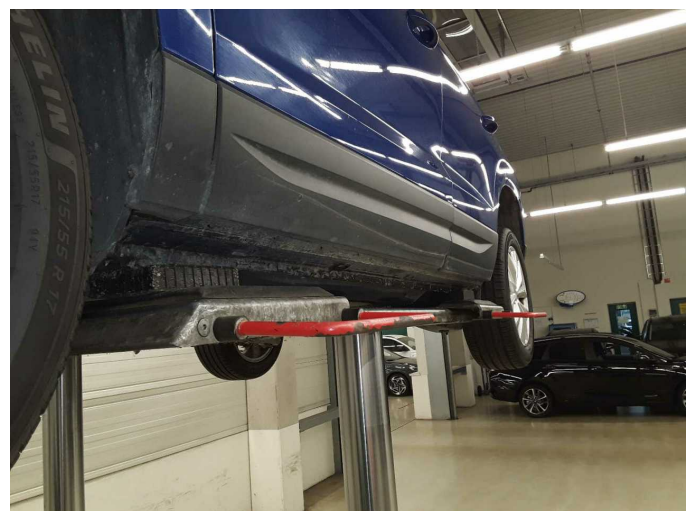


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

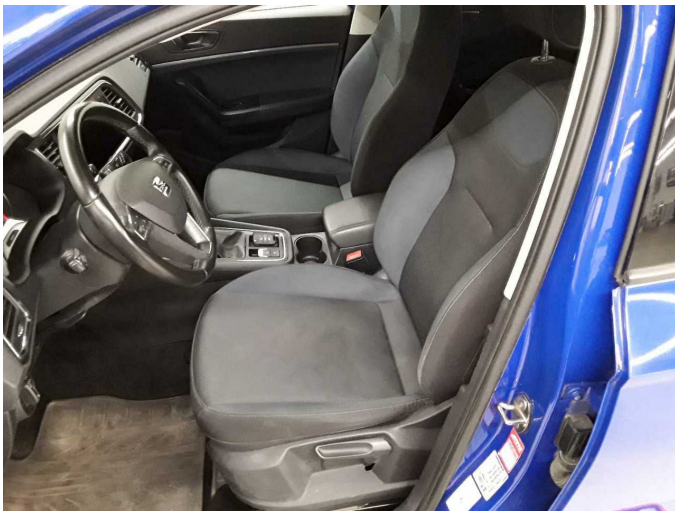

Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 3: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean



Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean



Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean




Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean



Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean



Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean

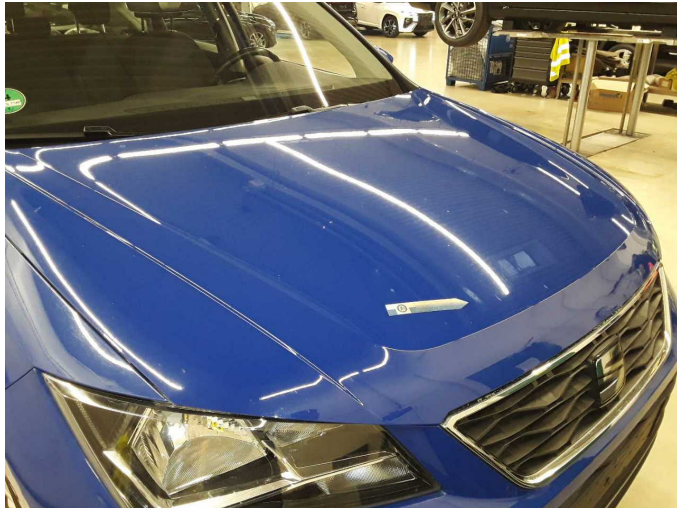

Damage 4: Body: Body (Baumharz: Lackaufbereitung) - Soiled - Clean




Damage 6: 2nd wheel set: 1 tyre (Luftleer, keine Beschädigung erkennbar.) - Leaking - Replace



Damage 6: 2nd wheel set: 1 tyre (Luftleer, keine Beschädigung erkennbar.) - Leaking - Replace



Damage 6: 2nd wheel set: 1 tyre (Luftleer, keine Beschädigung erkennbar.) - Leaking - Replace

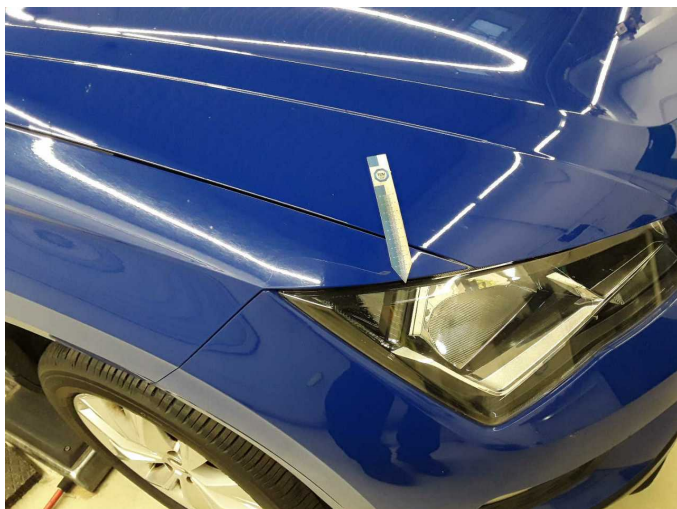

Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 7: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair




Damage 8: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 8: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 8: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

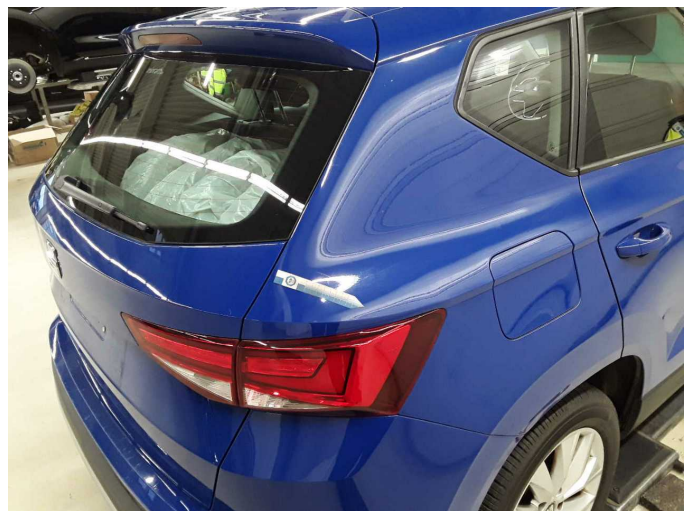

Damage 9: Side panel - rear right side: Side panel (Oberflächliche) - Scratch(es) - Smart repair



Damage 9: Side panel - rear right side: Side panel (Oberflächliche) - Scratch(es) - Smart repair



Damage 10: Door - rear left side: Brightware - lower - Scratched - Replace



Damage 10: Door - rear left side: Brightware - lower - Scratched - Replace



Damage 10: Door - rear left side: Brightware - lower - Scratched - Replace



Damage 11: Door - front left side: Brightware - lower - Scratched - Replace



Damage 11: Door - front left side: Brightware - lower - Scratched - Replace



Damage 11: Door - front left side: Brightware - lower - Scratched - Replace



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Paint

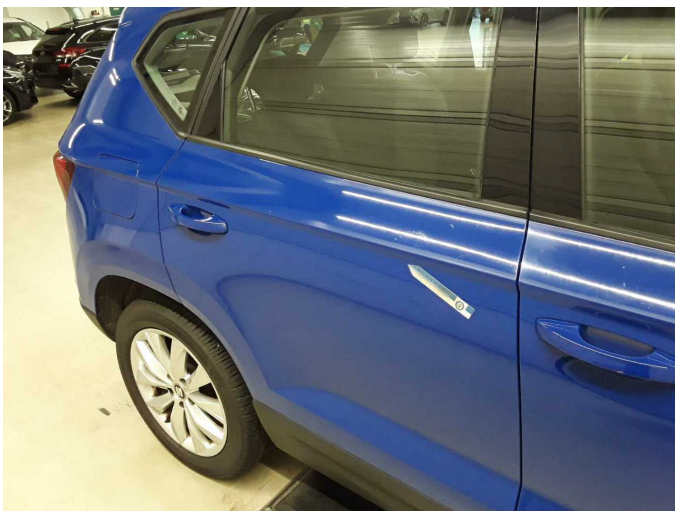


Damage 13: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Door - rear right side: Door - Scratch(es) - Paint




Damage 13: Door - rear right side: Door - Scratch(es) - Paint

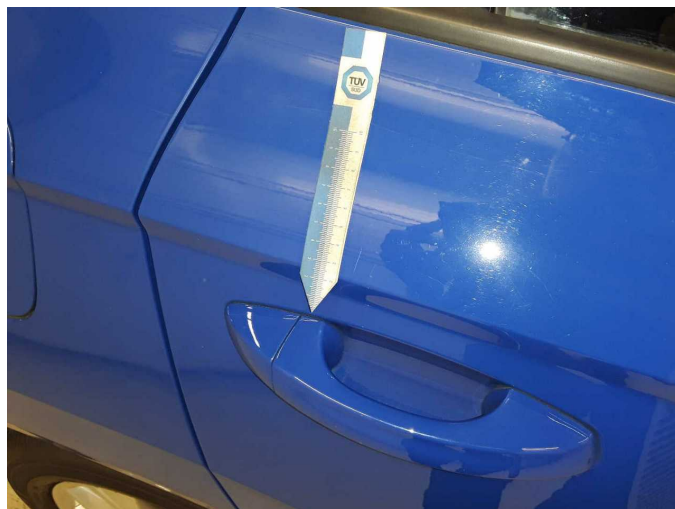

Damage 13: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Door - rear right side: Door - Scratch(es) - Paint

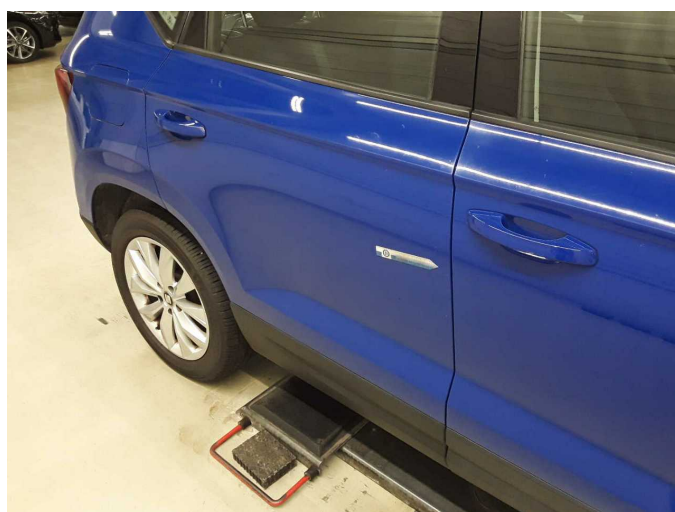

Damage 13: Door - rear right side: Door - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Paint



Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Paint



Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Paint



Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Paint




Damage 14: Front bumper: Front bumper - Dent / paintcoat damage - Paint



Damage 15: Door - front right side: Door - Dent / paintcoat damage - Paint



Damage 15: Door - front right side: Door - Dent / paintcoat damage - Paint

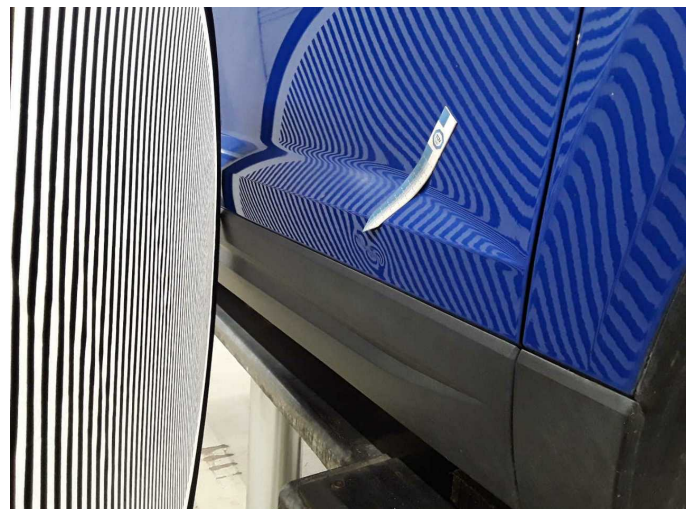

Damage 15: Door - front right side: Door - Dent / paintcoat damage - Paint



Damage 15: Door - front right side: Door - Dent / paintcoat damage - Paint




Damage 16: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 16: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 16: Vehicle glazing: Windscreen - Stone chips - Replace

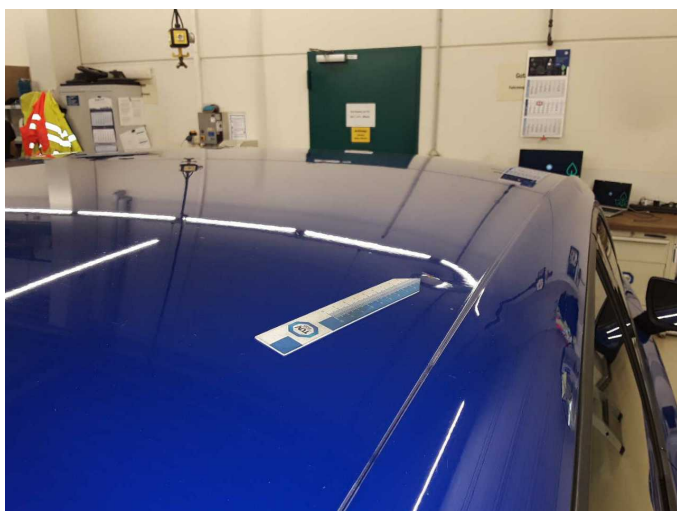

Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Repair and paint




Wear and tear 3: Roof: Roof rail - left side - dent(s) - No deduction



Wear and tear 3: Roof: Roof rail - left side - dent(s) - No deduction



Wear and tear 4: Headlight: Headlight - right side - Scratch(es) - No deduction

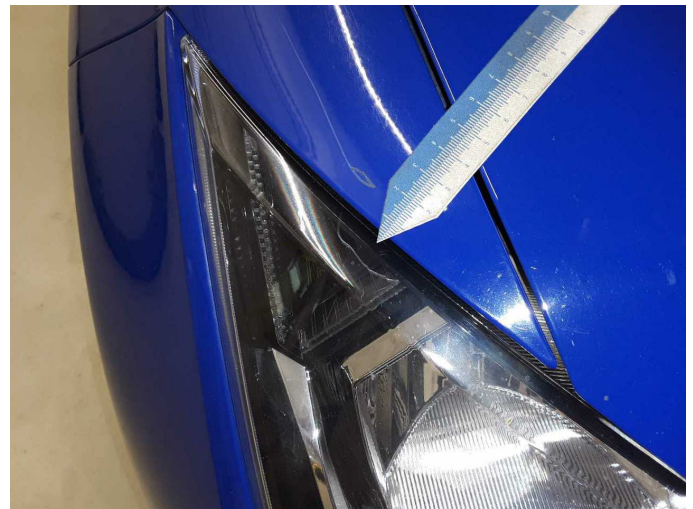

Wear and tear 4: Headlight: Headlight - right side - Scratch(es) - No deduction



Wear and tear 4: Headlight: Headlight - right side - Scratch(es) - No deduction



Wear and tear 6: Rear bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 6: Rear bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 6: Rear bumper: Spoiler - Scratch(es) - No deduction




Accident 1: Front, Underbody



Accident 1: Front, Underbody



Accident 1: Front, Underbody

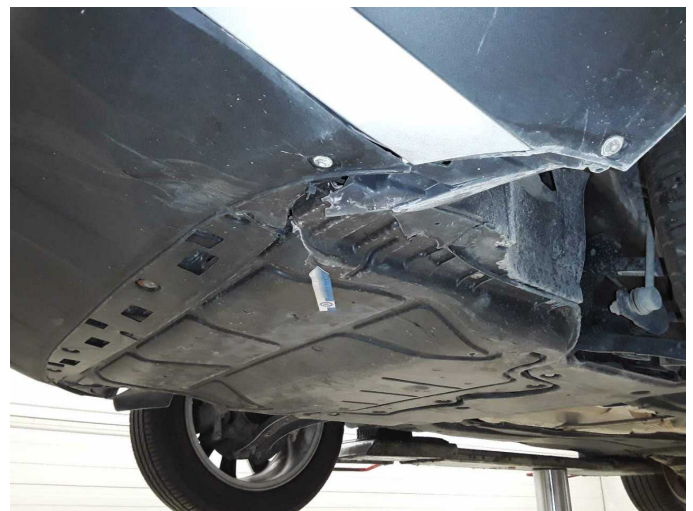

Accident 1: Front, Underbody



Accident 1: Front, Underbody




Accident 1: Front, Underbody




Accident 1: Front, Underbody



Accident 1: Front, Underbody

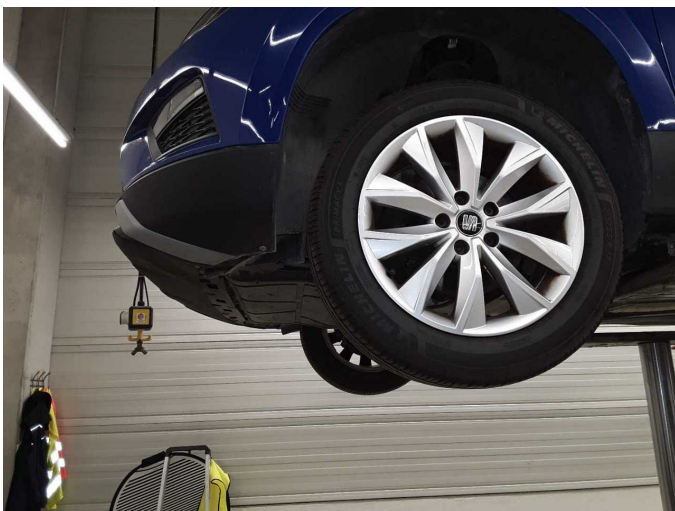

Accident 1: Front, Underbody

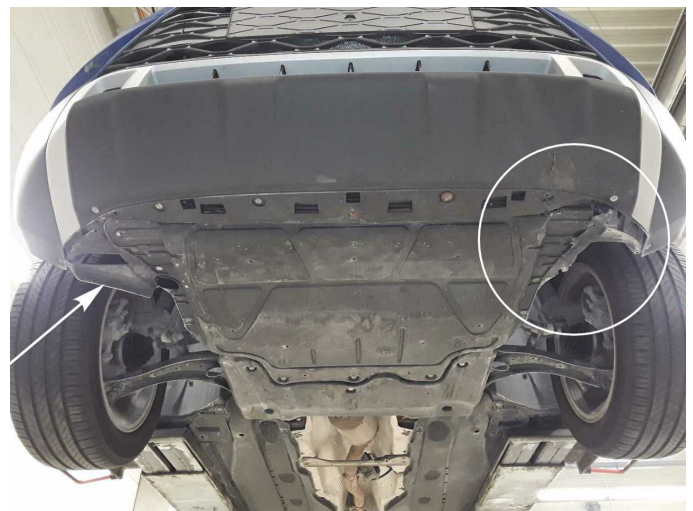

Accident 1: Front, Underbody



Accident 1: Front, Underbody



Accident 1: Front, Underbody



Accident 1: Front, Underbody



Accident 1: Front, Underbody