



Expertise

Protocol number: 46442658  
Order No. / Reference: 26580665  
Inspection date: 9 Jul 2026

Manufacturer: Volkswagen

Model: Transporter T6.1 DSG Kurz EcoProfi

VIN: WV1ZZZ7H5PX003531



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Transporter T6.1 DSG Kurz EcoProfi

Vehicle Identification number WV1ZZZ7H5PX003531

Mileage (Read) 119,027 km

First registration 2 Sept 2022

Number of holders 1

Power / Engine displacement 110 kw / 1,968 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle Van

Colour / colour code Pure Grey

Doors / Seats 4 / 3

Upholstery type Cloth

Colour of upholstery Black-Grey



| Vehicle details                              |                                |                         |                                                            |
|----------------------------------------------|--------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital proof / complete       | Next maintenance in     | 3,600 km                                                   |
| Last service on / at                         | 12/2025 at 101,286 km          |                         |                                                            |
| Key is / should be                           | 2 / 2                          | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                                | Letter No.              | GM615069                                                   |
| Previous damage / Accident                   | None detectable                | Repainting              | None detectable                                            |
| Inspection conditions                        | sufficient                     | Lifting equipment / pit | No                                                         |
| Test drive                                   | Not performed                  | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 0603 / BXU 86448               |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AR;PI/CI;N1 III, N2 | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,800 kg                       | Empty weight            |                                                            |

| Tyres         |                 |                                            |             |
|---------------|-----------------|--------------------------------------------|-------------|
| Mounted tyres |                 |                                            |             |
| #             | Tyre size       | Type of tyre                               | Tread depth |
| 1)            | 205/65 R16 105T | Summer tyres on Steel rim with wheel cover | 7mm / 7mm   |
| 2)            | 205/65 R16 105T | Summer tyres on Steel rim with wheel cover | 7mm / 7mm   |

| Replacement |           |                         |             |
|-------------|-----------|-------------------------|-------------|
| Typ         | Tyre size | Type of tyre            | Tread depth |
|             | Tirefit   | Expiration date 06/2026 |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Airbag for driver and front passenger
- Exterior mirrors, left and right convex
- Floor coverings: Rubber floor covering in the driver's cab
- third brake light
- Electronic Stability Program
- Windows: Laminated glass front pane in heat-insulating glazing
- Glove compartment with lockable flap
- Tailgate without window cutout
- Heating and ventilation system in the driver's cab
- Interior paneling: Side paneling (half-height) made of hardboard in the cargo area
- Fuel tank with a 70-liter tank capacity
- Headlight range control
- Non-smoking version
- Radio: Digital radio reception (DAB+)
- Wheels/Tires: Steel wheels 6.5 J x 16 in 20-hole design
- Wheels/Tire Accessories: Wheel covers for 16" wheels
- Sliding door in the passenger/cargo compartment: sliding door on the right
- Seat belts: Three-point automatic seat belts
- Power outlets: 2 12-volt sockets in the dashboard
- Telephone: Mobile phone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control and interior operation
- Approval with up to 3 seats
- Electrically adjustable and heated exterior mirrors
- Hill Start Assist
- Vehicle tool kit
- Tachometer
- Chassis: 16" chassis with 16" brake system
- Electric windows, front
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Tailgate closing without interior unlocking function
- Interior lighting in the cargo/passenger compartment
- Child safety lock, electrically operated
- Front and rear headrests
- Paint finish: Solid
- Multi-collision brake
- Particulate filter: Soot particle filter for diesel engines
- Wheels/Tires: 205/65 R 16 C 107/105 T, optimized for low rolling resistance
- Wheels: Tire Mobility Set
- Keys for locking system: 2 remote control flip keys
- Servotronic
- Start-stop system
- Daytime running light
- Inside step, in the driver's cab and cargo area
- Lashing eyes for securing cargo
- Green thermal insulation glazing
- Registration as a truck



## Extra equipment

- Auxiliary heater for windscreen defrosting and heating/ventilation of the driver's cab
- Console on the dashboard (with 1-DIN slot and additional switch positions (instead of the standard storage compartment))
- Fleet management system interface (functional control unit 1)
- Fuel tank with 80 l tank capacity
- Glove compartment with light
- Package: Driver Assistance Package Plus DSG (Traffic sign recognition, multifunction leather steering wheel, safety interior mirror with integrated display, "Front Assist" area monitoring system with City Emergency Braking function, electrically adjustable, heated, and folding exterior mirrors including folding function via vehicle key, "Lane Assist" lane keeping assistant, "Side Assist" lane change assistant, "Parking Assist", "Light Assist" high beam control, daytime running lights with automatic headlight control, windscreen wipers with automatic distance control (ACC) with "follow to stop", speed limiter).
- ParkPilot in the front and rear areas
- Rigid towbar (including trailer stabilization)
- Seats 1st row: Double passenger seat on the right (with lockable compartment in the seat base)
- Tire pressure monitoring system for road tires and winter tires
- Wheels/Tires: On-board tools and jack
- Wheels/Tires: Tire pressure monitoring system (direct measuring)
- Wheels/Tires: Winter tires (additional) 215/65 R 16 C 106/104 T mounted on 4 steel wheels
- "Transporter" lettering on the fender, no lettering on the rear
- Anti-theft alarm system with interior monitoring in the driver's cab, backup horn and tow-away protection (central locking with remote control, interior operation and safe locking)
- Heated seats for the driver's cab, left and right, separately adjustable
- Multifunction display "Plus" with fatigue detection (Multifunction display "Plus" with black and white display)
- Package: Comfort Package Plus (2 12-volt sockets, air conditioning in the driver's cab with manual control, fabric seat covers, "Bricks" design, 1 waste bin for the door pockets in the driver's cab, additional soundproofing measures in the driver's cab, height adjustment for the left single seat in the driver's cab, glove compartment lid with light, foldable grab handle on the roof frame on the passenger side, storage compartments on the driver's cab seats, reading light, sun visors with mirrors (front/rear), grab handle (front/rear), manual lumbar support for the left single seat in the 1st row of seats)
- Partition walls: High partition wall with fixed window and 8 lashing rings for securing cargo (partition wall, high, with window - without child safety lock in passenger compartment - lashing rings for securing cargo, reinforced (ISO 27956))
- Radio navigation system "Discover Media" including "Streaming & Internet" (voice control - 2 USB interfaces (Type C) in the dashboard - "Discover Media" radio navigation system with 20.3 cm (8 inch) touchscreen including "Streaming and Internet" - navigation function/ preparation - 4 speakers: 2 tweeters, 2 woofers - Wired & Wireless App-Connect)

## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

## Value reducing factors

| No. | Component group              | Description                                           |
|-----|------------------------------|-------------------------------------------------------|
| 1   | Misc.                        | Main inspection - No evidence - No deduction          |
| 2   | Equipment                    | Tirefit filler - Expired - Replace                    |
| 3   | Side panel - rear right side | Side panel - dent(s) - Smooth repair work             |
| 4   | Door - front right side      | Door - Scratch(es) - Smart repair                     |
| 5   | Door - rear right side       | Door - Scratch(es) - Smart repair                     |
| 6   | Body                         | Body - Glued / labelled - De-glue / neutralise        |
| 7   | Boot lid / rear door         | Boot lid - Dent / paintcoat damage - Repair and paint |



## Wear and tear

| No. | Component group        | Description                                           |
|-----|------------------------|-------------------------------------------------------|
| 1   | Rear bumper            | Rear bumper (unpainted) - Scratch(es) - No deduction  |
| 2   | Interior               | Cargo area floor - Scratch(es) - No deduction         |
| 3   | Door - front left side | Door - Scratch(es) - No deduction                     |
| 4   | Interior               | Interior - Scratch(es) - No deduction                 |
| 5   | Bonnet                 | Bonnet - Stone chips - No deduction                   |
| 6   | Vehicle glazing        | Windscreen - Stone chips - No deduction               |
| 7   | Front bumper           | Front bumper (unpainted) - Stone chips - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Missing parts

### Description

2nd wheel set - 2nd wheel set (Winter Radsatz)

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

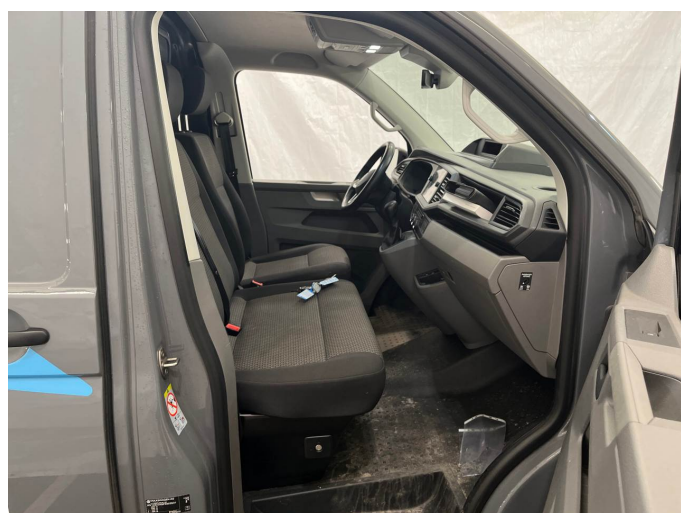


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

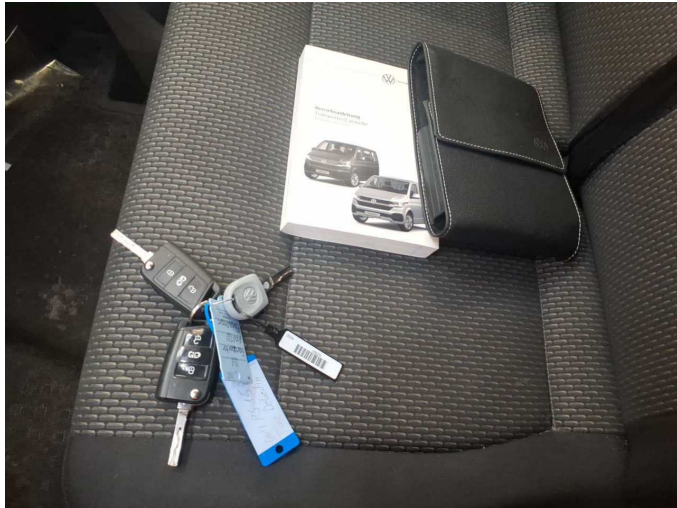


Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.

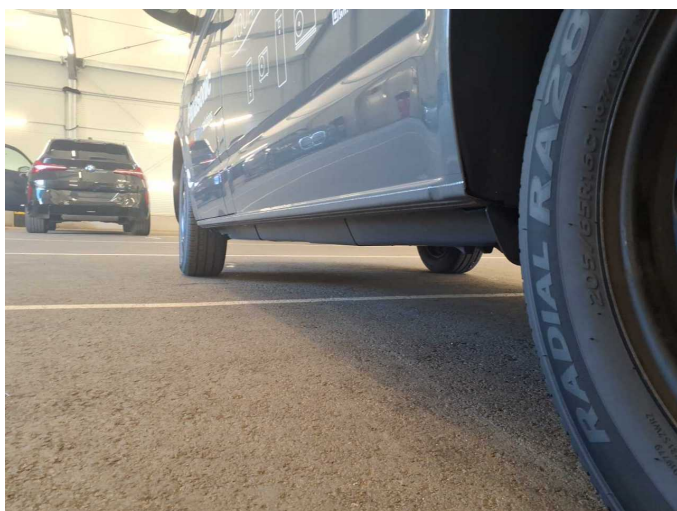


Figure 17: Misc.

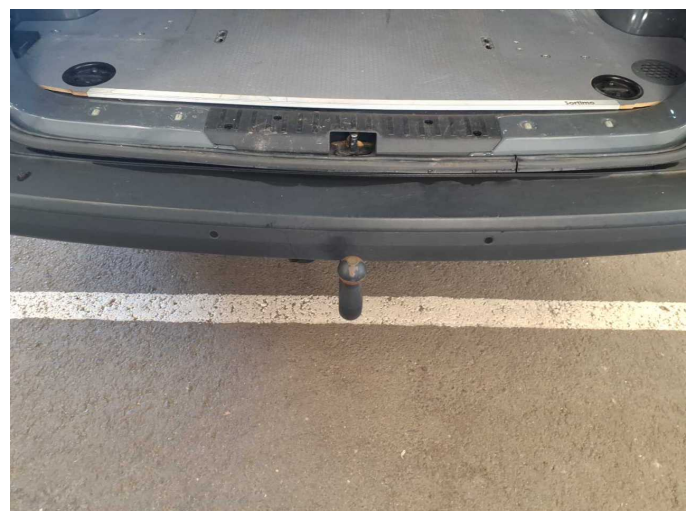


Figure 18: Misc.



**Figure 19:** Misc.



**Figure 20:** Misc.



**Figure 21:** Misc.



**Figure 22:** Misc.



**Figure 23:** Misc.



**Figure 24:** Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

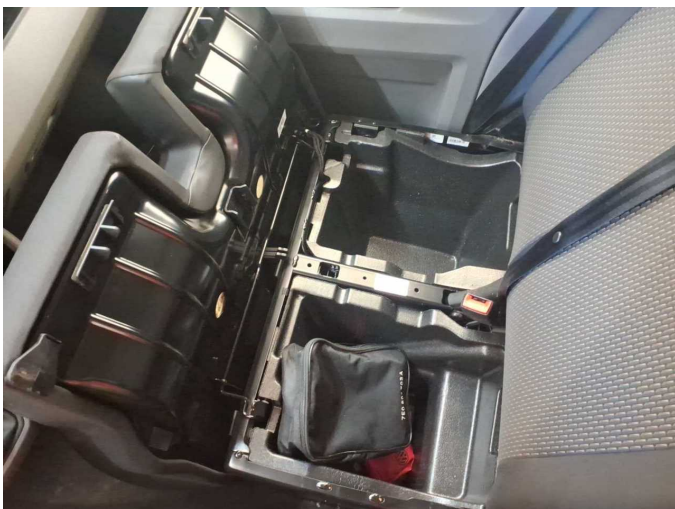


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

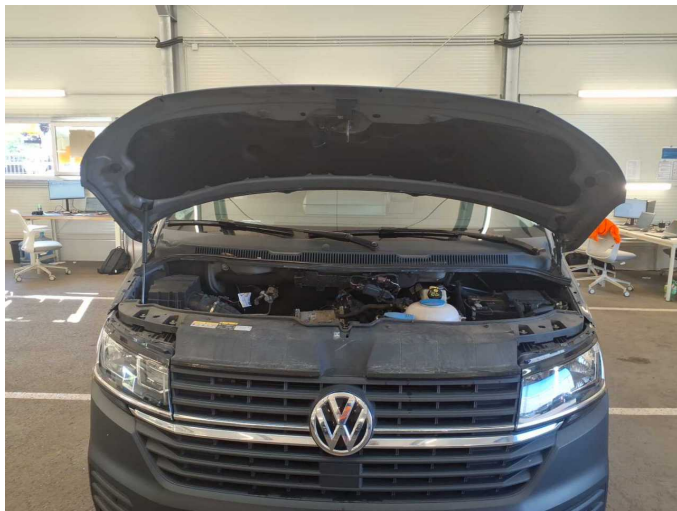


Figure 33: Misc.



Figure 34: Misc.

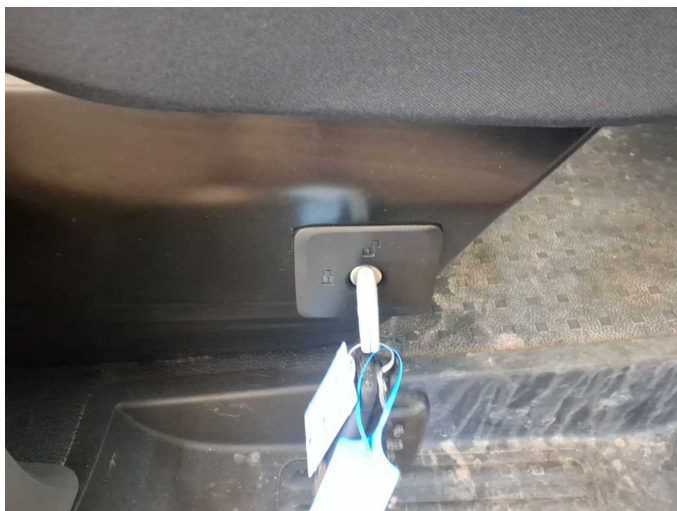


Figure 35: Misc.

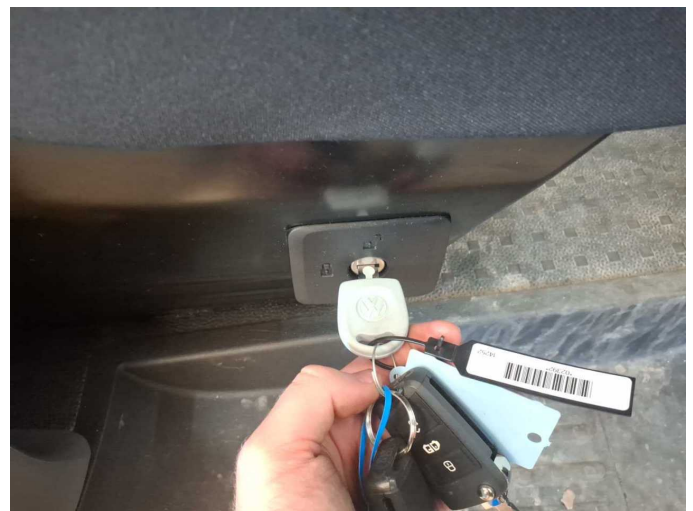


Figure 36: Misc.



**Figure 37:** Misc.




**Damage 2:** Equipment: Tirefit filler - Expired - Replace



**Damage 3:** Side panel - rear right side: Side panel - dent(s) - Smooth repair work



**Damage 3:** Side panel - rear right side: Side panel - dent(s) - Smooth repair work

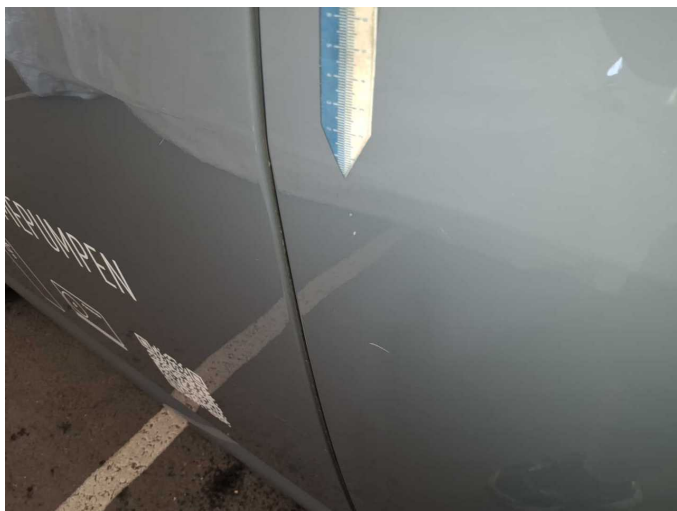

**Damage 4:** Door - front right side: Door - Scratch(es) - Smart repair



**Damage 4:** Door - front right side: Door - Scratch(es) - Smart repair



**Damage 4:** Door - front right side: Door - Scratch(es) - Smart repair



**Damage 5:** Door - rear right side: Door - Scratch(es) - Smart repair



**Damage 5:** Door - rear right side: Door - Scratch(es) - Smart repair



**Damage 5:** Door - rear right side: Door - Scratch(es) - Smart repair



**Damage 6:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 6:** Body: Body - Glued / labelled - De-glue / neutralise




**Damage 6:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 6:** Body: Body - Glued / labelled - De-glue / neutralise




**Damage 6:** Body: Body - Glued / labelled - De-glue / neutralise

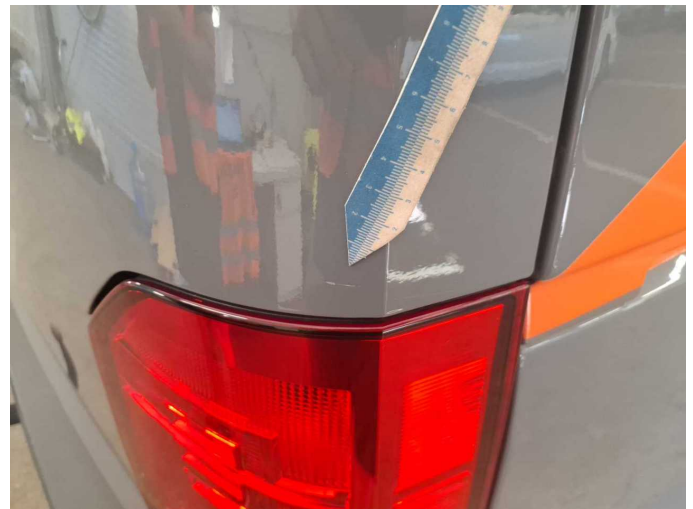

**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

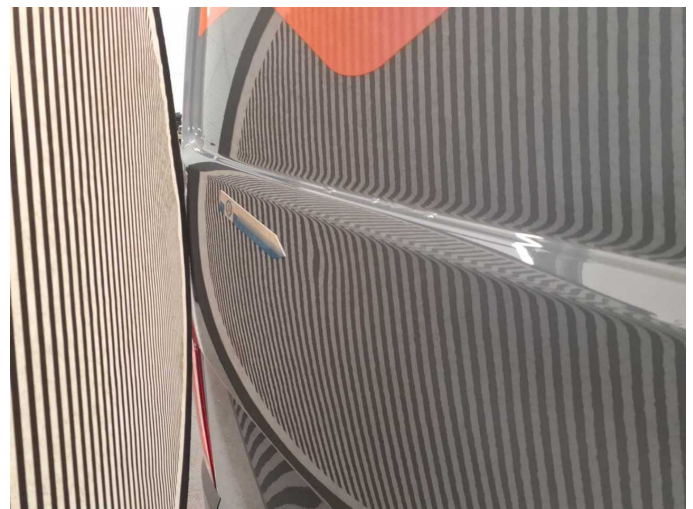


**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

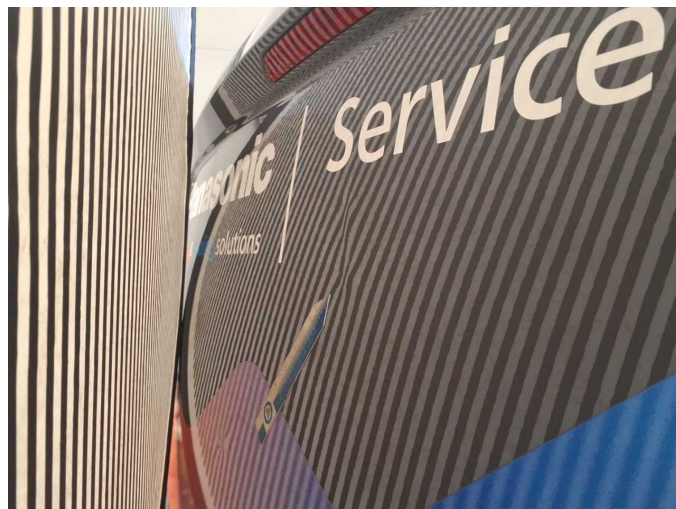

**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

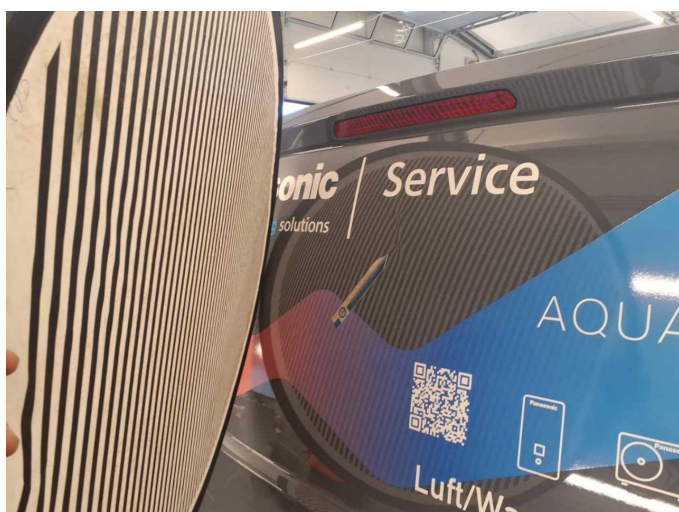

**Damage 7:** Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



**Wear and tear 1:** Rear bumper: Rear bumper (unpainted) - Scratch(es) - No deduction



**Wear and tear 2:** Interior: Cargo area floor - Scratch(es) - No deduction



**Wear and tear 3:** Door - front left side: Door - Scratch(es) - No deduction



**Wear and tear 5:** Bonnet: Bonnet - Stone chips - No deduction



**Wear and tear 6:** Vehicle glazing: Windscreen - Stone chips - No deduction




**Wear and tear 7:** Front bumper: Front bumper (unpainted) - Stone chips - No deduction



**Wear and tear 7:** Front bumper: Front bumper (unpainted) - Stone chips - No deduction



**Missing part 1:** 2nd wheel set: 2nd wheel set (Winter Radsatz) - Missing - Replace

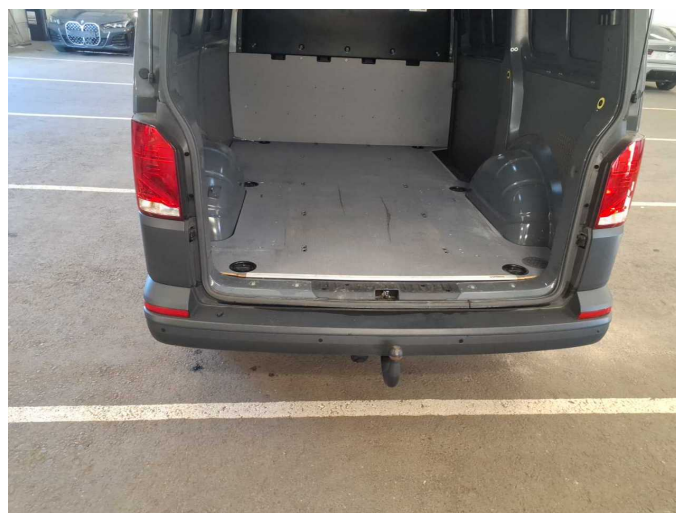

**Missing part 1:** 2nd wheel set: 2nd wheel set (Winter Radsatz) - Missing - Replace



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZ7H5PX003531

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Transporter T6.1 DSG Kurz  
EcoProfi

| Datum      | KM-Stand | Beschreibung                                                                                       |
|------------|----------|----------------------------------------------------------------------------------------------------|
| 19.03.2026 | 113.083  | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne |
| 05.12.2025 | 101.286  | Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges                                     |
| 11.07.2025 | 82.546   | Regelwartungsdienst                                                                                |
| 04.12.2024 | 70.477   | AU; Bremsflüssigkeit; Bremsflüssigkeit ern                                                         |
| 21.05.2024 | 60.820   | Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst                                     |
| 28.12.2023 | 41.551   | Regelwartungsdienst                                                                                |