



Expertise

Protocol number: 46279306
Order No. / Reference: 26673867
Inspection date: 2 Jul 2026

Manufacturer: Ford

Model: Kuga 2.5 Duratec FHEV ST-LINE X

VIN: WF0FXXWPMHNR55588



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.5 Duratec FHEV ST-LINE X	
Vehicle Identification number	WF0FXXWPMHNR55588
Mileage (Read)	107,182 km
First registration	31 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2026
(Report not on hand)	
Power / Engine displacement	112 kw / 2,488 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 1
Type of gearbox	CVT
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Chrome Blue Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	31 %
Last service on / at	01/2026 at 94,515 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP467928
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BUS 00085		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 106H	Winter tyres on Light alloy	Goodyear	3mm / 3mm
2)	225/65 R17 106H	Winter tyres on Light alloy	Goodyear	7mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R20 103V	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	245/45 R20 103V	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Ambient lighting at the front
- Electrically adjustable, heated and folding exterior mirrors
- Tires: Tire repair kit
- third brake light
- Fabric headliner
- Roof rails, black
- Tachometer
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Electric parking brake with auto hold function
- Ford Easy Fuel
- Ford Power Start function & Ford Key Free system (keyless locking/unlocking)
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Illuminated glove compartment
- Electric tailgate, sensor-controlled (opens via foot movement)
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- LED taillights
- Steering column, adjustable in height and reach
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- Front center console with integrated armrest
- Navigation system: Ford navigation system including Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - DAB/DAB+ radio reception (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - USB port - Voice control for audio and telephone - Acoustic and visual route guidance - Dynamic navigation with enhanced traffic information system - Lane guidance - Road map for Europe)
- Radio accessories: B&O Sound System (560 Watt premium sound system with 10 speakers, including subwoofer - based on the renowned sound and design expertise of Bang & Olufsen)
- Headlights with delayed shut-off
- Power steering
- Seats: Passenger seat, 8-way manually adjustable
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Front sports seats with integrated headrests
- Carpet floor mats front and rear
- Variable radiator air intake
- Central locking with remote control and remote luggage compartment release
- All-wheel drive
- Anti-lock braking system
- Passenger airbag deactivation
- Body styling kit (upper grille, ST-Line design - front and rear bumpers, ST-Line design - side skirts, painted in body color)
- 12.3-inch digital instrument panel
- Electronic Safety and Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric front and rear windows with all-around closing function
- Ford EcoCoach (shows the efficiency of current driving behavior)
- FordPass Connect (including eCall, Live Traffic information)
- Transmission: continuously variable automatic transmission (CVT)
- Heated rear window
- rear window wiper
- Intelligent Protection System (IPS)
- Air conditioning with automatic temperature control
- Front and rear headrests (5) height adjustable
- Steering wheel: ST-Line design, flattened at the bottom and with red decorative stitching, in Sensico synthetic leather
- Rear center armrest with two cup holders
- MyKey key system
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Upholstery: Premium Sensico upholstery in suede look, with red decorative stitching
- Post-Collision Assist
- Pre-Collision Assist (including forward alert system (FA) with pedestrian and bicycle detection - active from approx. 5 km/h to 130 km/h, pedestrian and bicycle detection up to approx. 80 km/h.)
- Tire Pressure Monitoring System (TPMS)
- Rear view camera
- Windscreen wipers with rain sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Driver's seat electrically adjustable, 10-way including electrically adjustable lumbar support
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Black trim around the side windows
- Immobiliser



Extra equipment

- Swiveling towbar (incl. ESP trailer stabilization)
- Tires: 8 J x 20 light alloy wheels (4) in 10-spoke design in Pearl Grey premium paint finish (gloss-turned, with tires 245/45 R20)
- Reversible luggage compartment mat
- Package: Driver Assistance Package (Automatic Transmission) (Intelligent Adaptive Cruise Control with Traffic Sign Recognition System - Traffic Jam Assist with Stop&Go Function and Lane Keeping Assist - Wrong-Way Driver Warning System - Evasive Steering Assist - Driver Drowsiness Detection - Pre-Collision Assist including Forward Collision Warning System with Cross Traffic Alert - Blind Spot Assist with Emergency Braking Function and Trailer Detection - Active Park Assist with Parking Assist and Semi-Autonomous Vehicle Steering - Front Camera with Split View - Door Edge Protectors - Intelligent Speed Limiter with Speed Limit Display)
- Mounting points behind the first and second row of seats according to ISO 27955, (required for the installation of the safety partition available as an accessory from your participating Ford dealer)
- Paint finish: Special metallic paint finish
- Package: ST-Line styling package (red painted brake calipers - large roof spoiler - front door sill trims, "ST-Line" design - pedals with aluminum covers)
- Package: Technology (Adaptive LED headlights with glare-free high beam assist and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)
- Package: Winter (heated windscreen - heated leather steering wheel)
- Safety partition net for attachment behind the 2nd row of seats (including attachment points behind the first and second rows of seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smart repair
2	Door - front right side	Door - dent(s) - Smart repair
3	Boot lid / rear door	Boot lid glazed - Dent / paintcoat damage - Smart repair
4	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyre - front - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 26 Dec 2024	3.033,77 €



Repainting

No. Repainting

1 Mudguard - left side, Mudguard - right side, Professionally carried out

Paint coat thickness measurement

Mudguard - left side	168 µm	Mudguard - right side	178 µm
----------------------	--------	-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

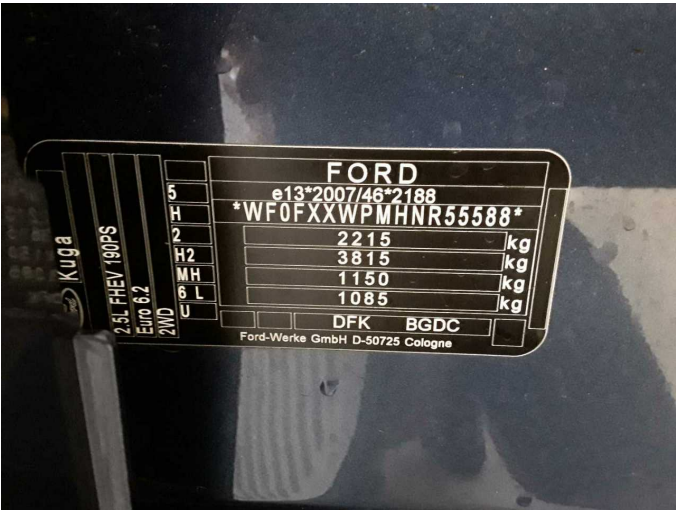


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

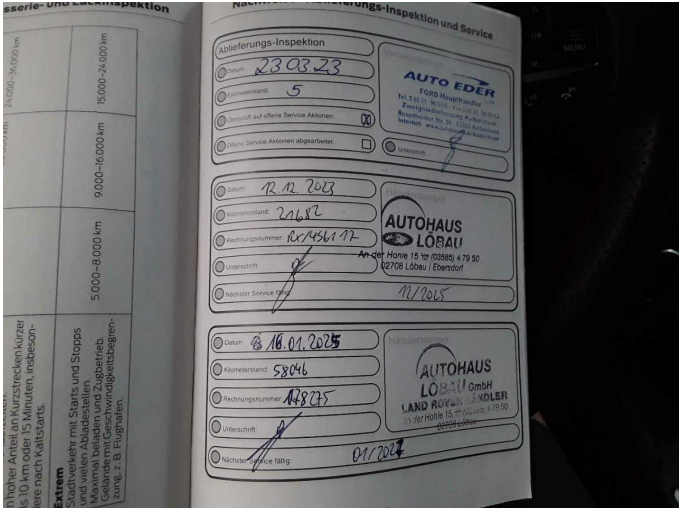


Figure 14: Documents

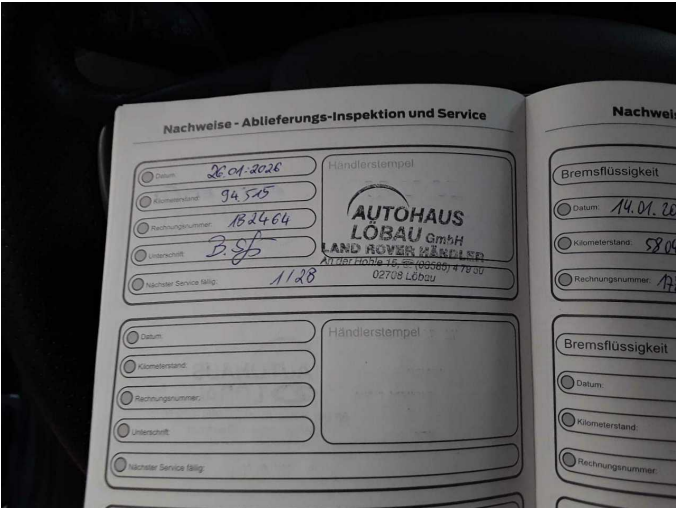


Figure 15: Documents

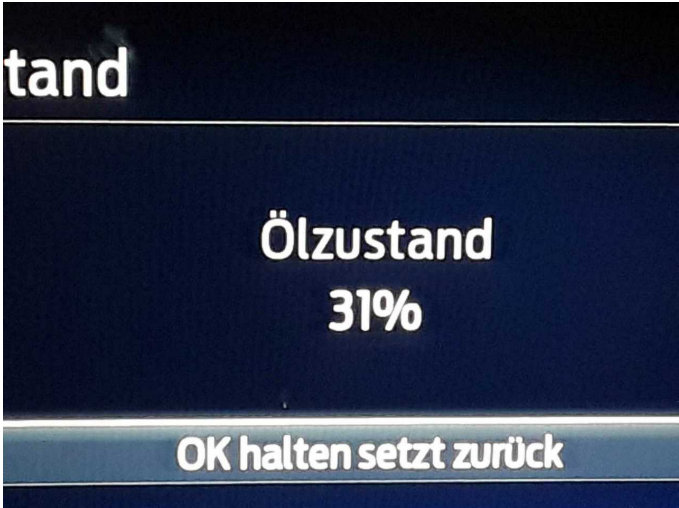


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.

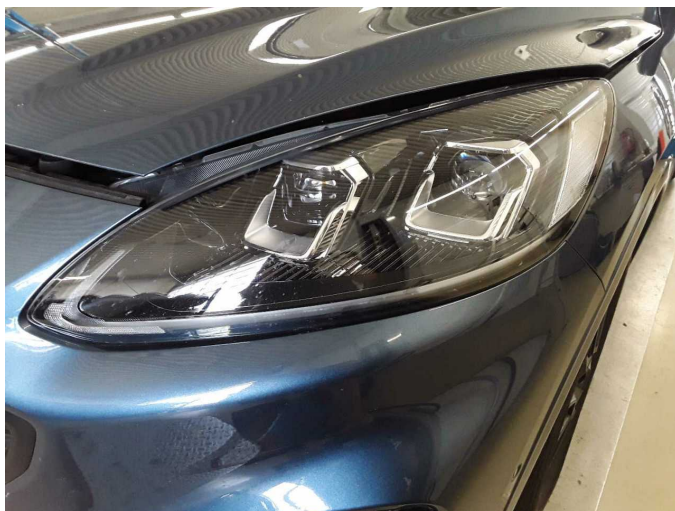


Figure 21: Misc.

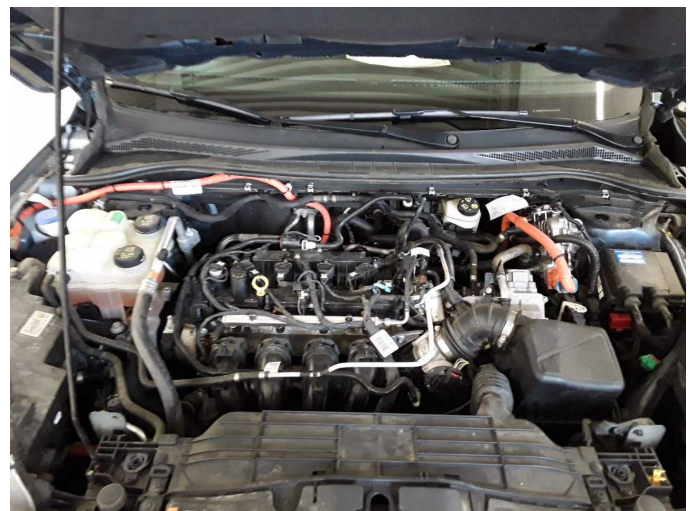


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

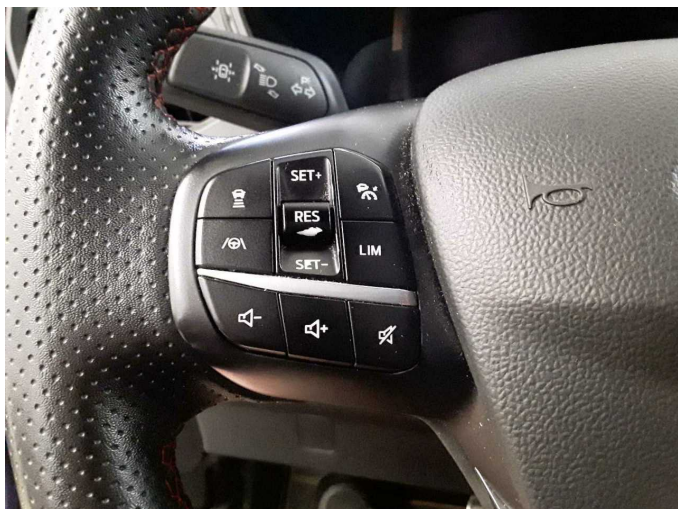


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

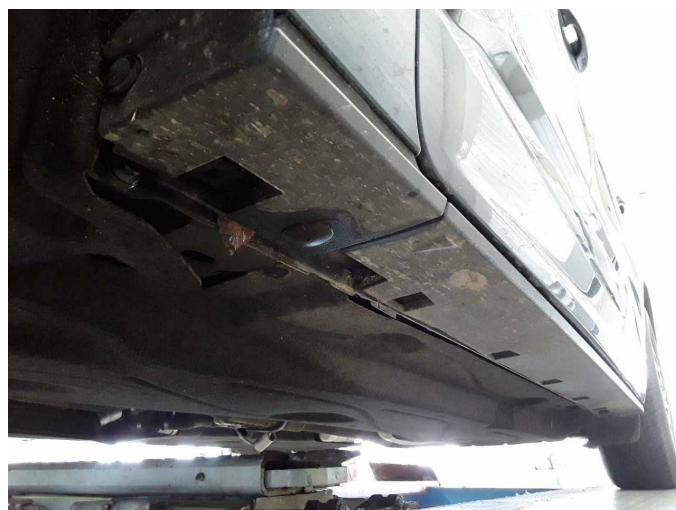


Figure 28: Misc.



Figure 29: Misc.

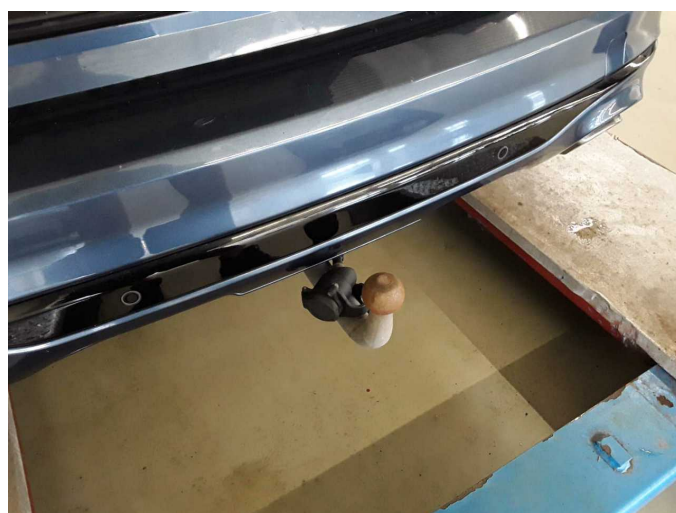


Figure 30: Misc.

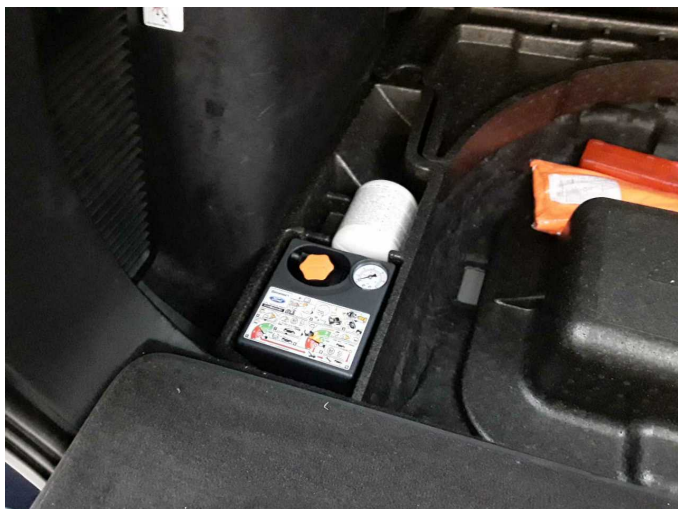


Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.




Damage 1: Roof: Roof - dent(s) - Smart repair

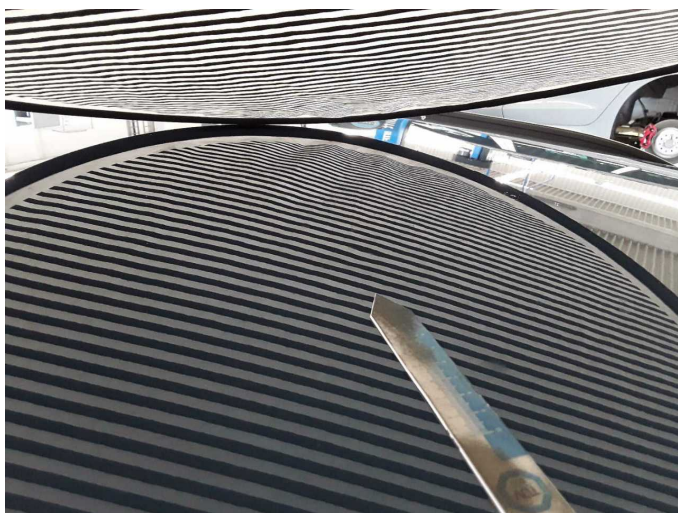

Damage 1: Roof: Roof - dent(s) - Smart repair



Damage 2: Door - front right side: Door - dent(s) - Smart repair

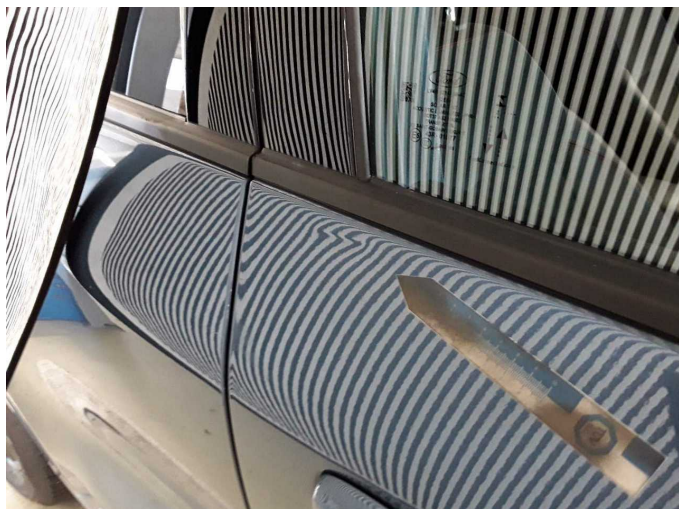

Damage 2: Door - front right side: Door - dent(s) - Smart repair



Damage 3: Boot lid / rear door: Boot lid glazed - Dent / paintcoat damage - Smart repair



Damage 3: Boot lid / rear door: Boot lid glazed - Dent / paintcoat damage - Smart repair



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Mudguard - left side: 168 μm



Mudguard - right side: 178 μm