



Expertise

Protocol number: 46844895
Order No. / Reference: 26816532
Inspection date: 3 Aug 2026

Manufacturer: Mercedes-Benz
VIN: W1VVKFZ1P4281925

Model: EQV 300 lang



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQV 300 lang	
Vehicle Identification number	W1VVKFZ1P4281925
Mileage (Read)	113,766 km
First registration	4 Jul 2023
Number of holders	1
Next periodical technical inspection	07/2028
(Report on hand)	
Fuel type	Electric
Power	70 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jupiterrot
Doors / Seats	4 / 7
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	340 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GX055428
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASK 00267		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/55 R17 106H	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	245/55 R17 106H	Summer tyres on Light alloy	Continental	7mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/55 R17 106H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	245/55 R17 106H	Winter tyres on Light alloy	Goodyear	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Adaptive brake light flashing
- Airbag: Thorax-pelvis sidebags for driver and front passenger
- Acoustic environmental protection
- Armrests for seating in the passenger compartment
- Illuminated exits in driver's and passenger's doors
- Outdoor temperature display
- Battery: fleece battery 12 V / 92 Ah
- Front footwell lighting
- Hill start assist
- Electronic Stability Program (ESP) (including Anti-lock Braking System (ABS) and Traction Control System (ASR))
- Vehicle key: Electronic key in chrome look
- Electric window regulator, 2-way (with comfort operation)
- electric parking brake
- Speed limit 140 km/h
- Seatbelt warning device for front passenger seat
- Grab handle in the rear
- Tailgate with window including rear window heating (and wiper/washer system)
- ISOFIX child seat attachment points in the rear and Top Tether attachment points on the back of the rear seat backrest
- Instrument cluster with color display
- Comfort roof control unit
- Front headrests
- Charging cable Mode 3 (Type 2, 3 x 20 A) 5 m
- Steering wheel: Leather steering wheel
- Headlight range control
- Mercedes-Benz emergency call system
- Navigation: Navigation including live traffic
- Package: Maintenance Package
- Upholstery: Santos fabric
- Radio accessories: Pre-installation for remote and navigation services
- Rain sensor
- Tire pressure monitoring
- Wheels: Comfort tires
- Halogen headlights
- Sliding door, right
- Crosswind Assist
- 3-point safety belts (including mechanical belt height adjustment, belt force limiter and belt tensioner for driver and front passenger)
- Seat: Comfort driver's seat
- Heated driver's seat
- Lane Keeping Assist
- 12V socket in the trunk/cargo area
- Cruise control
- Carpet in the rear
- Touchpad
- First aid kit
- Warm air duct to the passenger compartment
- Airbag for driver and front passenger
- Airbag: Windowbag for driver and front passenger
- Active Brake Assist
- Outer armrests for individual seats, 2nd rear row
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors with integrated turn signals
- Illuminated mirrors for sun visor
- Lighting in the rear grab handle
- Third brake light
- Driving light assistant
- Chassis: Basic chassis Plus (comfort damping on front and rear axles - comfort suspension on the front axle and standard suspension on the rear axle, stabilizer on the front axle)
- Transmission: Direct drive
- Seatbelt warning device for driver's seat
- Lockable glove compartment
- HOLD function
- Interior headliner Crystal Grey
- Mechanical child safety lock in the sliding doors
- Climate: Pre-conditioning
- TEMPMATIC air conditioning (semi-automatic controlled with pollen filter)
- Communication module (LTE) for digital services
- Paint finish: Solid
- Steering wheel adjustable for tilt and height
- Steering wheel: Multifunction steering wheel with trip computer
- Center console with storage compartment
- Navigation accessories: Pre-installation for navigation
- Breakdown management
- Radio accessories: 2-way speakers front and rear
- Radio: MBUX Multimedia System Mid (26 cm (10.25 inch) touchscreen - AM/FM radio with dual tuner - Bluetooth 4.0 with audio streaming and hands-free function - 1x USB-C port - WLAN/WIFI hotspot - digital operating instructions - programming of charging settings and pre-conditioning - charging station display - range indicator - EQ-optimized navigation)
- electric power steering
- Seat: Single seat 1st row left and right (incl. headrests)
- Seat: Single seat, 2nd row, left and right (including headrests)
- Passenger seat heating
- Seat rail system with quick-release mechanism
- 12V socket
- Bumpers and attachments painted in body color
- Carpet flooring in the front of the vehicle interior
- Blind Spot Assist
- Ambient lighting tailgate
- Traffic Sign Assistant
- Warning triangle
- Immobiliser



- Maintenance interval indicator "ASSYST"
- Heat-insulating glass all around
- Decorative elements in piano black
- Electric auxiliary heater

- Central locking with interior switch (automatic locking (can be deactivated) and crash sensor with emergency opening)

Extra equipment

- Active Distance Assist DISTRONIC (with Hold function)
- Parktronic
- Wheels: Alloy wheels 7.0Jx17 5-twin-spoke design (with tires 245/55 R 17 on 7J x 17)
- 12V power outlets for the rear seat rows, right and left
- Speed limit 160 km/h
- Radio accessories: Media interface cable kit
- Seats: 3-seater comfort bench seat, 2nd row (with folding outer seat)
- Folding table

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
3	Electrical system	Power socket (Laderaum - Deckel fehlt) - Broken / torn - Replace
4	Indicator - front	Mirror - right side - Scratched - Replace
5	Wing mirror - right side	Cap - Scratched - Paint
6	Sill - left side	Sill - Scratch(es) - Smart repair
7	Side panel - rear right side	Interior trim - Damaged - Smart repair
8	Side panel - rear left side	Interior trim - Damaged - Smart repair
9	Door - front left side	Door check strap / arrestor - Noise - Replace
10	Trim / covers	Trim / covers (Innenraum) - Scratched - Loss in value
11	Trim / covers	A-pillar - interior trim - right side - Damaged - Replace
12	Engine	Engine cowling lower front - Broken / torn - Replace
13	Equipment	tabletop (+ verschmutzt) - Scratched - Replace
14	Cab	Insulation lining (+ Motorhaube) - Damage caused by marten / rodent - Replace
15	Seat - front	Seat cover - right side (+ verschmutzt) - Damaged - Replace
16	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
17	Door - front left side	Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint
18	Front bumper	Bumper with Parktronic - Scratch(es) - Paint
19	Rear bumper	Bumper with Parktronic - Scratched - Paint
20	Bonnet	Bonnet - Deformed - Repair and paint
21	Sliding door, right	Sliding door with glass panel - dent(s) - Repair and paint
22	Side panel - rear left side	Side panel (wellig) - Unprofessionally repaired - Repair and paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen with lane departure assistant (+ Kratzer) - Stone chips - No deduction
2	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
3	Boot lid / rear door	Boot lid glazed - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Underbody, Provided by user / customer, from 14 Jul 2025	2.368,60 €
2	Side - left, Provided by user / customer, from 26 Jan 2024	3.653,76 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - front left side, Unprofessionally carried out

Paint coat thickness measurement

Side panel - rear left side	1,290 µm	Door - front left side	284 µm
-----------------------------	-------------	------------------------	--------

Order/Scope of Order

- An order was placed to prepare a sales report for the described vehicle. This report includes the following:
- Description of key vehicle information
 - Documentation of equipment features
(Delivery by third-party service providers)
 - Documentation of damage, defects, missing parts
 - Documentation of prior damage, unrepaired prior damage, repainting
 - A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
 - a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

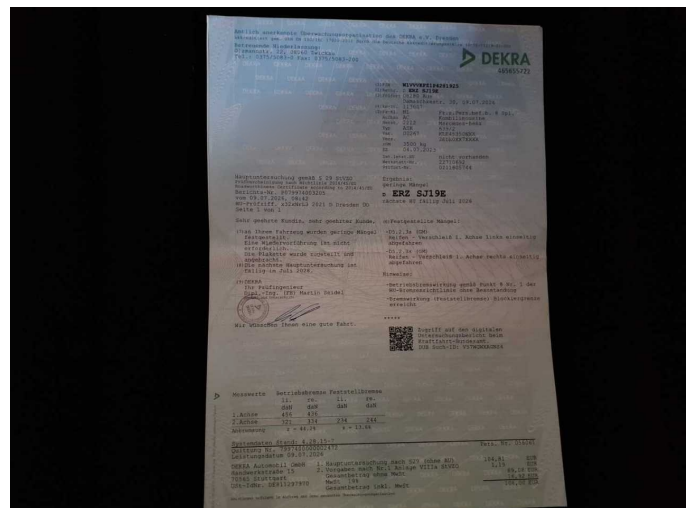


Figure 16: Documents



Figure 17: Additional tyres

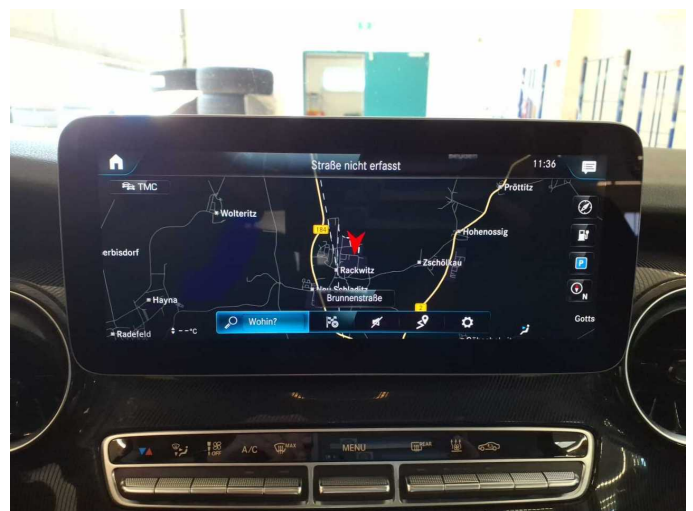


Figure 18: Navigation

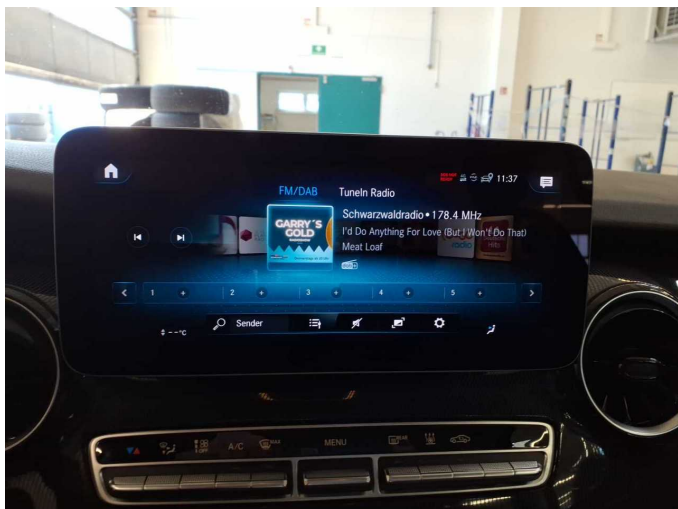


Figure 19: Misc.

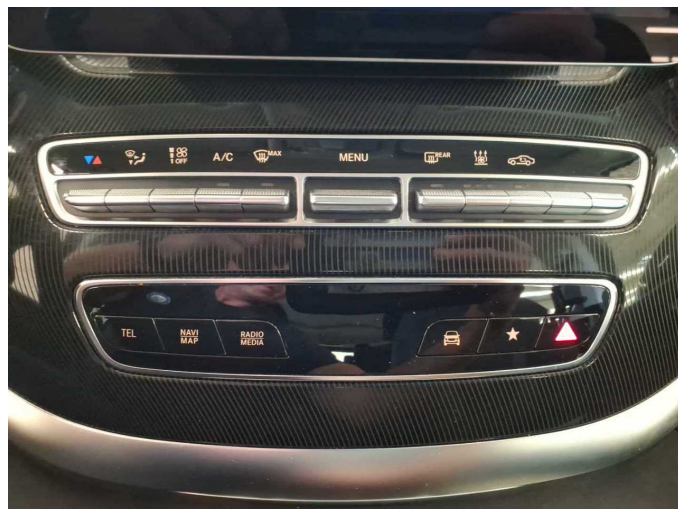


Figure 20: Misc.



Figure 21: Misc.

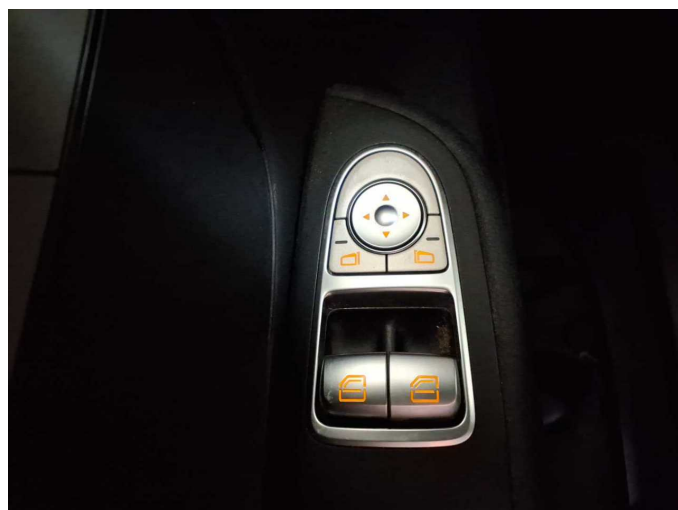


Figure 22: Misc.

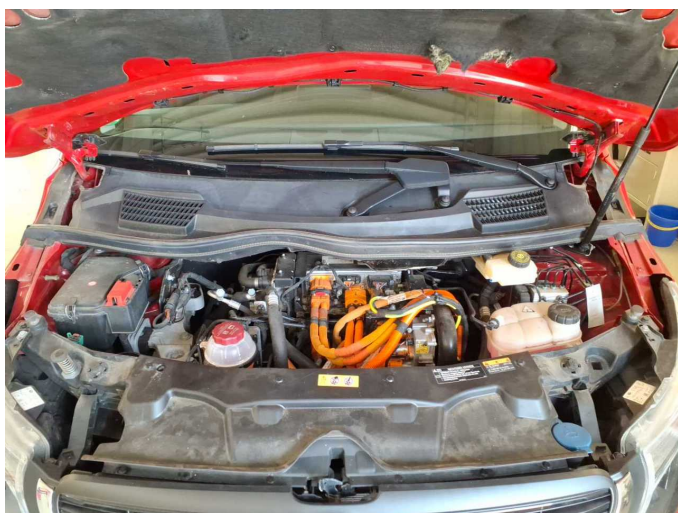


Figure 23: Misc.

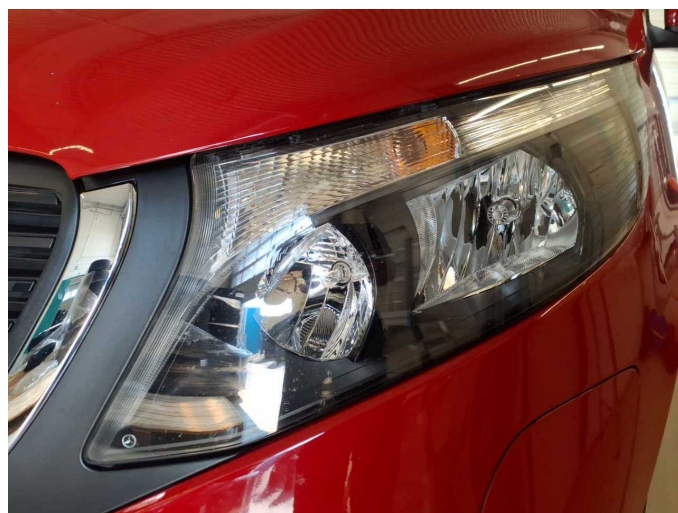


Figure 24: Misc.

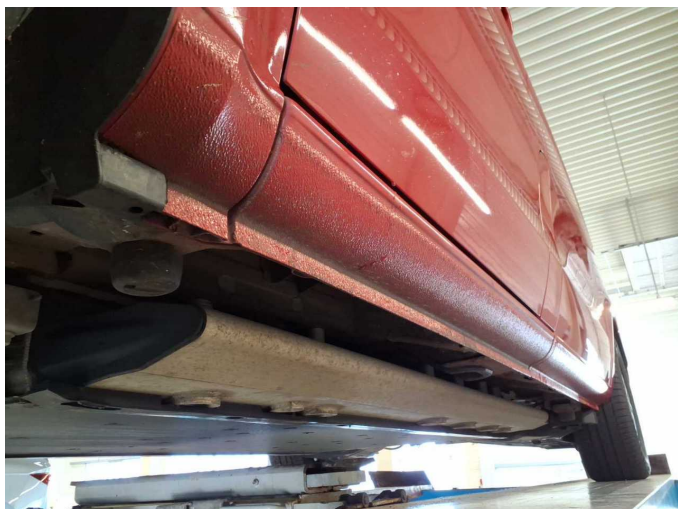


Figure 25: Misc.

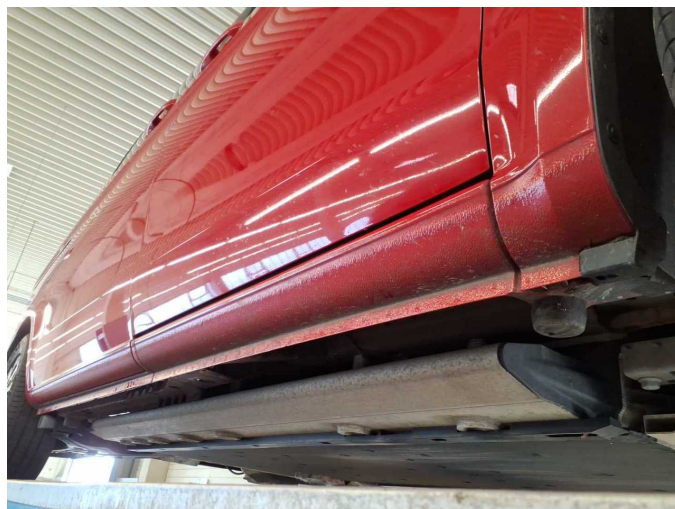


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction




Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Damage 3: Electrical system: Power socket (Laderaum - Deckel fehlt) - Broken / torn - Replace

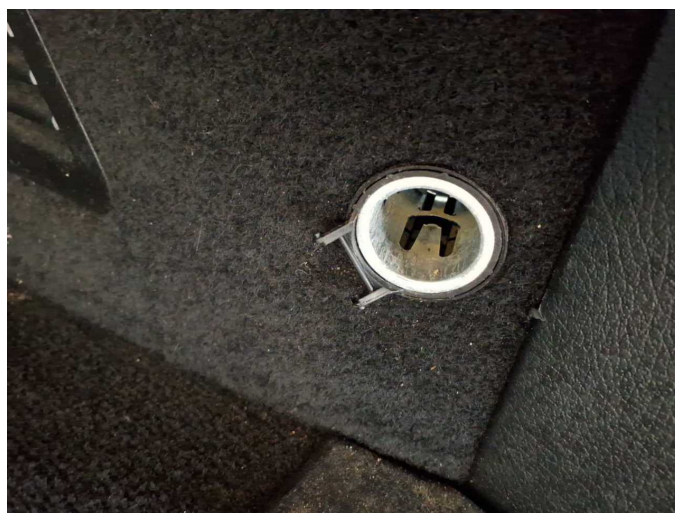


Damage 3: Electrical system: Power socket (Laderaum - Deckel fehlt) - Broken / torn - Replace




Damage 4: Indicator - front: Mirror - right side - Scratched - Replace



Damage 4: Indicator - front: Mirror - right side - Scratched - Replace

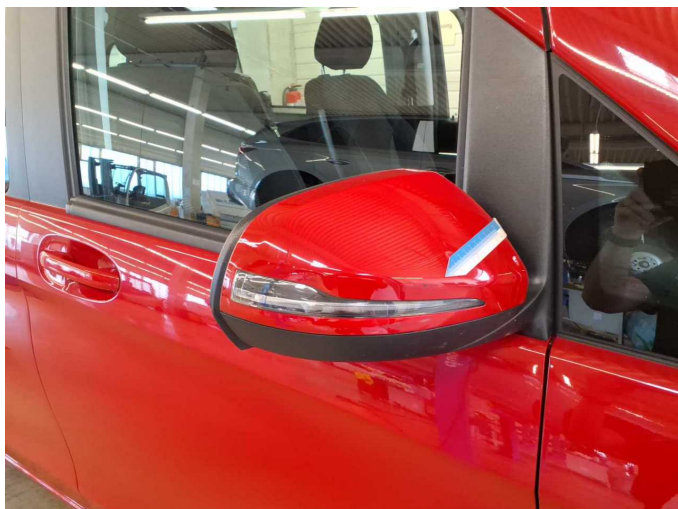

Damage 5: Wing mirror - right side: Cap - Scratched - Paint

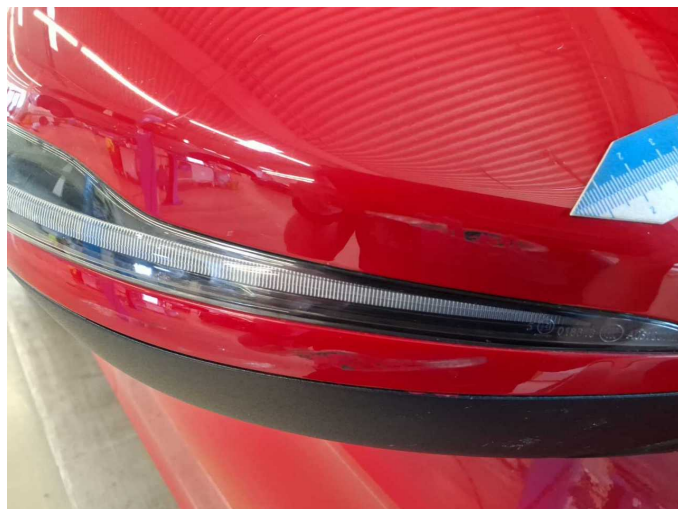


Damage 5: Wing mirror - right side: Cap - Scratched - Paint



Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair

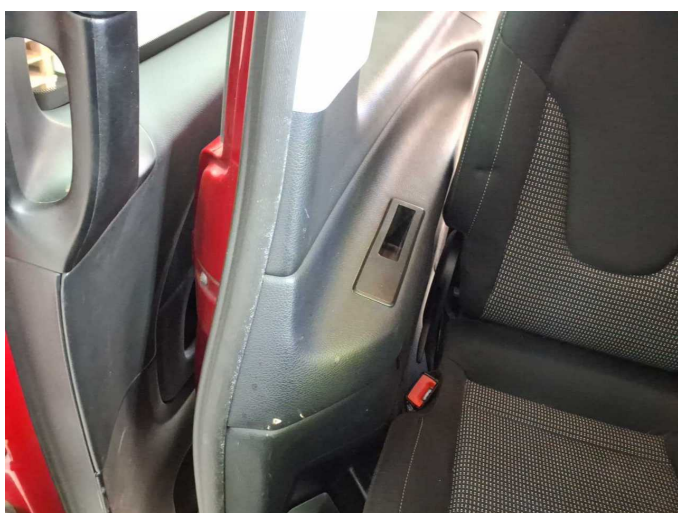

Damage 7: Side panel - rear right side: Interior trim - Damaged - Smart repair



Damage 7: Side panel - rear right side: Interior trim - Damaged - Smart repair

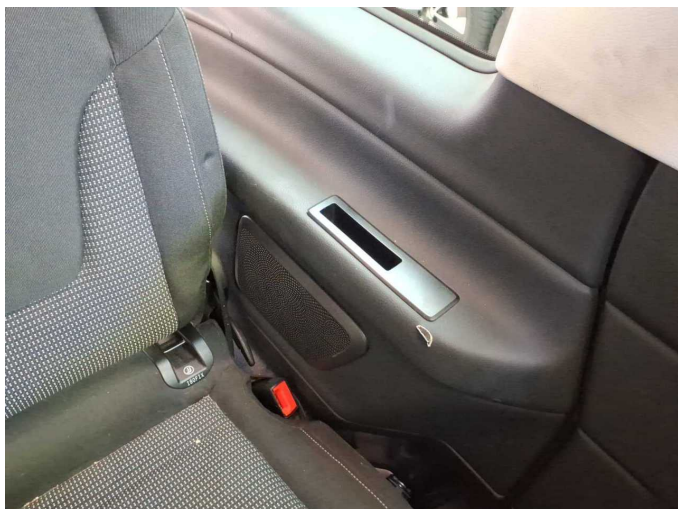


Damage 8: Side panel - rear left side: Interior trim - Damaged - Smart repair



Damage 8: Side panel - rear left side: Interior trim - Damaged - Smart repair



Damage 9: Door - front left side: Door check strap / arrestor - Noise - Replace

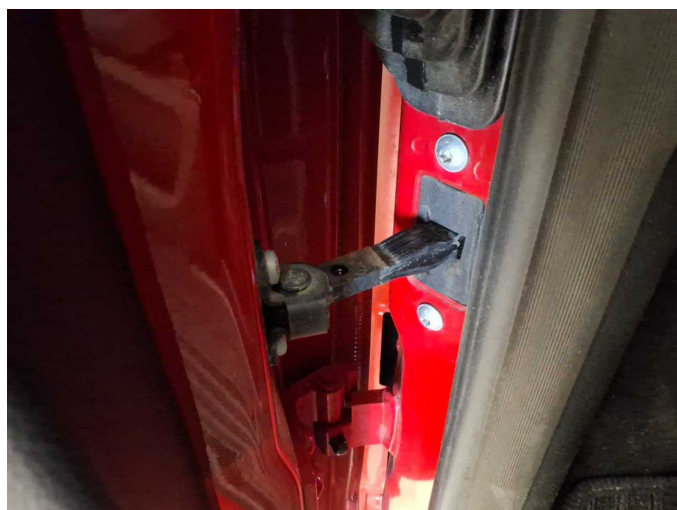

Damage 9: Door - front left side: Door check strap / arrestor - Noise - Replace



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value

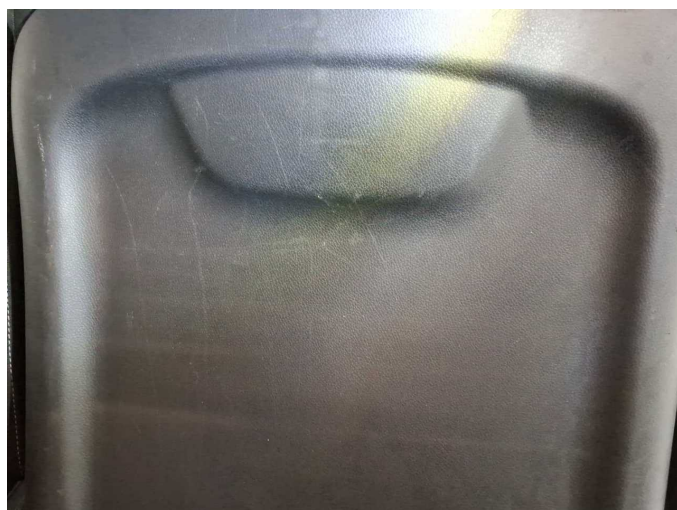

Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value

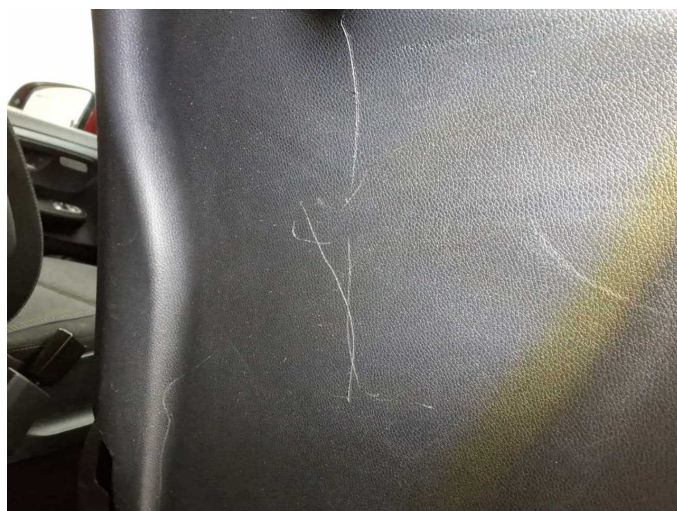

Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value

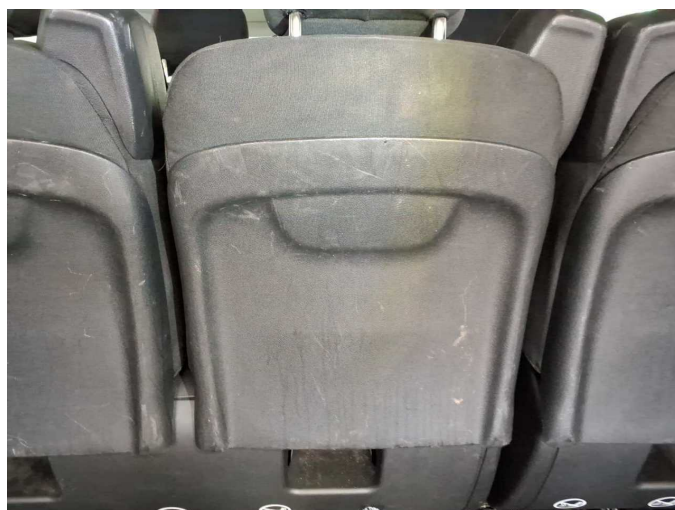

Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value

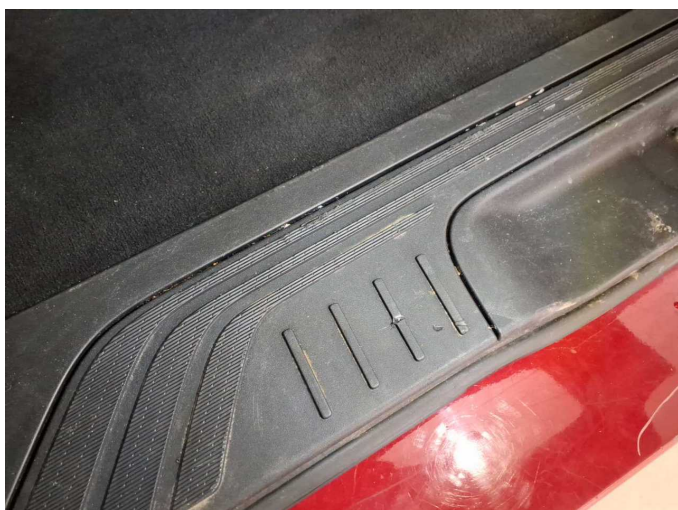

Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value



Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value




Damage 10: Trim / covers: Trim / covers (Innenraum) - Scratched - Loss in value

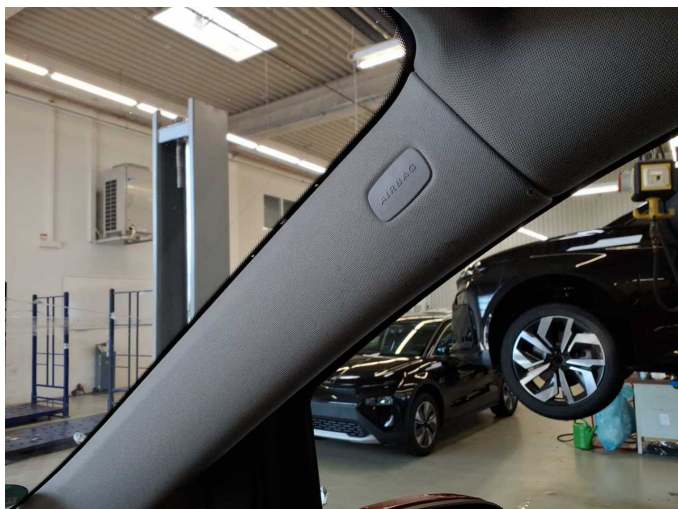

Damage 11: Trim / covers: A-pillar - interior trim - right side - Damaged - Replace



Damage 11: Trim / covers: A-pillar - interior trim - right side - Damaged - Replace

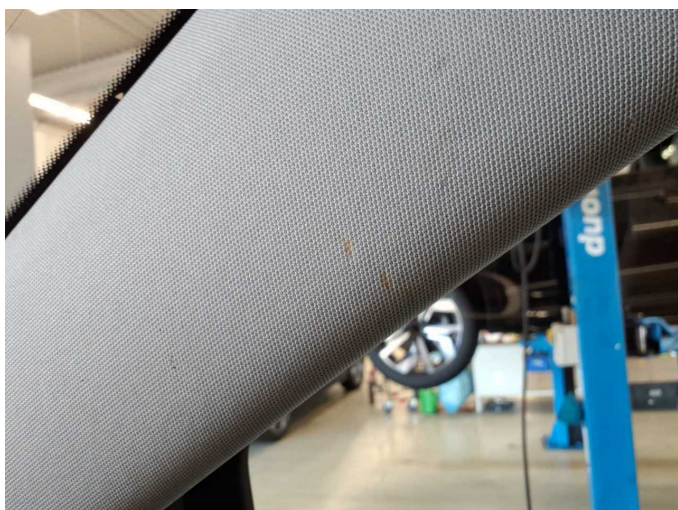


Damage 11: Trim / covers: A-pillar - interior trim - right side - Damaged - Replace



Damage 12: Engine: Engine cowling lower front - Broken / torn - Replace




Damage 12: Engine: Engine cowling lower front - Broken / torn - Replace

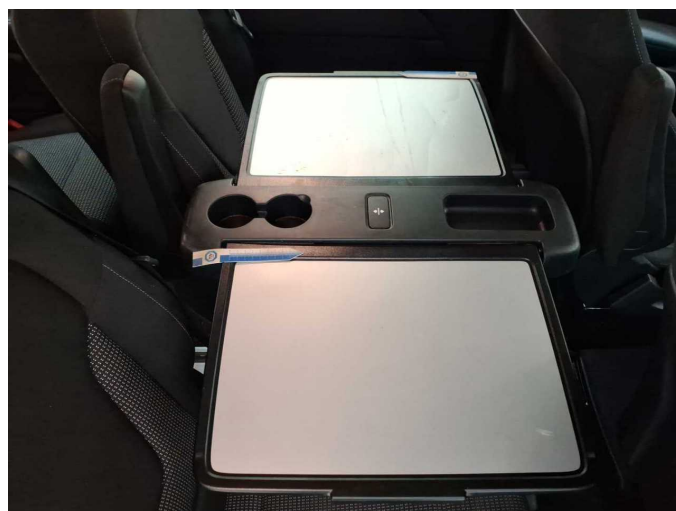

Damage 13: Equipment: tabletop (+ verschmutzt) - Scratched - Replace



Damage 13: Equipment: tabletop (+ verschmutzt) - Scratched - Replace

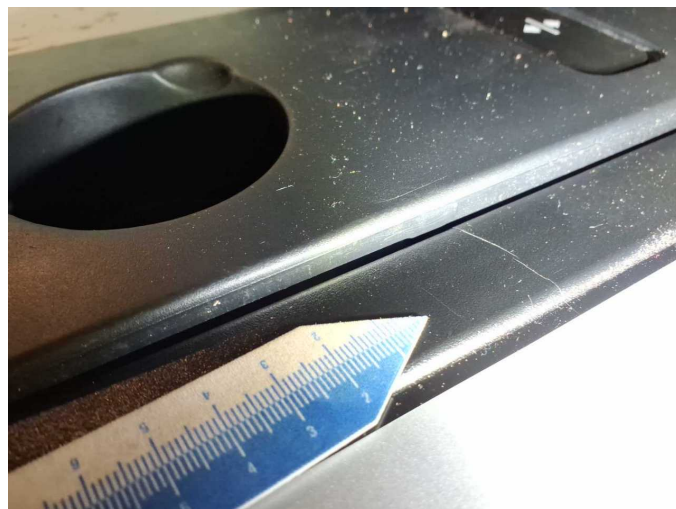

Damage 13: Equipment: tabletop (+ verschmutzt) - Scratched - Replace




Damage 13: Equipment: tabletop (+ verschmutzt) - Scratched - Replace



Damage 13: Equipment: tabletop (+ verschmutzt) - Scratched - Replace



Damage 14: Cab: Insulation lining (+ Motorhaube) - Damage caused by marten / rodent - Replace

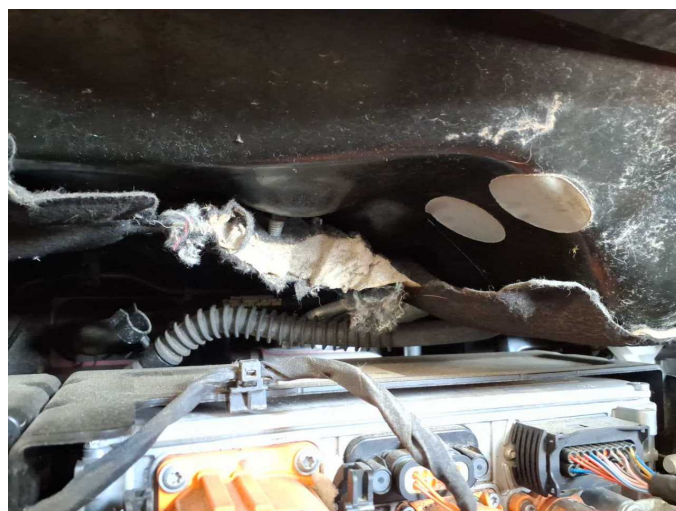

Damage 14: Cab: Insulation lining (+ Motorhaube) - Damage caused by marten / rodent - Replace



Damage 14: Cab: Insulation lining (+ Motorhaube) - Damage caused by marten / rodent - Replace




Damage 14: Cab: Insulation lining (+ Motorhaube) - Damage caused by marten / rodent - Replace




Damage 15: Seat - front: Seat cover - right side (+ verschmutzt) - Damaged - Replace




Damage 15: Seat - front: Seat cover - right side (+ verschmutzt) - Damaged - Replace

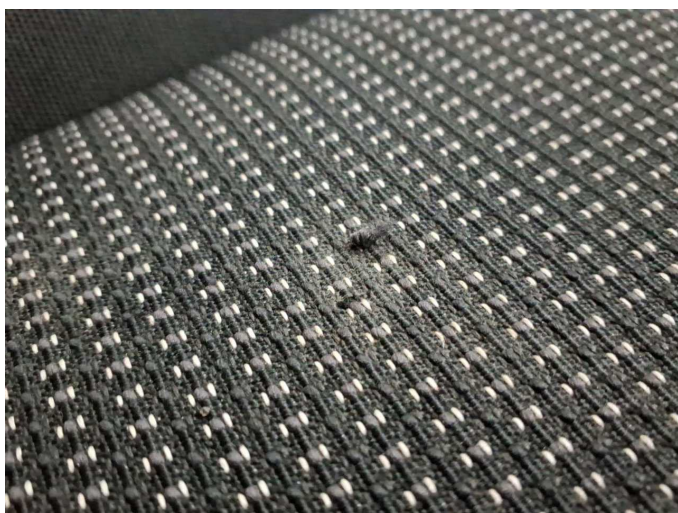


Damage 15: Seat - front: Seat cover - right side (+ verschmutzt) - Damaged - Replace

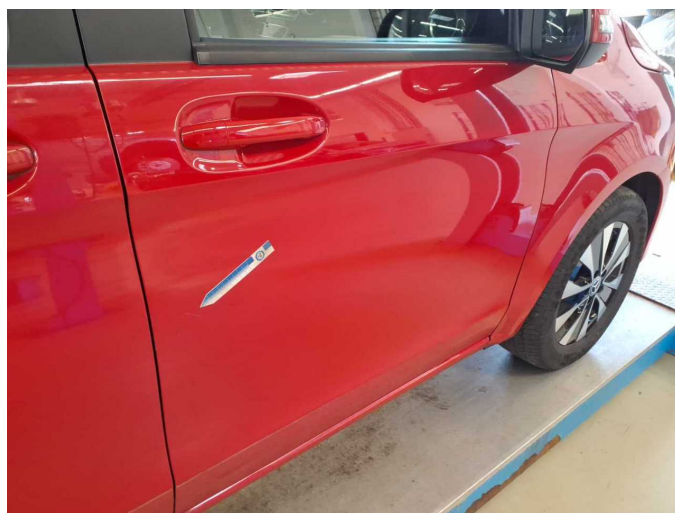

Damage 16: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

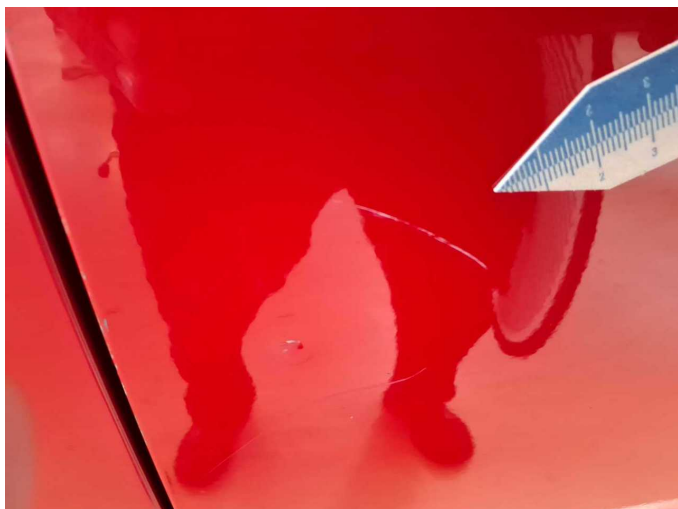


Damage 16: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

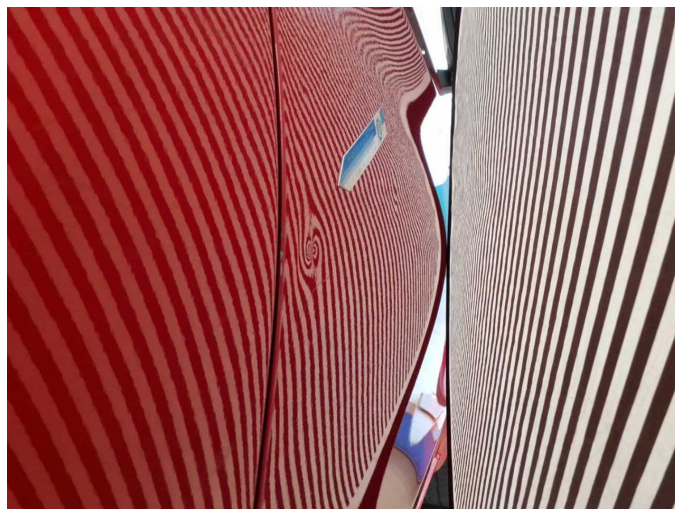


Damage 16: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 16: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

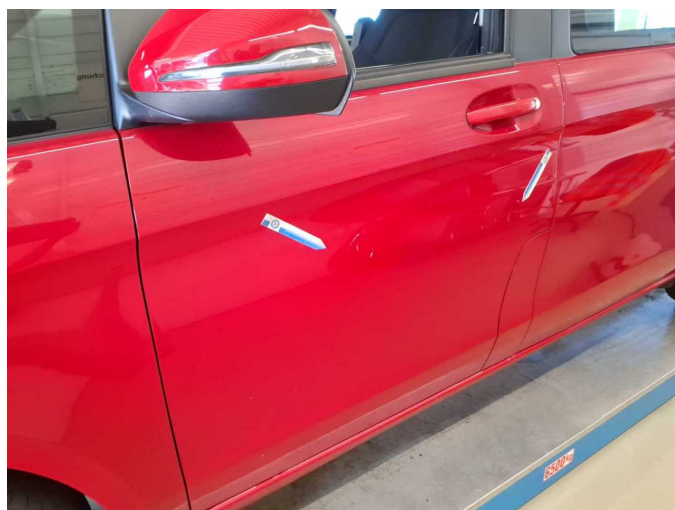


Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint

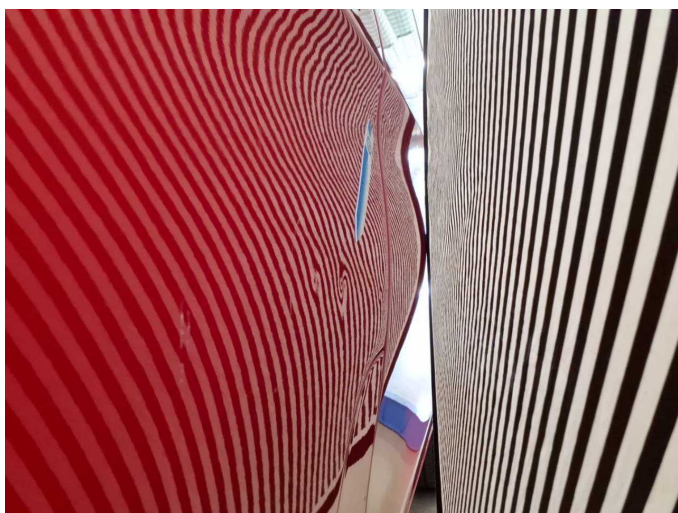


Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint

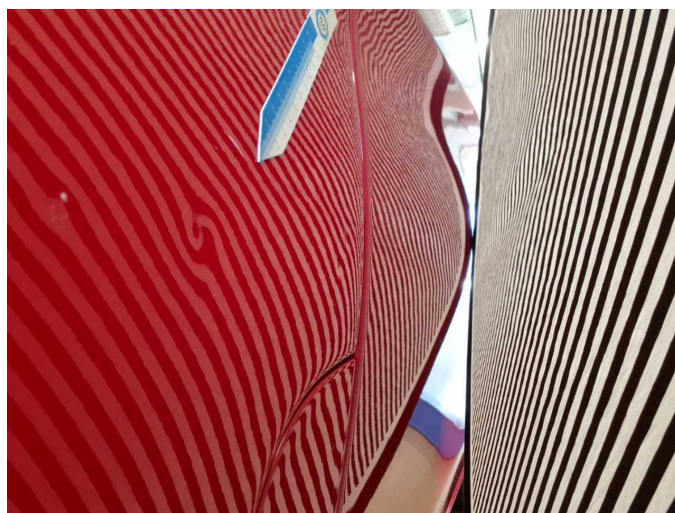


Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint

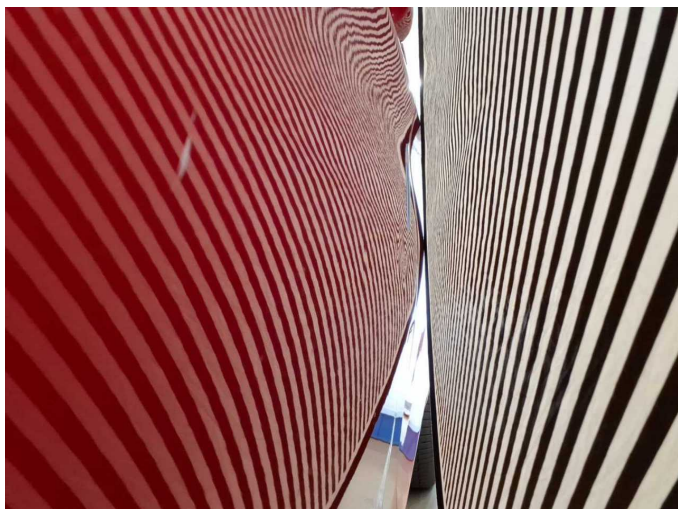

Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint

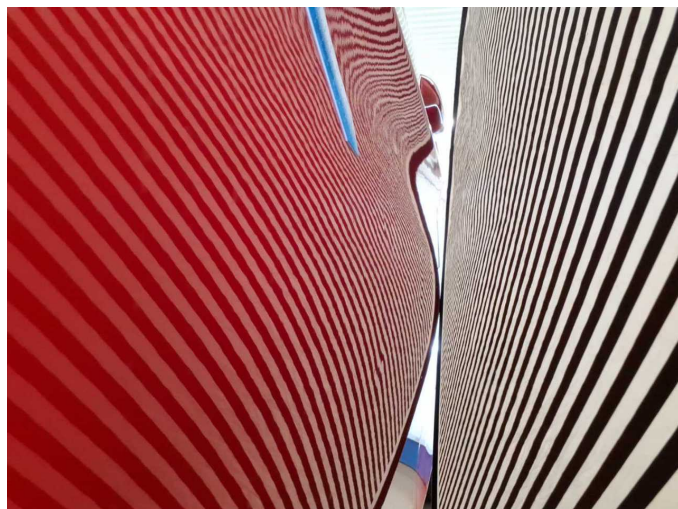

Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint

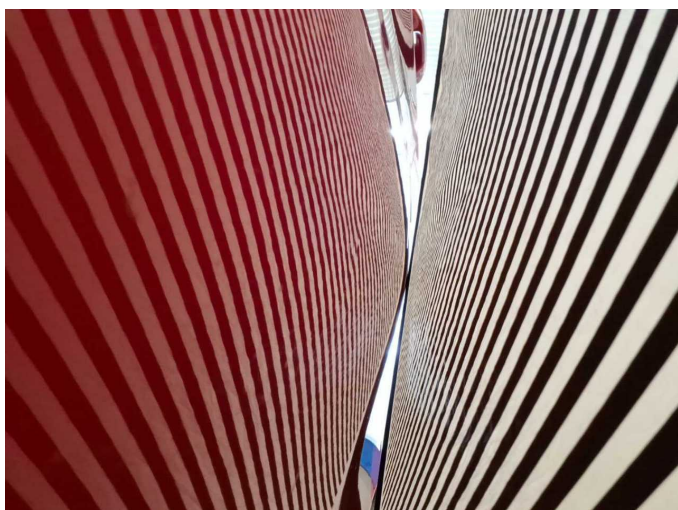

Damage 17: Door - front left side: Door (wellig + Folgeschaden) - Unprofessionally repaired - Repair and paint



Damage 18: Front bumper: Bumper with Parktronic - Scratch(es) - Paint



Damage 18: Front bumper: Bumper with Parktronic - Scratch(es) - Paint



Damage 18: Front bumper: Bumper with Parktronic - Scratch(es) - Paint



Damage 19: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 19: Rear bumper: Bumper with Parktronic - Scratched - Paint




Damage 19: Rear bumper: Bumper with Parktronic - Scratched - Paint



Damage 19: Rear bumper: Bumper with Parktronic - Scratched - Paint

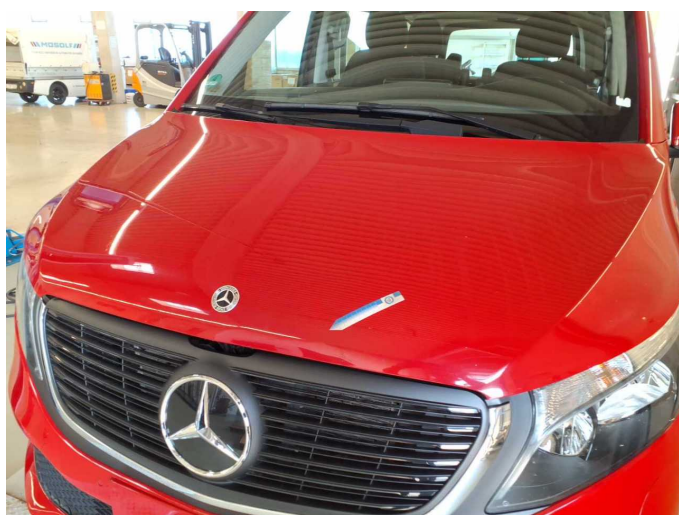

Damage 20: Bonnet: Bonnet - Deformed - Repair and paint

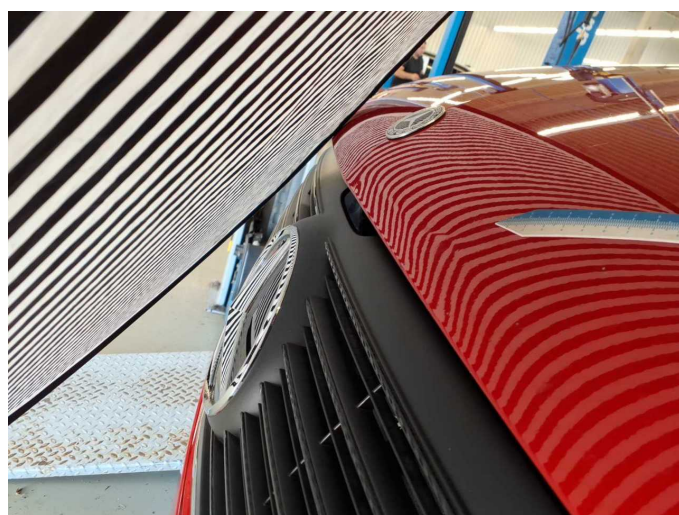


Damage 20: Bonnet: Bonnet - Deformed - Repair and paint




Damage 21: Sliding door, right: Sliding door with glass panel - dent(s) - Repair and paint



Damage 21: Sliding door, right: Sliding door with glass panel - dent(s) - Repair and paint

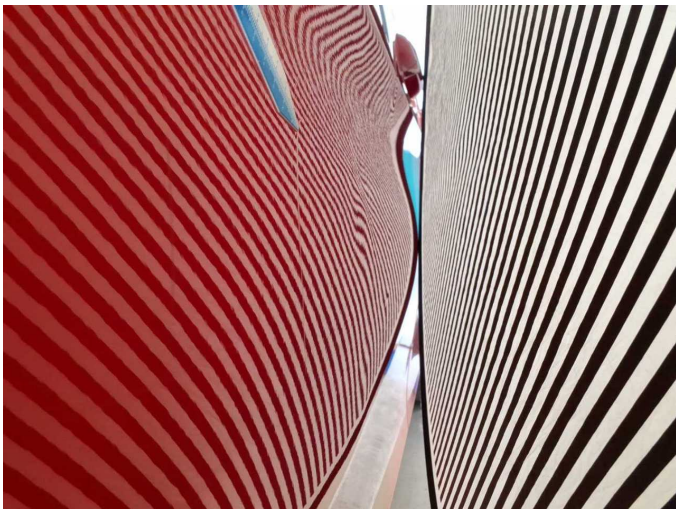


Damage 21: Sliding door, right: Sliding door with glass panel - dent(s) - Repair and paint

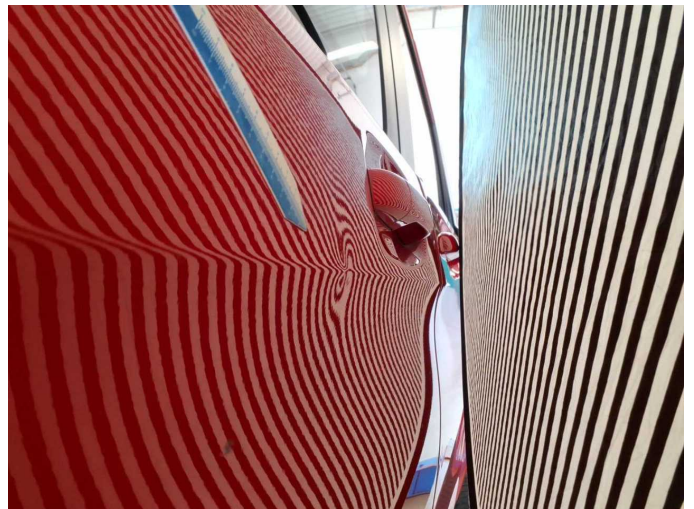


Damage 21: Sliding door, right: Sliding door with glass panel - dent(s) - Repair and paint




Damage 22: Side panel - rear left side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

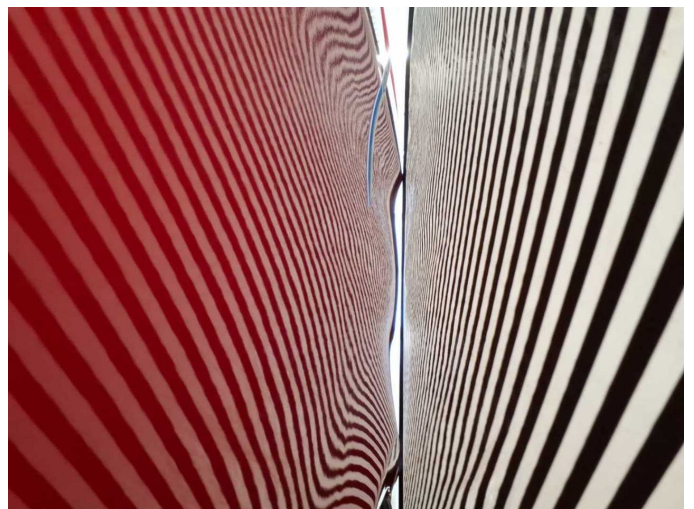


Damage 22: Side panel - rear left side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

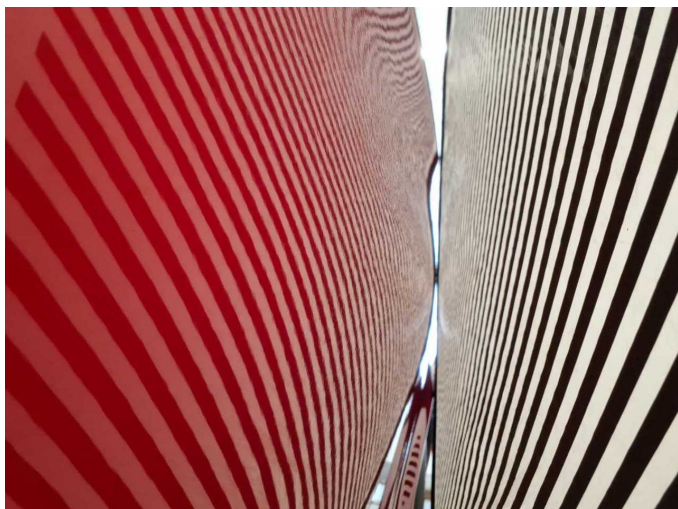

Damage 22: Side panel - rear left side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

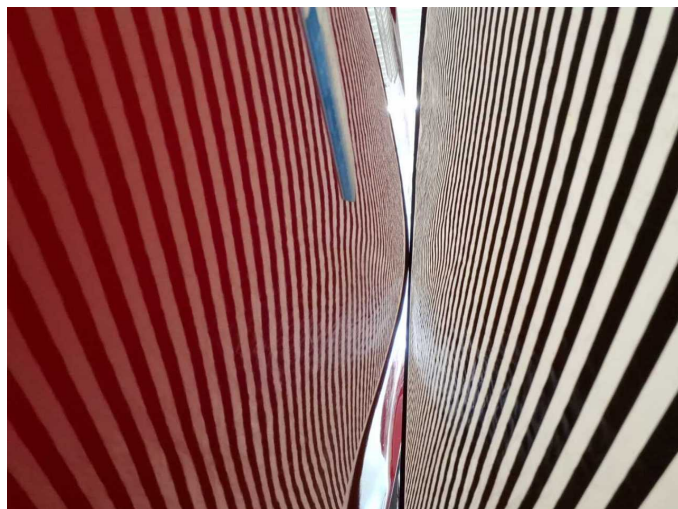


Damage 22: Side panel - rear left side: Side panel (wellig) - Unprofessionally repaired - Repair and paint

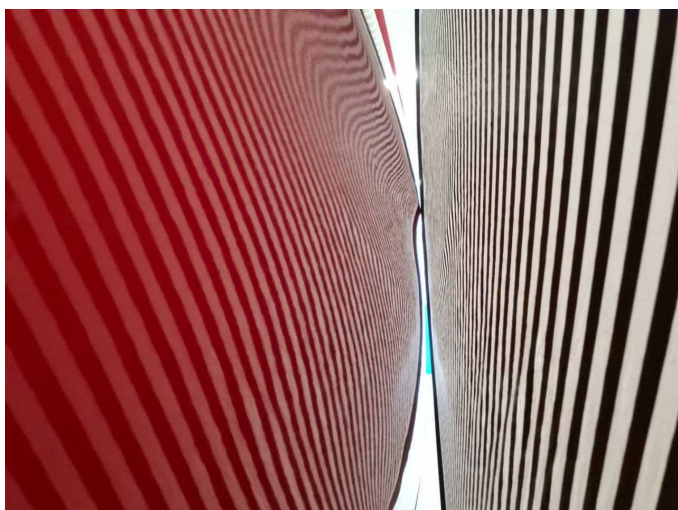


Damage 22: Side panel - rear left side: Side panel (wellig) - Unprofessionally repaired - Repair and paint



Wear and tear 3: Boot lid / rear door: Boot lid glazed - dent(s) - No deduction

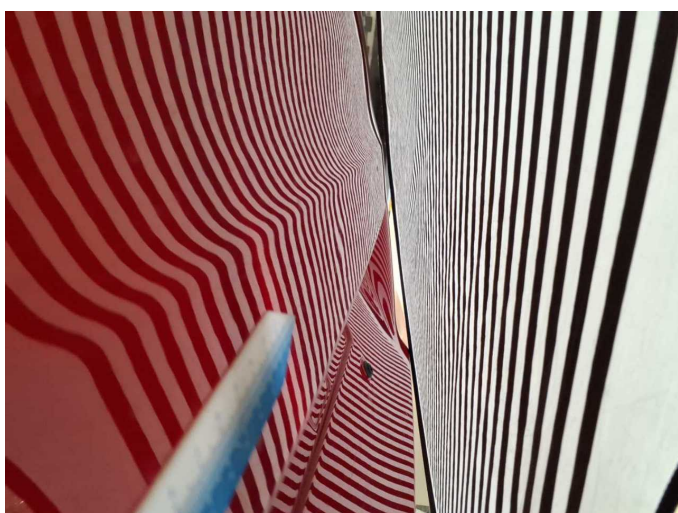

Wear and tear 3: Boot lid / rear door: Boot lid glazed - dent(s) - No deduction

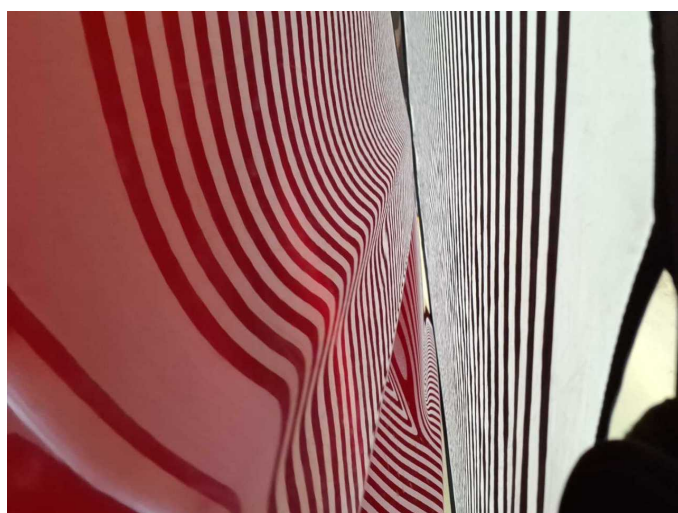

Wear and tear 3: Boot lid / rear door: Boot lid glazed - dent(s) - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid glazed - dent(s) - No deduction



Side panel - rear left side: 1,290 µm



Door - front left side: 284 µm