



Expertise

Protocol number: 46373716
Order No. / Reference: 26300764
Inspection date: 6 Jul 2026

Manufacturer: Ford

Model: Transit Connect 230 L2 Trend

VIN: WF0SXXWPGSNL57045



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Connect 230 L2 Trend	
Vehicle Identification number	WF0SXXWPGSNL57045
Mileage (Read)	100,319 km
First registration	13 Apr 2022
Number of holders	1
Next periodical technical inspection	02/2027
(Report on hand)	
Power / Engine displacement	73 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Agate Black Metallic
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	83 %
Last service on / at	03/2026 at 95,485 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH420051
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUU 00725		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, electrically adjustable and heated
- Battery, reinforced
- Rubberized flooring, front
- Front overhead storage compartment,
- Double-leaf rear doors without windows
- Third brake light
- Front electric windows
- FordPass Connect
- Glove compartment with lid
- Front air conditioning including semi-electronic recirculation system
- Cargo area lining, side, half-height
- Alternator/Generator
- Fog light
- Radio: Ford Audio System 2
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering
- Seat belts
- Seats: Seat package 4
- Front spoiler lip
- Dust and pollen filter
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Driver's side airbag
- Exterior mirrors, narrow mirror format
- Hill start assist
- On-board computer including outside temperature display
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Ford Easy Fuel
- Transmission: 6-speed transmission
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area floor protection plastic, molded
- Steering column, adjustable in height and reach
- Center console, front
- Emergency brake light
- Wheels: Tire repair kit
- Sliding door at rear, right
- Side protection strips, plastic
- Safety brake assist
- Automatic door locking mechanism (45 sec.)
- Sun visor for driver and front passenger
- Start-stop system
- Power outlet: 12-volt connection on the front center console
- Daytime running light
- Partition wall to the cargo area without window
- Door handles, black
- Electronic immobilizer (EPATS)
- Central locking with remote control

Extra equipment

- Exterior mirrors with large mirror format
- Cruise control system (with adjustable speed limiter including multifunction leather steering wheel with 4 spokes in aluminium decor)
- Tire pressure monitoring system
- Seats: Seat package 30 (fabric "Capitol/City" in Ebony (black) - double passenger seat, variably foldable and collapsible (with storage compartment under smaller seat section) - driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - headrests, height-adjustable - seat heating for driver's seat - lumbar support, manual (driver's seat))
- Sortimo conversion
- Power outlet: 12-volt connection in the charging/luggage compartment
- Auxiliary electric heater (PTC), front
- Vehicle security: MyKey key system (individually programmable second key)
- Paint finish: Metallic
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, Apple CarPlay, Android Auto, live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Partition wall to the cargo area with pass-through opening, no window



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratched - Smart repair
2	Body	Body - Damage by hail - repair according to calculation

Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance (30 000 er) - Missing - No deduction
2	Front bumper	Front bumper - dent(s) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Equipment - Vehicle key

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen im demontagefreien Zustand erstellt. Es können Mehrkosten und somit Abweichung der für den Hagelschaden ausgewiesener Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

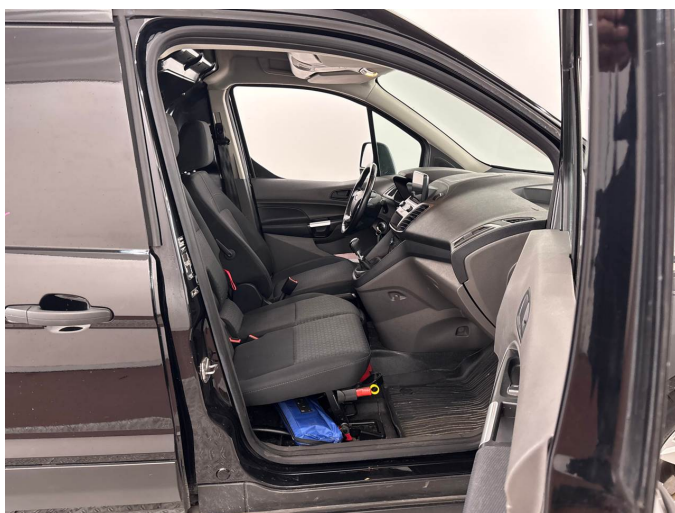


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

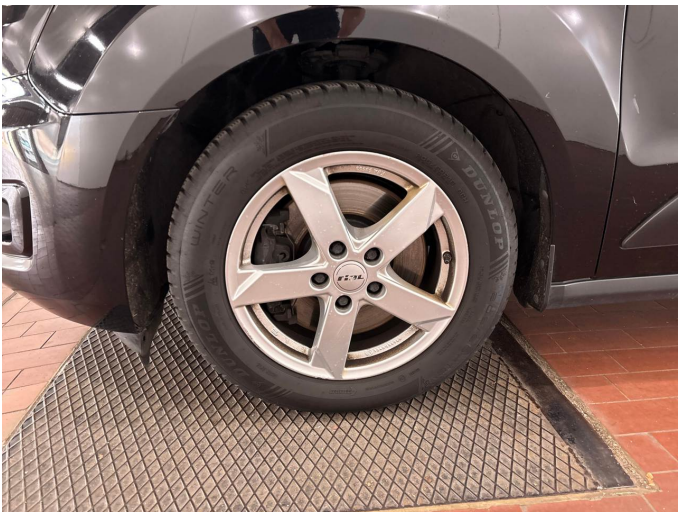


Figure 12: Mounted tyres

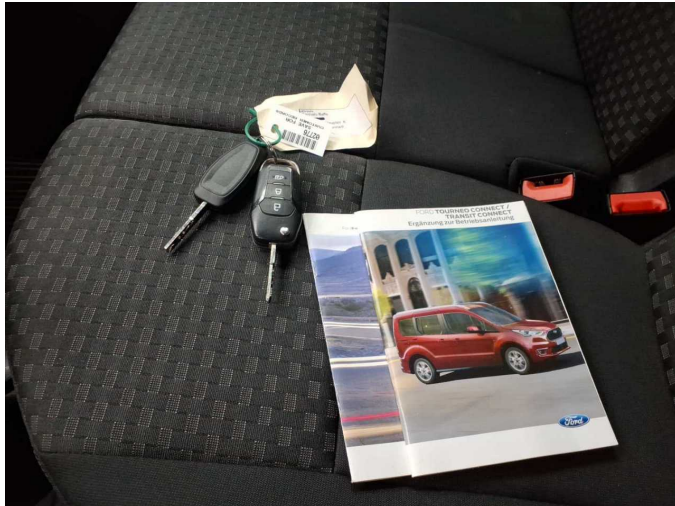


Figure 13: Documents

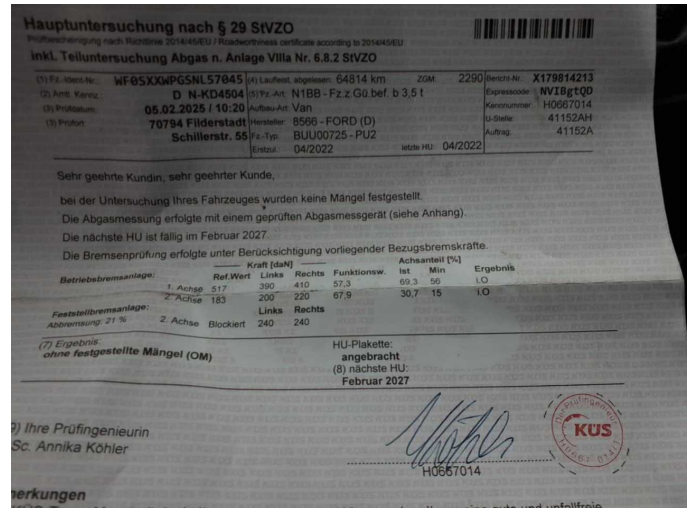


Figure 14: Documents

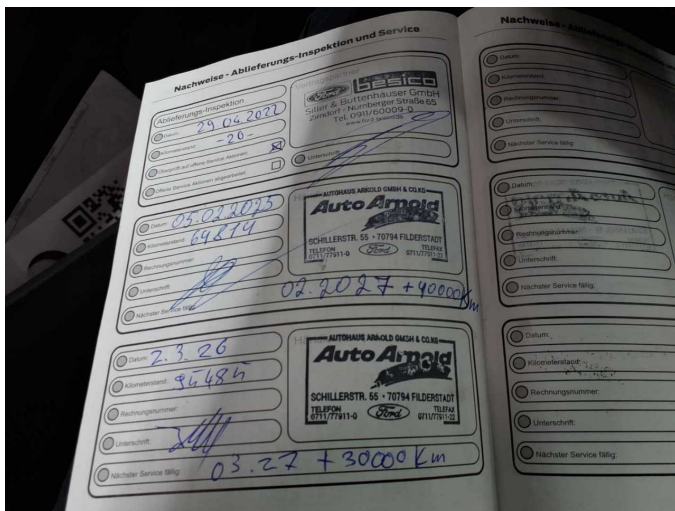


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

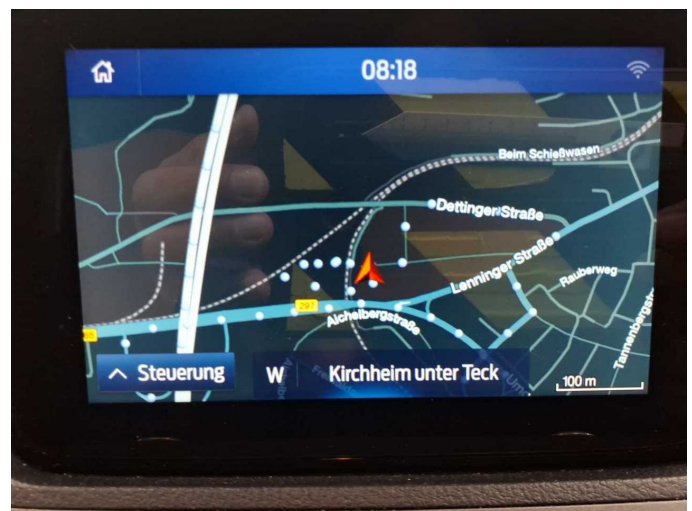


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

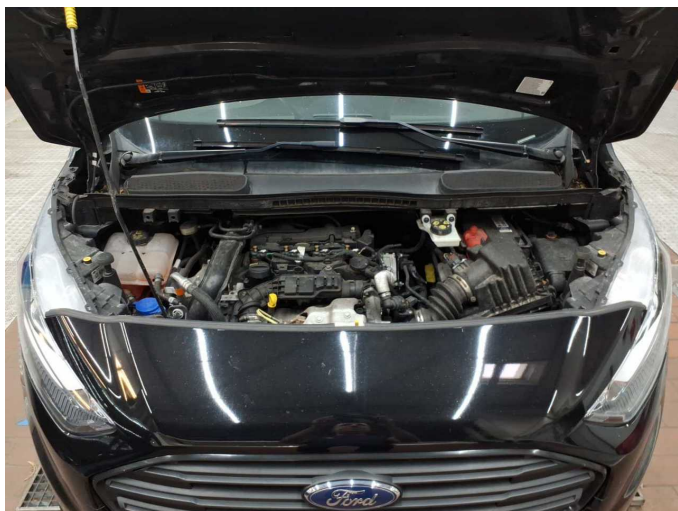


Figure 25: Misc.

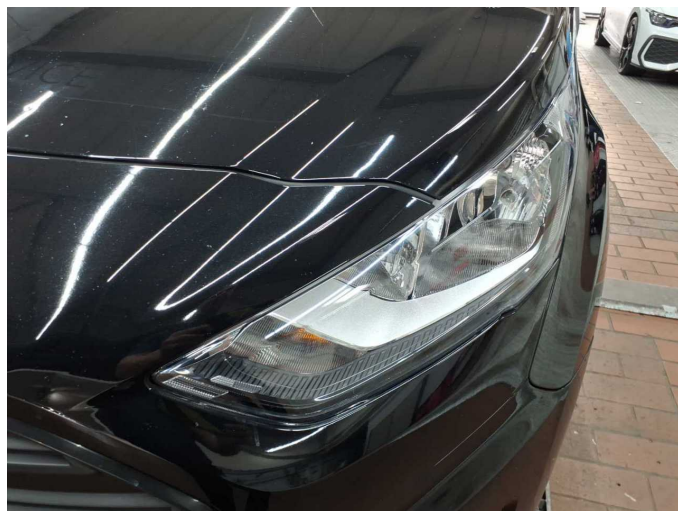


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Front bumper: Front bumper - Scratched - Smart repair



Damage 1: Front bumper: Front bumper - Scratched - Smart repair



Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation




Damage 2: Body: Body - Damage by hail - repair according to calculation




Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation

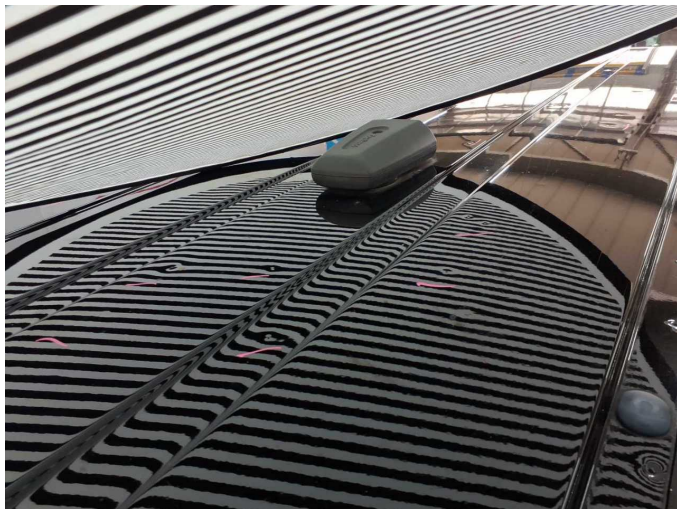

Damage 2: Body: Body - Damage by hail - repair according to calculation

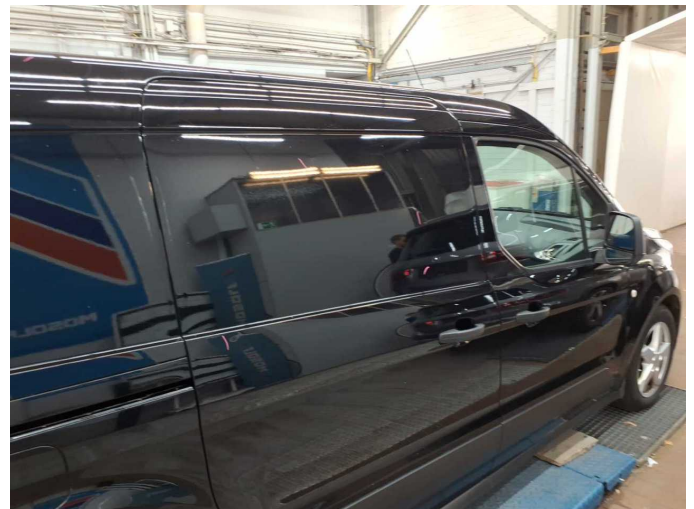

Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation




Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation

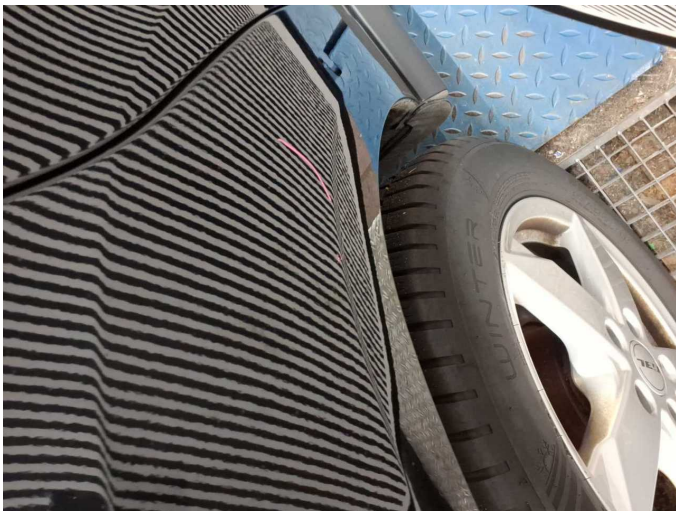


Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation

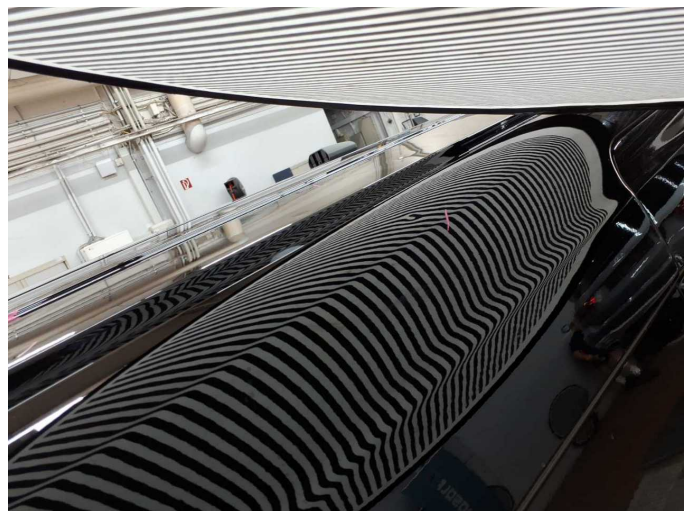

Damage 2: Body: Body - Damage by hail - repair according to calculation



Damage 2: Body: Body - Damage by hail - repair according to calculation

Damage 2: Body: Body - Damage by hail - repair according to calculation