



Expertise

Protocol number: 46569326
Order No. / Reference: 26723462
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Caddy Cargo 2.0 TDI BMT DSG Maxi

VIN: WV1ZZZSK0RX054537



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy Cargo 2.0 TDI BMT DSG Maxi	
Vehicle Identification number	WV1ZZZSK0RX054537
Mileage (Read)	159,738 km
First registration	19 Feb 2024
Number of holders	1
Next periodical technical inspection	02/2027
(Report not on hand)	
Power / Engine displacement	90 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	4 / 2
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	500 km
Last service on / at	12/2025 at 130,150 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HA887688
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / CME 00894		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	All-season tyres on Light alloy	Falken	3mm / 4mm
2)	215/55 R17 98V	All-season tyres on Light alloy	Falken	6mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments: Glove compartment open
- Airbag, side and head airbags for driver and front passenger
- Exterior mirror housings and door handles in black, sliding door track in silver
- Floor coverings: Carpet in the driver's cab
- third brake light
- Roof rail/roof rack preparation
- Three-point automatic seat belts (with front belt height adjustment and electric belt tensioners)
- Deletion: Without rear window (sheet metal)
- ESP Electronic Stability Program with Brake Assist (incl. Anti-lock Braking System (ABS), Traction Control (ASR), (EDS and MSR))
- Electric windows, front
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Heating and ventilation system in the driver's cab
- Interior lighting in the cargo area (1 light)
- Fuel fill quantity, standard fuel initial fill
- Diesel fuel system
- Headlight range control
- Air vents, front, in matte black
- Multifunction display "Plus"
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- eCall emergency call system
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Radio "Composition Audio" with 20.96 cm (8.25 inch) touch color display (2 USB interfaces (Type C) in the center console, front - 4 speakers - mobile phone interface)
- Wheels, tires: Wheel covers
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tires: Steel wheels 6.5J x 16, in black
- Gearshift DSG (with shift-by-wire technology)
- Sliding door, on the right in the passenger/cargo area
- Standard side panels in the cargo area
- Speed-sensitive power steering (Servotronic)
- Seats: Height adjustment for left seat, manual
- Sun visors without mirrors, with ticket pocket on the driver's side, plus airbag label on the sun visor
- Start-stop system (with brake energy recuperation)
- Telephone: Mobile phone interface
- Partition wall (tall) without window
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking with remote control and interior operation
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Exterior mirrors: electrically adjustable
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- Cockpit panel, matte
- Three-phase generator 140 A
- Rear parking assist
- Electronic parking brake including auto-hold function
- Omission: Without additional child seat anchorage
- Automatic headlight control with daytime running lights
- Windows: Laminated glass front pane in heat-insulating glazing
- Cruise control system including speed limiter
- Halogen dual headlights-H7
- Rear wing door (asymmetrically divided) without window cutout
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Center console with 2 universal cup holders
- Multifunctional camera
- Multimedia systems: 2 USB ports (Type C) in the center console, front
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Upholstery: Fabric, "Double Grid" design
- "Composition Audio" radio with 20.96 cm (8.25 inch) color touchscreen
- Radio accessories: 4 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels/Tires: 205/60 R 16 96 H XL, optimized for low rolling resistance
- taillights
- Windscreen wiper intermittent control with light sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- dimmable interior safety mirror
- Seats: Left and right seats in the 1st row (including headrests)
- Lane keeping assistant "Lane Assist"
- Bumper in grey
- Tire Mobility Set (12-volt compressor and tire sealant)
- Door trim and armrest in plastic
- Lashing points: 6 lashing points for securing cargo
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Additional dust protection seal on the outside



Extra equipment

- Storage compartments: Glove compartment with lockable, illuminated flap
- Floor coverings: Loading area covering made of wood (anthracite): multi-layered glued plywood (10 mm thick, non-slip)
- Windows: Front side windows in heat-insulating glass (rear side windows and rear window tinted, 74% light-absorbing)
- LED headlights with LED daytime running lights
- Navigation system "Discover Media" (25.4 cm (10 inch) touch color display - streaming & internet - 2 USB interfaces (Type C) in the center console, front - glove compartment with lockable, illuminated flap - 4 speakers - mobile phone interface)
- Package: Cool & Sound (Refrigerant R1234yf - Safety interior mirror, automatically dimming - Air Care Climatronic air conditioning with 2-zone temperature control and air purification function)
- Package: Winter package "Basic" (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Upholstery: Seat covers in synthetic leather, design "Pure Diamond"
- Radio: App-Connect incl. App-Connect Wireless (for Apple CarPlay and Android Auto)
- Wheels/Tires: "Colombo" 6.5 J x 17 alloy wheels, gloss black (tires 215/55 R 17 98 H XL, optimized for rolling resistance - covers for alloy wheels)
- Seats: Armrest for left front seat
- Partition wall (high) with windows and grilles
- Exterior mirror housings in black, door handles in body color and sliding door rail in silver
- Deletion: Lettering on the rear (excluding lettering for type/model designation - excluding promotional lettering and decals)
- Fire extinguisher (contents 1kg)
- Floor mats: Textile floor mats, front
- Paint finish: Pearl effect
- LED taillights
- Package: Assistance package (electrically adjustable, heated and folding exterior mirrors - Digital Cockpit, multicolor, various information profiles selectable - Parking aid in front and rear area - Rear View reversing camera - Central locking with keyless start system "Keyless Start" without safe locking)
- Package: Window package (Caddy Cargo with rear wing doors) (Rear wing doors with asymmetrically divided window cutouts - Fixed side window in the load/passenger compartment, front left - Fixed side window in the load/passenger compartment, front right - Fixed side window in the load/passenger compartment, rear left - Heated rear window - Fixed side window in the load/passenger compartment, rear right - Rear window wiper/washer system with intermittent function)
- Wheels/Tires: All-season tires 215/55 R 17 98 H XL, optimized for low rolling resistance
- Sliding door, left side in the passenger/cargo area
- Seats: AGR ergoComfort seats, left (front seats height-adjustable and seat surface tilt and depth adjustment - 4-way lumbar support, electrically adjustable, left)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear door glazed - right side (Lässt sich nicht bewegen) - Malposition - Diagnosed and repair if necessary
2	Instrument panel	Indicator light (RDKS) - on - Diagnosed and repair if necessary
3	Boot lid / rear door	Trim rear door - plywood - lower - Broken / torn - Replace
4	Wing mirror - right side	Cap - Scratched - Replace
5	Vehicle glazing	Windscreen - Stone chips - Smart repair
6	Wheel / tyres	Tyre - front (Unter 4mm) - Does not meet the leasing specifications - Replace



Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Scratch(es) - No deduction
2	Door - front right side	Door - Scratch(es) - No deduction
3	Boot lid / rear door	Rear door - left side - Scratch(es) - No deduction
4	Boot lid / rear door	Rear door - right side - Dent / paintcoat damage - No deduction
5	Bonnet	Bonnet - Stone chips - No deduction
6	Vehicle glazing	Windscreen - Stone chips - No deduction
7	Sliding door - left side	Sliding door with glass panel - dent(s) - No deduction
8	Body	Body - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Fire extinguisher

Equipment - Tirefit compressor

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 21 Jun 2024	2.792,06 €
2	Front, Side - left, Provided by user / customer, from 27 Mar 2026	5.490,66 €

Repainting

No. Repainting

1 Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - front left side 224 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

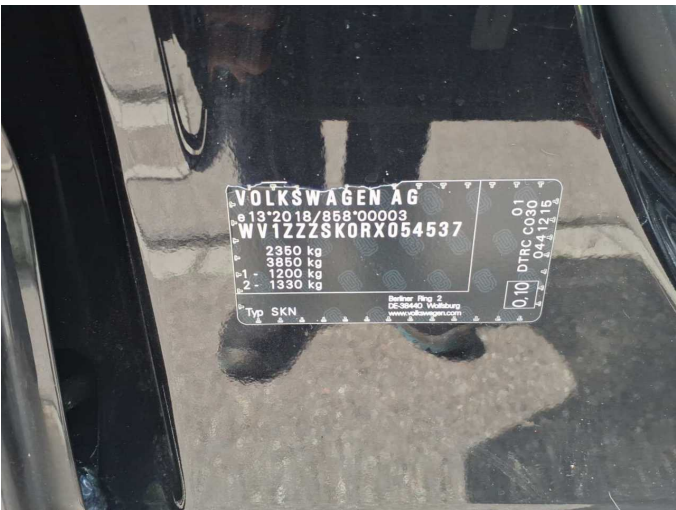


Figure 11: VIN



Figure 12: Mounted tyres

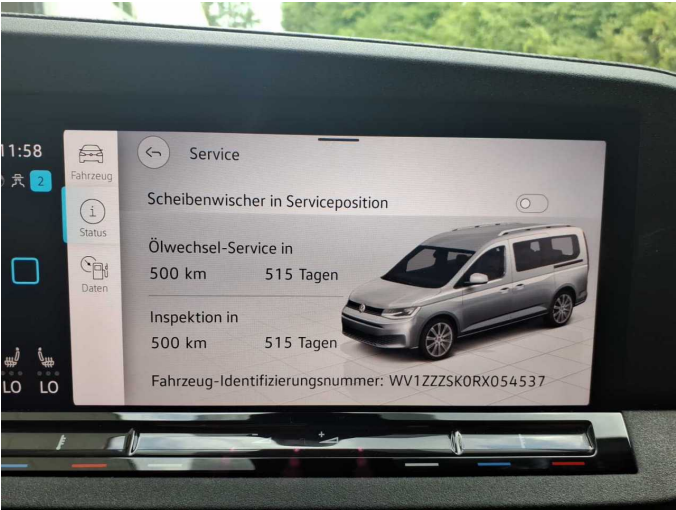


Figure 13: Documents



Figure 14: Documents

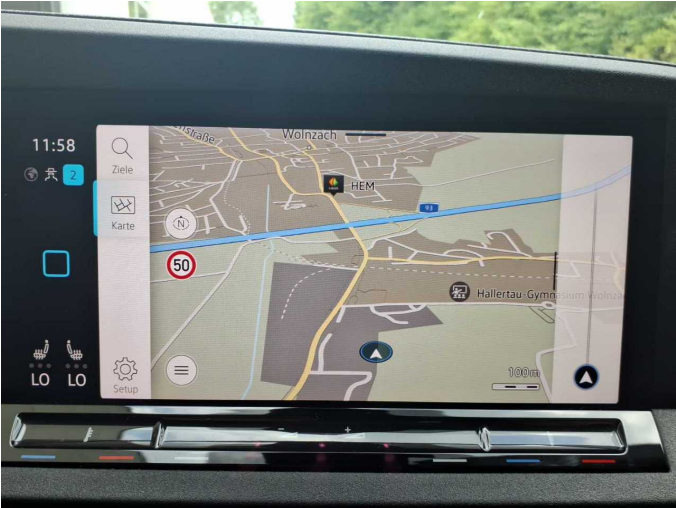


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

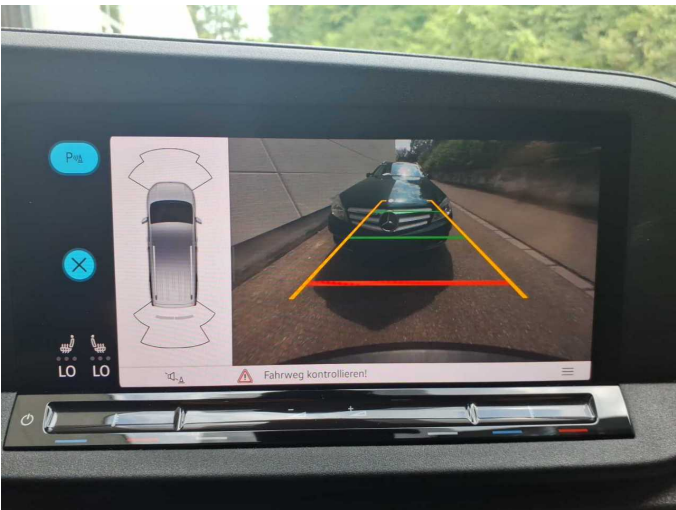


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.

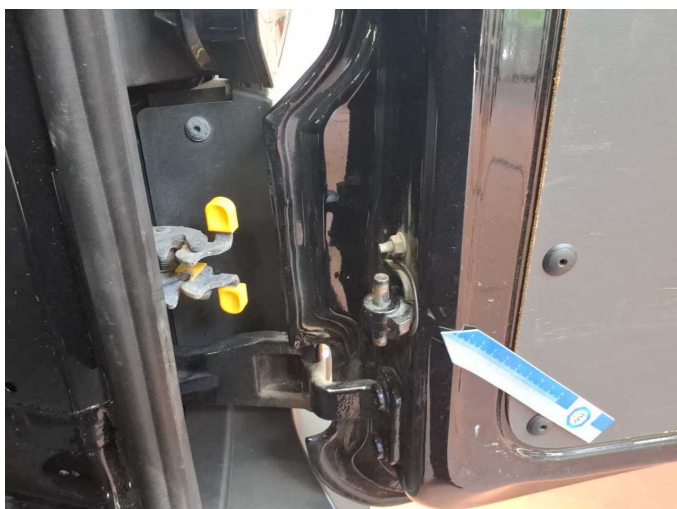

Damage 1: Boot lid / rear door: Rear door glazed - right side (Lässt sich nicht bewegen) - Malposition - Diagnosed and repair if necessary



Damage 2: Instrument panel: Indicator light (RDKS) - on - Diagnosed and repair if necessary

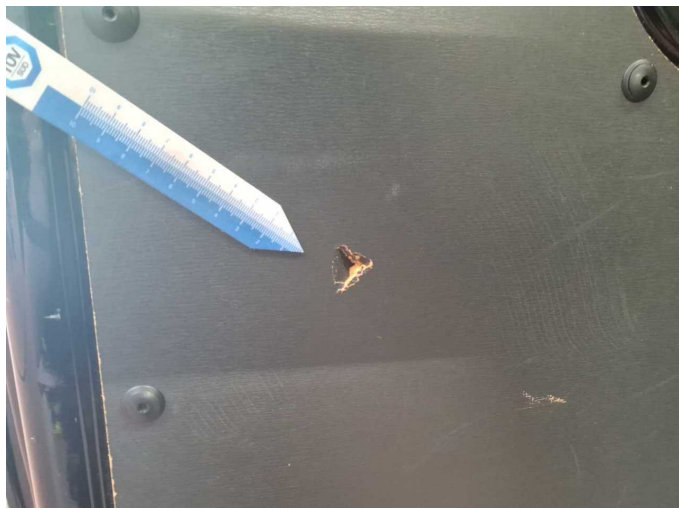


Damage 3: Boot lid / rear door: Trim rear door - plywood - lower - Broken / torn - Replace



Damage 3: Boot lid / rear door: Trim rear door - plywood - lower - Broken / torn - Replace




Damage 4: Wing mirror - right side: Cap - Scratched - Replace

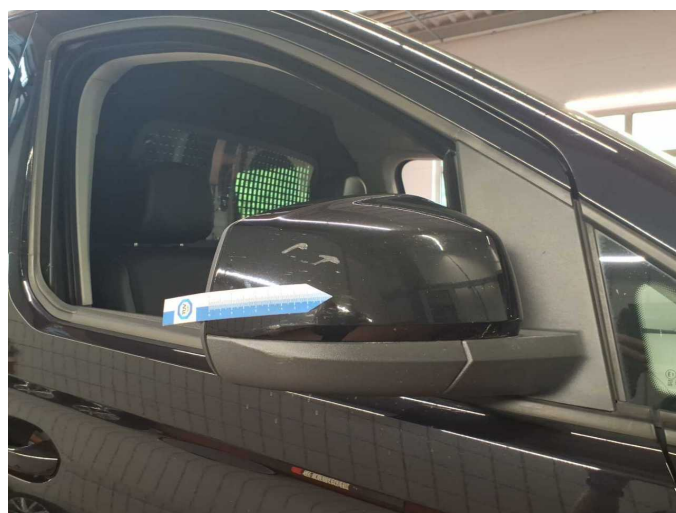

Damage 4: Wing mirror - right side: Cap - Scratched - Replace



Damage 4: Wing mirror - right side: Cap - Scratched - Replace

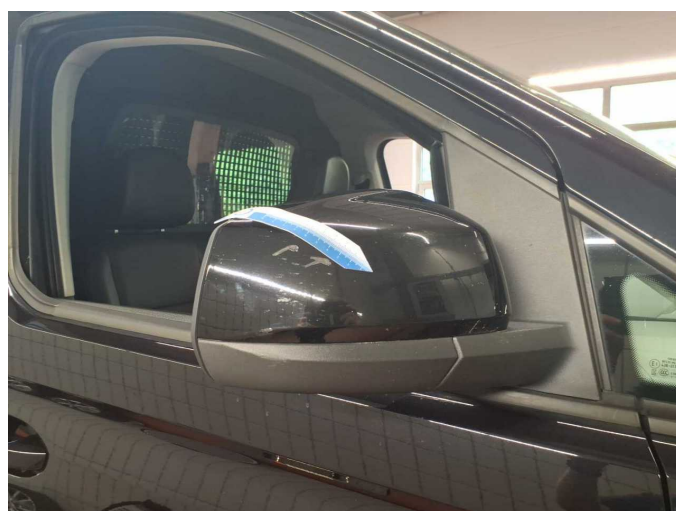

Damage 4: Wing mirror - right side: Cap - Scratched - Replace



Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 6: Wheel / tyres: Tyre - front (Unter 4mm) - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - front (Unter 4mm) - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - front (Unter 4mm) - Does not meet the leasing specifications - Replace

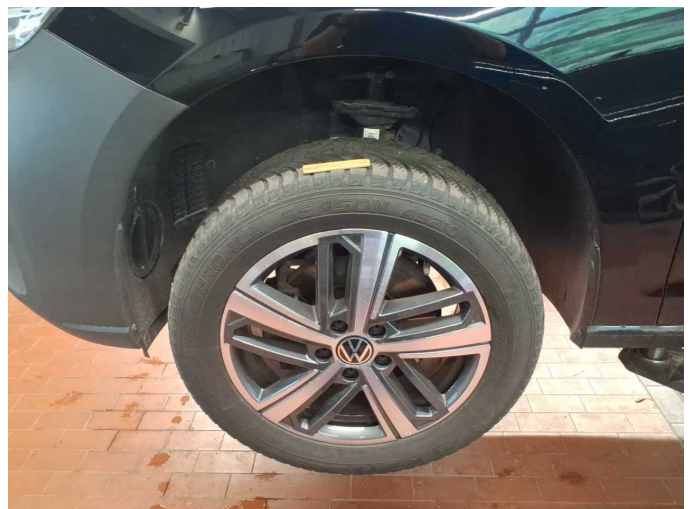

Damage 6: Wheel / tyres: Tyre - front (Unter 4mm) - Does not meet the leasing specifications - Replace



Wear and tear 1: Mudguard - right side: Mudguard - right side - Scratch(es) - No deduction



Wear and tear 3: Boot lid / rear door: Rear door - left side - Scratch(es) - No deduction



Wear and tear 4: Boot lid / rear door: Rear door - right side - Dent / paintcoat damage - No deduction



Repainting 1: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZSK0RX054537

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy Cargo 2.0 TDI BMT DSG
Maxi

Datum	KM-Stand	Beschreibung
15.12.2025	130.150	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.08.2025	97.888	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
06.02.2025	64.568	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.07.2024	30.364	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges