



Expertise

Protocol number: 46396744
Order No. / Reference: 26562525
Inspection date: 1 Jul 2026

Manufacturer: Ford

Model: Transit Connect Kombi 230 L2 S&S Trend

VIN: WF07XXWPG7LD25169



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect Kombi 230 L2 S&S Trend

Vehicle Identification number	WF07XXWPG7LD25169
Mileage (Read)	98,312 km
First registration	7 Oct 2021
Number of holders	1
Next periodical technical inspection	10/2027
(Report not on hand)	

Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frost-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	31 %
Last service on / at	01/2026 at 90,662 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FV090550
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BMN 01503		
Emission standard	EURO6;WLTP;CI;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	2,300 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Steel rim with wheel cover	Continental	7mm / 7mm
2)	205/60 R16 96V	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Continental	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel	Continental	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS with EBD
- Airbag package (front airbag for passenger, including deactivation function and glove compartment with lid - head and shoulder airbags in front and for outer rear seats - side airbags for driver and passenger)
- Hill start assist
- On-board computer including outside temperature display
- Tachometer
- Third brake light
- Fixed rear windows, right and left (at the height of the 3rd row of seats)
- Rear electric windows, right and left (at the height of the 2nd row of seats)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- FordPass Connect (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - incl. live traffic information in real time (in conjunction with Ford navigation system incl. Ford SYNC 3) - incl. Wi-Fi hotspot)
- Cruise control system with intelligent speed limiter (camera-based) (with intelligent speed limiter (camera-based) including traffic sign recognition system - multifunction leather steering wheel with 4 spokes in aluminum decor)
- Isofix mounting (on the outer seats of the 2nd row)
- Paint finish: Solid
- Steering column, adjustable in height and reach
- Center console, front (open with storage area, 2 cup holders)
- Package: Passenger car version package with rear swing door (folding front passenger seat, lane keeping assist, lane departure warning, driver drowsiness detection, cruise control, integrated speed limiter (camera-based), traffic sign recognition system, IPS: front and side airbags, front/rear head/shoulder airbags, seat belt tensioners and force limiters, safety pedals and steering column, 3-point seat belts at all seats, height-adjustable front seats, pre-collision assist, pedestrian/cyclist detection, tire pressure monitoring system (TPMS). Without partition and safety net).
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Passenger compartment seats: 2nd row (bench seat, 60:40 split, foldable, can be lowered into the footwell - ISOFIX mounting on the outer seats)
- Start-stop system
- Concealed storage compartment (in the floor of the 2nd row of seats)
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Lashing eyes
- Electronic immobilizer (EPATS)
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front
- Driver's side airbag
- Exterior mirrors, electrically adjustable and heated
- Exterior mirrors, narrow mirror format
- Exterior mirror housing black
- Battery (12 V / 71h) ((EFB, 12V 70 Ah, 700 CCA))
- Floor covering: Carpet (1st and 2nd row)
- Diesel particulate filter (DPF) (with SCR catalyst and AdBlue tank)
- Electronic Stability Program (ESP) (with Traction Control (TCS) including Torque Vectoring Control and Adaptive Load Control)
- Front electric windows (with one-touch down function for driver's side)
- Ford ECO-Coach (signals environmentally friendly driving style)
- Heated windscreen (including electrically adjustable and heated exterior mirrors)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Rubberized luggage compartment floor mat
- Transmission: 6-speed transmission
- Glove compartment with lid
- Heated rear windows
- Rear window wiper/washer system
- Front interior lighting with delay function
- Front air conditioning including semi-electronic recirculation system
- Alternator/Generator
- Fog light
- Emergency brake light (hazard warning flashing activated during heavy braking)
- Pre-Collision Assist, camera-based (with pedestrian and cyclist detection, including Automatic Emergency Braking (AEB), Dynamic Brake Support (DBS), Forward Collision Warning (FCW))
- Tire pressure monitoring system
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Sliding door, right and left
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Automatic security door lock (45 sec.) (Automatic relocking if no door is opened within 45 seconds of unlocking via remote control)
- Front spoiler lip
- Dust and pollen filter
- Power outlet: 12-volt connection on the center console, front and rear
- Daytime running light
- Carpet floor mats, front (2-piece set)
- Door handles, black
- Seatbelt warning system (Seatbelt warning system in all other seats)
- Central locking with remote control (door lock only on driver's door - 2 keys, one of which is a remote control key)



Extra equipment

- Active parking assistant with parking and exiting function (front and rear parking pilot system)
- Air conditioning with automatic temperature control (2 zones) (for driver and passenger side, separately adjustable)
- Crosswind Assist and Roll Stability Control (RSC)
- DPF regenerator, manual
- Electrically folding exterior mirrors (including electric front and rear windows with quick-up/down function - mirrors fold in automatically when the vehicle is locked)
- Fog lights with static cornering lights
- Heat-insulating glazing, tinted (from the B-pillar) (side windows from the 2nd row of seats)
- High beam assist (including windscreen wipers with rain sensor and automatically dimming interior mirror)
- Seats: Seat package 25
- SORTIMO CNRN
- Adaptive cruise control (with intelligent speed limiter - including radar- and camera-based pre-collision assist with pedestrian and cyclist detection, lane keeping assist including lane keeping assist and driver drowsiness detection - including traffic sign recognition system - leather multifunction steering wheel with 4 spokes in aluminum trim)
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Remote control: 2nd remote control key for central locking (instead of conventional key)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Seat - front	Seat cover - left side (Sitzschoner vorn) - Differs from the original configuration - Remove
2	Wheel / tyres	Wheel cover - rear right side - Scratch(es) - Replace
3	Equipment	Tirefit filler - Expired - Replace
4	Roof	Roof rail - right side - dent(s) - Smooth repair work
5	Trim / covers	Trim / covers - Missing - Replace
6	Body	D-pillar - left side - Scratch(es) - Smart repair
7	Sliding door, right	Sliding door - Dent / paintcoat damage - Smart repair
8	Side panel - rear right side	Side panel - dent(s) - Smart repair
9	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
10	Door - front left side	Door seal - Dent / paintcoat damage - Smart repair
11	Door - front left side	Brightware - lower - Scratch(es) - Smart repair
12	Rear bumper	Bumper - rear right side - Dent / paintcoat damage - Replace
13	Bonnet	Bonnet - Stone chips - Paint



Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Sill - Scratch(es) - No deduction
2	Trim / covers	Boot lining - Scratch(es) - No deduction
3	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction
4	Sill - right side	Trim - Scratch(es) - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 26 Jan 2024	752,13 €
2	Rear, Provided by user / customer, from 26 Jan 2024	1.202,83 €
3	Rear, Side - left, Side right, Provided by user / customer, from 23 Mar 2026	7.807,74 €

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	170 µm	Side panel - rear right side	662 µm
----------------------	--------	------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

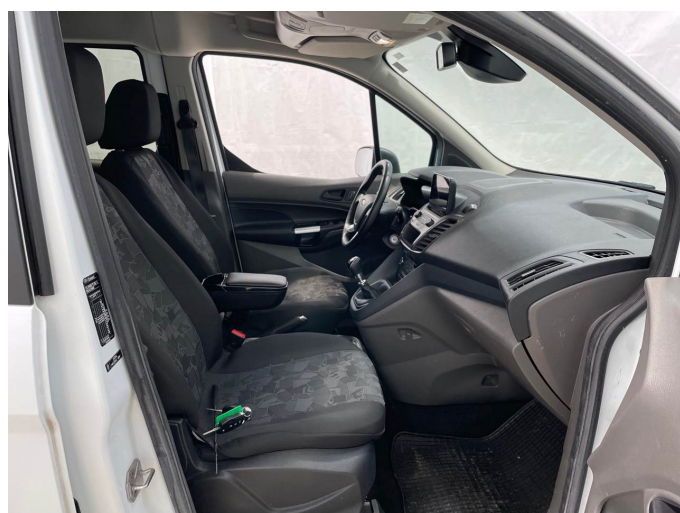


Figure 5: Interior - front

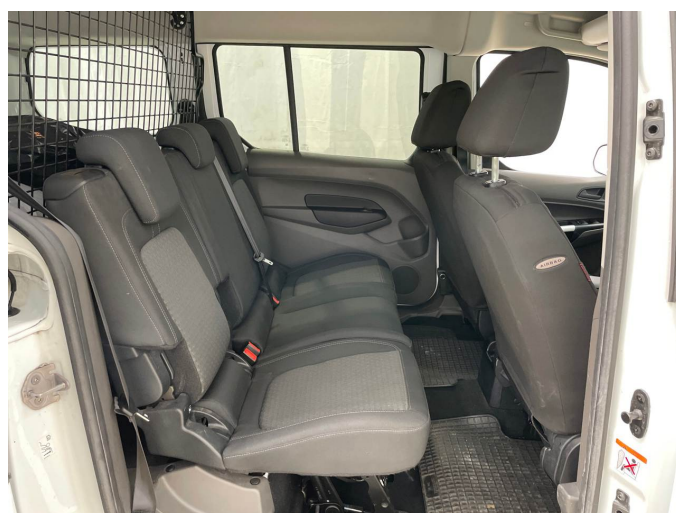


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

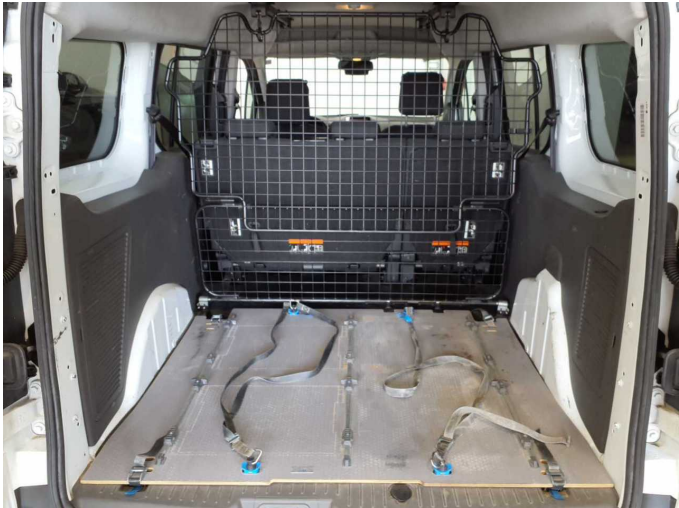


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

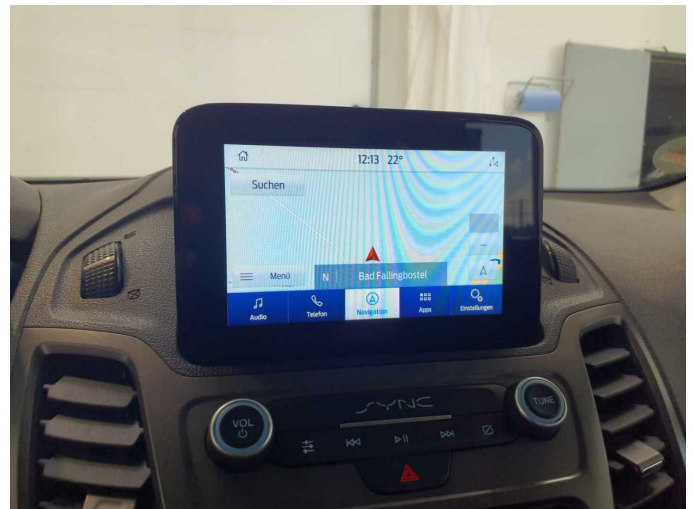


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

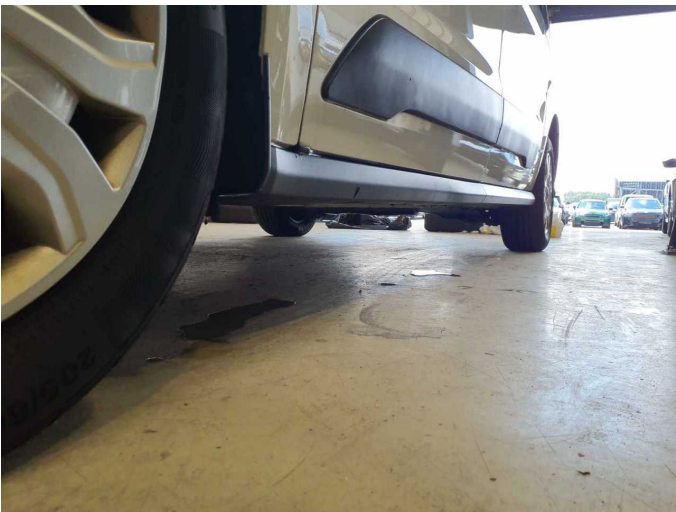


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Damage 1: Seat - front: Seat cover - left side (Sitzschoner vorn) - Differs from the original configuration - Remove



Damage 2: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - Replace



Damage 2: Wheel / tyres: Wheel cover - rear right side - Scratch(es) - Replace



Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 4: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 5: Trim / covers: Trim / covers - Missing - Replace



Damage 6: Body: D-pillar - left side - Scratch(es) - Smart repair



Damage 6: Body: D-pillar - left side - Scratch(es) - Smart repair



Damage 7: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 7: Sliding door, right: Sliding door - Dent / paintcoat damage - Smart repair



Damage 8: Side panel - rear right side: Side panel - dent(s) - Smart repair




Damage 8: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

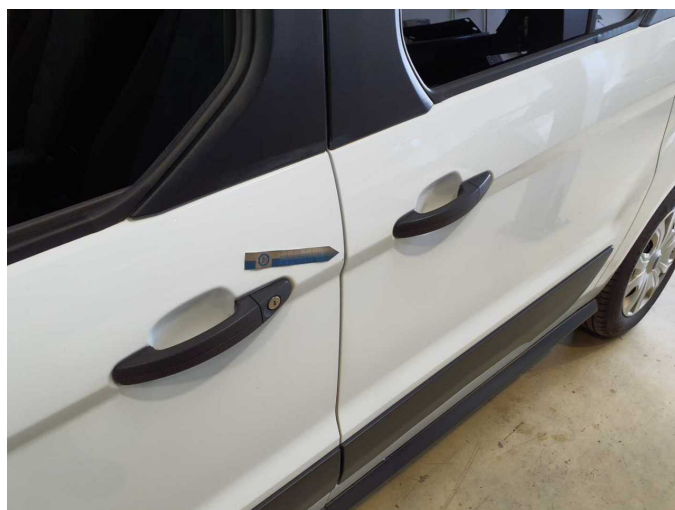

Damage 10: Door - front left side: Door seal - Dent / paintcoat damage - Smart repair




Damage 10: Door - front left side: Door seal - Dent / paintcoat damage - Smart repair



Damage 11: Door - front left side: Brightware - lower - Scratch(es) - Smart repair



Damage 11: Door - front left side: Brightware - lower - Scratch(es) - Smart repair

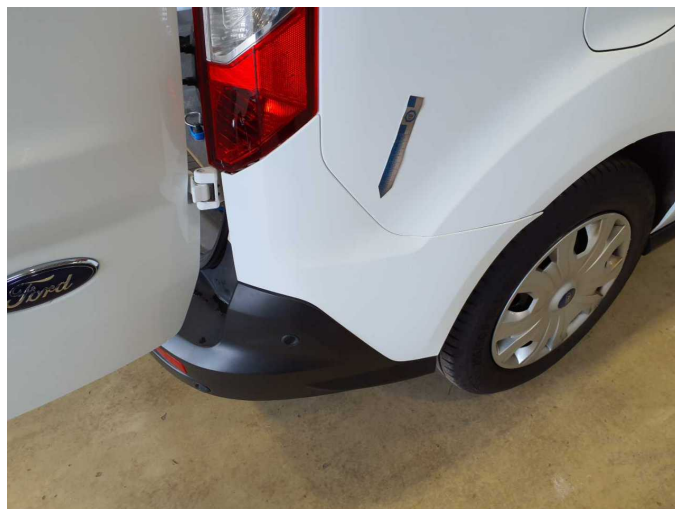


Damage 12: Rear bumper: Bumper - rear right side - Dent / paintcoat damage - Replace




Damage 12: Rear bumper: Bumper - rear right side - Dent / paintcoat damage - Replace




Damage 12: Rear bumper: Bumper - rear right side - Dent / paintcoat damage - Replace

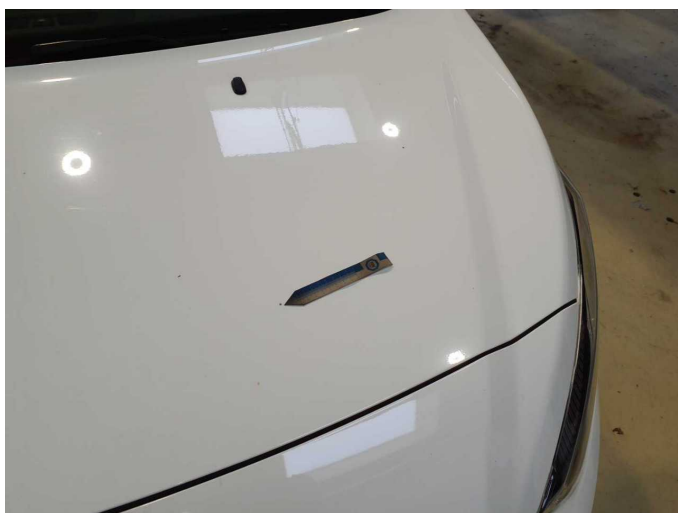

Damage 13: Bonnet: Bonnet - Stone chips - Paint

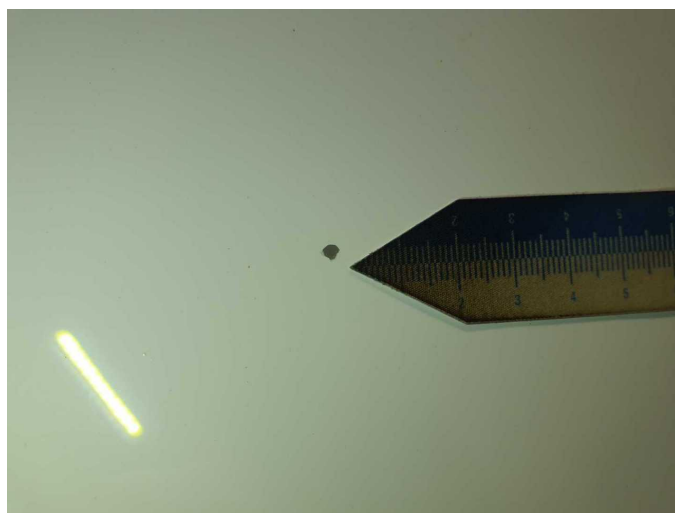

Damage 13: Bonnet: Bonnet - Stone chips - Paint

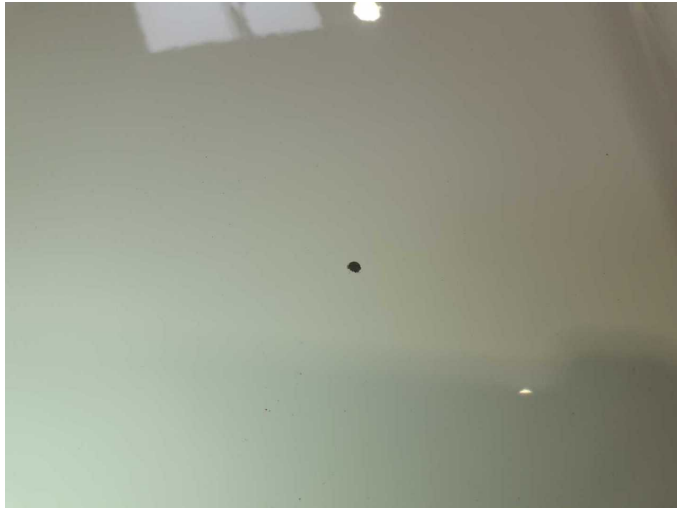

Damage 13: Bonnet: Bonnet - Stone chips - Paint




Damage 13: Bonnet: Bonnet - Stone chips - Paint



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door

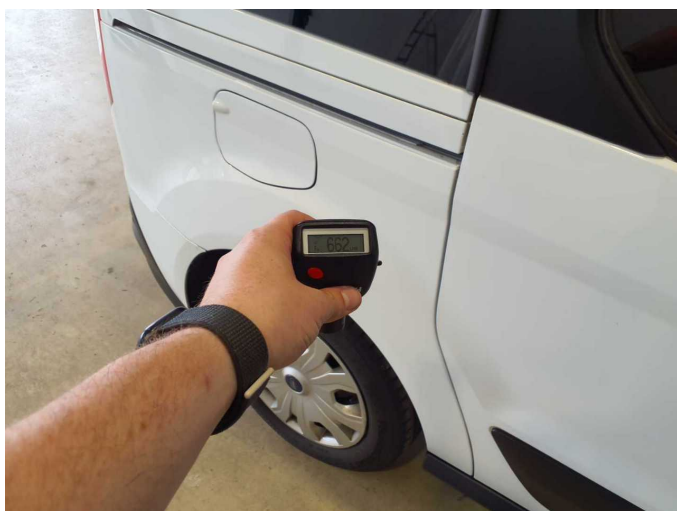

Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side