



Expertise

Protocol number: 46629531
Order No. / Reference: 26601110
Inspection date: 21 Jul 2026

Manufacturer: Iveco

Model: Daily Kasten 35 S 14N Aut.8 V Blue Power

VIN: ZCFCR35A905542201



Vehicle details

Manufacturer / Type / Model / Equipment

Iveco Daily Kasten 35 S 14N Aut.8 V Blue Power

Vehicle Identification number ZCFCR35A905542201
Mileage (Read) 62,831 km
First registration 28 Jun 2023
Number of holders 1
Next periodical technical inspection 06/2026
(Report not on hand)

Fuel type Natural gas
Engine displacement / Cylinder 2,998 ccm / 4
Power 100 kW
Gearbox / Number of gears Automatic / 8
Type of drive Rear drive
Type of vehicle Van

Colour / colour code Weiss
Doors / Seats 4 / 3
Upholstery type Cloth
Colour of upholstery Black

Re-import no
readiness to drive Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV979795
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	4192 / 000 001		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R16 112T	Summer tyres on Steel rim with wheel cover	Bridgestone	5mm / 5mm
2)	225/65 R16 112T	Summer tyres on Steel rim with wheel cover	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R16 115S	Winter tyres on Steel	Goodyear	5mm / 5mm
2)	235/65 R16 115S	Winter tyres on Steel	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • AdBlue tank 20l • Bodybuilder interface • 110 Ah battery • third brake light • First aid kit • Generator Eco-Smart 3080 W (14 V x 220 A) • Fuel tank 70 l • Paint finish: Solid color paint • Model designation on both sides • Tires: 225/65 R 16 • Sliding door on the right side • Seat belts, height-adjustable for driver and passenger seats • Preparation for trailer socket • Windscreen and side windows of the driver's cab tinted | <ul style="list-style-type: none"> • Driver airbag with seatbelt tensioner • Electrically adjustable and heated exterior mirrors • On-board computer • Tachometer • Electric window regulators, left and right • Transmission: 8-speed automatic • Heated crankcase ventilation • Manual headlight range adjustment • Upholstery: Cloth • Rear wall paneling of the driver's cab • Power steering • Mud flaps front and rear • TFT display instrument cluster in color • Electronic immobilizer • Central locking with remote control |
|---|--|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Storage: Central storage compartment with inductive charging tray (with USB charging port) • CNG tank centrally enlarged • Roof storage (above the windshield) • Floor mats, rubber, front • Rear door, opening angle 260° • LED cargo area lighting • Fog lights with static cornering lights • Without maintenance indicator • Package: Winter (Heated windscreen - Auxiliary hot water heater - Traction Plus with hill descent control - Heated and sprung luxury seats) • Front parking distance control including installation • Radio: Radio HI-Connect + Navigation (DAB radio with 7" color display - TomTom car and truck navigation - driving style analysis - voice recognition - Apple CarPlay - Android Auto) • Mirror for mounting width 2,200mm Category IV • Full LED headlights | <ul style="list-style-type: none"> • Airbag: Windowbag for driver and front passenger • Alarm system (with central locking and remote control, separate for driver's cab and cargo area.) • Heated windows in the rear doors • Grab handles on the A-pillar • Air conditioning compressor 170ccm • Air suspension on the rear axle • No CNG tank in the overhang • Package: Evolution (Cruise control - Automatic climate control - Leather steering wheel - Adjustable steering column - Hi-Connect radio - Storage compartment with USB port - Static comfort driver's seat - Passenger bench seat with multifunction storage compartment - Comfort headrests - Comfort dashboard - Light and rain sensor - Voice assistant - Radiator grille with chrome trim) • Reversing camera and external charging light above rear doors • Partition wall to the cargo area with window |
|---|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Tail light	License plate lamp - left side - Specify findings - Perform diagnosis
2	Misc.	Main inspection - Due - Perform
3	Braking system	Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis
4	Body	Body - Glued / labelled - De-glue / neutralise
5	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
6	Boot lid / rear door	Rear door - left side - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction
6	Rear of vehicle	Foot plate - Scratch(es) - No deduction
7	Misc.	Inspection / maintenance (Wartungsnachweis nicht vorhanden) - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Durch die Stahlfelgen ist keine genaue Prüfung der zu instandsetzenden Bremse möglich, Sichtprüfung ohne demontiertem Rad ergibt ca. gleichen Verschleiß der Bremsbeläge an beiden Fahrzeugachsen. Ohne weitere Demontage keine Fotodokumentation möglich. Mehrkosten sind möglich.
- Das Fahrzeugdach konnte unter den gegebenen Bedingungen nicht begutachtet werden. Etwaige wertmindernde Faktoren fließen nicht in diese Beurteilung hinein. Mehrkosten sind möglich.
- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Ein Nachweis über die Zulässigkeit des beiliegenden Radsatzes wurde nicht erbracht.
- Service-Restlauf wird nicht angezeigt.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

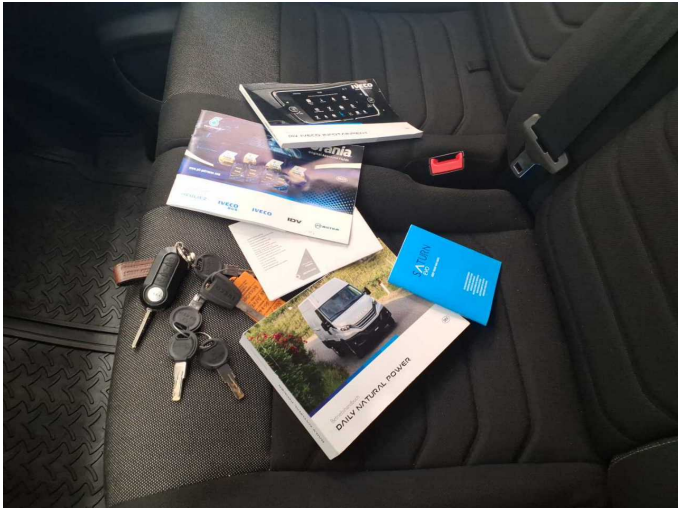


Figure 13: Documents

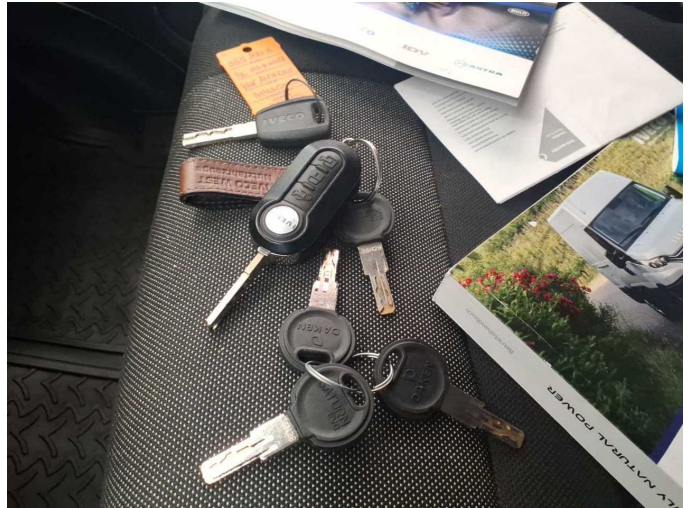


Figure 14: Documents



Figure 15: Additional tyres

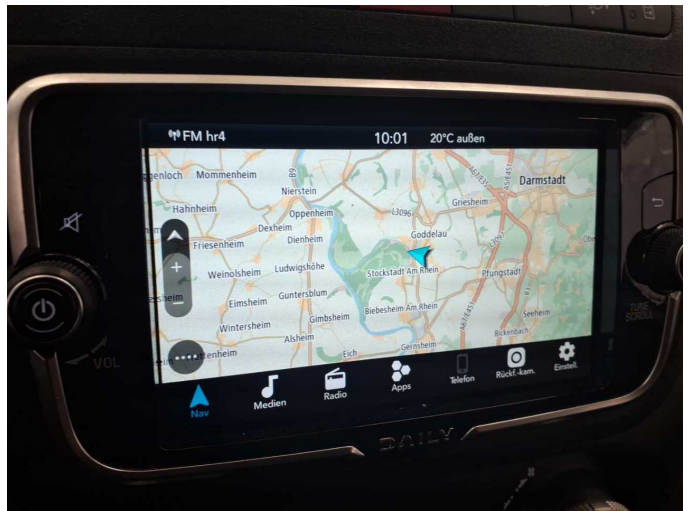


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

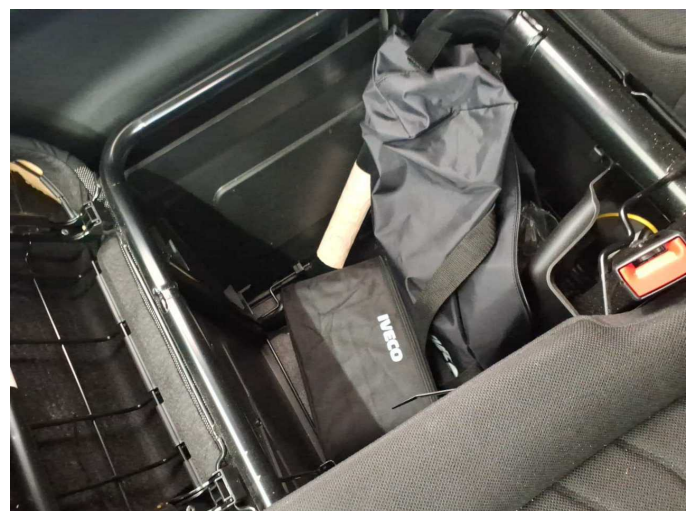


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Damage 1: Tail light: License plate lamp - left side - Specify findings - Perform diagnosis



Damage 3: Braking system: Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis



Damage 3: Braking system: Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis



Damage 3: Braking system: Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis



Damage 3: Braking system: Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis



Damage 3: Braking system: Braking system (Bremsbelag Verschleißsensor aktiv, Mehrkosten wahrscheinlich) - Specify findings - Perform diagnosis



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body - Glued / labelled - De-glue / neutralise



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 6: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 6: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint

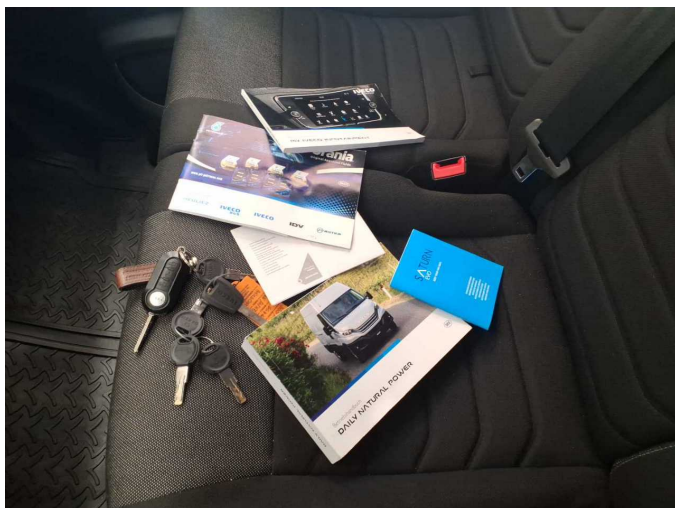

Missing part 1: Documents: Service book - Missing - Replace