



Expertise

Protocol number: 46548076
Order No. / Reference: 26534963
Inspection date: 16 Jul 2026

Manufacturer: Ford

Model: Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop Titanium

VIN: WF0UXXWPGUNS10691



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop Titanium

Vehicle Identification number	WF0UXXWPGUNS10691
Mileage (Read)	60,203 km
First registration	10 May 2022
Number of holders	1
Next periodical technical inspection	08/2027
(Report on hand)	

Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Frost-Weiß
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	3 %
Last service on / at	10/2024 at 40,514 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK800468
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BLK 00422		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,445 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	6mm / 6mm
2)	205/60 R16 96H	Summer tyres on Light alloy	7mm / 7mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 03/2026	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage: Door armrest, padded, with fabric cover
- Exterior mirrors, electrically adjustable, heated and foldable
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires
- On-board computer
- Roof rails, aluminum, without crossbars
- Third brake light
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Ford Power Start function
- FordPass Connect including live traffic information and Wi-Fi hotspot
- Transmission: 8-speed automatic transmission
- Rear swing door including heated rear window and wiper/washer system
- Interior mirror automatically dimming
- Intelligent security system
- Air conditioning with automatic temperature control
- Headrests 2 front, height adjustable
- Paint finish: Solid
- Leather gear knob
- Adjustable steering column
- Armrest - centre, rear
- Fog light
- Package: Seat Package 29
- Rear parking pilot system
- Pollen filter and dust filter
- Tire repair kit, space and weight saving
- Windscreen wipers with rain sensor
- Sliding door, right and left
- Electromechanical power steering
- Bench seat (in the 2nd row, 3 seats). 60:40 split, foldable.
- Front spoiler lip
- Start-stop system
- 12-volt socket in storage compartment on dashboard (driver's side)
- Rear bumper painted in body color
- Daytime running light
- Child safety lock on sliding doors
- Warning system for unfastened driver and front passenger seat belts
- Heat-insulating glazing, lightly tinted
- Central locking: 2nd remote control key for central locking
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Exterior mirror caps painted in car color
- Hill start assist
- Front overhead storage compartment
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Rear power windows, right and left, electric
- Front electric windows with quick-up/down and all-around closing function
- Heated windshield
- Cruise control
- Glove compartment with lid
- Interior lighting for passenger/cargo compartment
- Interior lighting front and rear with delay function
- Intelligent battery management system
- Isofix bracket
- Rear headrests (3)
- Radiator grille with 5 crossbars, black plastic and chrome trim
- Steering wheel: Multifunction leather steering wheel, 4 spokes
- Front center console "Premium"
- Emergency brake light
- Panoramic roof
- Pollen and dust filter
- Pre-Collision Assist
- Tire pressure monitoring system
- Headlight assistant with day/night sensor
- Side protection strips, painted in vehicle color
- Safety Brake Assist (EBA)
- Sun visor with mirror on driver and passenger side (for drivers with ticket holder)
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection on the center console, front and rear
- Front bumper painted in body color
- Carpet floor mats for the front (2-piece set)
- Traffic sign recognition system
- Immobilizer EPATS
- Heat-insulating glazing, tinted (from the B-pillar)
- Central locking with remote control (door lock only on driver's door)



Extra equipment

- Navigation: Ford Audio System 9 navigation systems, including Ford SYNC 3 with AppLink, touchscreen, and reversing camera (Ford SYNC 3 communication and entertainment system with voice control, 6" color touchscreen, high resolution, 15.2 cm screen diagonal, radio (FM/AM), 2 USB ports, 6 speakers, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, premium center console, reversing camera including rear parking assist system, phase-differentiated antenna, DAB/DAB+, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation TMCpro, live traffic, 3D display)
- Front and rear parking pilot system
- Seats: 3rd row of seats with two individual seats, foldable and sliding

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door - Dent / paintcoat damage - Smart repair
3	Side panel - rear left side	Side panel - dent(s) - Smart repair
4	Side panel - rear right side	Sill - dent(s) - Smart repair
5	Roof	Roof - dent(s) - Smart repair
6	Body	Body (Flugrost) - Soiled - Conditioning
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
9	Door - front right side	Door - Dent / paintcoat damage - Repair and paint

Missing parts

Description

Documents - Service book



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

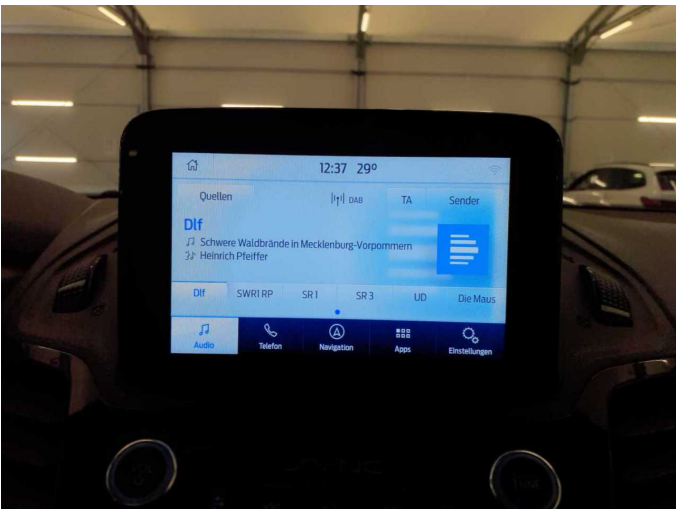


Figure 23: Misc.

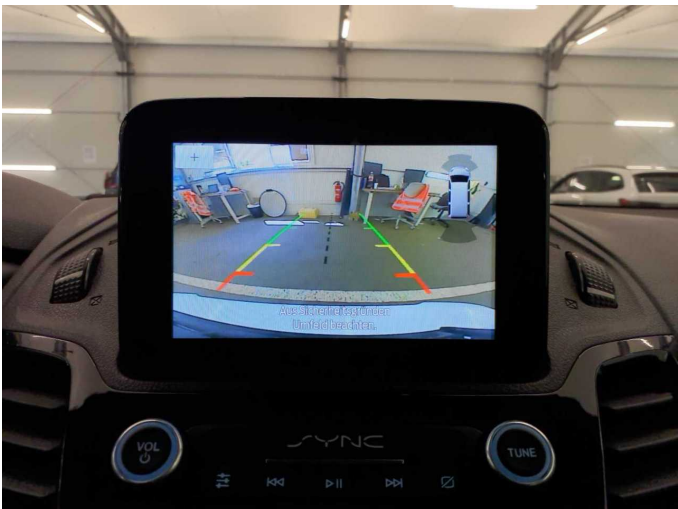


Figure 24: Misc.



Figure 25: Misc.

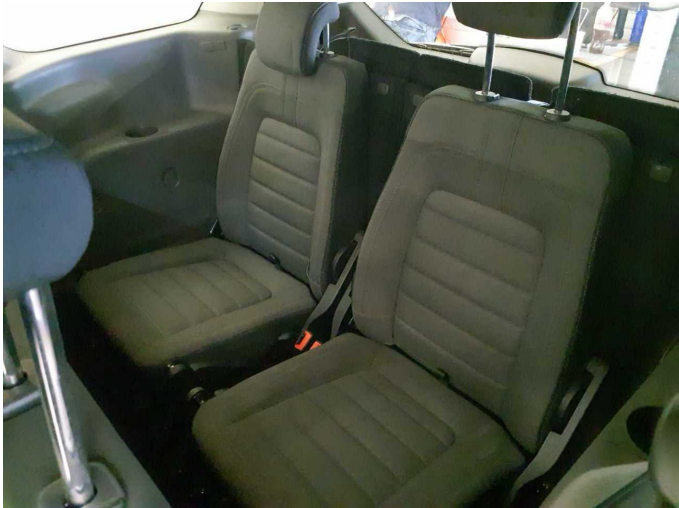


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair

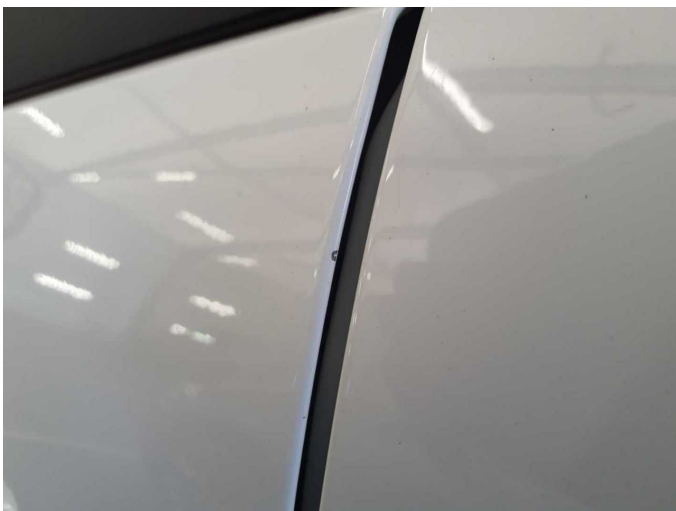

Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 4: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 4: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 4: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 5: Roof: Roof - dent(s) - Smart repair



Damage 5: Roof: Roof - dent(s) - Smart repair



Damage 6: Body: Body (Flugrost) - Soiled - Conditioning



Damage 6: Body: Body (Flugrost) - Soiled - Conditioning



Damage 6: Body: Body (Flugrost) - Soiled - Conditioning



Damage 6: Body: Body (Flugrost) - Soiled - Conditioning



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0UXXWPGUNS10691

Hersteller / Modell: FORD FORD Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop
Titanium

Datum	KM-Stand	Beschreibung
08.10.2024	40.514	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.06.2024	35.712	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Systemtest/ Eigendiagnose
07.05.2024	34.507	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
06.07.2023	20.819	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges